



GOLDER

REPORT

Phase I Environmental Site Assessment, Derry Heights Plaza, 6901, 6911, 6921, 6931, 6941 and 6951 Derry Road West, Milton, Ontario

Submitted to:

First Capital Asset Management LP

85 Hanna Avenue, Suite 400
Toronto, Ontario
M6K 3S3

Attention: Albert Ho, Senior Director, Environmental Programs


Submitted by:

Golder Associates Ltd.

100 Scotia Court, Whitby, Ontario, L1N 8Y6, Canada
+1 905 723 2727

20146311

October 2020

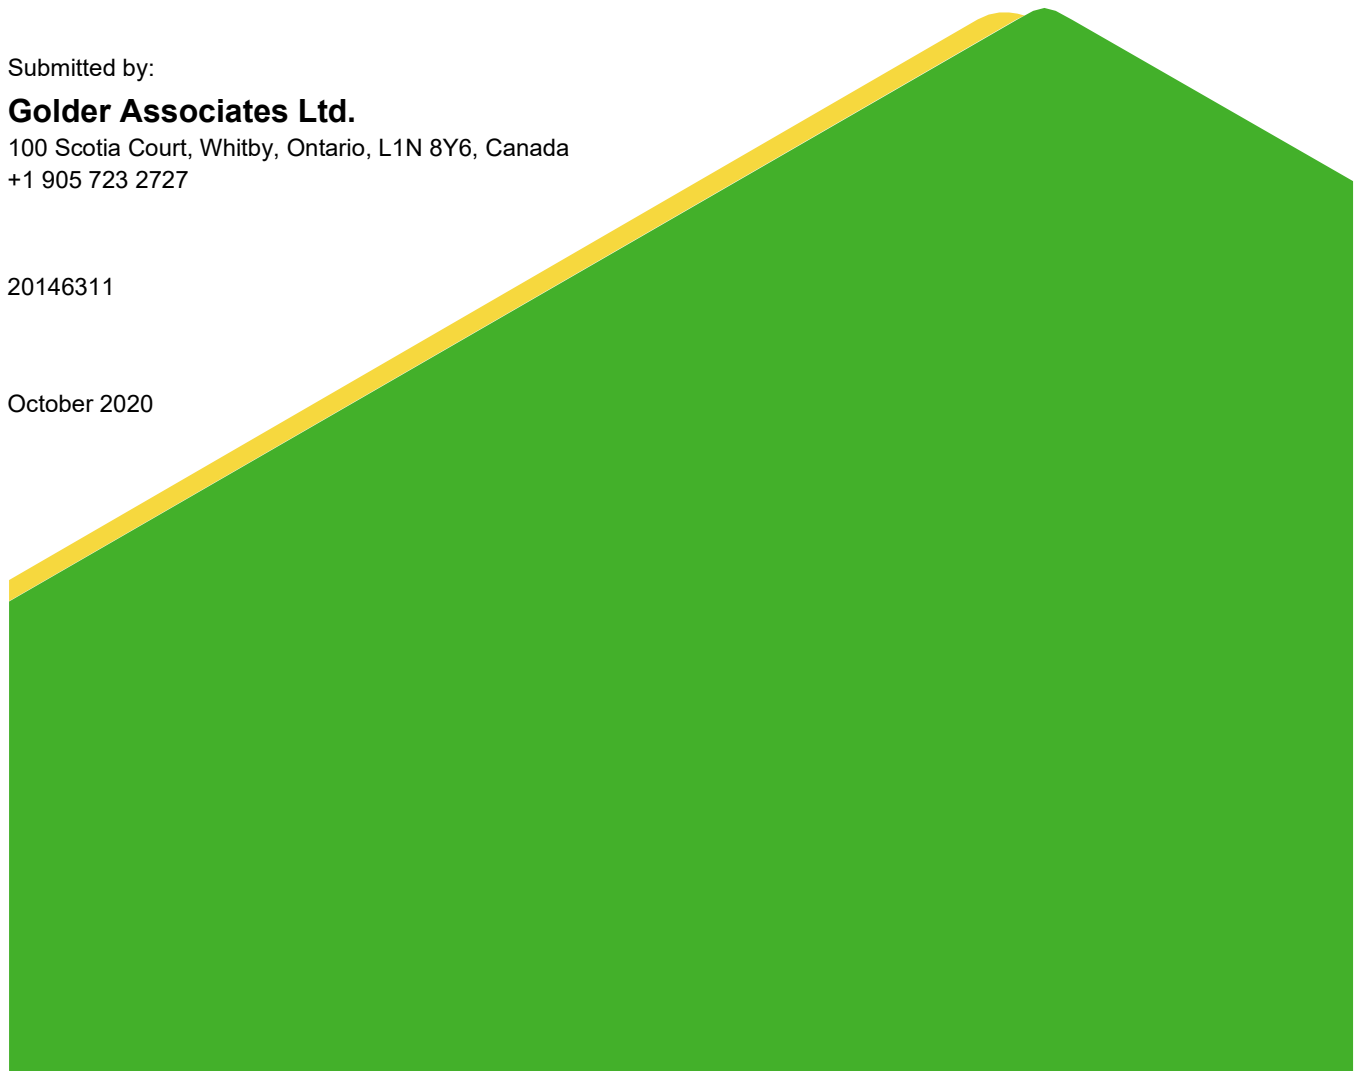

Distribution List

1 copy (.pdf) - First Capital Asset Management LP

1 copy (.pdf) - Golder Associates Ltd.

Executive Summary

Golder Associates Ltd. (“Golder”) was retained by First Capital Asset Management LP (“FCAM”) to conduct a Phase I Environmental Site Assessment (“ESA”) of the Derry Heights Plaza located at 6901, 6911, 6921, 6931, 6941, and 6951 Derry Road West, Milton, Ontario (the “Site”). The location, surroundings, and layout of the Site are shown in Figure 1. For the purposes of this report a project north has been assigned so that Derry Road West runs in an east to west direction.

There are currently four commercial buildings at the Site: one multi-tenant single-storey commercial building, two multi-tenant two-storey commercial buildings, and one single-story, single-tenant commercial building that are leased to individual tenants operating commercial uses such as retail outlets, quick service restaurants, financial institutions, and medical offices. Approximately one third of the Site is covered by buildings, and half of the Site is covered by asphalt-paved parking and driveway areas.

Between 1969 and 2004, 6901 Derry Road West was occupied by a manufacturer of gas meters (Canadian Meter Company). Between 2004 and 2019, 6901 Derry Road West was occupied by industrial and commercial tenants, including a distributor of imported light fixtures, a daycare, and a fitness centre. The former manufacturing building was vacated in May 2019 and demolished in 2019.

The primary objective of the Phase I ESA was to identify, insofar as possible based on readily available information and without an intrusive investigation, former or current practices at the Site that may represent issues of actual or potential environmental concern.

Authorization to proceed with this investigation was received by email from Mr. Albert Ho, Senior Director, Environmental Programs at FCAM, on September 24, 2020. This Phase I ESA report has been prepared for the use of FCAM and may not be relied upon by others without written consent from Golder.

The information obtained as part of this Phase I ESA was evaluated to identify relevant environmental conditions with the potential for contamination to be present in environmental media or building materials (“issues of potential environmental concern”). Environmental conditions that do not present a threat to human health or the environment and that generally would not be the subject of regulatory enforcement were not considered to represent an issue of potential environmental concern. Some land uses or activities in the surrounding area were not specifically identified as an issue of potential environmental concern based on their separation distance from the Site, the inferred hydrogeologic conditions, and/or the absence of evidence of a contaminant release to the subsurface associated with the off-Site land use or activity.

Golder notes that a Record of Site Condition (“RSC”) was submitted on the Ministry of Environment, Conservation, and Parks (“MECP”) Environmental Site Registry on June 28, 2011 under RSC Number 114246. On April 26, 2011, the MECP issued Certificate of Property Use Number 0660-7T9K7Y (the “CPU”). Record of Site Condition Number 114246 (the “RSC”) was filed on the Ministry’s Environmental Site Registry on June 28, 2011.

On April 22, 2015, the MECP replaced the CPU with an Amended Certificate of Property Use. The Amended CPU included Item 5.2 that prohibited the construction of any new building within a specified portion of the property (the “Conditional Build Area”) to address potential concerns relating to the potential for vapour intrusion to impact indoor air quality. On August 11, 2016, the MECP amended the CPU at the request of First Capital to allow the

construction of new slab-on-grade buildings in the Conditional Build Area that included a soil vapour intrusion mitigation system risk management measure. On March 20, 2019, the MECP further amended the CPU, which included a revised risk management measure for construction of buildings that include below grade structures within the Conditional Build Area, new risk management measures requiring HVAC modifications and vapour intrusion assessment below the building slab, alterations to the groundwater monitoring risk management measure, and a risk management measure to submit a soil and groundwater delineation plan and remedial action plan in response to concerns with increasing trends in VOC concentrations in groundwater.

Golder notes that there are known impacts to soil and groundwater at the Site associated with the former industrial use of 6901 Derry Road West (former address of 3037 Derry Road West) and that First Capital is obligated to manage these impacts in accordance with the requirements of the amended CPU, which is registered on title. Accordingly, the following former uses of 6901 Derry Road West are not considered to represent an issue of potential environmental concern, provided that the risk management requirements of the amended CPU are implemented:

- An approximately 27,300 L (6,000 gallon UST) was formerly present adjacent to the south of the building. The UST was removed prior to 1993 and PHC impacted soil in the vicinity of the UST was removed;
- Approximately 200 metric tonnes of PHC impacted soil from the UST excavation was stockpiled on the northwest portion of the Site;
- A chemical storage shed was formerly located outside the northwest corner of the Site building. The shed reportedly contained xylene, acetone, mineral spirits, oils, cutting fluids, lacquer thinners, isopropyl alcohol and coolants. There were also two approximately 1,150 L ASTs for waste cutting oils and waste oils and mineral spirits and one 200 L drum with unknown contents;
- There were former solvent degreasers located within four different areas of the building with the former address of 3037 Derry Road West (former manufacturing building). It was suspected that chlorinated solvents had been used during degreasing;
- Four small deposits of black/brown granular material, possibly foundry sand, were reported to be present outside the northwest corner of the former manufacturing building; and,

Based on supplemental intrusive investigations, soil and/or groundwater was identified to be impacted with various heavy metals and/or VOC at concentrations in excess of the generic assessment standards applicable for those times, and were generally present within the following three areas:

- A small deposit of apparent foundry sand located outside of the northwest corner of the previous building at 6091 Derry Road West, containing a marginally elevated concentration of beryllium (removed from the Site in 2009). In addition, a limited area of soil impacted by PHC F3 was identified within this area. These impacts were remediated in 2010;
- Approximately 200 metric tonnes of PHC impacted soil from the UST excavation was stockpiled on the northwest portion of the Site. These impacts are managed by the risk management measures in the amended CPU;
- Soil and groundwater beneath the northeast portion of the former manufacturing building and in the area outside this portion of the building with impacts that appeared to be related to both 1,1,1-trichloroethane and

trichloroethylene. These impacts are managed by the risk management measures in the amended CPU; and,

- Soil and groundwater in the vicinity of a former chemical storage shed located outside the northwest corner of the former manufacturing building with VOC impacts related to 1,1,1-trichloroethane. These impacts are managed by the risk management measures in the amended CPU.

Based on the information obtained as part of this Phase I ESA, no additional issues of actual or potential environmental concern were identified that are associated with uses of the Site that have occurred since the completion of the 2011 RSC. Accordingly, no further site assessment is recommended.

Table of Contents

1.0 INTRODUCTION	1
1.1 Background and Objective	1
1.2 Scope of Work	1
2.0 SITE DESCRIPTION	1
2.1 Site Location and Setting	1
2.2 Site Uses and Structures	2
2.3 Topographic, Geologic, and Hydrogeologic Setting	2
3.0 PROPERTY-USE INFORMATION REVIEW	2
3.1 Aerial Photographs	2
3.2 Fire Insurance Records	4
3.3 City Directories	5
3.4 EcoLog ERIS Search of Environmental Databases	5
3.4.1 Site	5
3.4.2 Surrounding Properties	6
3.5 Previous Environmental Reports	7
4.0 REGULATORY INFORMATION REVIEW	23
4.1 Provincial Ministry of Environment	23
4.2 Technical Standards & Safety Authority, Fuels Safety Division	23
5.0 SITE VISIT AND INTERVIEW(S)	24
5.1 Past Site Uses	24
5.2 Present Site Uses	26
5.3 Site Buildings and Equipment	27
5.4 Chemical and Fuel Storage	28
5.5 Waste Generation and Handling	29
5.6 Surrounding Properties	30
6.0 SPECIAL ATTENTION ITEMS	30

6.1	Polychlorinated Biphenyls	31
6.2	Asbestos-Containing Materials	31
6.3	Lead and Lead-Containing Surface Coatings	31
6.4	Ozone-Depleting Substances	32
6.5	Urea Formaldehyde Foam Insulation.....	32
6.6	Radon and Radioactive Substances	32
6.7	Mercury	32
6.8	Mould or Water Damage	33
6.9	Noise and Vibration	33
6.10	Non-ionizing Electromagnetic Radiation	33
7.0	ISSUES OF ENVIRONMENTAL CONCERN	33
8.0	LIMITATIONS.....	34
9.0	CLOSURE	35

TABLES

Table 1: Aerial Photographs	3
Table 2: Waste Generators - Site	6
Table 3: Waste Generators – Surrounding Properties	7
Table 4: Details of Site Visit.....	24
Table 5: Past Uses of the Site and Neighbouring Properties	24
Table 6: Uses of Buildings, Other Structures, and Areas	26
Table 7: Site Building(s) and Equipment	27
Table 8: Fuel and Chemical Storage	28
Table 9: Waste Generation and Handling	29

FIGURES

Figure 1: Site Plan

APPENDICES

APPENDIX A

EcoLog ERIS Report

APPENDIX B

Regulatory Responses

APPENDIX C

Site Photographs

1.0 INTRODUCTION

1.1 Background and Objective

Golder Associates Ltd. (“Golder”) was retained by First Capital Asset Management LP (“FCAM”) to conduct a Phase I Environmental Site Assessment (“ESA”) of the property located at 6901, 6911, 6921, 6931, 6941 and 6951 Derry Road West, Milton, Ontario (the “Site”). The location, surroundings, and layout of the Site are shown in Figure 1. For the purposes of this report a project north has been assigned so that Derry Road West runs in an east to west direction.

The primary objective of the Phase I ESA was to identify, insofar as possible based on readily available information and without an intrusive investigation, former or current practices at the Site that may represent issues of actual or potential environmental concern. Golder understands that this assessment is required to update FCAM’s environmental records for the property.

Authorization to proceed with this investigation was received by email from Mr. Albert Ho, Director, Environmental Programs at FCAM, on March 18, 2019. This Phase I ESA report has been prepared for the use of FCAM and may not be relied upon by others without written consent from Golder.

1.2 Scope of Work

Golder’s assessment was carried out in general accordance with Canadian Standards Association (“CSA”) Standard Z768-01, *Phase I Environmental Site Assessment* (reaffirmed 2016), and involved the following scope of work:

- reviewing readily available records to collect data on past and present activities on the Site;
- visiting the Site to observe current Site conditions and operations and further assess any potential environmental concerns identified in the records review;
- interviewing knowledgeable individual(s) to corroborate or augment the information gathered from the records review and Site visit;
- evaluating the information from the records review, Site visit, and interviews; and
- preparing a Phase I ESA report.

For the purposes of this Phase I ESA, the assessment area included the Site and surrounding properties within 250 m of the boundary of the Site.

In preparing this Phase I ESA, Golder has applied professional judgement in considering readily-available information and has relied in good faith on information provided by others. This level of effort is a method of risk reduction rather than risk elimination. This assessment included a cursory overview of the neighbouring land uses and does not constitute a complete assessment of neighbouring land uses. Further reductions in risk can be achieved through a program of intrusive testing at the Site, including sample collection and analysis.

2.0 SITE DESCRIPTION

2.1 Site Location and Setting

The Site consists of an irregular shaped parcel of land (4.61 hectares). The Site is located on the northwest corner of Derry Road West and Bronte Street South in Milton, Ontario.

2.2 Site Uses and Structures

There are currently four commercial buildings at the Site: one multi-tenant single-storey commercial building, two multi-tenant two-storey commercial buildings, and one single-story, single-tenant commercial building that are leased to individual tenants operating commercial uses such as retail outlets, quick service restaurants, financial institutions, and medical offices. Approximately one third of the Site is covered by buildings, and half of the Site is covered by asphalt-paved parking and driveway areas.

Between 1969 and 2004, 6901 Derry Road West was occupied by a manufacturer of gas meters (Canadian Meter Company). Between 2004 and 2019, 6901 Derry Road West was occupied by industrial and commercial tenants, including a distributor of imported light fixtures, a daycare, and a fitness centre. The building was vacated in May 2019 and demolished in 2019.

2.3 Topographic, Geologic, and Hydrogeologic Setting

The following summary of the Site's topographic, geologic, and hydrogeologic setting is based on Golder's observations during the Site visit and on a review of the following maps:

- Natural Resources Canada. *The Atlas of Canada*. Toporama Topographic Maps. Scale 1:20,000.
- Ontario Geological Survey. 2010. *Surficial Geology of Southern Ontario*. Ontario Geological Survey Map Miscellaneous Release – Data 128-REV. Scale 1:50,000.
- Ontario Geological Survey. 2011. *Bedrock Geology of Ontario*. Ontario Geological Survey Map Miscellaneous Release – Data 126 – Revision 1. Scale 1:250,000.

The Site topography is generally flat with the exception of the northwest portion of the Site, which is at a higher elevation and is landscaped with grass and trees. The nearest surface water body is a tributary of Sixteen Mile Creek, which is located 1 km northeast of the Site.

Bedrock in the vicinity of the Site consists of Upper Ordovician shale, limestone, dolostone, and siltstone units of the Queenston Formation (Ontario Geological Survey, 1991b). Based on previous investigations conducted at the Site by Golder and others, the surficial geology at the Site predominantly consists of silty clay. At the time of the Site visit, subsurface soil was not exposed on the Site.

Regional groundwater flow in the underlying aquifers is inferred to be in a southeasterly direction towards Sixteen Mile Creek¹. Buried utilities, underground structures, and septic systems can affect local (shallow) groundwater flow conditions. Inferred groundwater flow directions are subject to confirmation with field measurements.

3.0 PROPERTY-USE INFORMATION REVIEW

3.1 Aerial Photographs

Aerial photographs were obtained from LGI Copy Services ("LGI") and reviewed by Golder. Aerial photographs were selected based on availability and regular date intervals to help develop an understanding of the history of the development of the Site and surrounding properties. The information obtained from the aerial photographs was limited by the quality and scale of the available aerial photographs. The presence and absence of structures on the Site and on neighbouring properties were noted in the table below (Table 1).

¹ Oak Ridges Moraine Groundwater Program Website (Oakridgeswater.ca) 2018. Accessed October 14, 2020.

Table 1: Aerial Photographs

Year	Site	Surrounding Properties
1934	The Site consists of agricultural land. No buildings appear to be present on the Site.	North: Agricultural land with what appears to be associated agricultural structures immediately adjacent to the north of the Site. South: Derry Road West followed by agricultural land uses. West: Rail tracks followed by agricultural land uses. East: Bronte Road South followed by agricultural and residential land uses
1951	No significant changes as per the 1934 aerial photograph.	No significant changes as per the 1934 aerial photograph, with the exception that a disturbed area appears to be present associated with the agricultural structures adjacent to the north of the Site. Due to the quality of the aerial photograph details are difficult to distinguish.
1965	A building with associated asphalt paved parking has been constructed on the southwest portion of the Site, with the same approximate footprint as the former manufacturing building at 6901 Derry Road West (former address of 3037 Derry Road West). The remainder of the Site appears to consist of undeveloped vegetated land.	Generally as per the 1951 aerial photo with the exception that a building (possible hospital) has been constructed to the southeast of the Site across Derry Road West and Bronte Street South.
1979	Generally as per the 1965 aerial photograph. An unpaved trail is present on the west portion of the Site.	North: The property adjacent to the north of the Site appears to be under construction, and a large building has been constructed adjacent to the northwest portion of the Site, followed by agricultural land uses. South: Derry Road West followed by agricultural land uses as well as one small commercial-type building located on the southwest corner of the intersection of Derry Road West and Bronte Street South. West: Rail tracks followed by agricultural land uses as well as a possible transformer substation. East: Bronte Road South followed by a graded area which appears to be under construction with residential subdivisions.
1989	Same as the 1979 aerial photograph.	Generally the same as the 1979 aerial photograph, with the exception that residential subdivisions are now present to the east of the Site across Bronte Street South.

Year	Site	Surrounding Properties
2002	Generally the same as the 1989 aerial photograph. Loading docks appear to be present on the west side of the building. An unpaved area inferred to be used for additional parking is present just west of the Site building.	Generally the same as the 1989 aerial photograph, with the exception that a possible car dealership is now present adjacent to the northeast portion of the Site. In addition, a new building has been constructed to the west of the Site, across the rail tracks.
2009	The Site appears to be under redevelopment with the remaining four current-day Site buildings as they stand today. The Site building located at 6901 Derry Road West is still present on the southwest portion of the Site, along with what appears to be a concrete pad in the same location as the former chemical storage shed. Fill stockpiles from Site grading appear to be present on the northwest portion of the Site.	Generally the same as the 2002 Google Earth image, with the exception that further development has occurred farther north of the Site; and, additional residential development is present further south and west of the Site.
2018	The Site is developed with the five Site buildings as they stand today. Asphalt paved parking and driveway areas are present throughout the Site. Landscaped areas (primarily grass with some trees) is present along the perimeters of the Site, on curbed areas, and on the northwest portion of the Site.	Generally the same as the 2009 Google Earth image.

3.2 Fire Insurance Records

Golder asked Opta Information Intelligence (“Opta”) to provide any fire insurance plans (“FIPs”), property underwriters’ reports (“PURs”) and property underwriters’ plans (“PUPs”) related to the Site and surrounding properties. Golder was informed by Opta on March 22, 2019 that no records were available for the current Site addresses.

Upon noting through interactive mapping for the Town of Milton that a prior municipal number (3037 Derry Road) was associated with the Site, Golder requested a second search for property use reports and was advised on October 22, 2020 that a 2004 inspection report and a 1967 FIP were available.

The 2004 inspection report is for the former manufacturing building. The tenants at that time included a lighting importer and a children’s day care centre, with ongoing negotiated with a new fitness centre tenant. The owner at that time used a small area in the centre section of the building to store equipment and fixtures associated with his cold storage operation at an off-Site location. The building was heated with gas with no storage tanks (including heating fuel tanks). The report states that no unusual conditions were noted at the building.

The 1967 FIP does not include the Site but provides details of adjacent properties across Derry Road and Bronte Street South. The property east of Bronte Street South (2763 Derry) includes a building with a private garage. The property east of Bronte Street South and south of Derry Road is occupied by Milton District Hospital. The property south of Derry Road (3006 Derry Road) is occupied by three small buildings with a gasoline underground fuel storage tank located 50 metres south of the Site. This property was subsequently redeveloped as a multistorey commercial building. Given the separation distance from the Site, the low permeability of the surficial soils, and the subsequent redevelopment of 3006 Derry Road, this UST is unlikely to represent an issue of potential concern for the Site.

3.3 City Directories

Golder asked LGI to search city directories for the Site and surrounding properties. Golder was informed by LGI that city directories for the years 1958, 1966, 1972/73, 1977/78, 1983, 1989, 1994 and 2000 were available. Relevant findings from the city directory listings for the Site included:

- None of the current Site addresses were listing in any of the reviewed city directories.

Relevant findings from the city directory listings for the surrounding properties included:

- 500 Bronte Street South (adjacent to the north) was listed as Clements Motors of Milton Ltd. Automobiles in the 1977/78 city directory; as Autopro Dealers in the 1989 city directory; and, as Hunt Plymouth Chrysler Ltd. in the 1994 and 2000 city directories; and,
- 510 Bronte Street South (adjacent to the north) was listed as Reliance Products Ltd in the 1983 and 1989 city directories; as LMG Reliance Division of Lawson Mardon Group Ltd. in the 1994 city directory; and, as Honeywell Consumer Products Canada Inc./Polymer Distribution in the 2000 city directory.

3.4 EcoLog ERIS Search of Environmental Databases

Golder contracted ERIS to search available federal, provincial, and private-sector environmental databases for the Site and within 250 m from the boundary of the Site. The complete database report is included in Appendix A. Noteworthy findings of the ERIS report are summarized in the following sections.

3.4.1 Site

Based on Golder's review, the ERIS report indicated the following noteworthy findings originating at the Site:

- Trenwith Investments Inc. was listed with a Certificate of Property Use ("CPU") in the year 2007 under EBR Registry number IA7E0105 (Ministry reference No. 4041-6NZPD2);
- FCHT Holdings (Ontario) Corporation was listed with a CPU in the year 2010 under EBR Registry number 010-8708 (Ministry reference No. 0660-7T9K7Y). Updated CPUs were issued in 2014, 2016, and 2019. A Record of Site Condition ("RSC") was issued for the Site with a certification date of December 8, 2009. The former address of the Site was reported as 3037 Derry Road West;
- Renu Choudhary Pharmacy was listed as a limited vendor of pesticides under licence number 18201; and,
- The ERIS report identified waste generators at the Site, summarized in the below table (Table 2).

Table 2: Waste Generators - Site

Company	Generator Number	Years	Waste Description
Derry Heights Plaza	ON7215655	2010	PCBs, oil skimmings and sludges
Canadian Meter Company INC 08-004	ON0159400	1988, 1989, 1990, 1994-2004	Paint/pigment/coating residues, petroleum distillates, oil skimmings and sludges, emulsified oils, aliphatic solvents, waste oils and lubricants, organic laboratory chemicals (not all wastes for all years)
FCHT Holdings (Ontario)	ON4934849	2009	Oil skimmings and sludges, emulsified oils
FCR Management Services LP	ON3111717	2018	Light fuels, halogenated solvents (associated with the disposal of investigation-derived wastes generated as part of ongoing CPU compliance)
Renu Choudhary Pharmacy Ltd./P. Shalvardjian Drugs Ltd.	ON6088284	2015	Pathological waste, pharmaceuticals
Derry Heights Animal Hospital	ON4611473	2018	Pharmaceuticals, pathological wastes
Hawthorne West Urgent Care	ON6687714	2014-2018	Pathological wastes

- Eighteen wells used for groundwater monitoring/observation purposes were reported to be present on the Site. These wells were drilled between 2005 and 2017 to depths ranging from 3.65 to 6.4 mbgs. Subsurface stratigraphy generally consisted of a layer of topsoil underlain by layers of clay and/or silt, underlain by bedrock (shale).

3.4.2 Surrounding Properties

Based on Golder's review, the ERIS report indicated the following noteworthy findings originating on the surrounding properties:

- A total of four Certificates of Approval are listed for surrounding properties to the Site associated with industrial and municipal sewage, and industrial air;
- ADA Holdings Co. Ltd was registered for an RSC for the property located at 500 Bronte Street South (adjacent to the north of the northeast portion of the Site). The RSC had a Certification date of May 19, 2005. No CPU was in place for the property. The current property use was reported as agricultural, and the intended property use was reported as commercial; and,
- Milton District Hospital was listed at 7030 Derry Road East (50 m southeast) as a waste receiver under receiver number A210313 for incineration of pathological wastes in 1978-2008.

The ERIS report identified waste generators for surrounding properties in the Ontario Regulation 347 Waste Generators Summary. After considering the type of business, waste type, Site geology, and inferred groundwater flow direction, a subset of the waste generators listed for the surrounding properties were considered noteworthy (Table 3).

Table 3: Waste Generators – Surrounding Properties

Company	Location	Years	Waste Description
Reliance Products Division (ON0384200), L.M.G Reliance (ON1836900), Kaz Canada Inc./Honey Consumer Products (ON0144016)	510 Bronte Street South (adjacent to the north of the northwest portion of the Site)	1986-2016	Light fuels, petroleum distillates, waste oils and lubricants, inorganic laboratory chemicals, organic laboratory chemicals (not all wastes for all years)
Milton District Hospital (ON0377400)	7030 Derry Road East (50 m southeast of the Site)	1986-2018	Various wastes including inorganic laboratory chemicals, petroleum distillates, aliphatic solvents, waste compressed gases, waste oils & lubricants, organic laboratory chemicals, acid waste – heavy metals, alkaline wastes – other metals, paint/pigment/coating residues, oil skimmings & sludges, and/or aromatic solvents (not all wastes for all years)

3.5 Previous Environmental Reports

The following environmental reports/records related to the Site were summarized by Golder. Reports are ordered from oldest to most recent. While technical peer reviews of the reports were not completed, noteworthy findings are summarized below. Golder consulted these reports to develop an understanding of any issues previously identified for the Site and surrounding properties.

- 1) **(“2005 Phase I ESA”)**: *(“Phase I Environmental Site Assessment and Hazardous Materials Survey, Former Canadian Meter Company Inc. Property, 3037 Derry Road, Milton, Ontario”)*, prepared by Watters Environmental Group Inc. (“Watters Environmental”) for First Capital Acquisition Corporation, dated December 2005;
- 2) **(“2008 Revised Supplemental Phase II ESA”)**: *“Revised Supplement Phase II Environmental Site Assessment, Former Canadian Meter Company Inc. Property, 3037 Derry Road West, Milton, Ontario”* prepared by Watters Environmental for First Capital Holdings Trust, dated October 2008;
- 3) **(“2009 Risk Assessment and Addendum”)**: *“Human Health and Ecological Risk Assessment, Former Canadian Meter Inc. Property, 3037 Derry Road West, Milton, Ontario”* prepared by Ecometrix Incorporated and Watters Environmental Group Inc. for First Capital Holdings Trust dated February 2009 and *“Human Health and Ecological Risk Assessment, Former Canadian Meter Inc. Property, 3037 Derry Road West, Milton, Ontario, Addendum”* prepared for First Capital Holdings Trust by Ecometrix Incorporated and Watters Environmental dated May 2009;
- 4) **(“2009 Limited Soil Remediation”)**: *“Limited Soil Remediation Summary Report, Former Canadian Meter Company Inc. Property, 3037 Derry Road West, Milton, Ontario* prepared by Watters Environmental for FCHT Holdings (Ontario) Corporation dated December 2009;

- 5) (**"2010 Supplement Limited Soil Remediation"**): *"Supplemental Limited Soil Remediation Summary Report, Former Canadian Meter Company Inc. Property, 3037 Derry Road West, Milton, Ontario"* prepared by Watters Environmental for FCHT Holdings (Ontario) Corporation dated May 2010;
- 6) (**"RSC and Certificate of Property Use"**): Record of Site Condition For Part XV.1 of the Environmental Protection Act, RSC number 114246, 3037 Derry Road West, Milton, Ontario, filing date June 28, 2011; Certificate of Property Use 0660-7T9K7Y, dated April 26, 2011;
- 7) (**"2012 Monthly Air Quality Monitoring Report"**): *"Summary of 2011/2012 Monthly Air Quality Monitoring Events, 3037 Derry Road West, Milton, Ontario"* prepared by Watters Environmental for First Capital Asset Management ULC dated July 13, 2012;
- 8) (**"2013 Quarterly Groundwater Sampling Report"**): *"Quarterly Groundwater Sampling Results: Sept and Dec 2012, 3037 Derry Road West, Milton, Ontario"* prepared by Watters Environmental for First Capital Asset Management ULC dated February 26, 2013;
- 9) (**"2013 Groundwater Summary Report"**): *"Groundwater Summary Report June 2011 – May 2013, 6901-6951 Derry Road West, Milton, Ontario"* prepared by Watters Environmental for First Capital Assessment Management LP dated September 11, 2013;
- 10) (**"2014 Supplemental Site Assessment"**): *"Supplemental Phase II Environmental Site Assessment, Derry Heights Plaza, 6901-6951 Derry Road, Milton, Ontario"* prepared by Watters Environmental for First Capital Asset Management LP, dated February 2014;
- 11) (**"2014 HazMat Report"**): *"Hazardous Building Materials, Hazardous Controlled Products, and Ozone Depleting Substances Assessment, First Capital Realty Inc., 6901 Derry Road, Milton, Ontario"*, Prepared by Pinchin Environmental for FCR Management Services LP, dated September 23, 2014;
- 12) (**"2014 Quarterly Groundwater Monitoring Report"**): *"Quarterly Groundwater Monitoring Summary Report June 2013 to May 2014, 6901-6951 Derry Road West, Milton, Ontario (Formerly 3037 Derry Road West)"* prepared by Watters Environmental for First Capital Asset Management LP dated October 23, 2014;
- 13) (**"2014 Indoor Air Quality Monthly Monitoring Report"**): *"Indoor Air Quality Monthly Monitoring Summary Report June 2013 to May 2014, 6901-6951 Derry Road West, Milton, Ontario (Formerly 3037 Derry Road West)"* prepared by Watters Environmental for First Capital Asset Management LP dated October 23, 2014;
- 14) (**"2015 Assessment of Groundwater Impacts Report"**): *"Assessment of Groundwater Impacts Report, Derry Heights Plaza, 6901-6951 Derry Road, Milton, Ontario"* prepared by Watters Environmental Group Inc. for FCHT Holding (Ontario) Corporation, dated January 9, 2015;
- 15) (**"2015 CPU Amendment"**): Amended Certificate of Property Use 0660-7T9K7Y, dated April 22, 2015;
- 16) (**"2016 Annual Soil Cover Inspection Report"**): *"Annual Soil Cover Inspection Report, Derry Heights Plaza, 6901-6951 Derry Road West, Milton, Ontario"* prepared by Watters Environmental for First Capital Asset Management LP dated August 11, 2016;
- 17) (**"2016 Quarterly Groundwater Monitoring Report"**): *"Quarterly Groundwater Quality Monitoring Summary Report, June 2015 to March 2016, Derry Heights Plaza, 6901-6951 Derry Road West, Milton,*

- Ontario” prepared by Watters Environmental for First Capital Asset Management LP dated August 11, 2016;
- 18) (“**2016 Quarterly Indoor Air Monitoring Report**”): “*Quarterly Indoor Air Quality Monitoring Summary Report, May 2015 to March 2016, Derry Heights Plaza, 6901-6951 Derry Road West, Milton, Ontario*” prepared by Watters Environmental for First Capital Asset Management LP dated August 11, 2016;
- 19) (“**2016 CPU Amendment**”): Amendment to Certificate of Property Use 0660-7T9K7Y, dated August 11, 2016;
- 20) (“**2017 Annual Soil Cover Inspection Report**”): “*Annual Soil Cover Inspection Report, Derry Heights Plaza, 6901-6951 Derry Road West, Milton, Ontario*” prepared by Watters Environmental for First Capital Asset Management LP dated March 24, 2017;
- 21) (“**2017 Quarterly Groundwater Monitoring Report**”): “*Quarterly Groundwater Monitoring Annual Summary Report, June 2016 to March 2017, Derry Heights Plaza, 6901-6951 Derry Road West, Milton, Ontario*” prepared by Watters Environmental for First Capital Asset Management LP dated April 24, 2017;
- 22) (“**2017 Indoor Air Quality Quarterly Monitoring Report**”): “*Indoor Air Quality Quarterly Monitoring Summary Report, June 2016 to March 2017, Derry Heights Plaza, 6901-6951 Derry Road West, Milton, Ontario*” prepared by Watters Environmental for First Capital Asset Management LP dated April 24, 2017;
- 23) (“**2017 Subsurface Environmental Investigation**”): “*Subsurface Environmental Investigation, 6901-6951 Derry Road West, Milton, Ontario*”, prepared by Golder Associates Ltd. for FCR Management Services LP, dated November 2017;
- 24) (“**2018 Geotechnical Investigation**”): “*Geotechnical Investigation with Environmental Soil and Groundwater Analysis, Proposed Movati Building, 3037 Derry Road West, Milton, Ontario*” prepared by GHD for FCHT Holdings (Ontario) Corporation dated July 5, 2018;
- 25) (“**2018 Building Pressurization Work Plan**”): “*Building Pressurization Work Plan*”, prepared by Golder Associates Ltd. for FCR Management Services LP, October 1, 2018;
- 26) (“**2018 Work Plan for Vapour Intrusion Assessment**”): “*Work Plan For Vapour Intrusion Assessment at the Derry Heights Plaza, 6901-6951 Derry Road West, Milton, Ontario*”, prepared by Golder Associates Ltd. for FCR Management Services LP, September 27, 2018;
- 27) (“**2017 Annual Monitoring and Inspection Report**”): “*2018 Annual Monitoring and Inspection Report, 6901-6951 Derry Road West, Milton, Ontario*”, prepared by Golder Associates Ltd. for FCR Management Services LP dated March 2018;
- 28) (“**2018 Annual Monitoring and Inspection Report**”): “*2019 Annual Monitoring and Inspection Report, 6901-6951 Derry Road West, Milton, Ontario*”, prepared by Golder Associates Ltd. for FCR Management Services LP, March 2019;
- 29) (“**2019 Annual Monitoring and Inspection Report**”): “*2019 Annual Monitoring and Inspection Report, 6901-6951 Derry Road West, Milton, Ontario*”, prepared by Golder Associates Ltd. for First Capital Asset Management LP, March 2020;

- 30) (“**2019 CPU Amendment**”): Amended Certificate of Property Use No. 0660-7T9K7Y, dated March 20, 2019;
- 31) (“**2019 Delineation and Remediation Work Plans**”): “*Delineation and Remediation Work Plans as Required by CPU 0660-7T9K7Y at 6901-6951 Derry Road West, Milton, Ontario*” prepared by Golder Associates Ltd. for FCR Management Services LP dated June 28, 2019;
- 32) (“**2019 Subsurface Investigation**”): “*2019 Subsurface Investigation, 6901-6951 Derry Road West, Milton Ontario*” prepared by Golder Associates Ltd. for First Capital Asset Management LP dated June 2020;
- 33) (“**2020 Monitoring Well Re-Installation**”): “*Monitoring Well Reinstallation and Soil Sampling Program, Derry Heights Plaza, 6901-6951 Derry Road West, Milton, Ontario*” prepared by Golder Associates Ltd. for First Capital Asset Management LP dated October 16, 2020; and,
- 34) (“**Q3 2020 Groundwater Monitoring and Soil Barrier Inspection**”): “*Q3 2020 Groundwater Monitoring Event and Annual Soil Barrier Inspection, 6901-6951 Derry Road West, Milton, Ontario*” prepared by Golder Associates Ltd for First Capital Asset Management LP dated October 16, 2020.

1) 2005 Phase I ESA

The Site was developed with one building located on the southwest portion of the Site, that was occupied by three separate tenants: Pur Health and Fitness, Tim Development Schools Inc., and R.A.M. Lighting (in the warehouse area). This building was previously assigned the address of 3037 Derry Road West, and was formerly occupied by Canadian Meter Company (“CMC”) and used as a refurbishing and manufacturing operation of natural gas meter equipment from its initial development in the mid 1950s to approximately 2003. Watters Environmental reported the following issues of potential environmental concern at the Site:

- An approximately 27,300 L (6,000 gallon underground storage tank (“UST”)) was formerly present adjacent to the south of the building. The UST was removed prior to 1993 and petroleum hydrocarbon (“PHC”) impacted soil in the vicinity of the UST was removed. Groundwater quality in this area was not tested;
- Approximately 200 metric tonnes of PHC impacted soil from the UST excavation was stockpiled on the northwest portion of the Site. It was unknown whether this soil had since been removed from the Site;
- A chemical storage shed was formerly located outside the northwest corner of the Site building. The shed reportedly contained xylene, acetone, mineral spirits, oils, cutting fluids, lacquer thinners, isopropyl alcohol and coolants along with two approximately 1,150 L aboveground storage tanks (“ASTs”) for waste cutting oils and waste oils and mineral spirits and one 200 L drum with unknown contents;
- There were former solvent degreasers located within four different areas of the building. It was suspected that chlorinated solvents had been used during degreasing, but nothing was confirmed; and,
- Four small deposits of black/brown granular material, possibly foundry sand, were reported to be present outside the northwest corner of the building.

To address these issues, Watters Environmental recommended that a limited soil and groundwater investigation be completed in these areas.

2) 2008 Revised Supplemental Phase II ESA

The Revised Supplemental Phase II ESA was based on the findings of the 2005 Phase I ESA report in the area of the former manufacturing building as well as the results of a Phase II ESA conducted by Pinchin Environmental in 2003. The drilling program consisted of drilling 26 boreholes, where 24 were installed with monitoring wells and collecting a grab sample from a stockpile of what appeared to be foundry sand in the northwest corner of the building. Soil and groundwater samples were submitted for analysis of pH, metals, VOCs, PHCs, and PAH.

The reported concentrations of the following COCs in soil were above the Table 3 Standards: beryllium in the grab sample; and 1,1-dichloroethylene in soil samples collected from BH8(MW) and BH9(MW). No evidence of petroleum hydrocarbon product was observed in any soil or groundwater samples. The reported concentrations of the following COCs in groundwater were above the Table 3 Standards: 1,1,1-trichloroethane, 1,1-dichloroethylene, and/or vinyl chloride from BH4(MW), BH5(MW), BH8(MW) to BH10(MW), BH13(MW), BH14(MW), and BH18(MW). The soil and groundwater impacts related to volatile COCs at the northeast portion of the building were inferred to be related to the former degreaser/parts washer and northwest corner of the Site building is inferred to be related to the chemical storage shed that were identified during the 2005 Phase I ESA. The investigation did not include the collection of soil or groundwater samples within the footprint of the former chemical storage shed.

As the native silty clay till at the Site generally increased in density with depth, it was inferred that there would also be a decrease in hydraulic conductivity in depth; therefore, it was inferred that vertical delineation was not required since it was unlikely for the impacts to migrate vertically downward.

3) 2009 Risk Assessment and Addendum

The purpose of the risk assessment was to evaluate potential receptors, pathways of exposure to contaminants for the receptors, and the magnitude of potential human or ecological health hazards. The risk assessment generally followed O. Reg. 153/04, prior to the 2011 amendment. The contaminants of concern with property specific standard developed as part of the risk assessment included 1,1-dichloroethylene and PHC F3 in soil and 1,1,1-trichloroethane, 1,1-dichloroethylene, vinyl chloride, chloroethane, and carbon disulphide in groundwater. The risk management measures included the following recommendations:

- New buildings should not constructed where VOC impacts above the Table 3 Standards were present, unless a new risk assessment for the building show acceptable indoor air quality risks. The construction of slab-on-grade buildings located outside of the area where impacts above the Table 3 Standards were present with a minimum of 1 m between the foundation and the water table was permitted;
- Indoor air monitoring is recommended where the existing building overlies the VOC plume to demonstrate adequate indoor air quality or the need for physical controls (e.g., increased ventilation);
- Land use is restricted to commercial, industrial, community, and institutional uses;
- Where PHC F3 impacts are present, a minimum of 0.5 m of clean topsoil to be placed in landscaping areas to protect ecological receptors;
- Groundwater monitoring to verify compliance with the proposed property specific standards to ensure that the groundwater impacts are confined to the Site and do not impact new buildings; and,
- Inspections of the clean topsoil areas to ensure the integrity of the topsoil is maintained.

4) 2009 Limited Soil Remediation

A limited remediation program was completed to address beryllium impacted soil that was identified in the 2008 Revised Supplemental Phase II ESA (suspected foundry sand). The soil verification samples collected from the sidewalls and the floor of the excavation met the Table 3 Standards for metals (including beryllium). The excavation was approximately 24 m² and extended to a depth of 0.5 m. Approximately 102 metric tonnes of soil and 8,005 L of water were removed for off-Site disposal at the Newalta facilities in Stoney Creek and Rexdale, Ontario, respectively. The excavation was backfilled with clean fill materials (described as “commercially available granular fill”) that were imported as part of site re-development. The report concluded that the beryllium-impacted soil was remediated.

5) 2010 Supplemental Limited Soil Remediation

During the 2009 Limited Soil Remediation, PHC impacts in soil were identified that were not described in the 2009 Limited Soil Remediation report. The source of PHC impacts were not identified in the report and the location of the remedial excavation is approximately 50 m north of the former boiler room UST. The initial excavation resulted in verification soil samples were concentrations above the Table 3 Standards. A second and third round of excavations were carried out before the sidewalls and floor verification samples met the Table 3 Standards for PHC F1, PHC F2, and PHC F4 and the PSS derived in the risk assessment for PHC F3. The final excavation limits were approximately 225 m² and extended to a maximum depth of 0.9 m. Approximately 148 metric tonnes of soil and 48,080 L of water were removed for off-Site disposal at the Newalta facilities in Stoney Creek and Rexdale, Ontario, respectively. The excavation was backfilled with clean fill materials (described as “commercially available granular fill”) that were imported as part of site re-development. The report concluded that the PHC-impacted soil was remediated.

6) RSC and Certificate of Property Use

On June 16, 2009, the Ministry of the Environment, Parks and Conservation (“MECP”) acknowledged risk assessment No. 4041-6NZPD2. The remediations 2009 described in the 2009 Limited Soil Remediation report and the 2010 Supplemental Limited Soil Remediation report were conducted after the risk assessment was acknowledged. On April 26, 2011, the MECP issued Certificate of Property Use Number 0660-7T9K7Y (the “CPU”). The MECP acknowledged Record of Site Condition Number 114246 (the “RSC”), which was filed on the Environmental Site Registry on June 28, 2011.

7) 2012 Monthly Air Quality Monitoring Report 10) 2014 Supplemental Site Assessment

The objective of the report was to assess PHC-related impacts in soil and groundwater. The MECP also required that an investigation be conducted to delineate the extent of the contaminants of concern and identify why there have been increases in the concentrations of the contaminants of concern. Watters retained a geophysics subcontractor to carry out a geophysical investigation using ground penetrating radar (“GPR”) at the former manufacturing building to determine whether there might be a potential source of contamination such as a former storage tank or supply lines below the building. The survey identified two anomalous responses between 1.0 to 1.7 mbgs and 1.7 to 1.8 mbgs in the warehouse area of the former manufacturing building, which were suspected to be remnant service lines associated with former industrial activities.

11) 2014 HazMat Report

Hazardous materials were confirmed to be present within the Site building located at 6901 Derry Road West, including asbestos in parging cement on fittings and hangars, sweat warp, and transite piping and fascia; lead in paint ranging from <10 to 77,300 µg/g or <0.001% to 7.73% by weight, as well as in lead-acid batteries in back-up emergency lights; mercury within the vapour of all fluorescent lamps located throughout the building; silica in concrete mortar, brick, ceramics, slate, stone, asphalt, etc.; ozone depleting substances (“ODS”) in roof top HVAC units; and, polychlorinated biphenyls (“PCBs”) in light ballasts. Pinchin reported that all of these materials were observed to be in good condition and could be managed in place, and that no other action was required at that time.

12) 2014 Quarterly Groundwater Monitoring Report

The purpose of this report was to summarize the results of the four quarterly sampling events conducted from June 2013 to May 2014. Groundwater sampling was conducted per the CPU and compared to the PSS. Analytical results met the PSS, with the exception of BH4(MW), BH9(MW), BH13(MW) and BH14(MW). The MECP recommended groundwater sampling on a quarterly basis continue.

13) 2014 Indoor Air Quality Monthly Monitoring Report

The purpose of this report was to summarize the results of the indoor air monitoring events conducted from June 2013 to May 2014. Indoor air sampling was discontinued after the previous 12 sampling events conducted from June 2011 to May 2012, before the MECP provided notice to continue in 2013. Indoor air sampling was conducted monthly from June 2013 to May 2014 with the exception of January and February 2014. The indoor air results were below the Indoor Air Target Concentrations as per the CPU during the sampling events.

14) 2015 Assessment of Groundwater Impacts Report

The objective of the report was to further assess the lateral and vertical extent of VOC impacts in groundwater and to determine whether the existing risk management measures remained applicable. Four nested wells (BH32(MW), BH33(MW), BH34(MW) and BH35(MW) with shallow and deep screens at each location) were installed. The reported COC concentrations in all deep groundwater samples were below the Table 7 site condition standards. Watters concluded that COC impacts were confined to the upper aquifer and that the existing RMM remained applicable.

15) 2015 CPU Amendment

On April 22, 2015, the MECP replaced the CPU with the Amended Certificate of Property Use. The Amended CPU included Item 5.2 that prohibited the construction of any new building within a specific area of the Site (the “Conditional Build Area”) to address potential concerns relating to the potential for vapour intrusion to impact indoor air quality.

16) 2016 Annual Soil Cover Inspection Report

The purpose of this report is to summarize the findings of the annual soil cover inspection conducted on September 21, 2015 in the area identified in the CPU. It was reported that the barrier was free from any loss of integrity and in good condition at the time of the inspection.

17) 2016 Quarterly Groundwater Monitoring Report

The purpose of this report was to summarize the results of the quarterly groundwater monitoring events conducted from June 2015 to March 2016. Groundwater monitoring was conducted for the contaminants of concern included in the 2015 CPU Amendment. Two sampling events were conducted in the second quarter (September and October 2015) due to concentrations reported approximately three times that reported in the first quarterly sampling event in June 2015. During the fourth quarterly sampling event (January 2016), re-sampling was conducted at monitoring wells BH13(MW) and BH34(MW) due to concentrations for parameters above the PSS that had not previously exceeded. The MECF required that groundwater monitoring continue on a quarterly basis and that as long as the indoor air quality continues to be below the Indoor Air Target Concentrations than no further risk management measures are required due to the concentrations above the PSS in groundwater. It is of note that this is the first report that indicates that the applicable standards for the Site are the Table 7 Standards instead of the previously stated Table 3 Standards that were used in the risk assessment.

18) 2016 Quarterly Indoor Air Monitoring Report

The purpose of the report was to summarize the results of the quarterly indoor air monitoring events conducted from May 2015 to March 2016 per the CPU. It is of note that the 2015 CPU Amendment reduced the indoor air sampling frequency from monthly to quarterly. Two indoor air sampling events were conducted in the second quarter (September and October 2015) due to a faulty canister in the September 2015 sampling event. The indoor air results were below the Indoor Air Target Concentrations as per the CPU during the sampling events. It was noted that in August 2014, an exceedance of vinyl chloride was reported at location IAQ6, although met the Indoor Air Target Concentrations in the sampling events conducted thereafter.

19) 2016 CPU Amendment

On August 11, 2016, the MECF amended the CPU at the request of First Capital to allow the construction of new slab-on-grade buildings in the Conditional Build Area that included a soil vapour intrusion mitigation system risk management measure.

20) 2017 Annual Soil Cover Inspection Report

The purpose of this report was to summarize the findings of the annual soil cover inspection conducted on September 21, 2016 in the area identified in the CPU. It was reported that the barrier was free from any loss of integrity and in good condition at the time of the inspection.

21) 2017 Quarterly Groundwater Monitoring Report

The purpose of this report was to summarize the findings of the quarterly groundwater monitoring conducted from June 2016 to March 2017 per the CPU. Groundwater concentrations reported between June 2016 and March 2017 included concentrations above the PSS at monitoring wells BH4(MW), BH9(MW) during each of the four sampling events for one or more of the contaminants of concern per the CPU. Due to the concentrations above the PSS, a contingency plan was prepared, which concluded that until future re-development at the Site, the focus

of the groundwater monitoring would be protection of human health from groundwater impacts. This means there would be continued indoor air quality monitoring.

22) 2017 Indoor Air Quality Quarterly Monitoring Report

The purpose of this report was to summarize the findings of the quarterly indoor air monitoring conducted from June 2016 to March 2017 per the CPU. The indoor air results were below the Indoor Air Target Concentrations as per the CPU during the sampling events.

23) 2017 Subsurface Environmental Investigation

The objective of the report was to further assess geophysical anomalies identified in the 2014 Supplemental Environmental Site Assessment. The investigation included the advancement of eight hydro-vacuum test pits (HV17-1 to HV17-8) in the areas of the GPR anomalies and the advancement of two boreholes completed as monitoring wells (MW17-1 within the warehouse and MW17-2 adjacent to the west of the warehouse). Soil samples were collected from selected investigation locations for analysis of the contaminants of concern. Groundwater samples were collected from each of the new monitoring wells for COC analysis. The principal findings of the investigation included:

- No sources of bulk chemical storage (i.e., drums, USTs, etc) that could result in on-going groundwater impacts were noted in any of the investigation locations;
- Four asphalt-coated steel pipes (about 25.4 to 38.1 mm inch outside diameter) were present in area GPR 4. Golder notes that piping of this nature was commonly used for potable water conveyance;
- Elevated soil headspace concentrations were noted in soil samples collected from test pits HV17-1 (1,020 ppm), HV17-2 (703 ppm) and HV17-5 (905 ppm);
- The reported COC concentrations in soil samples submitted as part of this investigation were generally consistent with the known conditions at the Site; and,
- The reported COC concentrations in successive groundwater samples collected from MW17-2 represent the maximum Site-wide COC concentrations reported to date. MW17-2 is located in the vicinity of monitoring wells that are included in the CPU groundwater monitoring program and have reported COC concentrations that consistently exceed the PSS for groundwater (BH4, BH9 and BH34[s]).

24) 2018 Geotechnical Investigation

The objective of the report was to undertake a geotechnical investigation for a proposed athletic club to summarize the subsurface conditions and provide recommendation regarding the foundation types and bearing pressures, seismic site classification, and comment on excavation, backfill, groundwater, and construction field review. The proposed building was noted to be constructed slab on grade, with the exception of two pools and a gym that would have sub-grade excavations approximately 2-3 m below grade. The proposed building footprint was partially within the Conditional Build Area.

The environmental component of the investigation included the advancement of nine boreholes, eight of which were installed with monitoring wells in the northwest corner of the Site. The subsurface conditions encountered at the Site consisted of asphalt cover followed by silty clay (in some areas reworked, which may be fill material) to approximately 5.5 m below ground surface, overlain by a silty sand to sandy silt glacial till, which was followed by shale bedrock at approximately 23.7 m below ground surface. Soil concentrations from the six samples and

groundwater concentrations from the eight monitoring wells analyzed for PHCs and VOCs were below the Table 1 Standards.

25) 2018 Building Pressurization Work Plan

The objective of the work plan is to provide recommendations for HVAC modifications to maintain a positive pressure in the occupied spaces of the former manufacturing building, including the vacant warehouse and the two commercial tenant spaces, as an interim soil vapour mitigation system. The report notes that the building is serviced by fifteen gas-fired roof top units (RTU) with a total combined cooling capacity of 100 tons. No HVAC design drawings were available for review. The total building floor area is 49,872 sq. ft. Eight of the RTUs feature economizers with barometric relief dampers and seven of the RTUs feature economizers with no relief dampers. The estimated total air flow rate being supplied through the occupied spaces at 400 cfm/ton or 40,000 cfm. Based on the manufacturer's technical specifications, the heat exchangers in the RTU's could reasonably handle up to 30% outside air during the winter season. Recommendations for modification of RTU operation to positively pressurize the building were presented. The work plan further recommended that HVAC modifications should be considered as a potentially applicable long-term solution to maintaining positive pressure inside the occupied spaces. Golder notes that these recommendations were not implemented since the building was vacated in May 2019 and demolished in August 2019.

26) 2018 Work Plan for Vapour Intrusion Assessment

The objective of the work plan is to further characterize the potential exposure of occupants of the former manufacturing building to VOCs in indoor air and to collect additional information required to select and design an appropriate soil vapour intrusion mitigation system for the building. The recommended scope of work including a soil vapour screening survey, the installation of nine soil vapor probes and two quarterly soil vapour monitoring events. Golder notes that these recommendations were not implemented since the building was vacated in May 2019 and demolished in August 2019.

27) 2017 Annual Monitoring and Inspection Report

The annual report was completed to satisfy the requirements of the CPU from May 2017 to March 2018. The report notes that the reported COC concentrations in groundwater samples collected during the quarterly sampling program met the PSS and/or Table 7 Standards (as applicable) or exceeded standards during more than one the last four quarterly sampling events with the exception of samples collected during the May and September 2017 sampling events for BH13(MW) and BH34(MW)[d] and BH4(MW), BH14(MW), and BH34(MW)[s], respectively, which were required to be re-sampled. The concentrations remained above the applicable standard at BH34(MW)[d] during the May 2017 sampling event and at BH14(MW) during the September 2017 sampling event. Contingency plans were prepared for the May and September 2017 monitoring, although no additional risk management measures were determined to be required given that the indoor air monitoring program confirmed that the reported concentrations met the property specific target indoor air concentrations.

Indoor air monitoring was conducted on a quarterly basis from May 2017 to March 2018 per the CPU. The analytical results for indoor air were below the property specific target indoor air concentrations. Soil barrier inspections were conducted on a quarterly basis from May 2017 to March 2018, which reported that there were no significant disturbances to the soil cap and the soil cap was determined to be intact and in good condition.

28) 2018 Annual Monitoring and Inspection Report

The annual report was completed to satisfy the requirements of the CPU throughout the 2018 calendar year. The report notes that the reported COC concentrations in groundwater samples collected October 10, 2018 (BH13(MW)) and January 15, 2019 (BH4(MW) and BH13(MW)) were above the applicable standards, which required resampling to confirm the initial results. The reported concentrations of the confirmation samples were below the applicable standards. The report further notes that the reported COC concentrations for all indoor air samples collected as part of the monitoring program met the applicable standards. No disturbances in the soil cap were observed over the quarterly monitoring and it was observed to be intact and in good condition during all inspection events.

29) 2019 Annual Monitoring and Inspection Report

The annual report was completed to satisfy the requirements of the CPU throughout the 2019 calendar year. Groundwater monitoring was suspended during demolition of the former manufacturing building and subsequent remediation activities. In the March 2019 monitoring event, groundwater results met the applicable standards or had previously exceeded during the one of the last four sampling events with the exception of BH3(MW) and BH17-2, which also exceeded during the re-sampling event. A contingency plan was prepared, which concluded that any new building at the Site will be protected by a soil vapour intrusion mitigation system and no further risk management measures were necessary to protect off-Site receptors. Indoor air sampling was conducted in March 2019, then was suspended due to the building demolition in August 2019. The reported concentrations in indoor air were below the target indoor air concentrations. The annual soil barrier inspection was conducted in March 2019, which reported that the soil barrier was intact and in good condition.

30) 2019 CPU Amendment

On March 20, 2019, the MECP further amended the CPU, which included a revised risk management measure for construction of buildings that include below grade structures within the Conditional Build Area, new risk management measures requiring HVAC modifications and vapour intrusion assessment below the building slab, alterations to the groundwater monitoring risk management measure, and a risk management measure to submit a soil and groundwater delineation plan and remedial action plan in response to concerns with increasing trends in VOC concentrations in groundwater.

A summary of the CPU requirements and their disposition is provided in the following table.

RMM and Monitoring and Reporting Requirements	CPU Reference	Status	Comments
Conduct a groundwater monitoring program on the Site, which includes quarterly groundwater sampling of 26 monitoring wells and annual sampling of an additional 6 monitoring wells. Per MECP recommendation, the quarterly monitoring can be reduced to an annual frequency after 2 years. Implement contingency measures if the groundwater concentrations exceed the Property Specific Standards ("PSS") and/or the applicable Generic Site Condition Standards as set out in the CPU.	Section 4.2.1	On-going	Conducted first quarterly and annual sampling events in March 2019. A re-sampling event (May 2019) was conducted following the March 2019 quarterly sampling and a contingency plan was submitted to the MECP thereafter (refer to Section 3.2). Groundwater monitoring was suspended following demolition of the building at the Site. Monitoring well replacement was completed September 2, 2020 and the monitoring program will resume thereafter.

RMM and Monitoring and Reporting Requirements	CPU Reference	Status	Comments
Conduct an indoor air quality monitoring program on a quarterly basis for a minimum of two years following the date of the CPU. Implement contingency measures if the air concentrations exceed the commercial indoor air target concentrations set out in the CPU.	Section 4.2.2	Complete (building no longer exists)	Conducted first quarterly sampling in March 2019. No contingency measures were required. Indoor air monitoring was suspended following demolition of the former manufacturing buildings. The construction of a new building is not planned.
Prepare and implement a soil and groundwater management plan for any activities potentially involving contact with or exposing site soils and/or groundwater.	Section 4.2.3 (a)	On-going	The soil and groundwater management plan was previously developed by Watters Environmental.
Develop and implement a Site-specific health and safety plan for all intrusive, below grade construction activities that may potentially come in contact with or expose site soil or groundwater.	Section 4.2.3 (b)	Complete	An Environmental, Health and Safety Management Plan was previously prepared by Watters Environmental.
A soil cover barrier that has been installed in the area of the Site identified in Figure 1 of CPU shall be maintained as to prevent exposure to the COCs.	Section 4.2.4 (a)	Complete	There has been no necessary maintenance implemented on the soil cover barrier since issuance of the CPU.
Prepare and implement an inspection and maintenance program for the soil cover barrier for as long as the COCs are present on the Property in accordance with Section 7.4.3 of the Risk Assessment.	Section 4.2.4 (b)	Ongoing	Conducted on an annual basis in 2019 and 2020.
Take appropriate measures to contain any spill or release and implement and document a spill clean-up procedure as soon as practicable following any spill or unintentional release of impacted materials. Analytical testing shall be undertaken as necessary to confirm clean-up.	Section 4.2.5	Ongoing	A Spill Response Plan has been completed by others. There have been no spills or releases noted or observed.
Construction of new enclosed slab-on-grade or below-grade buildings within the Conditional Build Area with a soil vapour intrusion mitigation system.	Section 4.2.6	For new buildings only	No new buildings were constructed in 2019.
Implement a sub-slab vapour monitoring program for any new building constructed in the Conditional Build Area Including 30 m Buffer Zone.	Section 4.2.7	For new buildings only	No new buildings were constructed in 2019.
Implement modifications to the HVAC system in the building and conduct performance	Section 4.2.8	Required for the	The risk management is not required as the building at the Site has since been demolished.

RMM and Monitoring and Reporting Requirements	CPU Reference	Status	Comments
monitoring to ensure the building is under positive pressure		former building	
Implement a work plan for vapour intrusion assessment in the former building.	Section 4.2.9	Required for the former building	The risk management is not required as the building at the Site has since been demolished.
Section 4.2.8 and 4.2.9 will be revoked upon notification the MECP that the building has been demolished.	Section 4.2.10	Required for the former building	The risk management is not required as the building at the Site has since been demolished.
Provide the MECP with a work plan to delineation soil and ground water contamination at the Site and a remedial action plan if the building at the site is demolished.	Section 4.2.11	Complete	The plans were prepared dated June 28, 2019 and further described below.
Prepare an annual report by March 31 of each year documenting activities relating to the RMMs undertaken during the previous calendar year. The report is to include the results of all groundwater and indoor air monitoring, all records relating to the soil and groundwater management plan, all records relating to the health and safety plan, all records relating to the inspection and maintenance of the soil barrier, all records relating to any spills on the Site, all records relating to the soil vapour intrusion mitigation system, all records relating to the sub-slab vapour monitoring, and a copy of all financial assurance re-evaluations. It is assumed that the interpretation of the plume behaviour for the contaminants of concern (Section 4.1.2(j)) will be documented in the annual report.	Section 4.3	On-going	Annual reporting will continue until the CPU is revoked.

31) 2019 Delineation and Remediation Work Plans

The report summarizes delineation work plan and remedial action plan required per Section 4.2.11 of the 2019 CPU Amendment. The objectives of the delineation work plan were:

- Further delineation of the lateral extent of groundwater impacts at the northwest corner of the former manufacturing building;

- Further delineation of the lateral and vertical extent of groundwater impacts downgradient of monitoring well nest BH34(MW)[s&d];
- Further delineation of the lateral extent of groundwater impacts north of BH4(MW) and east of MW17-2; and,
- Further delineation of the vertical extent of groundwater impacts at MW17-2 and BH13(MW).

The scope of work for the remedial action plan consisted of:

- Monitoring wells with the building footprint, as well as MW17-1 and MW17-2, will be abandoned and select outdoor monitoring wells will be protected;
- The soil and groundwater management plan and construction health and safety plan previously prepared for the Site will be implemented during building demolition;
- When footings, floor slab, and surficial fills are removed from the building footprint, the delineated extent of the PSS impacts will be excavated to the extent practicable and confirmation samples in accordance with O. Reg. 153/04 will be collected, where applicable. Soil samples will be collected from 30 test pits within the remaining area of the building footprint;
- Excavation of any obvious evidence of potential contamination within the building footprint (such as buried drums);
- The location and elevation of sampling locations will be determined relative to a reference grid marked in the field;
- The excavation will be backfilled as specified by a geotechnical engineer and resurfaced as a parking area; and,
- Abandoned monitoring wells will be re-instated.

32) 2019 Subsurface Investigation

The objective of this report was to summarize the findings of the delineation work plan and the remedial action plan. Four boreholes advance and completed as monitoring wells to further delineate the COCs in groundwater. The reported concentrations in the groundwater samples collected as part of the investigation were below the PSS, with the exception of the reported concentration of vinyl chloride at monitoring well MW17-2R-D. The vertical extent of PSS impacts in groundwater at monitoring wells BH13(MW) and MW17-2 were not delineated, although it is of note that the RSC was filed without vertical delineation being achieved at the Site. While it is possible that further investigation may identify additional concentrations above the PSS in groundwater, as it was inferred that the maximum concentration has been located (at monitoring well MW17-2) and therefore further additional efforts to delineate the contaminants of concern at the Site is unlikely to contribute to further interpretation of the distribution of the COCs, and additional human risks are unlikely to be identified at the Site. The lateral extent of PSS impacts in groundwater in the area of monitoring wells BH13(MW), BH4(MW), BH9(MW), and MW17-2 was delineated.

The monitoring wells included in the remedial action plan were abandoned prior to the building being demolished in August 2019. Test pits were advanced in the footprint of the former building, adjacent to monitoring well MW17-2, and in the former boiler room. Based on those findings, two excavations were conducted at the Site (one to the west of the former building footprint due to exceedances of the PSS for 1,1-dichloroethylene at MW17-2 and test

pit TP19-W1 and a second within the former building on the west side due to strong odours and buried metals pails encountered at test pit TP19-N20), where soil with contaminants of concern concentrations above the PSS or visual or olfactory evidence of impacts were removed until there was no further field evidence of impacts, at which point confirmatory soil samples were collected at the sidewalls and floors of the excavations. The quantity of excavated soil that was removed for off-Site disposal was 8,375 tonnes (approximately 5,200 m³). The excavations were backfilled with reused soil from stockpiles and imported fill obtained from pre-approved source sites.

33) 2020 Monitoring Well Re-Installation

The purpose of this report was to summarize the monitoring well reinstallation of the abandoned monitoring wells within the former building footprint. The nine monitoring well locations were advanced in August and September 2020. It is of note that the initial attempt to install monitoring wells BH12(MW) and BH35(MW)[d] were abandoned due to evidence of potential impacts in the field (elevated headspace, odour, and staining). These two monitoring wells, as well as two additional boreholes for lateral and vertical delineation of the abandoned location for BH12(MW) were installed in September 2020. The analytical results of the soil samples collected during the monitoring well re-installation were below the PSS with the exception of soil samples collected at BH17-1-R, BH12-R (abandoned location) and BH35[D]-R (abandoned location). The soil samples above the PSS were vertically delineated. Additional investigation around BH12-R was completed to laterally delineate the impacts at this location.

34) Q3 2020 Groundwater Monitoring and Soil Barrier Inspection

The purpose of this report was to summarize the results of the Q3 2020 groundwater monitoring (the first event post-building demolition, soil remediation, and monitoring well re-installation) and the annual soil barrier inspection. The analytical results were below the PSS and/or Table 7 Standards (as applicable) or had previously exceeded the applicable standards within the last four quarterly sampling events with the exception of monitoring wells BH10(MW) and BH34(MW)[s]. These two locations were re-sampled and BH10(MW) continued to exceed. A contingency plan was prepared and concluded that no additional RMM were necessary to protect on- or off-Site receptors.

The annual soil barrier inspection was conducted, which reported that there were no disturbances to the soil barrier, and it was observed to be intact and in good condition.

Summary of Prior Reports

A Phase I ESA was conducted in 2005 at the Site that identified areas of potential environmental concern that related to the industrial use of the former manufacturing building, including a former boiler room UST to the south of the building, stockpiled PHC-impacted soil in the northwest portion of the Site, a chemical storage shed formerly in the northwest corner of the building, and former operation of solvent degreasing equipment within the building. At the time of the Phase I ESA, the Site was owned by Trenwith Investment Ltd. but was formerly occupied by Canadian Meter Company, which used the existing building for the refurbishing and manufacturing of natural gas meter equipment from 1969 to 2003/2004.

A Supplemental Phase II ESA was conducted at the Site in 2008, building on a prior Phase II ESA completed in 2003, to further assess the issues identified in the Phase I ESA. The Supplemental Phase II ESA identified concentrations beryllium and 1,1-dichloroethylene in soil and 1,1,1-trichloroethane, 1,1-dichloroethylene, and vinyl chloride in groundwater that were above the Table 3 site condition standards, suggesting a historical release of

1,1,1-TCA. It is of note that this investigation did not include the installation of a borehole or monitoring well in the footprint of the former chemical storage shed.

A risk assessment was conducted in support of an RSC. The risk assessment identified human health and ecological risks at the Site and as a result, CPU Number 0660-7T9K7Y dated April 26, 2011 was issued. The CPU was subsequently amended on April 22, 2015, August 11, 2016, and March 20, 2019. Limited remediation to remove the beryllium impacted soil was conducted in November 2009. During that remediation, PHC-impacted soil was observed, and further excavation was conducted to remove those impacts. The RSC was acknowledged in June 2011.

In 2013 and 2014, a Supplemental Phase II ESA was conducted to further assess PHC impacts in soil and groundwater. The MECP also required that an investigation be conducted to delineate the extent of the contaminants of concern and identify why there have been increases in the concentrations of the contaminants of concern. As part of this assessment, geophysical investigation was conducted using GPR in the Site building to determine whether there may be a potential subsurface source of VOC impacts such as a former storage. The GPR survey identified two areas of anomalous responses within the warehouse portion of the Site building, which were suspected to be remnant service lines associated with the former industrial uses. Two additional anomalies were identified; however, the reported depth was directly below the concrete floor slab and it was concluded that these anomalies represented a void below the floor slab caused by some minor subsidence of the underlying subgrade materials rather than buried equipment or other infrastructure. It was noted that there was the potential for residual VOCs within these suspect sources to act as a long-term source of VOC impacts to soil and groundwater.

Since the CPU was issued, groundwater and indoor air monitoring were conducted in accordance with the CPU coming into effect. Over the duration of the CPU monitoring program from 2011 and 2020, the reported COC concentrations at one or more monitoring wells were above the PSS in the first sampling event in June 2011 and continuously during each quarter since 2013, suggesting that the groundwater investigations conducted as part of the RSC may not have adequately characterized the maximum COC concentrations in groundwater, which were used to set the PSS in the CPU. Through the indoor air monitoring program for the former manufacturing building, the reported indoor air concentrations were below the Indoor Air Target Concentrations per the CPU with the exception of one sampling event in August 2014.

In 2017, an investigation to further assess potential sources of groundwater impacts at the Site was conducted. As part of this investigation, GPR was conducted to find any geophysical anomalies to assess the potential for these features to represent a potential source of VOC impacts (i.e., buried drums or storage tanks). This investigation concluded that there was no evidence that the geophysical anomalies were associated with a contaminant source with the potential to result in further groundwater impacts. The reported COC concentrations in groundwater samples collected from the new monitoring well MW17-2 (located immediately outside the building's northwest corner, in the approximate location of the former chemical storage shed), were significantly greater than the applicable PSS for 1,1-DCE, 1,1,1-TCA, and vinyl chloride), representing the new maximum COC concentration detected in groundwater at the Site at any time. Monitoring well MW17-2 is in the general location as other monitoring wells where reported COC concentrations in groundwater over the course of the CPU monitoring program have consistently exceeded the PSS, principally including BH4(MW), and BH9(MW), and BH13(MW).

In 2019, a CPU amendment was issued by the MECP that included obligations for FCAM to complete additional soil and groundwater investigations at the Site. The quarterly groundwater and indoor air monitoring were suspended upon confirmation of the building demolition. The 2019 investigation delineated the lateral extent of

PSS impacts in groundwater in the area of monitoring wells BH13(MW), BH4(MW), BH9(MW), and MW17-2, although the vertical extent of PSS impacts in groundwater at monitoring wells BH13(MW) and MW17-2 were not delineated. It was inferred that the maximum COC concentrations were located at monitoring well MW17-2 and additional human risks are unlikely to be identified at the Site. After the investigation was completed, the monitoring wells within the building were abandoned and the manufacturing building was demolished.

Following building demolition, the 2019 CPU Amendment required further delineation of COCs in soil within the building footprint, to the west of the building footprint and in the former boiler room. This investigation identified two areas where remedial excavations were then completed - one within the western portion of the former building footprint due to buried pails that were observed and a second to the west of the former building due to concentrations reported above the PSS at test pit location TP19-W1. At the completion of these excavations, the reported concentrations of the confirmatory soil samples were below the PSS. Four test pits and one other historical location (TP19-N13, TP19-N34, TP19-N11, TP19-G-SA1, 17-4) in the vicinity of monitoring well MW17-1 where a historical soil exceedance of the PSS was present, had soil samples that were submitted for analysis. The reported COC concentrations in the soil samples collected from the four test pits and historical location were below the PSS. The reported COC concentrations in groundwater samples collected from monitoring well MW17-1 were also below the PSS. It is of note that the reported concentrations of 1,1,1-trichloroethane, 1,1-dichloroethane, 1,1-dichloroethylene, tetrachloroethylene, and trichloroethylene in confirmatory samples collected from the two remedial excavations are above the Table 7 Standards.

Once the remedial excavations were completed, the monitoring wells that were abandoned prior to building demolition were replaced in accordance with the CPU requirements. During well replacement, PSS impacts were noted at from 1.5 to 2.3 m below ground surface (bgs) at MW17-1-R, from 2.3 to 3.0 m bgs at BH12-R, and from 3.8 to 4.4 m bgs at BH35[d]-R. Quarterly groundwater monitoring was resumed in September 2020.

4.0 REGULATORY INFORMATION REVIEW

4.1 Provincial Ministry of Environment

A Freedom of Information ("FOI") request was submitted to the Ontario Ministry of the Environment, Conservation, and Parks ("MECP") in writing with the following questions:

- Has the MECP ever issued any approvals, permits or licences for the Site?
- Has the MECP ever issued any control orders or violation notices with respect to the Site?

A response from MECP had been received from the MECP at the time of writing of this report indicating that additional records were available, although were not available for review at the time of report writing.

4.2 Technical Standards & Safety Authority, Fuels Safety Division

The Technical Standards & Safety Authority ("TSSA"), Fuels Safety Division maintains records related to registered fuel storage tanks and other petroleum-related infrastructure. The TSSA was contacted to identify whether any active, decommissioned, or in-service storage tanks were present on the Site, and to search for outstanding instructions, incident reports, spills, or contamination records.

Based on email correspondence between Golder and Ms. Sarah Quibell of TSSA's Public Information Services department on March 19, 2019, the TSSA has no record of fuel storage tanks on file pertaining to the Site.

A copy of the response is provided in Appendix B.

5.0 SITE VISIT AND INTERVIEW(S)

Mrs. Jaime Brear (Environmental Technician) of Golder visited the Site on September 24, 2020. Mrs. Brear has a BA in Environmental and Resource Studies from Trent University and has three years consulting experience. The Site Assessor was accompanied on Site by Ms. Elaine Morrison (Property Manager) of FCAM (the “Site Representative”). During the Site visit, the Site Assessor walked through and observed accessible areas of the interior and exterior of the Site, observed neighbouring properties, interviewed the Site Representative, and photographed representative Site features (Appendix C). The following table provides an overview of the Site visit (Table 4).

Table 4: Details of Site Visit

Item	Information
Site Representative	Ms. Elaine Morrison (Property Manager) of First Capital Asset Management and associated with the Site for two years
Weather	24°C, sunny
Restrictions on access or photography	Three tenant spaces were not accessible at the time of the site visit: doctors office, Playful Strides and the orthodontist at 6941 Derry Road; Milton Quran located at 6911 Derry Road.
Other obstructions or limiting conditions	Vehicles parked throughout the parking areas.

5.1 Past Site Uses

The Site Representative indicated that to the best of her knowledge, the Site has been used for commercial purposes since it was redeveloped with the current day Site buildings in approximately 2009. The Site was previously developed with a commercial type building with warehouse space located at 6901 Derry Road, but was demolished in 2019. The Site Representative was unsure of the prior uses of the Site.

The Site Representative was asked whether any of the specific activities of potential environmental concern listed in Table 5 had occurred at the Site or surrounding properties. A summary of the Site Representative’s responses is provided in Table 5.

Table 5: Past Uses of the Site and Neighbouring Properties

Reported Use	Details
Dry cleaner	None observed or reported.
Industrial metal finishing, including painting or electroplating	None reported or observed.
Other industry	None reported.

Reported Use	Details
Fuel storage	The previous Site building located at 6901 Derry Road West (no longer present on the Site) was formerly heated by fuel oil. A former 27,300 L UST containing fuel oil was reportedly present to the south of this building. The UST was removed sometime prior to 1993. A levelometer inferred to be associated with this former UST was observed to be present within the boiler room located in the southwest portion of this building. No other evidence of this UST was observed at the time of the Site visit. It is inferred that the Site was converted to natural gas at this time. In addition, according to the 2005 Phase I ESA, waste oil was stored in two ASTs located in a shed on the northwest exterior corner of the building located at 6901 Derry Road West.
Retail fuel outlet or vehicle service garage	A Chrysler dealership with an associated service garage is present adjacent to the north of the Site. No ASTs or USTs were observed on this property at the time of the Site visit, and no USTs were reported to be present within the EcoLog ERIS report. No vehicle servicing at the Site was reported.
Landfilling or placement of fill	The Site Representative was not aware of any fill being brought to the Site. According to the 2005 Phase I ESA, PHC impacted soil from the UST investigation was placed on the northwest portion of the Site in stockpiles. Based on the current Site visit, this area of the Site is at a higher elevation than the remainder of the Site and is landscaped with grass and trees.
Wastewater impoundments	None reported.
Solid or liquid waste storage or disposal	None reported.
Environmental sampling, wells, or evidence of drilling	The Site Representative reported that environmental consultants have sampled soil and groundwater from the Site. Refer to Section 3.5 for further details.
Any other activities that may have affected the environmental condition of the Site or neighbouring properties	None reported and no evidence of any observed during the Site visit.

5.2 Present Site Uses

At the time of the Site visit, the Site was being used for commercial purposes that included four buildings with various commercial tenants (Table 6).

Table 6: Uses of Buildings, Other Structures, and Areas

Building/Structure or Area	Uses
Building 1 (6911 Derry Road West)	Two-storey commercial building with the first floor occupied by retail commercial tenants, and the second floor occupied by offices. Besides stairs, a hydraulic elevator provides access to the 2 nd floor area. Schindler Elevators reportedly maintains this elevator, and no problems were reported by the Site Representative. No indications of spills and no significant staining were observed or reported during the Site visit.
Building 2 (6921 Derry Road West)	Single storey commercial building occupied by a four retail commercial tenants. The Site Representative indicated that grease traps located within the restaurants were maintained by the separate tenants, but that no problems had been reported. No indications of spills and no significant staining were observed or reported during the Site visit.
Building 3 (6931 Derry Road West)	Two storey building occupied by CIBC. No indications of spills and no significant staining were observed or reported during the Site visit.
Building 4 (6941 Derry Road West)	Two-storey commercial building with the first floor occupied by retail commercial tenants and medical offices, and the second floor occupied by office tenants and medical offices. Besides stairs, a hydraulic elevator provides access to the 2 nd floor area. Schindler Elevators reportedly maintains this elevator, and no problems were reported by the Site Representative. No indications of spills and no significant staining were observed or reported during the Site visit.
Yard areas	The yard areas consisted primarily of asphalt paved parking throughout the Site. Landscaped areas with grass cover were observed along the Site perimeters and on curbed areas in the center of the Site. Several asphalt paved driveways provide access to the Site off Derry Road West and Bronte Street South. An area of disturbed soils and grass was present where the former building 6901 Derry Road was located in the southwest corner of the Site. The building was demolished in 2019. No indications of spills and no significant staining were observed or reported during the Site visit.
Watercourses, ditches or standing water (including wetlands)	At the time of the Site visit, the Site contained no watercourses, ditches, or standing water.

At the time of the Site visit, the Site Buildings were occupied by the following tenants:

- 6911 Derry Road West was occupied by RBC, Meena Cleaners (no toxic chemicals used, as observed and reported by the Site Representative), Great Clips, and All Eyes On Me Optical on the first floor; and, vacant

office space on the second floor, which will be occupied by Milton Quran as office space in the near future according to the Site Representative;

- 6921 Derry Road West was occupied by Booster Juice, Pizza Nova, China Star, and Wild Wing;
- 6931 Derry Road West was occupied by CIBC; and,
- 6941 Derry Road West was occupied by Tim Hortons, Sunset Grill, Derry Heights Dental, Derry Road Animal Clinic, Pita Nutso, Pho Mo, an urgent care clinic, and Shoppers Drug Mart on the first floor; and, doctors office, Playful Strides, Kumon, and Playful Strides on the second floor.

5.3 Site Buildings and Equipment

At the time of the Site visit, the Site was developed with four buildings as described in Section 5.2.

Table 7: Site Building(s) and Equipment

Topic	Findings and Assessor Comments
Construction date(s)	The Site buildings located at 6911, 6921, 6931, and 6941 Derry Road West were constructed in 2009.
Renovation date(s)	The building located at 6921 Derry Road has undergone interior renovations in 2020.
Estimated Building footprint area	Building 1: 7,500 ft ² Building 2: 6,000 ft ² Building 3: 6,950 ft ² Building 4: 33,850 ft ²
Number of above-ground floors	Building 1: Two floors Building 2: One floor Building 3: One floor Building 4: Two floors
Below-ground floors and uses	None.
Frequently occupied rooms in contact with the ground	All ground floor areas.
Number of tenant units	Building 1: five Building 2: four Building 3: one Building 4: fifteen
Building exterior	All the Site Buildings are constructed on a concrete foundation with cast-in concrete panels, concrete block walls, and/or brick/stone siding veneer exterior walls.
Building interior	All the Site Buildings interior consisted of a combination of tile and/or carpet floors, painted drywall, and suspended ceiling tiles and/or exposed metal deck ceiling. No other evidence of stains, spills or damages associated with the interior finishes of the Site Building were observed at the time of the Site visit.

Topic	Findings and Assessor Comments
Heating system	The Site Buildings are heated by natural gas fired roof top heating, ventilation, and air conditioning (HVAC) units supplemented by electric baseboards.
Cooling system	Cooling is provided by natural gas fired roof HVAC units.
Backup power supply	No backup power supply is associated with the Site.
Potable water supply	Municipal water.
Other services	The Site is serviced with electricity from the municipal grid.
Hydraulic lift equipment	Three hydraulic elevators are present at the Site, one within Building 2, one within Building 3 and one within Building 5. All three elevators are maintained by Schindler Elevator and inspected on a quarterly basis. No evidence of hydraulic leak and/or spills in the vicinity of the hydraulic oil tanks associated with these elevators was observed at the time of the Site visit. No other hydraulic lift equipment associated with the Site were observed.
Other mechanical equipment	None observed or reported.
X-ray equipment	None reported or observed; however, the dental clinic (Derry Heights Dental) and Derry Road Animal Clinic had x-ray related equipment. The orthodontist office also may have x-ray related equipment.

5.4 Chemical and Fuel Storage

Information about chemical and fuel storage obtained during the Site visit and/or interviews are summarized in Table 8.

Table 8: Fuel and Chemical Storage

Item	Details
Janitorial supplies	Janitorial supplies were present in sufficient quantities for general-purpose cleaning. All were stored in manufacturer-supplied containers in the separate tenant spaces of the Site buildings.
Building maintenance products	No other building maintenance products were observed to be present at the Site.
Process chemicals or products	None observed or reported.
ASTs	No ASTs were observed or reported at the Site. In addition, no other evidence (fill/vent pipes extending through walls or slabs/ground surface, no staining or any obvious odours) was observed during the Site visit to indicate the current or former presence of fuel or chemical ASTs on the Site.

Item	Details
USTs	No current USTs were observed or reported to be present at the time of the Site visit. A former UST was reported to have been present associated with the boiler room associated with the building that use to be present at 6091 Derry Road, however, this UST was removed and investigated, and a CPU and RSC has since been issued for the Site (refer to Section 3.5).
Drums	Drums were observed on the portion of the Site where the 6901 Derry Road building was once located. The drums as associated with the ongoing CPU monitoring program. No other drums were reported or observed to be present at the Site.
Chlorinated solvents	None reported or observed at the time of the Site visit.
Compressed gases	Cylinders of oxygen were observed in the restaurant tenant spaces; reportedly used for their pop machines. A compressed air machine was observed in Derry Heights Dental. The Site Representative reported it was used for their patient chairs.
Other chemicals or fuels	None reported or observed at the time of the Site visit.
Unidentified substances	None reported or observed at the time of the Site visit.

No significant spills or staining associated with these items were reported or observed.

5.5 Waste Generation and Handling

Waste generation and handling practices at the Site are described in Table 9.

Table 9: Waste Generation and Handling

Item	Details
Solid waste typical of commercial operations	Non-hazardous waste and recyclable materials from the Site Buildings are collected in metal bins and picked up by licensed contractors.
Other solid waste or sludge	None reported and/or observed.
Sewage and grey water	Municipal sanitary sewer.
Other wastewater or liquid waste	Municipal sanitary sewer.
Hazardous waste and O. Reg. 347 Waste Generator registration	None reported or observed at the time of the Site visit; however, a list of wastes generated at the Site was provided in the ERIS report (discussed under section 3.4.1).

Item	Details
Lagoons, drains, sumps, pits, oil-water separators	With the exception of the pits associated with the hydraulic elevators in the buildings located at 6911 Derry Road, 6931 Derry Road and 6941 Derry Road, no lagoons, sumps or oil-water separators were observed or reported to be present at the Site. In ground grease traps were located in the restaurant tenant spaces. The Site Representative reported that the grease trap was maintained by the tenant. A grease bin was located at the rear of Pho Mo at Building 4. A cooking oil drum was also located at the rear of Pita Nutso at Building 4. Both were emptied once full. Minor staining was observed on the concrete around the drum.
Process vents	No process vents were reported by the Site Representative or observed by the Site Assessor.
Other air emissions	No other air emissions were reported or observed.
Strong, noxious, or pungent odours	No strong, pungent, or noxious odours were identified.

No significant spills or staining associated with these items were reported or observed.

5.6 Surrounding Properties

Golder observed surrounding properties from publicly accessible areas and from the Site.

The area surrounding the Site is principally commercial and community land use consisting of a hospital and medical clinics, retail store, a car dealership and a warehouse.

The Site Assessor made the following observations of the surrounding properties:

West (inferred to be hydraulically up-gradient of the Site): Rail tracks followed by residential subdivisions.

North (inferred cross to up-gradient): Commercial/industrial land uses are adjacent to the north of the Site, followed by multitenant commercial land uses.

South (inferred cross to down-gradient): Derry Road West, followed by commercial and residential land uses, as well as community land uses (Milton District Hospital) to the southeast of the Site. Construction activities were observed south of the Site between Derry Road West and Transcom Crescent.

East (inferred down-gradient): Bronte Road South, followed by residential subdivisions.

6.0 SPECIAL ATTENTION ITEMS

Information about Special Attention Items was collected during the Site visit and the interview with the Site Representative. In the following subsections, information collected during the Site visit and interview is supplemented with information from previous reports, where such reports exist.

6.1 Polychlorinated Biphenyls

Polychlorinated biphenyls (“PCB”) are a group of organic chemicals that were widely used in caulking and electrical equipment manufactured between the 1950’s and 1980. Caulking potentially containing PCB can found in any building constructed during this period. Electrical equipment potentially containing PCB is restricted to transformers, capacitors, heat transfer equipment, hydraulic equipment, electromagnets and vapour diffusion pumps manufactured prior to September 1977 and in lamp ballasts manufactured prior to July 1980. The PCB regulations of the Canadian Environmental Protection Act (SOR/2008-273) require that equipment containing more than 50 mg/kg PCB should be decommissioned, with PCB use to be eliminated by 2025.

Based on the reported age of the Site Buildings (constructed in 2009), PCB-containing electrical caulking and equipment are likely not present on-Site. Fluorescent lighting was observed to be present; however, the lamp ballasts associated with these fluorescent light fixtures were not inspected due to limited accessibility. The Site Representative was unaware whether the lamp ballasts contained PCB. Given the date of construction the lamp ballasts are not considered to potentially contain PCB.

Two concrete pad mounted transformers were observed at the Site. The Site Representative was not aware of whether these were PCB containing; however, no evidence of spills or leaks was noted in the area of the transformers at the time of the Site visit. No labels indicating whether the transformers are PCB-containing were noted on any of the transformers.

6.2 Asbestos-Containing Materials

The use of asbestos-containing building materials (“ACM”), including both friable and non-friable asbestos, in building construction materials significant declined on a voluntarily basis in the mid-1970’s. The use of materials containing friable asbestos in Canada was effectively discontinued by 1986 as a result of strict provincial regulation. Typical examples of friable ACM include thermal, fire-proofing or acoustical insulating materials and can include deteriorated materials containing non-friable ACM (e.g., Transite™ pipe). Typical examples of non-friable ACM can include packings, gaskets, sealants, resilient flooring, asphalt roofing, mastics, drywall joint compounds, stuccos, cementitious and Transite™ materials (including drains and downspouts), and Transite™ shingles. Buildings constructed prior to 1986 potentially contain both friable and non-friable ACM. Buildings constructed after 1986 potentially contain non-friable ACM; however, as a practical matter, the condition of some non-friable ACM can deteriorate, releasing asbestos fibres if disturbed.

Based on the reported age of the Site buildings (constructed in 2009). During the Site visit, no indications of friable or deteriorated non-friable ACMs were observed.

6.3 Lead and Lead-Containing Surface Coatings

Paints manufactured prior to 1960 commonly contained significant lead. In 1976, the Canadian Hazardous Products Act restricted the lead content of paints and other surface coatings on furniture, household products, children's products, and exterior and interior surfaces and since that time lead content of paints has continued to decline. Lead-containing surface coatings in good condition are not typically associated with health risks to building occupants; however, unacceptable lead exposures can occur during building renovations, modifications or demolition activities. Other potential sources of lead in buildings include soldered plumbing joints installed prior to 1986 and lead plumbing pipe (used up until 1975). Lead is present in leaded glass and other type of radiation shielding that are used where radiation sources are present (e.g., medical and dental clinics).

Based on the reported age of the Site Buildings (constructed in 2009), it is unlikely that interior or exterior surface coatings contain significant lead concentrations. The observed painted surfaces of the Site buildings were generally noted to be in good condition, with no significant sections of paint that were peeling and/or flaking. The Site Representative was not aware of the presence of any lead and/or lead-containing surface coatings. Additionally, lead aprons and lead-lined rooms were present within the x-ray rooms in the dental office and animal clinic in and mostly likely present in the orthodontist office in Building 5.

6.4 Ozone-Depleting Substances

Refrigeration and air conditioning equipment in service prior to 1998 may contain chlorofluorocarbon refrigerants that are designated as ozone-depleting substances ("ODS"). Non-ODS refrigerants have been developed and are available to replace these materials in newer equipment. Other ODS include halons, methyl chloroform and carbon tetrachloride. Under the Ozone Depleting Substances Regulations 1998 of the Canadian Environmental Protection Act (SOR/99-07), all ODS are being phased out of use in Canada.

At the time of the Site visit, ODS-containing equipment on-Site would be limited to roof-mounted HVAC units. The refrigerant types associated with the remaining HVAC units could not be confirmed at the time of the Site visit, although based on the reported age of the Site Buildings (constructed in 2009), it is unlikely that ODS-containing equipment is present at the Site.

6.5 Urea Formaldehyde Foam Insulation

Urea formaldehyde foam insulation ("UFFI") is low-density foam that was used as an insulating material in the 1970s until it was banned from use in Canada in 1980. UFFI was commonly injected through walls by drilling injection holes, typically in walls, roof structures, ceilings and overhangs.

The Site Representative was not aware of UFFI having been used at the Site.

6.6 Radon and Radioactive Substances

Radon is a radioactive gas formed by the decay of naturally occurring uranium. In 2012 Health Canada released a major study demonstrating that radon concentrations in 7% of Canadian homes exceed the recommended guideline of 200 Becquerels/m³. It is likely that similar proportion of commercial and industrial buildings are also impacted by radon at concentrations exceeding this recommended guideline. Although radon concentrations vary significantly across Canada, no geographic area is radon-free and Health Canada recommends the completion of long-term radon testing to determine radon concentrations within a building.

Radioactive sources are found within a wide range of testing equipment including lasers, x-ray sources, imaging and radiography equipment, industrial gauges (including density gauges and other materials testing equipment), and smoke detectors. Radioactive products include any uranium containing material and medical isotopes.

The Site Representative was unaware if radon testing was conducted at the Site. X-ray equipment in medical and dental offices may contain radioactive sources but is unlikely to represent a concern.

6.7 Mercury

Mercury may be present in both mechanical and electrical equipment including thermometers, thermostats, switch gears, barometers, vacuum gauges, gas pressure regulators, electrical switches/relays, batteries and electrolytic manufacturing processes. Small amounts of mercury are present in some fluorescent lights, including mercury vapour, metal halide, and sodium vapour lamps.

During the Site visit, Golder did not observe any equipment or products potentially containing mercury.

6.8 Mould or Water Damage

Mould can grow on damp building materials such as ceiling tiles, drywall, carpeting, and areas. Mould growth is commonly associated with water leakage.

The Site Representative stated that mould has not been of concern at the Site.

6.9 Noise and Vibration

No major or persistent sources of noise and vibration were observed or reported to be present other than that typical of vehicular traffic on the adjacent roadways.

6.10 Non-ionizing Electromagnetic Radiation

Non-ionizing types of electromagnetic radiation include radiofrequency and microwave radiation, which can be associated with tissue damage through heating. Radiofrequency radiation is produced by radio and TV transmitters, induction heaters, and dielectric sealers. Microwave radiation is produced by microwave ovens, parabolic antennas, radar devices, and diathermy applicators. No human health risks are known to be associated with the low-energy electromagnetic radiation from commercial electronics and power transmission lines.

No sources of non-ionizing electromagnetic radiation were observed or reported to be present at the time of the Site reconnaissance.

7.0 ISSUES OF ENVIRONMENTAL CONCERN

The information obtained as part of this Phase I ESA was evaluated to identify relevant environmental conditions with the potential for contamination to be present in environmental media or building materials ("issues of potential environmental concern"). Environmental conditions that do not present a threat to human health or the environment and that generally would not be the subject of regulatory enforcement were not considered to represent an issue of potential environmental concern. Some land uses or activities in the surrounding area were not specifically identified as an issue of potential environmental concern based on their separation distance from the Site, the inferred hydrogeologic conditions and/or the absence of evidence of a contaminant release to the subsurface associated with the off-Site land use or activity.

Golder notes that there are known impacts to soil and groundwater at the Site associated with the former industrial use of 6901 Derry Road West (former address of 3037 Derry Road West) and that First Capital is obligated to manage these impacts in accordance with the requirements of the amended CPU, which is registered on title. Accordingly, the following former uses of 6901 Derry Road West are not considered to represent an issue of potential environmental concern, provided that the risk management requirements of the amended CPU are implemented:

- An approximately 27,300 L (6,000 gallon) UST was formerly present adjacent to the south of the building. The UST was removed prior to 1993 and PHC impacted soil in the vicinity of the UST was removed;
- Approximately 200 metric tonnes of PHC impacted soil from the UST excavation was stockpiled on the northwest portion of the Site;
- A chemical storage shed was formerly located outside the northwest corner of the Site building. The shed reportedly contained xylene, acetone, mineral spirits, oils, cutting fluids, lacquer thinners, isopropyl alcohol

and coolants. There were also two approximately 1,150 L ASTs for waste cutting oils and waste oils and mineral spirits and one 200 L drum with unknown contents;

- There were former solvent degreasers located within four different areas of the building with the former address of 3037 Derry Road West. It was suspected that chlorinated solvents had been used during degreasing;
- Four small deposits of black/brown granular material, possibly foundry sand, were reported to be present outside the northwest corner of the previous building associated with 6091 Derry Road West; and,

Based on supplemental intrusive investigations, soil and/or groundwater was identified to be impacted with various heavy metals and/or VOC at concentrations in excess of the generic assessment standards applicable for those times, and were generally present within the following areas:

- A small deposit of apparent foundry sand located outside of the northwest corner of the previous building at 6091 Derry Road West, containing a marginally elevated concentration of beryllium (removed from the Site in 2009). In addition, a limited area of soil impacted by PHC F3 was identified within this area. These impacts were remediated in 2010;
- Approximately 200 metric tonnes of PHC impacted soil from the UST excavation was stockpiled on the northwest portion of the Site. These impacts are managed by the risk management measures in the amended CPU;
- Soil and groundwater beneath the northeast portion of the previous building at 6091 Derry Road West and in the area outside this portion of the building with impacts that appeared to be related to both 1,1,1-TCA and trichloroethylene. These impacts are managed by the risk management measures in the amended CPU; and,
- Soil and groundwater in the vicinity of a former chemical storage shed located outside the northwest corner the previous building located at 6901 Derry Road West with VOC impacts related to 1,1,1-TCA. These impacts are managed by the risk management measures in the amended CPU.

Based on the information obtained as part of this Phase I ESA, no additional issues of actual or potential environmental concern were identified that are associated with uses of the Site that have occurred since the completion of the 2011 RSC. Accordingly, no further site assessment is recommended.

8.0 LIMITATIONS

This report (the "Report") was prepared for the exclusive use of First Capital Asset Management LP for the express purpose of providing advice with respect to the environmental condition of the Site. In evaluating the site, Golder Associates Ltd. has relied in good faith on information provided by others as noted in the Report. We have assumed that the information provided is factual and accurate. We accept no responsibility for any deficiency, misstatement or inaccuracy contained in this report as a result of omissions, misinterpretations or fraudulent acts of persons interviewed or contacted.

Any use which a third party makes of this Report, or any reliance on or decisions to be made based on it, are the sole responsibility of the third parties. If a third party require reliance on this Report, written authorization from Golder is required. Golder disclaims responsibility of consequential financial effects on transactions or property values, or requirements for follow-up actions and costs.

The scope and the period of Golder's assessment are described in this Report, and are subject to restrictions, assumptions and limitations. Except as noted herein, the work was conducted in accordance with the scope of work and terms and conditions within Golder's proposal. Distances noted in this report were determined using mapping data of variable accuracy, and should therefore be considered approximate. Golder did not perform a complete assessment of all possible conditions or circumstances that may exist at the site referenced in the Report. Conditions may therefore exist which were not detected given the limited nature of the assessment Golder was retained to undertake with respect to the Site and additional environmental studies and actions may be required. In addition, it is recognized that the passage of time affects the information provided in the Report. Golder's opinions are based upon information available to Golder as of the date of the Site visit. It is understood that the services provided for in the scope of work allowed Golder to form no more than an opinion of the actual conditions at the Site at the time of the site visit and cannot be used to assess the effect of any subsequent changes in any laws or regulations and the environmental quality of the Site or its surroundings. Asbestos and mould surveys were not performed. If a service is not expressly indicated, do not assume it has been provided.

The results of an assessment of this nature should in no way be construed as a warranty that the Site is free from any and all contamination from past or current practices.

9.0 CLOSURE

We trust that this report meets your immediate requirements. If you have any questions regarding the content of this report, please do not hesitate to contact this office.

Signature Page


Golder Associates Ltd.



Laura Burchell, BASc, PgCert
Environmental Scientist



Eric Hood, PhD, PEng
Associate, Senior Engineer

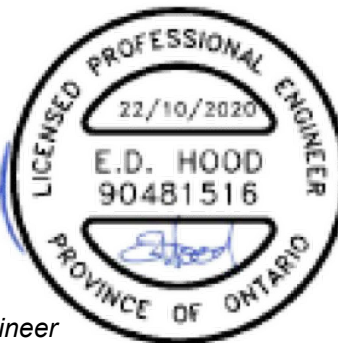

TZ/JB/LKB/EH/lb

Golder and the G logo are trademarks of Golder Associates Corporation

[https://golderassociates.sharepoint.com/sites/129430/project files/6 deliverables/04 phase i esa update/20201022 final/20146311 rpt rev0 20oct22 ph i esa derry heights final.docx](https://golderassociates.sharepoint.com/sites/129430/project%20files/6%20deliverables/04%20phase%20i%20esa%20update/20201022%20final/20146311%20rpt%20rev0%20oct22%20ph%20i%20esa%20derry%20heights%20final.docx)

FIGURES

APPENDIX A

EcoLog ERIS Report



DATABASE REPORT

Project Property:	<i>6951 Derry Road 6951 Derry Road Milton ON L9T 7H5</i>
Project No:	<i>19120170</i>
Report Type:	<i>Quote - Custom-Build Your Own Report</i>
Order No:	<i>20190314116</i>
Requested by:	<i>Golder Associates Ltd.</i>
Date Completed:	<i>March 22, 2019</i>

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	6
Executive Summary: Site Report Summary - Surrounding Properties.....	12
Executive Summary: Summary By Data Source.....	20
Map.....	35
Aerial.....	36
Topographic Map.....	37
Detail Report.....	38
Unplottable Summary.....	185
Unplottable Report.....	187
Appendix: Database Descriptions.....	206
Definitions.....	215

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report(s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: 6951 Derry Road
6951 Derry Road Milton ON L9T 7H5

Project No: 19120170

Order Information:

Order No: 20190314116
Date Requested: March 14, 2019
Requested by: Golder Associates Ltd.
Report Type: Quote - Custom-Build Your Own Report

Historical/Products:

Aerial Photographs Aerials - National Collection - .tiff files
City Directory Search CD - Subject Site plus 250m Radius
Insurance Products Fire Insurance Maps/Inspection Reports/Site Plans

Executive Summary: Report Summary

Database	Name	Searched	Project Property	Boundary to 0.25km	Total
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	0	0
CA	Certificates of Approval	Y	0	4	4
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	7	0	7
DRL	Drill Hole Database	Y	0	0	0
DRYCLEANERS	Dry Cleaning Facilities	Y	0	0	0
EASR	Environmental Activity and Sector Registry	Y	0	0	0
EBR	Environmental Registry	Y	0	1	1
ECA	Environmental Compliance Approval	Y	0	1	1
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	1	6	7
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EXP	List of TSSA Expired Facilities	Y	0	0	0
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FST	Fuel Storage Tank	Y	0	0	0
FSTH	Fuel Storage Tank - Historic	Y	0	0	0
GEN	Ontario Regulation 347 Waste Generators Summary	Y	17	48	65
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	0	0
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0
INC	TSSA Incidents	Y	0	0	0
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MISA PENALTY	Environmental Penalty Annual Report	Y	0	0	0

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.25km</i>	<i>Total</i>
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBW	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory	Y	0	0	0
OGW	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	3	0	3
PINC	TSSA Pipeline Incidents	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	0	0	0
PTTW	Permit to Take Water	Y	0	0	0
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	2	2
RSC	Record of Site Condition	Y	1	1	2
RST	Retail Fuel Storage Tanks	Y	0	0	0
SCT	Scott's Manufacturing Directory	Y	0	5	5
SPL	Ontario Spills	Y	0	0	0
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	TSSA Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	18	27	45
Total:			47	95	142

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	WWIS		MILTON ON <i>Well ID:</i> 2810295	-/0.0	0.00	<u>38</u>
<u>2</u>	WWIS		MILTON ON <i>Well ID:</i> 2810420	-/0.0	0.17	<u>40</u>
<u>3</u>	WWIS		MILTON ON <i>Well ID:</i> 2810368	-/0.0	0.35	<u>42</u>
<u>4</u>	WWIS		lot 11 con 1 MILTON ON <i>Well ID:</i> 7292746	-/0.0	0.00	<u>46</u>
<u>5</u>	WWIS		lot 11 con 1 Milton ON <i>Well ID:</i> 7130781	-/0.0	0.00	<u>49</u>
<u>5</u>	WWIS		lot 11 con 1 Milton ON <i>Well ID:</i> 7129541	-/0.0	0.00	<u>51</u>
<u>6</u>	GEN	Derry Heights Plaza	6901 Derry Road Milton ON L9T 7H5	-/0.0	0.00	<u>54</u>
<u>7</u>	WWIS		lot 11 con 1 MILTON ON <i>Well ID:</i> 7292742	-/0.0	0.00	<u>54</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
8	WWIS		lot 11 con 1 MILTON ON <i>Well ID: 7292743</i>	-/0.0	0.00	57
9	WWIS		Milton ON <i>Well ID: 7212248</i>	-/0.0	0.00	60
10	WWIS		MILTON ON <i>Well ID: 7035386</i>	-/0.0	0.00	62
11	WWIS		lot 11 con 1 MILTON ON <i>Well ID: 7292741</i>	-/0.0	0.00	65
12	WWIS		ON <i>Well ID: 7217943</i>	-/0.0	0.00	68
13	CPU	Trenwith Investments Inc.	3037 Derry Road West, Former Canadian Meter Company Inc., Derry Road West and Bronte Street South, Part of Lot 11, Concession 1, Town of Milton, Regional Municipality of Halton TOWN OF MILTON ON	-/0.0	0.00	69
13	CPU	FCHT Holdings (Ontario) Corporation	3037 Derry Road West Part of Lot 11, CON 1, Trafalgar New Survey, Regional Municipality of Halton TOWN OF MILTON ON	-/0.0	0.00	69
13	GEN	CANADIAN METER COMPANY INC 08-004	DIV OF SINGER CO OF CANADA LTD 3037 DERRY RD. W. MILTON ON L9T 2X6	-/0.0	0.00	69
13	GEN	CANADIAN METER COMPANY INC	3037 DERRY ROAD WEST MILTON ON L9T 2X6	-/0.0	0.00	70

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>13</u>	GEN	FCHT Holdigs (Ontario)	3037 Derry Rd. W. Milton ON L9T 2X6	-/0.0	0.00	<u>70</u>
<u>13</u>	GEN	CANADIAN METER COMPANY LIMITED	DIV OF SINGER CO OF CANADA LTD 3037 DERRY RD. W. MILTON ON L9T 2X6	-/0.0	0.00	<u>70</u>
<u>13</u>	GEN	CANADIAN METER COMPANY INC	DIV OF SINGER CO OF CANADA LTD 3037 DERRY RD. W. MILTON ON L9T 2X6	-/0.0	0.00	<u>71</u>
<u>13</u>	GEN	CANADIAN METER COMPANY INC.	SINGER COMPANY OF CANADA LTD, A DIV. OF 3037 DERRY ROAD WEST MILTON ON L9T 2X6	-/0.0	0.00	<u>71</u>
<u>13</u>	GEN	CANADIAN METER COMPANY INC.	3037 DERRY RD W MILTON ON L9T 2X6	-/0.0	0.00	<u>72</u>
<u>13</u>	RSC	FCHT Holdings (Ontario) Corporation	3037 Derry Road West, Milton, Ontario L9T 2X6 ON L9T 2X6	-/0.0	0.00	<u>73</u>
<u>14</u>	WWIS		lot 11 con 1 MILTON ON <i>Well ID: 7292747</i>	-/0.0	0.00	<u>73</u>
<u>15</u>	WWIS		Milton ON <i>Well ID: 7166971</i>	-/0.0	0.00	<u>76</u>
<u>16</u>	WWIS		lot 11 con 1 MILTON ON <i>Well ID: 7292745</i>	-/0.0	0.00	<u>79</u>
<u>17</u>	WWIS		lot 11 con 1 MILTON ON	-/0.0	0.00	<u>82</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
Well ID: 7292740						
<u>18</u>	CPU	FCHT Holdings (Ontario) Corporation	6901-6951 Derry Road West TOWN OF MILTON ON	-/0.0	0.00	<u>85</u>
<u>18</u>	CPU	FCHT Holdings (Ontario) Corporation	6901 - 6951 Derry Road West Milton ON	-/0.0	0.00	<u>85</u>
<u>18</u>	CPU	FCHT Holdings (Ontario) Corporation	6901 - 6951 Derry Road West TOWN OF MILTON ON	-/0.0	0.00	<u>85</u>
<u>18</u>	CPU	FCHT Holdings (Ontario) Corporation	6901 - 6951 Derry Road West TOWN OF MILTON ON	-/0.0	0.00	<u>86</u>
<u>18</u>	CPU	FCHT Holdings (Ontario) Corporation	6901 - 6951 Derry Road West TOWN OF MILTON ON	-/0.0	0.00	<u>86</u>
<u>18</u>	GEN	FCR Management Services LP	6901-6951 Derry Rd. West Milton ON L9T 7Y9	-/0.0	0.00	<u>86</u>
<u>18</u>	GEN	P. Shalvardjian Drugs Ltd.	6951 DERRY ROAD WEST, BUILDING B MILTON ON L9T 7H5	-/0.0	0.00	<u>86</u>
<u>18</u>	GEN	Renu Choudhary Pharmacy Limited	6951 DERRY ROAD WEST, BUILDING B MILTON ON L9T 7H5	-/0.0	0.00	<u>87</u>
<u>18</u>	GEN	P. Shalvardjian Drugs Ltd.	6951 DERRY ROAD WEST, BUILDING B MILTON ON L9T 7H5	-/0.0	0.00	<u>87</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>18</u>	PES	RENU CHOUDHARY PHARMACY LIMITED O/A SHOPPERS DRUG MART #1201	6951 BUILDING B DERRY RD MILTON ON L9T7H5	-/0.0	0.00	<u>87</u>
<u>18</u>	PES	SHOPPERS DRUG MART O/A SHOPPERS DRUG MART #1201	6951 DERRY RD BLDG B MILTON ON L9T7H5	-/0.0	0.00	<u>88</u>
<u>18</u>	PES	RENU CHOUDHARY PHARMACY LIMITED O/A SHOPPERS DRUG MART #1201	6951 BUILDING B DERRY ROAD MILTON ON L9T 7H5	-/0.0	0.00	<u>88</u>
<u>19</u>	WWIS		ON Well ID: 7210119	-/0.0	0.00	<u>88</u>
<u>20</u>	WWIS		lot 11 con 1 MILTON ON Well ID: 7292744	-/0.0	0.00	<u>89</u>
<u>21</u>	EHS		6941 Derry Rd Milton ON L9T7H5	-/0.0	1.00	<u>92</u>
<u>21</u>	GEN	DERRY HEIGHTS ANIMAL HOSPITAL	6941,DERRY ROAD, UNIT B5 MILTON ON L9T 7H5	-/0.0	1.00	<u>92</u>
<u>21</u>	GEN	Hawthorne West Urgent Care	6941 Derry Rd Suite 1B Milton ON L9T 7H5	-/0.0	1.00	<u>92</u>
<u>21</u>	GEN	Hawthorne West Urgent Care	6941 Derry Rd Suite 1B Milton ON L9T 7H5	-/0.0	1.00	<u>93</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
21	GEN	Hawthorne West Urgent Care	6941 Derry Rd Suite 1B Milton ON L9T 7H5	-/0.0	1.00	93
21	GEN	Hawthorne West Urgent Care	6941 Derry Rd Suite 1B Milton ON L9T 7H5	-/0.0	1.00	93

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>22</u>	WWIS		ON Well ID: 7195047	SW/0.0	-0.65	<u>93</u>
<u>22</u>	WWIS		ON Well ID: 7202159	SW/0.0	-0.65	<u>94</u>
<u>23</u>	WWIS		ON Well ID: 7204187	SW/5.4	-1.00	<u>95</u>
<u>24</u>	WWIS		Milton ON Well ID: 7286326	WNW/6.0	0.00	<u>95</u>
<u>25</u>	WWIS		Milton ON Well ID: 7180499	NW/14.4	0.82	<u>98</u>
<u>26</u>	WWIS		lot 11 con 1 Milton ON Well ID: 7286333	NW/16.7	0.47	<u>102</u>
<u>27</u>	WWIS		lot 10 con 1 Milton ON Well ID: 7120514	SE/17.4	0.00	<u>104</u>
<u>28</u>	CA	R.M. OF HALTON	BRONTE ST/DERRY RD. MILTON TOWN ON	E/19.9	1.00	<u>106</u>
<u>28</u>	CA	R.M. OF HALTON	DERRY RD./BRONTE ST./TREMAINE MILTON TOWN ON	E/19.9	1.00	<u>107</u>
<u>29</u>	WWIS		Milton ON Well ID: 7172570	S/30.9	0.02	<u>107</u>
<u>30</u>	EHS		3006 Derry Road West Milton ON L9T 5B5	E/31.6	1.00	<u>110</u>
<u>30</u>	EHS		3006 Derry Road West MILTON ON L9T 5B5	E/31.6	1.00	<u>110</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
31	WWIS		Milton ON Well ID: 7104588	S/51.5	-1.00	110
32	WWIS		Milton ON Well ID: 7286325	WNW/54.7	0.00	116
33	SCT	HONEYWELL CONSUMER PRODUCTS	5100 BRONTE ST S MILTON ON L9T 2X6	N/62.0	1.06	118
34	EHS		500 Bronte Road South Milton ON L9T 2X6	NNW/67.6	1.03	118
35	WWIS		Milton ON Well ID: 7220158	SSW/69.6	-1.00	119
35	WWIS		MILTON ON Well ID: 7261482	SSW/69.6	-1.00	121
36	GEN	David Meisels	6990 Derry Road, unit 107 Milton ON L9T 7H3	ESE/74.2	0.00	123
36	GEN	David Meisels	6990 Derry Road, unit 107 Milton ON L9T 7H3	ESE/74.2	0.00	124
36	GEN	DERRY MEDICAL CENTRE INC.	6990 DERRY ROAD MILTON ON	ESE/74.2	0.00	124
36	SCT	Air Separation Technologies	6990 Derry Rd Suite 204 Milton ON L9T 7H3	ESE/74.2	0.00	124
37	WWIS		Milton ON Well ID: 7180498	NNW/78.6	1.03	124
38	WWIS		Milton ON Well ID: 7286334	NW/81.9	0.27	128
39	WWIS		Milton ON	SSW/102.1	-1.39	130

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7220159			
39	WWIS		MILTON ON Well ID: 7261481	SSW/102.1	-1.39	133
40	WWIS		ON Well ID: 7269754	SSE/108.1	-1.00	135
41	WWIS		Milton ON Well ID: 7180497	NNW/117.8	1.00	136
42	WWIS		Milton ON Well ID: 7220157	SSW/132.1	-2.00	138
42	WWIS		MILTON ON Well ID: 7261480	SSW/132.1	-2.00	141
43	WWIS		Milton ON Well ID: 7286332	NW/137.2	0.03	143
44	CA	MILTON DISTRICT HOSPITAL	DERRY RD. MILTON TOWN ON	ENE/147.4	1.00	146
44	CA	MILTON DISTRICT HOSPITAL	30 DERRY RD.E., PT.LOT 10/C-2 MILTON ON	ENE/147.4	1.00	146
44	GEN	MILTON DISTRICT HOSPITAL 26-041	30 DERRY ROAD EAST MILTON ON L9T 2X5	ENE/147.4	1.00	146
44	GEN	MILTON DISTRICT HOSPITAL	DERRY ROAD - MILTON HALTON ON L9T 2X5	ENE/147.4	1.00	147
44	GEN	MILTON DISTRICT HOSPITAL	30 DERRY ROAD EAST MILTON ON L9T 2X5	ENE/147.4	1.00	147
44	GEN	MILTON DISTRICT HOSPITAL (PATHOLOGICAL)	30 DERRY ROAD EAST MILTON ON L9T 2X5	ENE/147.4	1.00	148
44	REC	MILTON DISTRICT HOSPITAL (PATHOLOGICAL)	30 DERRY ROAD EAST MILTON ON L9T 2X5	ENE/147.4	1.00	148

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
44	REC	MILTON DISTRICT HOSPITAL	30 DERRY ROAD EAST MILTON ON L9T 2X5	ENE/147.4	1.00	149
45	WWIS		Milton ON Well ID: 7286327	NW/162.1	0.83	149
46	WWIS		Milton ON Well ID: 7286328	NW/171.1	0.00	152
47	EBR	Halton Healthcare Services Corporation	7030 Derry Road Milton Regional Municipality of Halton L9T 7H6 TOWN OF MILTON ON	E/178.4	1.19	154
47	ECA	Halton Healthcare Services Corporation	7030 Derry Rd Milton ON L9T 7H6	E/178.4	1.19	155
47	EHS		7030 Derry Rd Milton ON L9T7H6	E/178.4	1.19	155
47	GEN	MILTON DISTRICT HOSPITAL	7030 DERRY ROAD EAST MILTON ON	E/178.4	1.19	155
47	GEN	MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON L9T-7H6	E/178.4	1.19	156
47	GEN	MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON	E/178.4	1.19	157
47	GEN	MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON	E/178.4	1.19	158
47	GEN	MILTON DISTRICT HOSPITAL	7030 DERRY ROAD EAST MILTON ON	E/178.4	1.19	159
47	GEN	MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON	E/178.4	1.19	160

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>47</u>	GEN	MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON L9T-7H6	E/178.4	1.19	<u>161</u>
<u>47</u>	GEN	MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON L9T-7H6	E/178.4	1.19	<u>162</u>
<u>47</u>	GEN	MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON L9T-7H6	E/178.4	1.19	<u>162</u>
<u>48</u>	WWIS		Milton ON Well ID: 7286331	WNW/181.3	0.00	<u>163</u>
<u>49</u>	GEN	MyHealthCentre	480 Bronte St South Suite 212 Milton ON L9T2X6	NNW/184.8	1.02	<u>166</u>
<u>49</u>	GEN	MyHealthCentre	480 Bronte St South Suite 212 Milton ON L9T2X6	NNW/184.8	1.02	<u>166</u>
<u>49</u>	GEN	My Safari Hygiene Inc.	480 Bronte Street South Milton ON L9T9A9	NNW/184.8	1.02	<u>167</u>
<u>50</u>	WWIS		ON Well ID: 7259825	SSE/188.6	-1.00	<u>167</u>
<u>51</u>	WWIS		Milton ON Well ID: 7286330	WNW/191.3	0.00	<u>169</u>
<u>52</u>	WWIS		Milton ON Well ID: 7286329	NW/200.9	0.00	<u>171</u>
<u>53</u>	GEN	PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	NW/214.1	0.97	<u>174</u>
<u>53</u>	GEN	PRIME CARE FAMILY HEALTH TEAM	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	NW/214.1	0.97	<u>174</u>
<u>53</u>	GEN	LifeLabs LP	470 Bronte Street S, Suite 106 Milton ON L9T 2J4	NW/214.1	0.97	<u>175</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>53</u>	GEN	PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	NW/214.1	0.97	<u>175</u>
<u>53</u>	GEN	PRIME CARE FAMILY HEALTH TEAM	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	NW/214.1	0.97	<u>175</u>
<u>53</u>	GEN	PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON	NW/214.1	0.97	<u>175</u>
<u>53</u>	GEN	PRIME CARE FAMILY HEALTH TEAM	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	NW/214.1	0.97	<u>176</u>
<u>53</u>	GEN	PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	NW/214.1	0.97	<u>176</u>
<u>53</u>	GEN	PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	NW/214.1	0.97	<u>176</u>
<u>54</u>	EHS		Adjacent to the north of 510 Bronte Street South Milton ON L9T 2X6	NW/217.2	0.97	<u>177</u>
<u>54</u>	EHS		510 Bronte St. South Milton ON L9T 2X6	NW/217.2	0.97	<u>177</u>
<u>54</u>	GEN	RELIANCE PRODUCTS DIVISION OF	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>177</u>
<u>54</u>	GEN	RELIANCE PRODUCTS DIVISION OF	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>177</u>
<u>54</u>	GEN	L.M.G. RELIANCE	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>178</u>
<u>54</u>	GEN	Lawter International Inc. a Delaware Corporation	Polymer Distribution Inc. 510 Bronte Street Milton ON L9T 3K5	NW/217.2	0.97	<u>178</u>
<u>54</u>	GEN	RELIANCE PRODUCTS DIVISION OF	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>178</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>54</u>	GEN	RELIANCE PRODUCTS LTD. 33-104	DIV OF LAWSON MARDON GROUP 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>178</u>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE ROAD SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>179</u>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE RD. S MILTON ON L9T 2X6	NW/217.2	0.97	<u>179</u>
<u>54</u>	GEN	RELIANCE PRODUCTS LTD.	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>179</u>
<u>54</u>	GEN	RELIANCE PRODUCTS LTD.	DIV. OF LAWSON MARDON GROUP 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>180</u>
<u>54</u>	GEN	RELIANCE PRODUCTS LTD.	DIV OF LAWSON MARDON GROUP 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>180</u>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE RD. S MILTON ON L9T 2X6	NW/217.2	0.97	<u>180</u>
<u>54</u>	GEN	HONEY CONSUMER PRODUCTS	510 BRONTE ROAD SOUTH MILTON ON L9T 2X6	NW/217.2	0.97	<u>181</u>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE RD. S MILTON ON L9T 2X6	NW/217.2	0.97	<u>181</u>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE Street. S MILTON ON	NW/217.2	0.97	<u>181</u>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE Street. S MILTON ON	NW/217.2	0.97	<u>182</u>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE Street South MILTON ON L9T 2X6	NW/217.2	0.97	<u>182</u>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE Street South MILTON ON L9T 2X6	NW/217.2	0.97	<u>182</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE Street South MILTON ON L9T 2X6	NW/217.2	0.97	<u>182</u>
<u>54</u>	GEN	KAZ CANADA INC.	510 BRONTE Street South MILTON ON	NW/217.2	0.97	<u>183</u>
<u>54</u>	SCT	Kaz Canada Inc.	510 Bronte St S Milton ON L9T 2X6	NW/217.2	0.97	<u>183</u>
<u>54</u>	SCT	Honeywell Consumer Products (Canada) Inc.	510 Bronte St S Milton ON L9T 2X6	NW/217.2	0.97	<u>183</u>
<u>54</u>	SCT	HONEYWELL CONSUMER PRODUCTS	510 Bronte St S Milton ON L9T 2X6	NW/217.2	0.97	<u>183</u>
<u>55</u>	RSC	ADA Holding Co. Ltd.	Bronte Street South, Milton, Ontario , (west side, adjacent to 510 Bronte Street ON	NW/221.2	0.51	<u>184</u>

Executive Summary: Summary By Data Source

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 4 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
R.M. OF HALTON	DERRY RD./BRONTE ST./TREMAINE MILTON TOWN ON	19.9	<u>28</u>
R.M. OF HALTON	BRONTE ST/DERRY RD. MILTON TOWN ON	19.9	<u>28</u>
MILTON DISTRICT HOSPITAL	DERRY RD. MILTON TOWN ON	147.4	<u>44</u>
MILTON DISTRICT HOSPITAL	30 DERRY RD.E., PT.LOT 10/C-2 MILTON ON	147.4	<u>44</u>

CPU - Certificates of Property Use

A search of the CPU database, dated 1994-Feb 28, 2019 has found that there are 7 CPU site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
FCHT Holdings (Ontario) Corporation	3037 Derry Road West Part of Lot 11, CON 1, Trafalgar New Survey, Regional Municipality of Halton TOWN OF MILTON ON	0.0	<u>13</u>
Trenwith Investments Inc.	3037 Derry Road West, Former Canadian Meter Company Inc., Derry Road West and Bronte Street South, Part of Lot 11, Concession 1, Town of Milton, Regional Municipality of Halton TOWN OF MILTON ON	0.0	<u>13</u>
FCHT Holdings (Ontario) Corporation	6901 - 6951 Derry Road West TOWN OF MILTON ON	0.0	<u>18</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
FCHT Holdings (Ontario) Corporation	6901 - 6951 Derry Road West TOWN OF MILTON ON	0.0	<u>18</u>
FCHT Holdings (Ontario) Corporation	6901 - 6951 Derry Road West Milton ON	0.0	<u>18</u>
FCHT Holdings (Ontario) Corporation	6901-6951 Derry Road West TOWN OF MILTON ON	0.0	<u>18</u>
FCHT Holdings (Ontario) Corporation	6901 - 6951 Derry Road West TOWN OF MILTON ON	0.0	<u>18</u>

EBR - Environmental Registry

A search of the EBR database, dated 1994-Feb 28, 2019 has found that there are 1 EBR site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Halton Healthcare Services Corporation	7030 Derry Road Milton Regional Municipality of Halton L9T 7H6 TOWN OF MILTON ON	178.4	<u>47</u>

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011-Feb 28, 2019 has found that there are 1 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Halton Healthcare Services Corporation	7030 Derry Rd Milton ON L9T 7H6	178.4	<u>47</u>

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Jan 31, 2019 has found that there are 7 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	6941 Derry Rd Milton ON L9T7H5	0.0	<u>21</u>
	3006 Derry Road West Milton ON L9T 5B5	31.6	<u>30</u>
	3006 Derry Road West MILTON ON L9T 5B5	31.6	<u>30</u>
	500 Bronte Road South Milton ON L9T 2X6	67.6	<u>34</u>
	7030 Derry Rd Milton ON L9T7H6	178.4	<u>47</u>
	510 Bronte St. South Milton ON L9T 2X6	217.2	<u>54</u>
	Adjacent to the north of 510 Bronte Street South Milton ON L9T 2X6	217.2	<u>54</u>

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Dec 31, 2018 has found that there are 65 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Derry Heights Plaza	6901 Derry Road Milton ON L9T 7H5	0.0	<u>6</u>
CANADIAN METER COMPANY INC 08-004	DIV OF SINGER CO OF CANADA LTD 3037 DERRY RD. W. MILTON ON L9T 2X6	0.0	<u>13</u>
CANADIAN METER COMPANY INC	3037 DERRY ROAD WEST MILTON ON L9T 2X6	0.0	<u>13</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
FCHT Holdigs (Ontario)	3037 Derry Rd. W. Milton ON L9T 2X6	0.0	<u>13</u>
CANADIAN METER COMPANY LIMITED	DIV OF SINGER CO OF CANADA LTD 3037 DERRY RD. W. MILTON ON L9T 2X6	0.0	<u>13</u>
CANADIAN METER COMPANY INC	DIV OF SINGER CO OF CANADA LTD 3037 DERRY RD. W. MILTON ON L9T 2X6	0.0	<u>13</u>
CANADIAN METER COMPANY INC.	SINGER COMPANY OF CANADA LTD, A DIV. OF 3037 DERRY ROAD WEST MILTON ON L9T 2X6	0.0	<u>13</u>
CANADIAN METER COMPANY INC.	3037 DERRY RD W MILTON ON L9T 2X6	0.0	<u>13</u>
FCR Management Services LP	6901-6951 Derry Rd. West Milton ON L9T 7Y9	0.0	<u>18</u>
P. Shalvardjian Drugs Ltd.	6951 DERRY ROAD WEST, BUILDING B MILTON ON L9T 7H5	0.0	<u>18</u>
Renu Choudhary Pharmacy Limited	6951 DERRY ROAD WEST, BUILDING B MILTON ON L9T 7H5	0.0	<u>18</u>
P. Shalvardjian Drugs Ltd.	6951 DERRY ROAD WEST, BUILDING B MILTON ON L9T 7H5	0.0	<u>18</u>
DERRY HEIGHTS ANIMAL HOSPITAL	6941,DERRY ROAD, UNIT B5 MILTON ON L9T 7H5	0.0	<u>21</u>
Hawthorne West Urgent Care	6941 Derry Rd Suite 1B Milton ON L9T 7H5	0.0	<u>21</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Hawthorne West Urgent Care	6941 Derry Rd Suite 1B Milton ON L9T 7H5	0.0	<u>21</u>
Hawthorne West Urgent Care	6941 Derry Rd Suite 1B Milton ON L9T 7H5	0.0	<u>21</u>
Hawthorne West Urgent Care	6941 Derry Rd Suite 1B Milton ON L9T 7H5	0.0	<u>21</u>
David Meisels	6990 Derry Road, unit 107 Milton ON L9T 7H3	74.2	<u>36</u>
David Meisels	6990 Derry Road, unit 107 Milton ON L9T 7H3	74.2	<u>36</u>
DERRY MEDICAL CENTRE INC.	6990 DERRY ROAD MILTON ON	74.2	<u>36</u>
MILTON DISTRICT HOSPITAL 26-041	30 DERRY ROAD EAST MILTON ON L9T 2X5	147.4	<u>44</u>
MILTON DISTRICT HOSPITAL	DERRY ROAD - MILTON HALTON ON L9T 2X5	147.4	<u>44</u>
MILTON DISTRICT HOSPITAL	30 DERRY ROAD EAST MILTON ON L9T 2X5	147.4	<u>44</u>
MILTON DISTRICT HOSPITAL (PATHOLOGICAL)	30 DERRY ROAD EAST MILTON ON L9T 2X5	147.4	<u>44</u>
MILTON DISTRICT HOSPITAL	7030 DERRY ROAD EAST MILTON ON	178.4	<u>47</u>
MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON L9T-7H6	178.4	<u>47</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON	178.4	<u>47</u>
MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON	178.4	<u>47</u>
MILTON DISTRICT HOSPITAL	7030 DERRY ROAD EAST MILTON ON	178.4	<u>47</u>
MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON	178.4	<u>47</u>
MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON L9T-7H6	178.4	<u>47</u>
MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON L9T-7H6	178.4	<u>47</u>
MILTON DISTRICT HOSPITAL	7030 DERRY ROAD MILTON ON L9T-7H6	178.4	<u>47</u>
MyHealthCentre	480 Bronte St South Suite 212 Milton ON L9T2X6	184.8	<u>49</u>
MyHealthCentre	480 Bronte St South Suite 212 Milton ON L9T2X6	184.8	<u>49</u>
My Safari Hygiene Inc.	480 Bronte Street South Milton ON L9T9A9	184.8	<u>49</u>
PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	214.1	<u>53</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PRIME CARE FAMILY HEALTH TEAM	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	214.1	<u>53</u>
LifeLabs LP	470 Bronte Street S, Suite 106 Milton ON L9T 2J4	214.1	<u>53</u>
PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	214.1	<u>53</u>
PRIME CARE FAMILY HEALTH TEAM	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	214.1	<u>53</u>
PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON	214.1	<u>53</u>
PRIME CARE FAMILY HEALTH TEAM	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	214.1	<u>53</u>
PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	214.1	<u>53</u>
PRIME CARE FAMILY HEALTH TEAM INC.	470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	214.1	<u>53</u>
KAZ CANADA INC.	510 BRONTE Street South MILTON ON	217.2	<u>54</u>
RELIANCE PRODUCTS DIVISION OF	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>
RELIANCE PRODUCTS DIVISION OF	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>
L.M.G. RELIANCE	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Lawter International Inc. a Delaware Corporation	Polymer Distribution Inc. 510 Bronte Street Milton ON L9T 3K5	217.2	<u>54</u>
RELIANCE PRODUCTS DIVISION OF	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>
RELIANCE PRODUCTS LTD. 33-104	DIV OF LAWSON MARDON GROUP 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>
KAZ CANADA INC.	510 BRONTE ROAD SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>
KAZ CANADA INC.	510 BRONTE RD. S MILTON ON L9T 2X6	217.2	<u>54</u>
RELIANCE PRODUCTS LTD.	510 BRONTE STREET SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>
RELIANCE PRODUCTS LTD.	DIV. OF LAWSON MARDON GROUP 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>
RELIANCE PRODUCTS LTD.	DIV OF LAWSON MARDON GROUP 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>
KAZ CANADA INC.	510 BRONTE RD. S MILTON ON L9T 2X6	217.2	<u>54</u>
HONEY CONSUMER PRODUCTS	510 BRONTE ROAD SOUTH MILTON ON L9T 2X6	217.2	<u>54</u>
KAZ CANADA INC.	510 BRONTE RD. S MILTON ON L9T 2X6	217.2	<u>54</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
KAZ CANADA INC.	510 BRONTE Street. S MILTON ON	217.2	<u>54</u>
KAZ CANADA INC.	510 BRONTE Street. S MILTON ON	217.2	<u>54</u>
KAZ CANADA INC.	510 BRONTE Street South MILTON ON L9T 2X6	217.2	<u>54</u>
KAZ CANADA INC.	510 BRONTE Street South MILTON ON L9T 2X6	217.2	<u>54</u>
KAZ CANADA INC.	510 BRONTE Street South MILTON ON L9T 2X6	217.2	<u>54</u>

PES - Pesticide Register

A search of the PES database, dated 1988-Sep 2018 has found that there are 3 PES site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
RENU CHOUDHARY PHARMACY LIMITED O/A SHOPPERS DRUG MART #1201	6951 BUILDING B DERRY RD MILTON ON L9T7H5	0.0	<u>18</u>
RENU CHOUDHARY PHARMACY LIMITED O/A SHOPPERS DRUG MART #1201	6951 BUILDING B DERRY ROAD MILTON ON L9T 7H5	0.0	<u>18</u>
SHOPPERS DRUG MART O/A SHOPPERS DRUG MART #1201	6951 DERRY RD BLDG B MILTON ON L9T7H5	0.0	<u>18</u>

REC - Ontario Regulation 347 Waste Receivers Summary

A search of the REC database, dated 1986-2016 has found that there are 2 REC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
MILTON DISTRICT HOSPITAL (PATHOLOGICAL)	30 DERRY ROAD EAST MILTON ON L9T 2X5	147.4	<u>44</u>
MILTON DISTRICT HOSPITAL	30 DERRY ROAD EAST MILTON ON L9T 2X5	147.4	<u>44</u>

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-Jan 2019 has found that there are 2 RSC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
FCHT Holdings (Ontario) Corporation	3037 Derry Road West, Milton, Ontario L9T 2X6 ON L9T 2X6	0.0	<u>13</u>
ADA Holding Co. Ltd.	Bronte Street South, Milton, Ontario , (west side, adjacent to 510 Bronte Street ON	221.2	<u>55</u>

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 5 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
HONEYWELL CONSUMER PRODUCTS	5100 BRONTE ST S MILTON ON L9T 2X6	62.0	<u>33</u>
Air Separation Technologies	6990 Derry Rd Suite 204 Milton ON L9T 7H3	74.2	<u>36</u>
HONEYWELL CONSUMER PRODUCTS	510 Bronte St S Milton ON L9T 2X6	217.2	<u>54</u>
Honeywell Consumer Products (Canada) Inc.	510 Bronte St S Milton ON L9T 2X6	217.2	<u>54</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Kaz Canada Inc.	510 Bronte St S Milton ON L9T 2X6	217.2	<u>54</u>

WWIS - Water Well Information System

A search of the WWIS database, dated Dec 31, 2017 has found that there are 45 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	MILTON ON <i>Well ID: 2810295</i>	0.0	<u>1</u>
	MILTON ON <i>Well ID: 2810420</i>	0.0	<u>2</u>
	MILTON ON <i>Well ID: 2810368</i>	0.0	<u>3</u>
	lot 11 con 1 MILTON ON <i>Well ID: 7292746</i>	0.0	<u>4</u>
	lot 11 con 1 Milton ON <i>Well ID: 7130781</i>	0.0	<u>5</u>
	lot 11 con 1 Milton ON <i>Well ID: 7129541</i>	0.0	<u>5</u>
	lot 11 con 1 MILTON ON <i>Well ID: 7292742</i>	0.0	<u>7</u>
	lot 11 con 1 MILTON ON <i>Well ID: 7292743</i>	0.0	<u>8</u>
	Milton ON	0.0	<u>9</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7212248		
	MILTON ON	0.0	<u>10</u>
	Well ID: 7035386		
	lot 11 con 1 MILTON ON	0.0	<u>11</u>
	Well ID: 7292741		
	ON	0.0	<u>12</u>
	Well ID: 7217943		
	lot 11 con 1 MILTON ON	0.0	<u>14</u>
	Well ID: 7292747		
	Milton ON	0.0	<u>15</u>
	Well ID: 7166971		
	lot 11 con 1 MILTON ON	0.0	<u>16</u>
	Well ID: 7292745		
	lot 11 con 1 MILTON ON	0.0	<u>17</u>
	Well ID: 7292740		
	ON	0.0	<u>19</u>
	Well ID: 7210119		
	lot 11 con 1 MILTON ON	0.0	<u>20</u>
	Well ID: 7292744		
	ON	0.0	<u>22</u>
	Well ID: 7195047		
	ON	0.0	<u>22</u>
	Well ID: 7202159		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON <i>Well ID: 7204187</i>	5.4	<u>23</u>
	Milton ON <i>Well ID: 7286326</i>	6.0	<u>24</u>
	Milton ON <i>Well ID: 7180499</i>	14.4	<u>25</u>
	lot 11 con 1 Milton ON <i>Well ID: 7286333</i>	16.7	<u>26</u>
	lot 10 con 1 Milton ON <i>Well ID: 7120514</i>	17.4	<u>27</u>
	Milton ON <i>Well ID: 7172570</i>	30.9	<u>29</u>
	Milton ON <i>Well ID: 7104588</i>	51.5	<u>31</u>
	Milton ON <i>Well ID: 7286325</i>	54.7	<u>32</u>
	Milton ON <i>Well ID: 7220158</i>	69.6	<u>35</u>
	MILTON ON <i>Well ID: 7261482</i>	69.6	<u>35</u>
	Milton ON <i>Well ID: 7180498</i>	78.6	<u>37</u>
	Milton ON	81.9	<u>38</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7286334		
	Milton ON	102.1	<u>39</u>
	Well ID: 7220159		
	MILTON ON	102.1	<u>39</u>
	Well ID: 7261481		
	ON	108.1	<u>40</u>
	Well ID: 7269754		
	Milton ON	117.8	<u>41</u>
	Well ID: 7180497		
	Milton ON	132.1	<u>42</u>
	Well ID: 7220157		
	MILTON ON	132.1	<u>42</u>
	Well ID: 7261480		
	Milton ON	137.2	<u>43</u>
	Well ID: 7286332		
	Milton ON	162.1	<u>45</u>
	Well ID: 7286327		
	Milton ON	171.1	<u>46</u>
	Well ID: 7286328		
	Milton ON	181.3	<u>48</u>
	Well ID: 7286331		
	ON	188.6	<u>50</u>
	Well ID: 7259825		


<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Milton ON <i>Well ID: 7286330</i>	191.3	<u>51</u>
	Milton ON <i>Well ID: 7286329</i>	200.9	<u>52</u>



Map : 0.25 Kilometer Radius

Order No: 20190314116


Address: 6951 Derry Road, Milton, ON, L9T 7H5

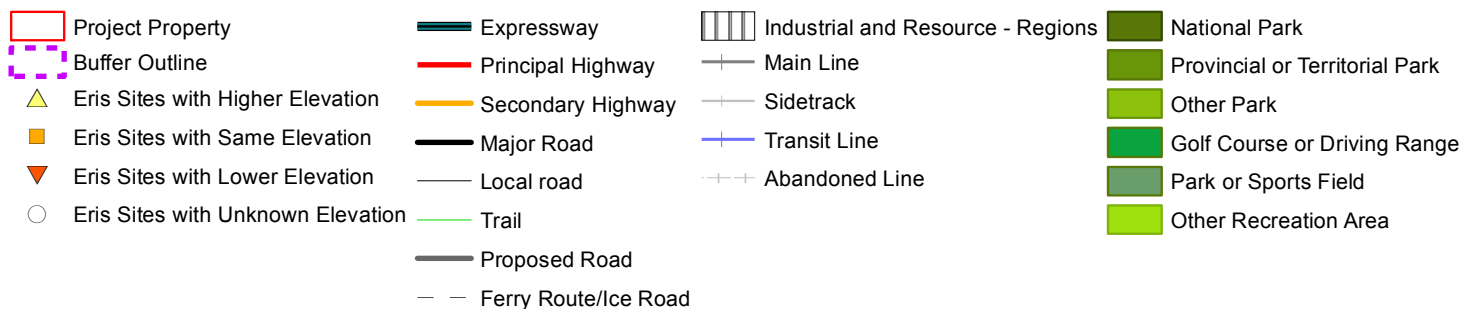

79°52'30"W

43°30'N

43°30'N

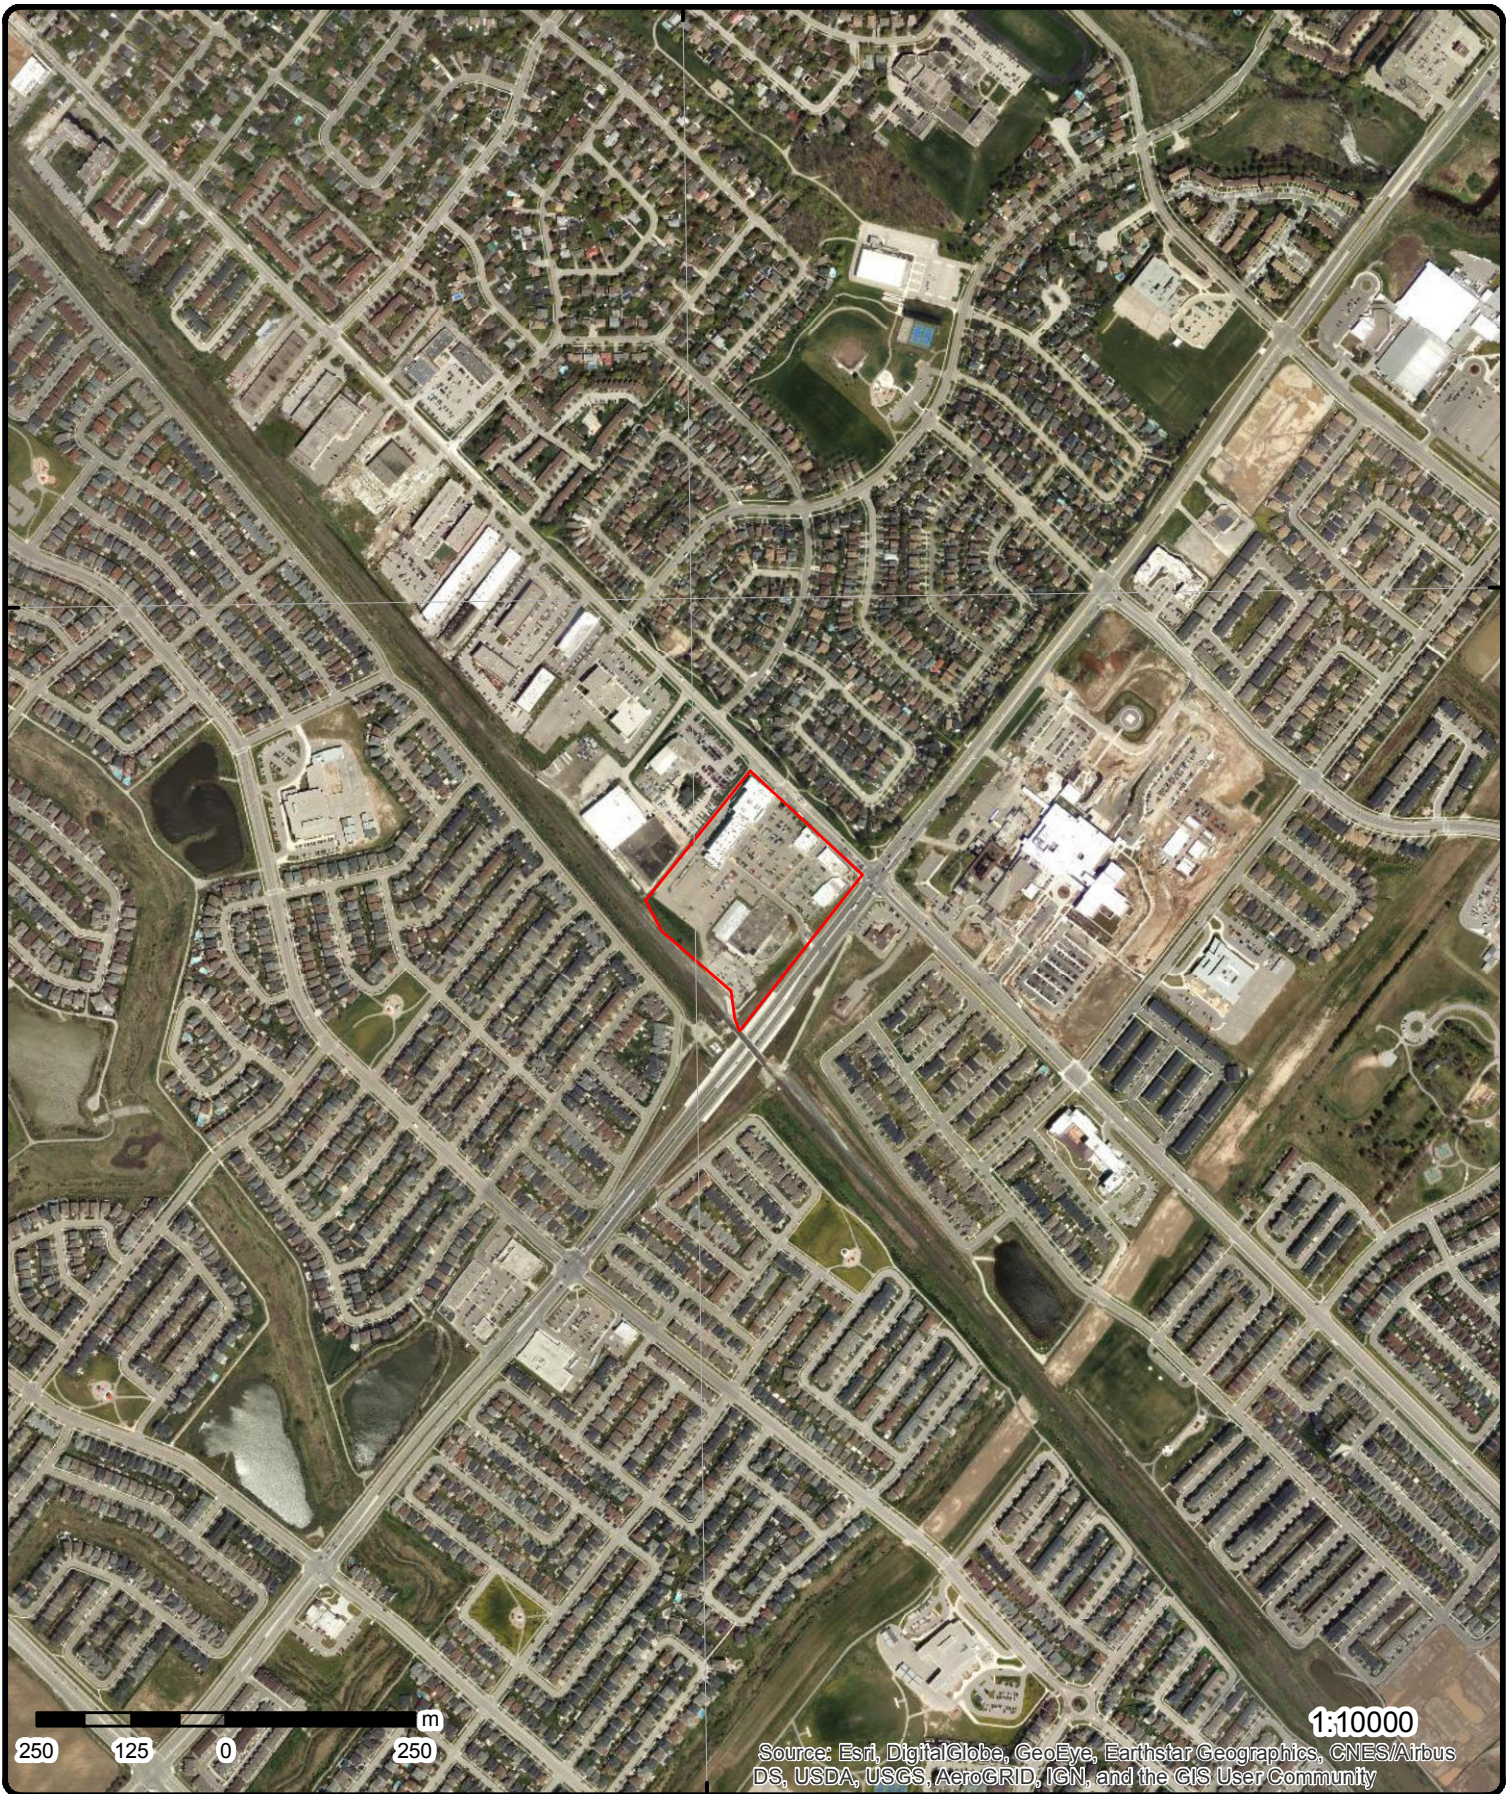

Aerial (2017)


Address: 6951 Derry Road, Milton, ON, L9T 7H5

Source: ESRI World Imagery

Order No: 20190314116



© ERIS Information Limited Partnership

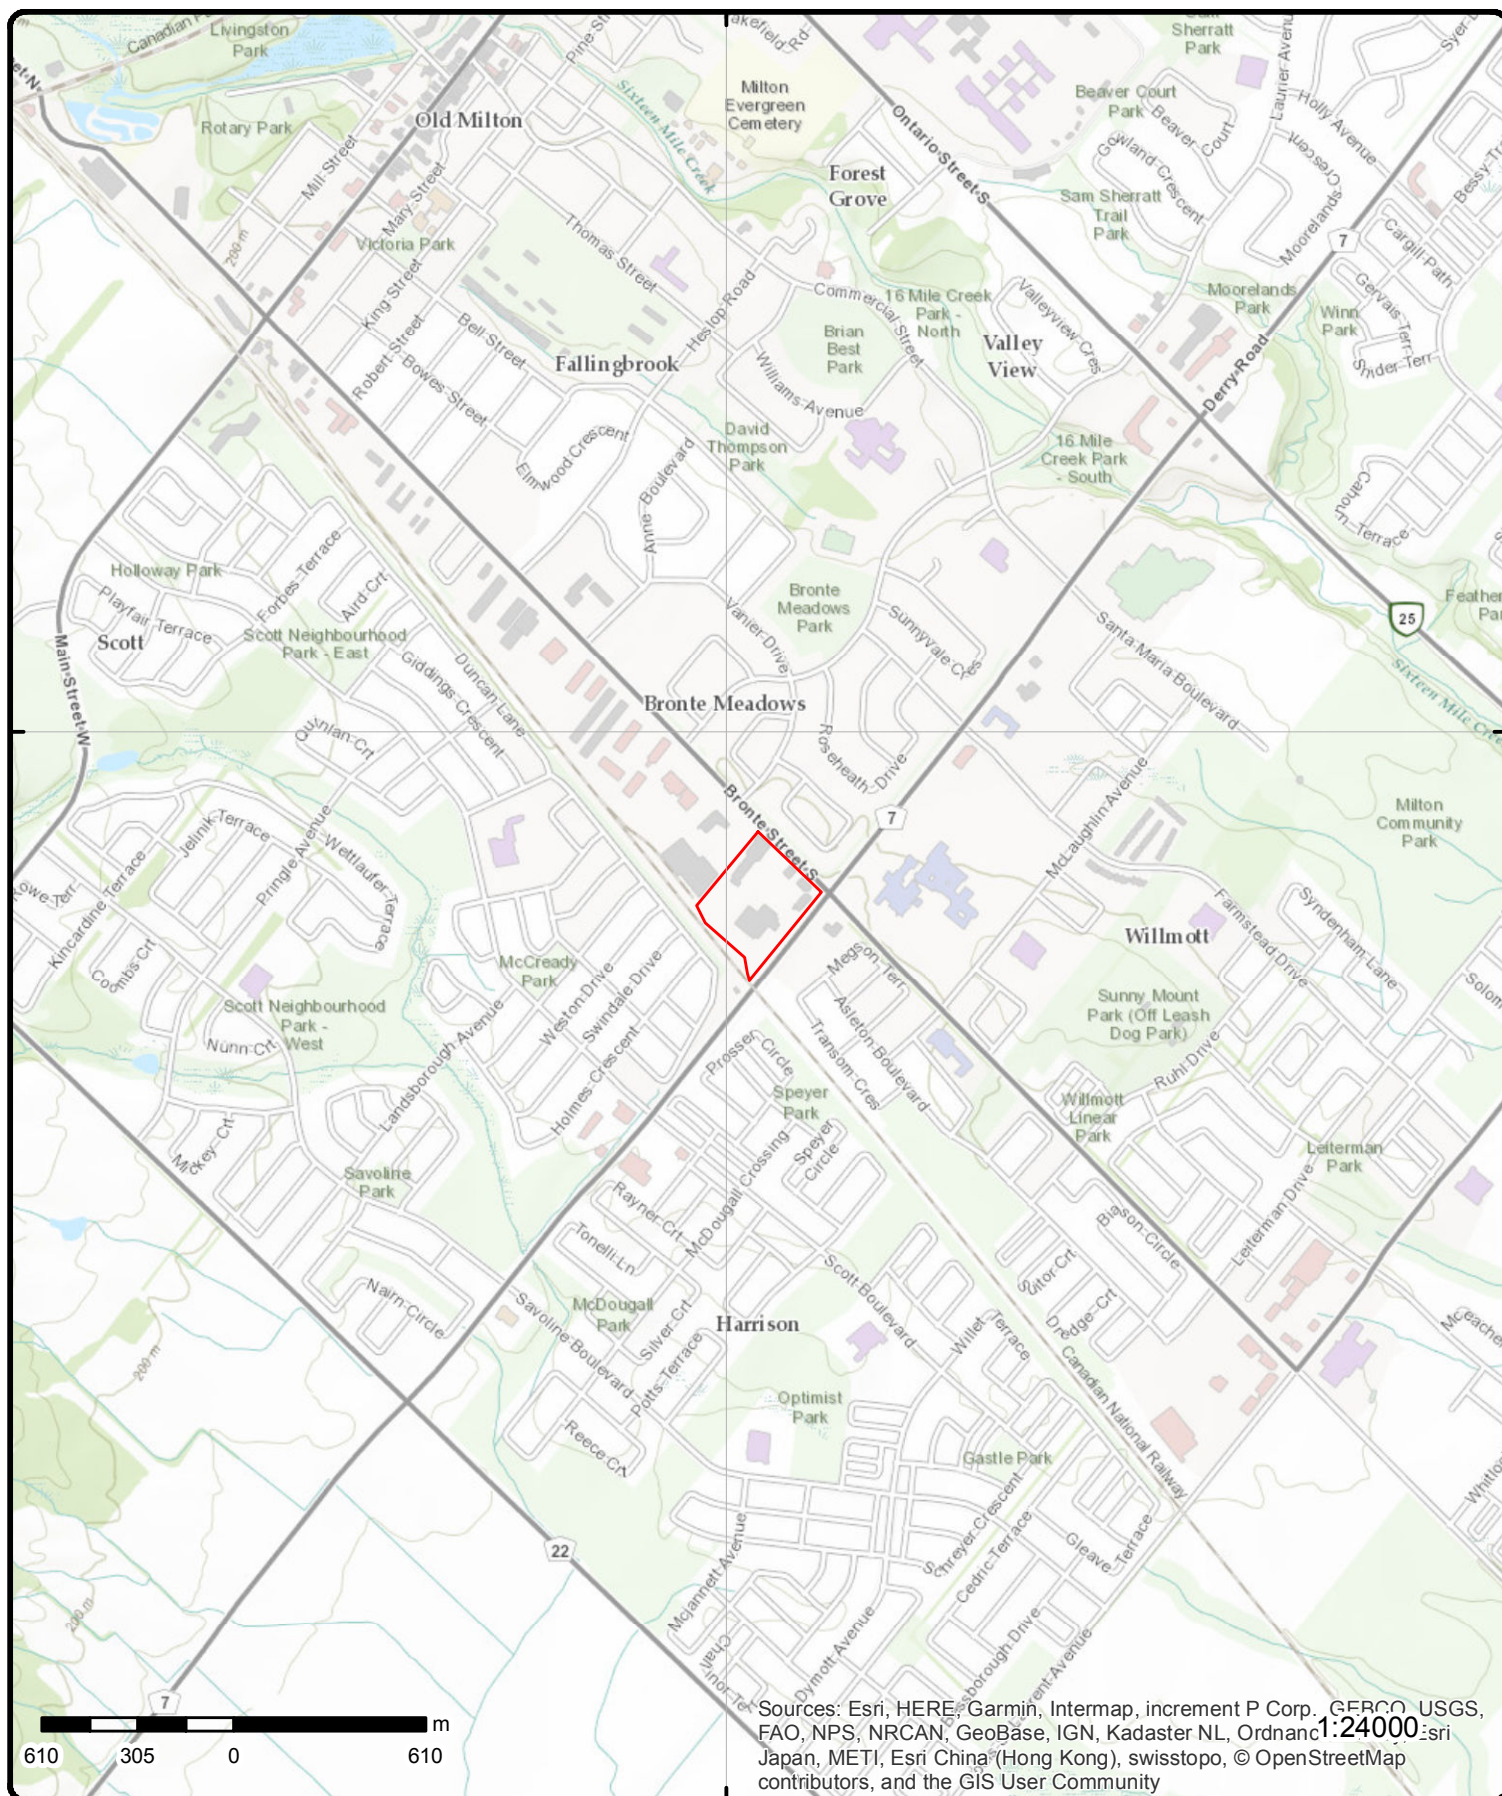

Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), swisstopo, © OpenStreetMap contributors, and the GIS User Community

Topographic Map

Address: 6951 Derry Road, Milton, ON, L9T 7H5

Source: ESRI World Topographic Map

Order No: 20190314116



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 1	-/0.0	198.8 / 0.00	MILTON ON	WWIS
Well ID: 2810295 Construction Date: Primary Water Use: Not Used Sec. Water Use: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z29893 Tag: A027881 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Data Entry Status: Data Src: Date Received: 7/20/2005 Selected Flag: Yes Abandonment Rec: Contractor: 7241 Form Version: 3 Owner: Street Name: 3037 WEST DERRY ROAD County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 11319250 DP2BR: Spatial Status: Code OB: 0 Code OB Desc: Overburden Open Hole: Cluster Kind: Date Completed: 07-JUN-05 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: 199.59 Elevrc: Zone: 17 East83: 591030 North83: 4816555 Org CS: G83a UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 933007460 Layer: 2 Color: 6 General Color: BROWN Mat1: 05 Most Common Material: CLAY Mat2: 06 Other Materials: SILT					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		34			
Other Materials:		TILL			
Formation Top Depth:		.3			
Formation End Depth:		6.1			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933007459			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:					
Other Materials:					
Mat3:		77			
Other Materials:		LOOSE			
Formation Top Depth:		0			
Formation End Depth:		.3			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933273216			
Layer:		3			
Plug From:		.91			
Plug To:		6.1			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933273217			
Layer:		2			
Plug From:		.3			
Plug To:		.91			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933273218			
Layer:		1			
Plug From:		0			
Plug To:		.3			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		962810295			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11334105			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No: Comment: Alt Name:		1			
<u>Construction Record - Casing</u>					
Casing ID:		930860241			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		1.5			
Casing Diameter:		3.17			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933413701			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		6.1			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		3.67			
<u>Hole Diameter</u>					
Hole ID:		11537827			
Diameter:		8.89			
Depth From:		0			
Depth To:		6.1			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

2	1 of 1	-/0.0	199.0 / 0.17	MILTON ON	WWIS
Well ID:	2810420			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Not Used			Date Received:	11/16/2005
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	6607
Casing Material:				Form Version:	3
Audit No:	Z27813			Owner:	
Tag:	A026605			Street Name:	3037 DERRY ROAD WEST
Construction				County:	HALTON
Method:				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation (m):				Site Info:	
Elevation Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Flowing (Y/N):				UTM Reliability:	
Flow Rate:					
Clear/Cloudy:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	11319375			Elevation:	199.65
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:	0			East83:	591020
Code OB Desc:	Overburden			North83:	4816590
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11-MAY-05			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	933007771				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:					
Other Materials:					
Mat3:	34				
Other Materials:	TILL				
Formation Top Depth:	1.5				
Formation End Depth:	5.7				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	933007770				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	02				
Most Common Material:	TOPSOIL				
Mat2:					
Other Materials:					
Mat3:	68				
Other Materials:	DRY				
Formation Top Depth:	0				
Formation End Depth:	1.5				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	933280967				
Layer:	1				
Plug From:	0				
Plug To:	2.4				
Plug Depth UOM:	m				
<u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		962810420			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11334230			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930860378			
Layer:		1			
Material:					
Open Hole or Material:					
Depth From:		0			
Depth To:		2.7			
Casing Diameter:		5.1			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933415458			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.7			
Screen End Depth:		5.7			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.4			
<u>Water Details</u>					
Water ID:		934067553			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		4.2			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11537968			
Diameter:		21			
Depth From:		0			
Depth To:		5.7			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>3</u>	1 of 1	-0.0	199.2 / 0.35	MILTON ON	WWIS
Well ID:	2810368			Data Entry Status:	
Construction Date:				Data Src:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Primary Water Use: Sec. Water Use: Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z34256 Tag: A027912 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:				Date Received: 9/14/2005 Selected Flag: Yes Abandonment Rec: Yes Contractor: 7241 Form Version: 3 Owner: Street Name: 3037 DERRY RD. County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
Bore Hole Information					
Bore Hole ID: 11319323 DP2BR: Spatial Status: Code OB: 0 Code OB Desc: Overburden Open Hole: Cluster Kind: Date Completed: 24-AUG-05 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:				Elevation: 199.71 Elevrc: Zone: 17 East83: 591067 North83: 4816571 Org CS: G83a UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr	
Overburden and Bedrock					
Materials Interval					
Formation ID: 933007631 Layer: 3 Color: 6 General Color: BROWN Mat1: 05 Most Common Material: CLAY Mat2: 06 Other Materials: SILT Mat3: 73 Other Materials: HARD Formation Top Depth: 2.4 Formation End Depth: 3.66 Formation End Depth UOM: m					
Overburden and Bedrock					
Materials Interval					
Formation ID: 933007629 Layer: 1 Color: 6 General Color: BROWN Mat1: 34					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		TILL			
Mat2:		28			
Other Materials:		SAND			
Mat3:		77			
Other Materials:		LOOSE			
Formation Top Depth:		0			
Formation End Depth:		1.22			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933007633			
Layer:		5			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Other Materials:		SILT			
Mat3:					
Other Materials:					
Formation Top Depth:		4.88			
Formation End Depth:		6.1			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933007632			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Other Materials:		SILT			
Mat3:		73			
Other Materials:		HARD			
Formation Top Depth:		3.66			
Formation End Depth:		4.88			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933007630			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Other Materials:		GRAVEL			
Mat3:					
Other Materials:					
Formation Top Depth:		1.22			
Formation End Depth:		2.4			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		933276885			
Layer:		2			
Plug From:		.31			
Plug To:		2.74			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933276883			
Layer:		1			
Plug From:		0			
Plug To:		.31			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933276884			
Layer:		3			
Plug From:		2.74			
Plug To:		6.1			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		962810368			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11334178			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930860327			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		3.1			
Casing Diameter:		3.81			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930860328			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		.25			
Depth To:		6.1			
Casing Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933414568			
Layer:		1			
Slot:		010			
Screen Top Depth:		3.1			
Screen End Depth:		6.1			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Hole Diameter</u>					
Hole ID:		11537912			
Diameter:		5.75			
Depth From:		0			
Depth To:		6.1			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
4	1 of 1	-/0.0	198.8 / 0.00	lot 11 con 1 MILTON ON	WWIS
Well ID:		7292746		Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:		Monitoring		Date Received:	
Sec. Water Use:				8/17/2017	
Final Well Status:		Observation Wells		Selected Flag:	
Water Type:				Yes	
Casing Material:				Abandonment Rec:	
Audit No:		Z263017		Contractor:	
Tag:		A225905		7238	
Construction				Form Version:	
Method:				7	
Elevation (m):				Owner:	
Elevation Reliability:				Street Name:	
Depth to Bedrock:				6901 DERRY ROAD WEST	
Well Depth:				County:	
Overburden/Bedrock:				HALTON	
Pump Rate:				Municipality:	
Static Water Level:				MILTON TOWN (TRAFALGAR)	
Flowing (Y/N):				Site Info:	
Flow Rate:				Lot:	
Clear/Cloudy:				011	
				Concession:	
				01	
				Concession Name:	
				NS	
				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
<u>Bore Hole Information</u>					
Bore Hole ID:		1006712311		Elevation:	
DP2BR:				199.56	
Spatial Status:				Elevrc:	
Code OB:				Zone:	
Code OB Desc:				17	
Open Hole:				East83:	
Cluster Kind:				590991	
Date Completed:		27-JUL-17		North83:	
Remarks:				4816587	
Elevrc Desc:				Org CS:	
Location Source Date:				UTM83	
				UTMRC:	
				4	
				UTMRC Desc:	
				margin of error : 30 m - 100 m	
				Location Method:	
				wwr	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006835563			
Layer:		3			
Color:		7			
General Color:		RED			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Other Materials:					
Mat3:		73			
Other Materials:		HARD			
Formation Top Depth:		5			
Formation End Depth:		20			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006835561			
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		1			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006835562			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Other Materials:		GRAVEL			
Mat3:		73			
Other Materials:		HARD			
Formation Top Depth:		1			
Formation End Depth:		5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1006835570			
Layer:		1			
Plug From:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		1			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835571			
Layer:		2			
Plug From:		1			
Plug To:		9			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835572			
Layer:		3			
Plug From:		9			
Plug To:		20			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006835569			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006835560			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006835566			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		10			
Casing Diameter:		2			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006835567			
Layer:		1			
Slot:		10			
Screen Top Depth:		10			
Screen End Depth:		20			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1006835565			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006835564			
Diameter:		8			
Depth From:		0			
Depth To:		20			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>5</u>	1 of 2	-/0.0	198.8 / 0.00	lot 11 con 1 Milton ON	WWIS
Well ID:	7130781			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	10/1/2009
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Abandoned-Other			Abandonment Rec:	Yes
Water Type:				Contractor:	7320
Casing Material:				Form Version:	7
Audit No:	Z103163			Owner:	
Tag:	A089661			Street Name:	3037 DERRY ROAD
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	011
Well Depth:				Concession:	01
Overburden/Bedrock:				Concession Name:	NS
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1002729415			Elevation:	199.55
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590983
Code OB Desc:				North83:	4816598
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	5
Date Completed:	14-SEP-09			UTMRC Desc:	margin of error : 100 m - 300 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1002870616			
Layer:		1			
Plug From:		0			
Plug To:		6.1			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002870620			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002870613			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002870618			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002870619			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1002870617			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1002870615			
Diameter:					
Depth From:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To: Hole Depth UOM: m Hole Diameter UOM: cm					
5	2 of 2	-/0.0	198.8 / 0.00	lot 11 con 1 Milton ON	WWIS
Well ID: 7129541 Construction Date: Primary Water Use: Test Hole Sec. Water Use: Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z103197 Tag: A089661 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Data Entry Status: Data Src: Date Received: 9/11/2009 Selected Flag: Yes Abandonment Rec: Contractor: 7320 Form Version: 7 Owner: Street Name: 3037 DEERY ROAD County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: 011 Concession: 01 Concession Name: NS Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1002719058 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 26-APR-09 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: 199.55 Elevrc: Zone: 17 East83: 590983 North83: 4816598 Org CS: UTM83 UTMRC: 5 UTMRC Desc: margin of error : 100 m - 300 m Location Method: wwr					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1002845037 Layer: 4 Color: 2 General Color: GREY Mat1: 06 Most Common Material: SILT Mat2: 28 Other Materials: SAND Mat3: 91 Other Materials: WATER-BEARING Formation Top Depth: 4.2 Formation End Depth: 4.4 Formation End Depth UOM: m					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002845035			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Other Materials:					
Mat3:		66			
Other Materials:		DENSE			
Formation Top Depth:		3.6			
Formation End Depth:		3.9			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002845034			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Other Materials:		CLAY			
Mat3:		66			
Other Materials:		DENSE			
Formation Top Depth:		0			
Formation End Depth:		3.6			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002845038			
Layer:		5			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		4.4			
Formation End Depth:		6.1			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002845036			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		3.9			
Formation End Depth:		4.2			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002845042			
Layer:		3			
Plug From:		2.7			
Plug To:		6.1			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002845040			
Layer:		1			
Plug From:		0			
Plug To:		.3			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002845041			
Layer:		2			
Plug From:		.3			
Plug To:		2.7			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002845047			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		SSA			
<u>Pipe Information</u>					
Pipe ID:		1002845033			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002845044			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		3			
Casing Diameter:		5.1			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:	1002845045				
Layer:	1				
Slot:	.01				
Screen Top Depth:	3				
Screen End Depth:	6.1				
Screen Material:	5				
Screen Depth UOM:	m				
Screen Diameter UOM:	cm				
Screen Diameter:	6.1				
<u>Water Details</u>					
Water ID:	1002845043				
Layer:	1				
Kind Code:	1				
Kind:	FRESH				
Water Found Depth:					
Water Found Depth UOM:	m				
<u>Hole Diameter</u>					
Hole ID:	1002845039				
Diameter:	15				
Depth From:	0				
Depth To:	6.1				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>6</u>	1 of 1	-/0.0	198.8 / 0.00	Derry Heights Plaza 6901 Derry Road Milton ON L9T 7H5	GEN
Generator No:	ON7215655			PO Box No:	
Status:				Country:	
Approval Years:	2010			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	452999				
SIC Description:	All Other Miscellaneous General Merchandise Stores				
<u>--Details--</u>					
Waste Code:	243				
Waste Description:	PCBS				
Waste Code:	251				
Waste Description:	OIL SKIMMINGS & SLUDGES				
<u>7</u>	1 of 1	-/0.0	198.8 / 0.00	lot 11 con 1 MILTON ON	WWIS
Well ID:	7292742			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	8/17/2017
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7238
Casing Material:				Form Version:	7
Audit No:	Z263013			Owner:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag: Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:	A225884			Street Name: County: Municipality: Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	6901 DERRY ROAD WEST HALTON MILTON TOWN (TRAFALGAR) 011 01 NS
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1006712100 26-JUL-17 			Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	199.47 17 590969 4816560 UTM83 4 margin of error : 30 m - 100 m wwr
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Other Materials: Mat3: Other Materials: Formation Top Depth: Formation End Depth: Formation End Depth UOM:	1006835466 2 6 BROWN 28 SAND 11 GRAVEL 1 5 ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Other Materials: Mat3: Other Materials: Formation Top Depth:	1006835465 1 0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:	1				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006835467				
Layer:	3				
Color:	7				
General Color:	RED				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					
Other Materials:					
Mat3:	73				
Other Materials:	HARD				
Formation Top Depth:	5				
Formation End Depth:	12				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1006835476				
Layer:	3				
Plug From:	3				
Plug To:	12				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1006835475				
Layer:	2				
Plug From:	1				
Plug To:	3				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1006835474				
Layer:	1				
Plug From:	0				
Plug To:	1				
Plug Depth UOM:	ft				
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1006835473				
Method Construction Code:	6				
Method Construction:	Boring				
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1006835464				
Casing No:	0				
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1006835470			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		4			
Casing Diameter:		2			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006835471			
Layer:		1			
Slot:		10			
Screen Top Depth:		4			
Screen End Depth:		12			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006835469			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006835468			
Diameter:		8			
Depth From:		0			
Depth To:		12			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>8</u>	1 of 1	-/0.0	198.8 / 0.00	lot 11 con 1 MILTON ON	WWIS
Well ID:	7292743			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	8/17/2017
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7238
Casing Material:				Form Version:	7
Audit No:	Z263012			Owner:	
Tag:	A225885			Street Name:	6901 DERRY ROAD WEST
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	011
Well Depth:				Concession:	01

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock:				Concession Name:	NS
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006712103			Elevation:	199.52
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590971
Code OB Desc:				North83:	4816601
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	25-JUL-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006835495				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:					
Other Materials:					
Mat3:	01				
Other Materials:	FILL				
Formation Top Depth:	1				
Formation End Depth:	5				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006835496				
Layer:	3				
Color:	7				
General Color:	RED				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					
Other Materials:					
Mat3:	73				
Other Materials:	HARD				
Formation Top Depth:	5				
Formation End Depth:	12				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1006835494			
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		1			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835504			
Layer:		2			
Plug From:		1			
Plug To:		3			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835505			
Layer:		3			
Plug From:		3			
Plug To:		12			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835503			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006835502			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006835493			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006835499			
Layer:		1			
Material:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		4			
Casing Diameter:		2			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006835500			
Layer:		1			
Slot:		10			
Screen Top Depth:		4			
Screen End Depth:		12			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
 <u>Water Details</u>					
Water ID:		1006835498			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1006835497			
Diameter:		8			
Depth From:		0			
Depth To:		12			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

9	1 of 1	-/0.0	198.8 / 0.00	Milton ON	WWIS
Well ID:	7212248			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	12/2/2013
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Abandoned-Other			Abandonment Rec:	Yes
Water Type:				Contractor:	6607
Casing Material:				Form Version:	7
Audit No:	Z170012			Owner:	
Tag:				Street Name:	901 DERRY RD. W
Construction				County:	HALTON
Method:				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation (m):				Site Info:	
Elevation Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Flowing (Y/N):				UTM Reliability:	
Flow Rate:					
Clear/Cloudy:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1004658894			Elevation:	199.4
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590974
Code OB Desc:				North83:	4816518
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05-NOV-13			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1004993116				
Layer:	1				
Plug From:					
Plug To:					
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1004993117				
Layer:	1				
Plug From:	0				
Plug To:	6				
Plug Depth UOM:	m				
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1004993115				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1004993108				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1004993112				
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:	cm				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004993113			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1004993111			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		1			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004993110			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
10	1 of 1	-/0.0	198.8 / 0.00	MILTON ON	WWIS
Well ID:	7035386			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	10/17/2006
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:				Abandonment Rec:	
Water Type:				Contractor:	7241
Casing Material:				Form Version:	3
Audit No:	Z50138			Owner:	
Tag:	A039338			Street Name:	3037 DERRY ROAD WEST
Construction				County:	HALTON
Method:				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation (m):				Site Info:	
Elevation Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Flowing (Y/N):				UTM Reliability:	
Flow Rate:					
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	11760836			Elevation:	199.48
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	17
Code OB:	0			East83:	591044
Code OB Desc:	Overburden			North83:	4816489
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	30-JUN-06			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933084837			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		05			
Other Materials:		CLAY			
Mat3:		66			
Other Materials:		DENSE			
Formation Top Depth:		0			
Formation End Depth:		2.44			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933084839			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		05			
Other Materials:		CLAY			
Mat3:		91			
Other Materials:		WATER-BEARING			
Formation Top Depth:		4.88			
Formation End Depth:		5.49			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933084838			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		05			
Other Materials:		CLAY			
Mat3:		66			
Other Materials:		DENSE			
Formation Top Depth:		2.44			
Formation End Depth:		4.88			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933084840			
Layer:		4			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		05			
Other Materials:		CLAY			
Mat3:		66			
Other Materials:		DENSE			
Formation Top Depth:		5.49			
Formation End Depth:		6.4			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933309856			
Layer:		3			
Plug From:		1.5			
Plug To:		6.4			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933309854			
Layer:		1			
Plug From:		0			
Plug To:		.3			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933309855			
Layer:		2			
Plug From:		.3			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967035386			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11768526			
Casing No:		1			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:	930893065				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0				
Depth To:	1.83				
Casing Diameter:	3.81				
Casing Diameter UOM:	cm				
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	933422125				
Layer:	1				
Slot:	10				
Screen Top Depth:	1.83				
Screen End Depth:	6.4				
Screen Material:	5				
Screen Depth UOM:	m				
Screen Diameter UOM:	cm				
Screen Diameter:	3.67				
<u>Hole Diameter</u>					
Hole ID:	11846741				
Diameter:	8.89				
Depth From:	0				
Depth To:	6.4				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>11</u>	1 of 1	-0.0	198.8 / 0.00	lot 11 con 1 MILTON ON	WWIS
Well ID:	7292741			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	8/17/2017
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7238
Casing Material:				Form Version:	7
Audit No:	Z263014			Owner:	
Tag:	A225883			Street Name:	6901 DERRY ROAD WEST
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	011
Well Depth:				Concession:	01
Overburden/Bedrock:				Concession Name:	NS
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006712097			Elevation:	199.34

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590952
Code OB Desc:				North83:	4816536
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	26-JUL-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006835453			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Other Materials:		GRAVEL			
Mat3:					
Other Materials:					
Formation Top Depth:		1			
Formation End Depth:		5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006835454			
Layer:		3			
Color:		7			
General Color:		RED			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Other Materials:					
Mat3:		73			
Other Materials:		HARD			
Formation Top Depth:		5			
Formation End Depth:		12			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006835452			
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:	1				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1006835462				
Layer:	2				
Plug From:	1				
Plug To:	3				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1006835463				
Layer:	3				
Plug From:	3				
Plug To:	12				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1006835461				
Layer:	1				
Plug From:	0				
Plug To:	1				
Plug Depth UOM:	ft				
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1006835460				
Method Construction Code:	6				
Method Construction:	Boring				
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1006835451				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1006835457				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0				
Depth To:	4				
Casing Diameter:	2				
Casing Diameter UOM:	inch				
Casing Depth UOM:	ft				
<u>Construction Record - Screen</u>					
Screen ID:	1006835458				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Slot:		10			
Screen Top Depth:		4			
Screen End Depth:		12			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
 <u>Water Details</u>					
Water ID:		1006835456			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1006835455			
Diameter:		8			
Depth From:		0			
Depth To:		12			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
12	1 of 1	-/0.0	198.8 / 0.00	ON	WWIS
Well ID:	7217943			Data Entry Status:	Yes
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	3/20/2014
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:				Abandonment Rec:	
Water Type:				Contractor:	6607
Casing Material:				Form Version:	8
Audit No:	C22280			Owner:	
Tag:	A157310			Street Name:	
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1004722862			Elevation:	199.4
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590979
Code OB Desc:				North83:	4816495
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	31-JAN-14			UTMRC Desc:	margin of error : 30 m - 100 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:				Location Method: WWW	
13	1 of 10	-/0.0	198.8 / 0.00	Trenwith Investments Inc. 3037 Derry Road West, Former Canadian Meter Company Inc., Derry Road West and Bronte Street South, Part of Lot 11, Concession 1, Town of Milton, Regional Municipality of Halton TOWN OF MILTON ON	CPU
EBR Registry No:		IA07E0105	Proposal Date:		January 18, 2007
Ministry Ref. No:		4041-6NZPD2	Notice Date:		January 30, 2015
Notice Type:		Instrument Decision	Year:		2007
Company Name:		Trenwith Investments Inc.			
Proponent Name:					
Proponent Address:		7288 Guelph Line, Campbellville Ontario, L0P 1B0			
Instrument Type:		(EPA s. 168.6) - Certificate of Property Use			
URL:					
Location:					
3037 Derry Road West, Former Canadian Meter Company Inc., Derry Road West and Bronte Street South, Part of Lot 11, Concession 1, Town of Milton, Regional Municipality of Halton TOWN OF MILTON					
13	2 of 10	-/0.0	198.8 / 0.00	FCHT Holdings (Ontario) Corporation 3037 Derry Road West Part of Lot 11, CON 1, Trafalgar New Survey, Regional Municipality of Halton TOWN OF MILTON ON	CPU
EBR Registry No:		010-8708	Proposal Date:		February 12, 2010
Ministry Ref. No:		0660-7T9K7Y	Notice Date:		April 27, 2011
Notice Type:		Instrument Decision	Year:		2010
Company Name:		FCHT Holdings (Ontario) Corporation			
Proponent Name:					
Proponent Address:		85 Hanna avenue , Suite 400, Toronto Ontario, Canada M6K 3S3			
Instrument Type:		(EPA s. 168.6) - Certificate of Property Use			
URL:					
Location:					
3037 Derry Road West Part of Lot 11, CON 1, Trafalgar New Survey, Regional Municipality of Halton TOWN OF MILTON					
13	3 of 10	-/0.0	198.8 / 0.00	CANADIAN METER COMPANY INC 08-004 DIV OF SINGER CO OF CANADA LTD 3037 DERRY RD. W. MILTON ON L9T 2X6	GEN
Generator No:		ON0159400	PO Box No:		
Status:			Country:		
Approval Years:		94,95,96	Choice of Contact:		
Contam. Facility:			Co Admin:		
MHSW Facility:			Phone No Admin:		
SIC Code:		3999			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		OTHER MANU. PROD.			
--Details--					
Waste Code:		145			
Waste Description:		PAINT/PIGMENT/COATING RESIDUES			
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
Waste Code:		253			
Waste Description:		EMULSIFIED OILS			
13	4 of 10	-/0.0	198.8 / 0.00	CANADIAN METER COMPANY INC 3037 DERRY ROAD WEST MILTON ON L9T 2X6	GEN
Generator No:		ON0159400		PO Box No:	
Status:				Country:	
Approval Years:		92,93,97		Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:		3999			
SIC Description:		OTHER MANU. PROD.			
--Details--					
Waste Code:		145			
Waste Description:		PAINT/PIGMENT/COATING RESIDUES			
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
Waste Code:		253			
Waste Description:		EMULSIFIED OILS			
13	5 of 10	-/0.0	198.8 / 0.00	FCMT Holdigs (Ontario) 3037 Derry Rd. W. Milton ON L9T 2X6	GEN
Generator No:		ON4934849		PO Box No:	
Status:				Country:	
Approval Years:		2009		Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:		522299			
SIC Description:		All Other Non-Depository Credit Intermediation			
--Details--					
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
13	6 of 10	-/0.0	198.8 / 0.00	CANADIAN METER COMPANY LIMITED	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				DIV OF SINGER CO OF CANADA LTD 3037 DERRY RD. W. MILTON ON L9T 2X6	
Generator No:	ON0159400			PO Box No:	
Status:				Country:	
Approval Years:	86,87			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	3999				
SIC Description:		OTHER MANU. PROD.			
--Details--					
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
Waste Code:		253			
Waste Description:		EMULSIFIED OILS			
13	7 of 10	-/0.0	198.8 / 0.00	CANADIAN METER COMPANY INC DIV OF SINGER CO OF CANADA LTD 3037 DERRY RD. W. MILTON ON L9T 2X6	GEN
Generator No:	ON0159400			PO Box No:	
Status:				Country:	
Approval Years:	88,89,90			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	3999				
SIC Description:		OTHER MANU. PROD.			
--Details--					
Waste Code:		145			
Waste Description:		PAINT/PIGMENT/COATING RESIDUES			
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
Waste Code:		253			
Waste Description:		EMULSIFIED OILS			
13	8 of 10	-/0.0	198.8 / 0.00	CANADIAN METER COMPANY INC. SINGER COMPANY OF CANADA LTD, A DIV. OF 3037 DERRY ROAD WEST MILTON ON L9T 2X6	GEN
Generator No:	ON0159400			PO Box No:	
Status:				Country:	
Approval Years:	98,99,00,01,02,03,04			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	3999				
SIC Description:		OTHER MANU. PROD.			
--Details--					
Waste Code:		145			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Description:		PAINT/PIGMENT/COATING RESIDUES			
Waste Code:		212			
Waste Description:		ALIPHATIC SOLVENTS			
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
Waste Code:		253			
Waste Description:		EMULSIFIED OILS			
Waste Code:		263			
Waste Description:		ORGANIC LABORATORY CHEMICALS			
13	9 of 10	-0.0	198.8 / 0.00	CANADIAN METER COMPANY INC. 3037 DERRY RD W MILTON ON L9T 2X6	GEN
Generator No:		28805		PO Box No:	
Status:				Country:	
Approval Years:		19971024		Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:					
SIC Description:					
--Details--					
Waste Code:		3823			
Waste Description:		INDUSTRIAL INSTRUMENTS FOR MEASUREMENT, DISPLAY, AND CONTROL OF PROCESS VARIABLES; & RELATED ITEMS			
Waste Code:		3824			
Waste Description:		TOTALIZING FLUID METERS AND COUNTING DEVICES			
Waste Code:		3569			
Waste Description:		GENERAL INDUSTRIAL MACHINERY AND EQUIPMENT, NOT ELSEWHERE CLASSIFIED			
Waste Code:		3663			
Waste Description:		RADIO AND TELEVISION BROADCASTING AND COMMUNICATIONS EQUIPMENT			
Waste Code:		333990			
Waste Description:		All Other General-Purpose Machinery Manufacturing			
Waste Code:		334220			
Waste Description:		Radio and Television Broadcasting and Wireless Communications Equipment Manufacturing			
Waste Code:		334512			
Waste Description:		Measuring, Medical and Controlling Devices Manufacturing			
Waste Code:		3569			
Waste Description:		GENERAL INDUSTRIAL MACHINERY AND EQUIPMENT, NOT ELSEWHERE CLASSIFIED			
Waste Code:		3663			
Waste Description:		RADIO AND TELEVISION BROADCASTING AND COMMUNICATIONS EQUIPMENT			
Waste Code:		3823			
Waste Description:		INDUSTRIAL INSTRUMENTS FOR MEASUREMENT, DISPLAY, AND CONTROL OF PROCESS VARIABLES; &			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
RELATED ITEMS					
Waste Code:		3824			
Waste Description:		TOTALIZING FLUID METERS AND COUNTING DEVICES			
Waste Code:		333990			
Waste Description:		All Other General-Purpose Machinery Manufacturing			
Waste Code:		334220			
Waste Description:		Radio and Television Broadcasting and Wireless Communications Equipment Manufacturing			
Waste Code:		334512			
Waste Description:		Measuring, Medical and Controlling Devices Manufacturing			
13	10 of 10	-/0.0	198.8 / 0.00	FCHT Holdings (Ontario) Corporation 3037 Derry Road West, Milton, Ontario L9T 2X6 ON L9T 2X6	RSC
Reg No:	114246			Cert Date:	8-Dec-09
RA No:				Cert Prop Use No:	0660-7T9K7Y
RSC Type:				Intended Prop Use:	Institutional
Curr Property Use:	Institutional			Nm of Qual. Person:	Ms. Jodi Shpigel
District Office:	MILTON			Stratified (Y/N):	
Date Submitted:	28-Jun-11			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	Yes
Date Returned:				Accuracy Estimate:	21 to 100 meters
Restoration Type:				Telephone:	416-5044114
Soil Type:				Fax:	416-9411655
Criteria:				Email:	jodi.shpigel@FirstCapitalRealty.ca
CPU Issued Sect 1686:	Yes				
Asmt Roll No:		2.40901E+18			
Prop. ID No:		24962-0094 (LT)			
Property Municipal Address:		3037 Derry Road West, Milton, Ontario L9T 2X6			
Mailing Address:		Suite 400, 85 HANNA AVE, TORONTO, ON, M6K 3S3			
Latitude & Latitude:		43.49633230N 79.87383350W (converted from UTM)			
UTM Coordinates:		NAD83 17-591050-4816550			
Consultant:					
Filing Owner:					
Legal Desc:		PT LT 11, CON 1 Trafalgar New Survey, AS IN 679067, EXCEPT PM163, MILTON/TRAFALGAR; S/T EASEMENT IN GROSS AS IN HR520590			
Measurement Method:		Digitized from a map			
Applicable Standards:		Full Depth Site Conditions Standard, with Nonpotable Ground Water, Medium/Fine Textured Soil, for Residential/Parkland/Institutional property use with			
RSC PDF:					
14	1 of 1	-/0.0	198.8 / 0.00	lot 11 con 1 MILTON ON	WWIS
Well ID:	7292747			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	8/17/2017
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7238
Casing Material:				Form Version:	7
Audit No:	Z263016			Owner:	
Tag:	A225904			Street Name:	6901 DERRY ROAD WEST
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock:				Lot:	011
Well Depth:				Concession:	01
Overburden/Bedrock:				Concession Name:	NS
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006712314			Elevation:	199.43
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590952
Code OB Desc:				North83:	4816614
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-JUL-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006835575				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Other Materials:	GRAVEL				
Mat3:					
Other Materials:					
Formation Top Depth:	1				
Formation End Depth:	5				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006835574				
Layer:	1				
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:	0				
Formation End Depth:	1				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1006835576			
Layer:		3			
Color:		7			
General Color:		RED			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		5			
Formation End Depth:		12			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835583			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835584			
Layer:		2			
Plug From:		1			
Plug To:		3			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835585			
Layer:		3			
Plug From:		3			
Plug To:		12			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006835582			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006835573			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006835579			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		4			
Casing Diameter:		2			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006835580			
Layer:		1			
Slot:		10			
Screen Top Depth:		4			
Screen End Depth:		12			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
 <u>Water Details</u>					
Water ID:		1006835578			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1006835577			
Diameter:		8			
Depth From:		0			
Depth To:		12			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

15	1 of 1	-/0.0	198.8 / 0.00	Milton ON	WWIS
Well ID:	7166971			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Test Hole			Date Received:	8/9/2011
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Test Hole			Abandonment Rec:	
Water Type:				Contractor:	7215
Casing Material:				Form Version:	7
Audit No:	Z133625			Owner:	
Tag:	A117907			Street Name:	6901 DERRY RD
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1003547276			Elevation:	199.28
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590947
Code OB Desc:				North83:	4816521
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	03-JUN-11			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003911555				
Layer:	3				
Color:	6				
General Color:	BROWN				
Mat1:	06				
Most Common Material:	SILT				
Mat2:					
Other Materials:					
Mat3:	73				
Other Materials:	HARD				
Formation Top Depth:	10				
Formation End Depth:	20				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003911554				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	28				
Other Materials:	SAND				
Mat3:	85				
Other Materials:	SOFT				
Formation Top Depth:	2				
Formation End Depth:	10				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003911553				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	01				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		FILL			
Mat2:					
Other Materials:					
Mat3:		77			
Other Materials:		LOOSE			
Formation Top Depth:		0			
Formation End Depth:		2			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003911563			
Layer:		2			
Plug From:		8			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003911564			
Layer:		3			
Plug From:		1			
Plug To:		0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003911562			
Layer:		1			
Plug From:		20			
Plug To:		8			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003911561			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003911552			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003911558			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		10			
Depth To:		0			
Casing Diameter:		2			
Casing Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1003911559			
Layer:		1			
Slot:		10			
Screen Top Depth:		20			
Screen End Depth:		10			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2			
<u>Water Details</u>					
Water ID:		1003911557			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1003911556			
Diameter:		8			
Depth From:		20			
Depth To:		0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
16	1 of 1	-/0.0	198.8 / 0.00	lot 11 con 1 MILTON ON	WWIS
Well ID:	7292745			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	8/17/2017
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7238
Casing Material:				Form Version:	7
Audit No:	Z263018			Owner:	
Tag:	A225908			Street Name:	6901 DERRY ROAD WEST
Construction				County:	HALTON
Method:				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation (m):				Site Info:	
Elevation Reliability:				Lot:	011
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	NS
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Flowing (Y/N):				UTM Reliability:	
Flow Rate:					
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006712229			Elevation:	199.33
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	17
Code OB:				East83:	590935
Code OB Desc:				North83:	4816592
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		28-JUL-17	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006835533			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		34			
Other Materials:		TILL			
Mat3:					
Other Materials:					
Formation Top Depth:		1			
Formation End Depth:		20			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006835532			
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		1			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006835540			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006835541			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		1			
Plug To:		9			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835542			
Layer:		3			
Plug From:		9			
Plug To:		20			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006835539			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006835531			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006835536			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		20			
Casing Diameter:		2			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006835537			
Layer:		1			
Slot:		10			
Screen Top Depth:		10			
Screen End Depth:		20			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006835535			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		2			
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1006835534			
Diameter:		8			
Depth From:		0			
Depth To:		20			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>17</u>	1 of 1	-/0.0	198.8 / 0.00	lot 11 con 1 MILTON ON	WWIS
Well ID:	7292740			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	8/17/2017
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7238
Casing Material:				Form Version:	7
Audit No:	Z263015			Owner:	
Tag:	A225882			Street Name:	6901 DERRY ROAD WEST
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	011
Well Depth:				Concession:	01
Overburden/Bedrock:				Concession Name:	NS
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006712094			Elevation:	199.25
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590932
Code OB Desc:				North83:	4816551
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	26-JUL-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006835426				
Layer:	3				
Color:	7				
General Color:	RED				
Mat1:	34				
Most Common Material:	TILL				
Mat2:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Other Materials:					
Mat3:		73			
Other Materials:		HARD			
Formation Top Depth:		5			
Formation End Depth:		12			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006835424			
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		1			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006835425			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Other Materials:		GRAVEL			
Mat3:					
Other Materials:					
Formation Top Depth:		1			
Formation End Depth:		5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835433			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006835434			
Layer:		2			
Plug From:		1			
Plug To:		3			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1006835435			
Layer:		3			
Plug From:		3			
Plug To:		12			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006835432			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006835423			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006835429			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		3			
Casing Diameter:		2			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006835430			
Layer:		1			
Slot:		10			
Screen Top Depth:		3			
Screen End Depth:		12			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006835428			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006835427			
Diameter:		8			
Depth From:		0			
Depth To:		12			
Hole Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		inch			
18	1 of 12	-/0.0	198.8 / 0.00	FCHT Holdings (Ontario) Corporation 6901-6951 Derry Road West TOWN OF MILTON ON	CPU
EBR Registry No:		013-4615	Proposal Date:		February 01, 2019
Ministry Ref. No:		0660-7T9K7Y-01	Notice Date:		February 01, 2019
Notice Type:		Instrument Proposal	Year:		2019
Company Name:					
Proponent Name:		FCHT Holdings (Ontario) Corporation			
Proponent Address:		85 Hanna avenue Suite 400 Toronto Ontario Canada M6K 3S3			
Instrument Type:		Certificate of Property Use - EPA s. 168.6			
URL:		http://www.ebr.gov.on.ca/ERS-WEB- External/displaynoticecontent.do?noticeId=MTM3MTg0&statusId=MjA5MDUx&language=en			
Location:					
6901-6951 Derry Road West TOWN OF MILTON					
18	2 of 12	-/0.0	198.8 / 0.00	FCHT Holdings (Ontario) Corporation 6901 - 6951 Derry Road West Milton ON	CPU
EBR Registry No:		012-2725	Proposal Date:		October 06, 2014
Ministry Ref. No:		0660-7T9K7Y	Notice Date:		
Notice Type:		Instrument Proposal	Year:		2014
Company Name:					
Proponent Name:					
Proponent Address:		85 Hanna avenue , Suite 400, Toronto Ontario, Canada M6K 3S3			
Instrument Type:		(EPA s. 168.6) - Certificate of Property Use			
URL:					
Location:					
6901 - 6951 Derry Road West TOWN OF MILTON					
18	3 of 12	-/0.0	198.8 / 0.00	FCHT Holdings (Ontario) Corporation 6901 - 6951 Derry Road West TOWN OF MILTON ON	CPU
EBR Registry No:		012-7884	Proposal Date:		June 14, 2016
Ministry Ref. No:			Notice Date:		June 14, 2016
Notice Type:		Instrument Proposal	Year:		2016
Company Name:					
Proponent Name:					
Proponent Address:		85 Hanna avenue , Suite 400, Toronto Ontario, Canada M6K 3S3			
Instrument Type:		FCHT Holdings (Ontario) Corporation (EPA s. 168.6) - Certificate of Property Use			
URL:					
Location:					
6901 - 6951 Derry Road West TOWN OF MILTON					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
18	4 of 12	-/0.0	198.8 / 0.00	FCHT Holdings (Ontario) Corporation 6901 - 6951 Derry Road West TOWN OF MILTON ON	CPU
EBR Registry No: 012-7884 Ministry Ref. No: 8374-966MFH Notice Type: Instrument Decision Company Name: FCHT Holdings (Ontario) Corporation Proponent Name: Proponent Address: 85 Hanna avenue , Suite 400, Toronto Ontario, Canada M6K 3S3 Instrument Type: (EPA s. 168.6) - Certificate of Property Use URL: Location: 6901 - 6951 Derry Road West TOWN OF MILTON					
18	5 of 12	-/0.0	198.8 / 0.00	FCHT Holdings (Ontario) Corporation 6901 - 6951 Derry Road West TOWN OF MILTON ON	CPU
EBR Registry No: 012-2725 Ministry Ref. No: 0660-7T9K7Y Notice Type: Instrument Decision Company Name: FCHT Holdings (Ontario) Corporation Proponent Name: Proponent Address: 85 Hanna avenue , Suite 400, Toronto Ontario, Canada M6K 3S3 Instrument Type: (EPA s. 168.6) - Certificate of Property Use URL: Location: 6901 - 6951 Derry Road West TOWN OF MILTON					
18	6 of 12	-/0.0	198.8 / 0.00	FCR Management Services LP 6901-6951 Derry Rd. West Milton ON L9T 7Y9	GEN
Generator No: ON3111717 Status: Registered Approval Years: As of Dec 2018 Contam. Facility: MHSW Facility: SIC Code: SIC Description: --Details-- Waste Code: 221 L Waste Description: Light fuels Waste Code: 241 L Waste Description: Halogenated solvents and residues					
18	7 of 12	-/0.0	198.8 / 0.00	P. Shalvardjian Drugs Ltd. 6951 DERRY ROAD WEST, BUILDING B MILTON ON L9T 7H5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON6088284 Status: Registered Approval Years: As of Dec 2018 Contam. Facility: MHSW Facility: SIC Code: SIC Description:					
PO Box No: Country: Canada Choice of Contact: Co Admin: Phone No Admin:					
--Details--					
Waste Code: 261 A Waste Description: Pharmaceuticals					
Waste Code: 312 P Waste Description: Pathological wastes					
18	8 of 12	-/0.0	198.8 / 0.00	Renu Choudhary Pharmacy Limited 6951 DERRY ROAD WEST, BUILDING B MILTON ON L9T 7H5	GEN
Generator No: ON6088284 Status: Approval Years: 2015 Contam. Facility: No MHSW Facility: No SIC Code: 446110 SIC Description: 446110					
PO Box No: Country: Canada Choice of Contact: CO_ADMIN Co Admin: NASTRAN NAJAFI-FARD Phone No Admin: 4164931220 Ext.3218					
--Details--					
Waste Code: 312 Waste Description: PATHOLOGICAL WASTES					
Waste Code: 261 Waste Description: PHARMACEUTICALS					
18	9 of 12	-/0.0	198.8 / 0.00	P. Shalvardjian Drugs Ltd. 6951 DERRY ROAD WEST, BUILDING B MILTON ON L9T 7H5	GEN
Generator No: ON6088284 Status: Approval Years: 2016 Contam. Facility: No MHSW Facility: No SIC Code: 446110 SIC Description: 446110					
PO Box No: Country: Canada Choice of Contact: CO_ADMIN Co Admin: NASTRAN NAJAFI-FARD Phone No Admin: 4164931220 Ext.3218					
--Details--					
Waste Code: 312 Waste Description: PATHOLOGICAL WASTES					
Waste Code: 261 Waste Description: PHARMACEUTICALS					
18	10 of 12	-/0.0	198.8 / 0.00	RENU CHOUDHARY PHARMACY LIMITED O/A SHOPPERS DRUG MART #1201 6951 BUILDING B DERRY RD MILTON ON L9T7H5	PES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Billing No: 078338 Trade Name: Licence No: 15023 Detail Licence No: Licence Type Code: 23 Licence Type: Limited Vendor Licence Class: 01 Licence Control: Operator No: Operator Class: Operator Type: Operator Lot: Oper Concession: Operator Box: Op Municipality: Operator Region: Operator District: Operator County: Oper Area Code: 905 Oper Phone No: 6369064 Operator Ext: Region: County: District: Lot: Concession: Post Office Box: Report Source: Legacy Licenses (Excluding TS)					
18	11 of 12	-/0.0	198.8 / 0.00	SHOPPERS DRUG MART O/A SHOPPERS DRUG MART #1201 6951 DERRY RD BLDG B MILTON ON L9T7H5	PES
Billing No: 080505 Trade Name: Licence No: 18201 Detail Licence No: Licence Type Code: 23 Licence Type: Limited Vendor Licence Class: 01 Licence Control: Operator No: Operator Class: Operator Type: Operator Lot: Oper Concession: Operator Box: Op Municipality: Operator Region: Operator District: Operator County: Oper Area Code: 905 Oper Phone No: 6369064 Operator Ext: Region: County: District: Lot: Concession: Post Office Box: Report Source: Legacy Licenses (Excluding TS)					
18	12 of 12	-/0.0	198.8 / 0.00	RENU CHOUDHARY PHARMACY LIMITED O/A SHOPPERS DRUG MART #1201 6951 BUILDING B DERRY ROAD MILTON ON L9T 7H5	PES
Billing No: Trade Name: Licence No: Detail Licence No: Licence Type Code: Licence Type: Vendor Licence Class: Licence Control: Operator No: Operator Class: Operator Type: Operator Lot: Oper Concession: Operator Box: Op Municipality: Operator Region: Operator District: Operator County: Oper Area Code: Oper Phone No: Operator Ext: Region: County: District: Lot: Concession: Post Office Box: Report Source:					
19	1 of 1	-/0.0	198.8 / 0.00	ON	WWIS
Well ID: 7210119 Data Entry Status: Yes					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date: Primary Water Use: Sec. Water Use: Final Well Status: Water Type: Casing Material: Audit No: C22121 Tag: A146717 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Data Src: Date Received: 10/29/2013 Selected Flag: Yes Abandonment Rec: Contractor: 6607 Form Version: 8 Owner: Street Name: County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1004616333 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 08-AUG-13 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: 199.43 Elevrc: Zone: 17 East83: 590995 North83: 4816458 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
20	1 of 1	-/0.0	198.8 / 0.00	lot 11 con 1 MILTON ON	WWIS
Well ID: 7292744 Construction Date: Primary Water Use: Monitoring Sec. Water Use: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z263019 Tag: A225903 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Data Entry Status: Data Src: Date Received: 8/17/2017 Selected Flag: Yes Abandonment Rec: Contractor: 7238 Form Version: 7 Owner: Street Name: 6901 DERRY RD W County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: 011 Concession: 01 Concession Name: NS Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1006712106			Elevation:	199.17
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590915
Code OB Desc:				North83:	4816568
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	28-JUL-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006835521				
Layer:	2				
Color:	7				
General Color:	RED				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	34				
Other Materials:	TILL				
Mat3:					
Other Materials:					
Formation Top Depth:	1				
Formation End Depth:	20				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006835520				
Layer:	1				
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:	0				
Formation End Depth:	1				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1006835529				
Layer:	2				
Plug From:	1				
Plug To:	9				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1006835528			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006835530			
Layer:		3			
Plug From:		9			
Plug To:		20			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006835527			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006835519			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006835524			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		10			
Casing Diameter:		2			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006835525			
Layer:		1			
Slot:		10			
Screen Top Depth:		10			
Screen End Depth:		20			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006835523			
Layer:		1			
Kind Code:		8			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind:		Untested			
Water Found Depth:		2			
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006835522			
Diameter:		8			
Depth From:		0			
Depth To:		20			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
21	1 of 6	-/0.0	199.8 / 1.00	6941 Derry Rd Milton ON L9T7H5	EHS
Order No:		20150908066		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Site Report		Client Prov/State: IL	
Report Date:		09-SEP-15		Search Radius (km): .001	
Date Received:		08-SEP-15		X: -79.872713	
Previous Site Name:				Y: 43.49662	
Lot/Building Size:					
Additional Info Ordered:					
21	2 of 6	-/0.0	199.8 / 1.00	DERRY HEIGHTS ANIMAL HOSPITAL 6941,DERRY ROAD, UNIT B5 MILTON ON L9T 7H5	GEN
Generator No:		ON4611473		PO Box No:	
Status:		Registered		Country: Canada	
Approval Years:		As of Dec 2018		Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:					
SIC Description:					
<u>--Details--</u>					
Waste Code:		261 A			
Waste Description:		Pharmaceuticals			
Waste Code:		312 P			
Waste Description:		Pathological wastes			
21	3 of 6	-/0.0	199.8 / 1.00	Hawthorne West Urgent Care 6941 Derry Rd Suite 1B Milton ON L9T 7H5	GEN
Generator No:		ON6687714		PO Box No:	
Status:		Registered		Country: Canada	
Approval Years:		As of Dec 2018		Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:					
SIC Description:					
<u>--Details--</u>					
Waste Code:		312 P			
Waste Description:		Pathological wastes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
21	4 of 6	-/0.0	199.8 / 1.00	Hawthorne West Urgent Care 6941 Derry Rd Suite 1B Milton ON L9T 7H5	GEN
Generator No: ON6687714 Status: Approval Years: 2015 Contam. Facility: No MHSW Facility: No SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS PO Box No: Country: Canada Choice of Contact: CO_OFFICIAL Co Admin: Phone No Admin:					
--Details-- Waste Code: 312 Waste Description: PATHOLOGICAL WASTES					
21	5 of 6	-/0.0	199.8 / 1.00	Hawthorne West Urgent Care 6941 Derry Rd Suite 1B Milton ON L9T 7H5	GEN
Generator No: ON6687714 Status: Approval Years: 2016 Contam. Facility: No MHSW Facility: No SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS PO Box No: Country: Canada Choice of Contact: CO_OFFICIAL Co Admin: Phone No Admin:					
--Details-- Waste Code: 312 Waste Description: PATHOLOGICAL WASTES					
21	6 of 6	-/0.0	199.8 / 1.00	Hawthorne West Urgent Care 6941 Derry Rd Suite 1B Milton ON L9T 7H5	GEN
Generator No: ON6687714 Status: Approval Years: 2014 Contam. Facility: No MHSW Facility: No SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS PO Box No: Country: Canada Choice of Contact: CO_OFFICIAL Co Admin: Phone No Admin:					
--Details-- Waste Code: 312 Waste Description: PATHOLOGICAL WASTES					
22	1 of 2	SW/0.0	198.2 / -0.65	ON	WWIS
Well ID: 7195047 Construction Date: Primary Water Use: Sec. Water Use: Data Entry Status: Yes Data Src: Date Received: 1/10/2013 Selected Flag: Yes					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status: Water Type: Casing Material: Audit No: Tag: Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:	C19354			Abandonment Rec: Contractor: Form Version: Owner: Street Name: County: Municipality: Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	7215 8 HALTON MILTON TOWN (TRAFALGAR)
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1004232943			Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	199.26 17 590950 4816480 UTM83 5 margin of error : 100 m - 300 m wwr
22	2 of 2	SW/0.0	198.2 / -0.65	ON	WWIS
Well ID: Construction Date: Primary Water Use: Sec. Water Use: Final Well Status: Water Type: Casing Material: Audit No: Tag: Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:	7202159			Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: Street Name: County: Municipality: Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	Yes 5/28/2013 Yes 7215 8 HALTON MILTON TOWN (TRAFALGAR)
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR:	1004313706			Elevation: Elevrc:	199.26

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	17
Code OB:				East83:	590950
Code OB Desc:				North83:	4816480
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	22-AUG-12			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

23	1 of 1	SW/5.4	197.8 / -1.00	ON	WWIS
Well ID:		7204187		Data Entry Status:	Yes
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	7/5/2013
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:				Abandonment Rec:	
Water Type:				Contractor:	7147
Casing Material:				Form Version:	8
Audit No:	C22644			Owner:	
Tag:				Street Name:	
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					

Bore Hole Information

Bore Hole ID:		1004394007		Elevation:	199.26
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590951
Code OB Desc:				North83:	4816472
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	29-JUN-13			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

24	1 of 1	WNW/6.0	198.8 / 0.00	Milton ON	WWIS
Well ID:		7286326		Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Test Hole			Date Received:	5/11/2017
Sec. Water Use:	Monitoring			Selected Flag:	Yes

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Monitoring and Test Hole			Abandonment Rec:	
Water Type:				Contractor:	7241
Casing Material:				Form Version:	7
Audit No:	Z254255			Owner:	
Tag:	A186584			Street Name:	570 BRONTE ST
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					

Bore Hole Information

Bore Hole ID:	1006441874	Elevation:	199.17
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590912
Code OB Desc:		North83:	4816596
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	20-APR-17	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1006670732
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	11
Most Common Material:	GRAVEL
Mat2:	28
Other Materials:	SAND
Mat3:	
Other Materials:	
Formation Top Depth:	0
Formation End Depth:	3
Formation End Depth UOM:	ft

Overburden and Bedrock Materials Interval

Formation ID:	1006670733
Layer:	2
Color:	2
General Color:	GREY
Mat1:	05
Most Common Material:	CLAY
Mat2:	06
Other Materials:	SILT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		34			
Other Materials:		TILL			
Formation Top Depth:		3			
Formation End Depth:		19			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006670743			
Layer:		3			
Plug From:		8			
Plug To:		19			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006670741			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006670742			
Layer:		2			
Plug From:		1			
Plug To:		8			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006670740			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006670731			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006670736			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		9			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1006670737			
Layer:		1			
Slot:		10			
Screen Top Depth:		9			
Screen End Depth:		19			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1006670735			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006670734			
Diameter:		2.25			
Depth From:		0			
Depth To:		19			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
25	1 of 1	NW/14.4	199.7 / 0.82	Milton ON	WWIS
Well ID:	7180499			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring and Test Hole			Date Received:	5/10/2012
Sec. Water Use:	0			Selected Flag:	Yes
Final Well Status:	Test Hole			Abandonment Rec:	
Water Type:				Contractor:	7241
Casing Material:				Form Version:	7
Audit No:	Z147156			Owner:	
Tag:	A125656			Street Name:	500 BRONTE ST
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1003757104			Elevation:	199.41
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590944
Code OB Desc:				North83:	4816649
Open Hole:				Org CS:	UTM83

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:			UTMRC:	4	
Date Completed:		19-MAR-12	UTMRC Desc:	margin of error : 30 m - 100 m	
Remarks:			Location Method:	www	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004298103			
Layer:		4			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		15.5			
Formation End Depth:		16			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004298105			
Layer:		6			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		17			
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004298102			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Other Materials:		SILT			
Mat3:					
Other Materials:					
Formation Top Depth:		12			
Formation End Depth:		15.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1004298101			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		06			
Other Materials:		SILT			
Mat3:					
Other Materials:					
Formation Top Depth:		6			
Formation End Depth:		12			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004298104			
Layer:		5			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		28			
Other Materials:		SAND			
Mat3:					
Other Materials:					
Formation Top Depth:		16			
Formation End Depth:		17			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004298100			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		6			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004298114			
Layer:		2			
Plug From:		11			
Plug To:		6			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1004298113			
Layer:		1			
Plug From:		17			
Plug To:		11			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004298115			
Layer:		3			
Plug From:		6			
Plug To:		0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004298112			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1004298099			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004298108			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		12			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1004298109			
Layer:		1			
Slot:		10			
Screen Top Depth:		12			
Screen End Depth:		17			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.75			
 <u>Water Details</u>					
Water ID:		1004298107			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:	1004298106				
Diameter:	3.25				
Depth From:	0				
Depth To:	17				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
26	1 of 1	NW/16.7	199.3 / 0.47	lot 11 con 1 Milton ON	WWIS
Well ID:	7286333		Data Entry Status:		
Construction Date:			Data Src:		
Primary Water Use:	Test Hole		Date Received:	5/11/2017	
Sec. Water Use:	Monitoring		Selected Flag:	Yes	
Final Well Status:	Monitoring and Test Hole		Abandonment Rec:		
Water Type:			Contractor:	7241	
Casing Material:			Form Version:	7	
Audit No:	Z254273		Owner:		
Tag:	A221627		Street Name:	510 BRONTE ST S	
Construction Method:			County:	HALTON	
Elevation (m):			Municipality:	MILTON TOWN (TRAFALGAR)	
Elevation Reliability:			Site Info:		
Depth to Bedrock:			Lot:	011	
Well Depth:			Concession:	01	
Overburden/Bedrock:			Concession Name:	NS	
Pump Rate:			Easting NAD83:		
Static Water Level:			Northing NAD83:		
Flowing (Y/N):			Zone:		
Flow Rate:			UTM Reliability:		
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006441935		Elevation:	199.33	
DP2BR:			Elevrc:		
Spatial Status:			Zone:	17	
Code OB:			East83:	590933	
Code OB Desc:			North83:	4816639	
Open Hole:			Org CS:	UTM83	
Cluster Kind:			UTMRC:	4	
Date Completed:	19-APR-17		UTMRC Desc:	margin of error : 30 m - 100 m	
Remarks:			Location Method:	wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006671439				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		3			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006671440			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Other Materials:		SILT			
Mat3:		34			
Other Materials:		TILL			
Formation Top Depth:		3			
Formation End Depth:		19			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006671449			
Layer:		2			
Plug From:		1			
Plug To:		8			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006671448			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006671450			
Layer:		3			
Plug From:		8			
Plug To:		19			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006671447			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID: 1006671438					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1006671443					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0					
Depth To: 9					
Casing Diameter: 1.25					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1006671444					
Layer: 1					
Slot: 10					
Screen Top Depth: 9					
Screen End Depth: 19					
Screen Material: 5					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter: 1.5					
<u>Water Details</u>					
Water ID: 1006671442					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006671441					
Diameter: 2.25					
Depth From: 0					
Depth To: 19					
Hole Depth UOM: ft					
Hole Diameter UOM: inch					
27	1 of 1	SE/17.4	198.8 / 0.00	lot 10 con 1 Milton ON	WWIS
Well ID: 7120514					
Construction Date:					
Primary Water Use: Other					
Sec. Water Use:					
Final Well Status: Abandoned-Other					
Water Type:					
Casing Material:					
Audit No: Z74893					
Tag: A057280					
Construction Method:					
Elevation (m):					
Data Entry Status:					
Data Src:					
Date Received: 3/12/2009					
Selected Flag: Yes					
Abandonment Rec: Yes					
Contractor: 7305					
Form Version: 3					
Owner:					
Street Name: 3037 DERRY ROAD WEST					
County: HALTON					
Municipality: MILTON TOWN (TRAFALGAR)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	010
Well Depth:				Concession:	01
Overburden/Bedrock:				Concession Name:	NS
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1002032340				Elevation:	199.27
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	591106
Code OB Desc:				North83:	4816475
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed: 02-MAR-09				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1002622501					
Layer: 1					
Plug From: 0					
Plug To: 4.5					
Plug Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1002622502					
Layer: 2					
Plug From: 4.5					
Plug To: 7.5					
Plug Depth UOM: m					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1002622507					
Method Construction Code: 6					
Method Construction: Boring					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1002622498					
Casing No: 0					
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1002622504			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002622505			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1002622503			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1002622500			
Diameter:					
Depth From:		0			
Depth To:		7.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>28</u>	1 of 2	E/19.9	199.8 / 1.00	R.M. OF HALTON BRONTE ST/DERRY RD. MILTON TOWN ON	CA
Certificate #:		3-0749-99-			
Application Year:		99			
Issue Date:		7/8/1999			
Approval Type:		Municipal sewage			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
28	2 of 2	E/19.9	199.8 / 1.00	R.M. OF HALTON DERRY RD./BRONTE ST./TREMAINE MILTON TOWN ON	CA
Certificate #: 7-0952-93- Application Year: 93 Issue Date: 10/29/1993 Approval Type: Municipal water Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
29	1 of 1	S/30.9	198.9 / 0.02	Milton ON	WWIS
Well ID: 7172570 Construction Date: Primary Water Use: Monitoring Sec. Water Use: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z121360 Tag: A116437 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:					
Data Entry Status: Data Src: Date Received: 11/29/2011 Selected Flag: Yes Abandonment Rec: Contractor: 6032 Form Version: 7 Owner: Street Name: HALTON County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1003614220 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 14-OCT-11 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: 199.37 Elevrc: Zone: 17 East83: 591061 North83: 4816396 Org CS: UTM83 UTMRC: 5 UTMRC Desc: margin of error : 100 m - 300 m Location Method: wwr					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1004112163			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Other Materials:		CLAY			
Mat3:		66			
Other Materials:		DENSE			
Formation Top Depth:		8			
Formation End Depth:		35			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004112164			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Other Materials:		SAND			
Mat3:		85			
Other Materials:		SOFT			
Formation Top Depth:		35			
Formation End Depth:		40			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004112162			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:		11			
Other Materials:		GRAVEL			
Mat3:		85			
Other Materials:		SOFT			
Formation Top Depth:		0			
Formation End Depth:		8			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004112172			
Layer:		2			
Plug From:		25			
Plug To:		3			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004112173			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		3			
Plug From:		3			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004112171			
Layer:		1			
Plug From:		28			
Plug To:		25			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004112174			
Layer:		4			
Plug From:		1			
Plug To:		0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004112170			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004112161			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004112167			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		30			
Depth To:		0			
Casing Diameter:		2			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1004112168			
Layer:		1			
Slot:		10			
Screen Top Depth:		40			
Screen End Depth:		30			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:	1004112166				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	ft				
<u>Hole Diameter</u>					
Hole ID:	1004112165				
Diameter:	8				
Depth From:	0				
Depth To:	40				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
30	1 of 2	E/31.6	199.8 / 1.00	3006 Derry Road West Milton ON L9T 5B5	EHS
Order No:	20110823052			Nearest Intersection:	Derry Road and Bronte Street
Status:	C			Municipality:	milton
Report Type:	Site Report			Client Prov/State:	ON
Report Date:	8/24/2011			Search Radius (km):	0.25
Date Received:	8/23/2011 3:11:49 PM			X:	-79.87214
Previous Site Name:				Y:	43.496189
Lot/Building Size:					
Additional Info Ordered:					
30	2 of 2	E/31.6	199.8 / 1.00	3006 Derry Road West MILTON ON L9T 5B5	EHS
Order No:	20090901034w			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Self Serve Instant Report			Client Prov/State:	ON
Report Date:	9/1/2009			Search Radius (km):	0.25
Date Received:	9/1/2009			X:	0
Previous Site Name:				Y:	0
Lot/Building Size:					
Additional Info Ordered:					
31	1 of 1	S/51.5	197.8 / -1.00	Milton ON	WWIS
Well ID:	7104588			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	1/14/2008
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Test Hole			Abandonment Rec:	
Water Type:				Contractor:	6607
Casing Material:				Form Version:	5
Audit No:	M00727			Owner:	
Tag:	A062526			Street Name:	DERRY RD
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:				Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
<u>Bore Hole Information</u>					
Bore Hole ID:	1002665505			Elevation:	195.72
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590796
Code OB Desc:				North83:	4816078
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	28-NOV-07			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1002665509				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	1002665508				
Method Construction Code:					
Method Construction:					
Other Method Construction:	AUGER				
<u>Pipe Information</u>					
Pipe ID:	1002665510				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1002665512				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	9.1				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1002665511			
Layer:					
Slot:					
Screen Top Depth:		9.1			
Screen End Depth:		10.6			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pump Test ID:		1002665513			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002665507			
Diameter:		15			
Depth From:					
Depth To:		10.6			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002665514			Elevation:	199.25
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590999
Code OB Desc:				North83:	4816334
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	29-NOV-07			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002665518			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer: Plug From: Plug To: Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1002665517				
Method Construction Code:					
Method Construction:					
Other Method Construction:	AUGER				
<u>Pipe Information</u>					
Pipe ID:	1002665519				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1002665521				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	9.1				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1002665520				
Layer:					
Slot:					
Screen Top Depth:	9.1				
Screen End Depth:	10.6				
Screen Material:					
Screen Depth UOM:	m				
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pump Test ID:	1002665522				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1002665516			
Diameter:		15			
Depth From:					
Depth To:		10.6			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1001582822		Elevation:	195.56	
DP2BR:			Elevrc:		
Spatial Status:			Zone:	17	
Code OB:			East83:	590791	
Code OB Desc:			North83:	4816055	
Open Hole:			Org CS:	UTM83	
Cluster Kind:			UTMRC:	3	
Date Completed:	27-NOV-07		UTMRC Desc:	margin of error : 10 - 30 m	
Remarks:			Location Method:	wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002665525			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		17			
Other Materials:		SHALE			
Mat3:		73			
Other Materials:		HARD			
Formation Top Depth:		6			
Formation End Depth:		10.6			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002665524			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		05			
Other Materials:		CLAY			
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		6			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002665527			
Layer:		1			
Plug From:		0			
Plug To:		.15			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002665528			
Layer:		2			
Plug From:		.15			
Plug To:		10			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002665532			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002665523			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002665529			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		10.6			
Casing Diameter:		1.9			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002665530			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Hole Diameter</u>					
Hole ID:		1002665526			
Diameter:		15			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0			
Depth To:		10.6			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

[32](#)

1 of 1

WNW/54.7

198.8 / 0.00

Milton ON

WWIS

Well ID: 7286325
Construction Date:
Primary Water Use: Test Hole
Sec. Water Use: Monitoring
Final Well Status: Monitoring and Test Hole
Water Type:
Casing Material:
Audit No: Z254256
Tag: A186588
Construction Method:
Elevation (m):
Elevation Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Flowing (Y/N):
Flow Rate:
Clear/Cloudy:

Data Entry Status:
Data Src:
Date Received: 5/11/2017
Selected Flag: Yes
Abandonment Rec:
Contractor: 7241
Form Version: 7
Owner:
Street Name: 570 BRONTE ST
County: HALTON
Municipality: MILTON TOWN (TRAFALGAR)
Site Info:
Lot:
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 1006441871
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 20-APR-17
Remarks:
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation: 198.87
Elevrc:
Zone: 17
East83: 590860
North83: 4816609
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Overburden and Bedrock

Materials Interval

Formation ID: 1006670676
Layer: 1
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 11
Other Materials: GRAVEL
Mat3:
Other Materials:
Formation Top Depth: 0
Formation End Depth: 3
Formation End Depth UOM: ft

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006670677			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Other Materials:		CLAY			
Mat3:		34			
Other Materials:		TILL			
Formation Top Depth:		3			
Formation End Depth:		19			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006670686			
Layer:		2			
Plug From:		1			
Plug To:		8			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006670685			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006670687			
Layer:		3			
Plug From:		8			
Plug To:		19			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006670684			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006670675			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1006670680			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		9			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006670681			
Layer:		1			
Slot:		10			
Screen Top Depth:		9			
Screen End Depth:		19			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1006670679			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006670678			
Diameter:		2.25			
Depth From:		0			
Depth To:		19			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>33</u>	1 of 1	N/62.0	199.9 / 1.06	HONEYWELL CONSUMER PRODUCTS 5100 BRONTE ST S MILTON ON L9T 2X6	SCT
Established:		1993			
Plant Size (ft²):		0			
Employment:		7			
<u>--Details--</u>					
Description:		INDUSTRIAL AND COMMERCIAL FANS AND BLOWERS AND AIR PURIFICATION EQUIPMENT			
SIC/NAICS Code:		3564			
Description:		ELECTRIC HOUSEWARES AND FANS			
SIC/NAICS Code:		3634			
<u>34</u>	1 of 1	NNW/67.6	199.9 / 1.03	500 Bronte Road South Milton ON L9T 2X6	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 20120117011 Status: C Report Type: Standard Report Report Date: 1/25/2012 11:33:52 AM Date Received: 1/17/2012 11:32:23 AM Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Milton Client Prov/State: ON Search Radius (km): 0.25 X: -79.874902 Y: 43.498625					
35	1 of 2	SSW/69.6	197.8 / -1.00	Milton ON	WWIS
Well ID: 7220158 Construction Date: Primary Water Use: Monitoring Sec. Water Use: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z185033 Tag: A161405 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:					
Data Entry Status: Data Src: Date Received: 5/12/2014 Selected Flag: Yes Abandonment Rec: Contractor: 7472 Form Version: 7 Owner: Street Name: DUNCAN LANE CN TRACKS County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1004750960 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 24-MAR-14 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: 199.08 Elevrc: Zone: 17 East83: 590947 North83: 4816359 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1005161700 Layer: 2 Color: 2 General Color: GREY Mat1: 08 Most Common Material: FINE SAND Mat2: 06 Other Materials: SILT					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		05			
Other Materials:		CLAY			
Formation Top Depth:		4.6			
Formation End Depth:		10.7			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005161701			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		08			
Other Materials:		FINE SAND			
Mat3:		11			
Other Materials:		GRAVEL			
Formation Top Depth:		10.7			
Formation End Depth:		13.7			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005161699			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		08			
Most Common Material:		FINE SAND			
Mat2:		06			
Other Materials:		SILT			
Mat3:		66			
Other Materials:		DENSE			
Formation Top Depth:		0			
Formation End Depth:		4.6			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005161709			
Layer:		2			
Plug From:		10.4			
Plug To:		13.7			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005161708			
Layer:		1			
Plug From:		0			
Plug To:		10.4			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005161707			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005161698			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005161704			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		10.7			
Casing Diameter:		5.2			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005161705			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.7			
Screen End Depth:		13.7			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.4			
<u>Water Details</u>					
Water ID:		1005161703			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005161702			
Diameter:		15			
Depth From:		0			
Depth To:		13.7			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
35	2 of 2	SSW/69.6	197.8 / -1.00	MILTON ON	WWIS
Well ID:		7261482		Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	4/14/2016
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:		Abandoned-Other		Abandonment Rec:	Yes

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type: Casing Material: Audit No: Z227579 Tag: A161405 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:				Contractor: 7472 Form Version: 7 Owner: Street Name: DUNCAN LANE/CN TRACKS County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
<u>Bore Hole Information</u>					
Bore Hole ID: 1005931196 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 17-FEB-16 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:				Elevation: 199.08 Elevrc: Zone: 17 East83: 590947 North83: 4816359 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr	
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1006029890 Layer: 1 Plug From: 0 Plug To: 13.7 Plug Depth UOM: m					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1006029889 Method Construction Code: Method Construction: Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1006029882 Casing No: 0 Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1006029887 Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006029888			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006029886			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006029884			
Diameter:		21			
Depth From:		0			
Depth To:		2			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1006029885			
Diameter:		5.2			
Depth From:		2			
Depth To:		13.7			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
36	1 of 4	ESE/74.2	198.8 / 0.00	David Meisels 6990 Derry Road, unit 107 Milton ON L9T 7H3	GEN
Generator No:		ON7826328		PO Box No:	
Status:		Registered		Country:	Canada
Approval Years:		As of Dec 2018		Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:					
SIC Description:					
<u>--Details--</u>					
Waste Code:		312 P			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Description:		Pathological wastes			
36	2 of 4	ESE/74.2	198.8 / 0.00	David Meisels 6990 Derry Road, unit 107 Milton ON L9T 7H3	GEN
Generator No:		ON7826328		PO Box No:	
Status:				Country:	
Approval Years:		2016		Choice of Contact:	
Contam. Facility:		No		Co Admin:	
MHSW Facility:		No		Phone No Admin:	
SIC Code:		621210		905-864-9954 Ext.	
SIC Description:		OFFICES OF DENTISTS			
--Details--					
Waste Code:		312			
Waste Description:		PATHOLOGICAL WASTES			
36	3 of 4	ESE/74.2	198.8 / 0.00	DERRY MEDICAL CENTRE INC. 6990 DERRY ROAD MILTON ON	GEN
Generator No:		ON4231514		PO Box No:	
Status:				Country:	
Approval Years:		2011		Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:		531120			
SIC Description:					
36	4 of 4	ESE/74.2	198.8 / 0.00	Air Separation Technologies 6990 Derry Rd Suite 204 Milton ON L9T 7H3	SCT
Established:		01-JAN-92			
Plant Size (ft²):					
Employment:					
--Details--					
Description:		Plumbing, Heating and Air-Conditioning Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		416120			
Description:		Industrial Machinery, Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417230			
37	1 of 1	NNW/78.6	199.9 / 1.03	Milton ON	WWIS
Well ID:		7180498		Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:		Monitoring and Test Hole		Date Received:	
Sec. Water Use:		0		Selected Flag:	
Final Well Status:		Test Hole		Abandonment Rec:	
Water Type:				Contractor:	
Casing Material:				Form Version:	
Audit No:		Z147157		Owner:	
Tag:		A125657		Street Name:	
				500 BRONTE ST	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:				County: Municipality: Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	HALTON MILTON TOWN (TRAFALGAR)
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1003757084 19-MAR-12			Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	199.8 17 590955 4816765 UTM83 4 margin of error : 30 m - 100 m wwr
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Other Materials: Mat3: Other Materials: Formation Top Depth: Formation End Depth: Formation End Depth UOM:	1004298085 2 2 GREY 34 TILL 06 SILT 8 12 ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Other Materials: Mat3: Other Materials: Formation Top Depth: Formation End Depth: Formation End Depth UOM:	1004298088 5 2 GREY 05 CLAY 28 SAND 16 17 ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004298084			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		8			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004298086			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Other Materials:		SILT			
Mat3:					
Other Materials:					
Formation Top Depth:		12			
Formation End Depth:		15.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004298087			
Layer:		4			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		15.5			
Formation End Depth:		16			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004298096			
Layer:		1			
Plug From:		17			
Plug To:		11			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1004298097			
Layer:		2			
Plug From:		11			
Plug To:		6			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004298098			
Layer:		3			
Plug From:		6			
Plug To:		0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1004298095			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004298083			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004298091			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		12			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1004298092			
Layer:		1			
Slot:		10			
Screen Top Depth:		12			
Screen End Depth:		17			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.75			
<u>Water Details</u>					
Water ID:		1004298090			
Layer:					
Kind Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1004298089 Diameter: 3.25 Depth From: 0 Depth To: 17 Hole Depth UOM: ft Hole Diameter UOM: inch					
38	1 of 1	NW/81.9	199.1 / 0.27	Milton ON	WWIS
Well ID: 7286334 Construction Date: Primary Water Use: Test Hole Sec. Water Use: Monitoring Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z254272 Tag: A221626 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:					
Data Entry Status: Data Src: Date Received: 5/11/2017 Selected Flag: Yes Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: Street Name: 510 BRONTE ST S County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1006441938 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 19-APR-17 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: 199.15 Elevrc: Zone: 17 East83: 590879 North83: 4816676 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1006671505 Layer: 2 Color: 2 General Color: GREY					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		06			
Most Common Material:		SILT			
Mat2:		34			
Other Materials:		TILL			
Mat3:		05			
Other Materials:		CLAY			
Formation Top Depth:		3			
Formation End Depth:		17			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006671504			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		01			
Other Materials:		FILL			
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		3			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671514			
Layer:		2			
Plug From:		1			
Plug To:		6			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671513			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671515			
Layer:		3			
Plug From:		6			
Plug To:		17			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006671512			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1006671503			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006671508			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		7			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006671509			
Layer:		1			
Slot:		10			
Screen Top Depth:		7			
Screen End Depth:		17			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1006671507			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006671506			
Diameter:		2.25			
Depth From:		0			
Depth To:		17			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

39	1 of 2	SSW/102.1	197.5 / -1.39	Milton ON	WWIS
Well ID:	7220159			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	5/12/2014
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7472
Casing Material:				Form Version:	7
Audit No:	Z185032			Owner:	
Tag:	A161404			Street Name:	DUNCAN LANE CN TRACKS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:			County: Municipality: Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1004750975 24-MAR-14 				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005161718			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		08			
Most Common Material:		FINE SAND			
Mat2:		06			
Other Materials:		SILT			
Mat3:		05			
Other Materials:		CLAY			
Formation Top Depth:		4.6			
Formation End Depth:		10.7			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005161726			
Layer:		1			
Plug From:		0			
Plug To:		10.4			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005161727			
Layer:		2			
Plug From:		10.4			
Plug To:		13.7			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005161725			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005161716			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005161722			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		10.7			
Casing Diameter:		5.2			
Casing Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005161723			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.7			
Screen End Depth:		13.7			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.4			
<u>Water Details</u>					
Water ID:		1005161721			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005161720			
Diameter:		15			
Depth From:		0			
Depth To:		13.7			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
39	2 of 2	SSW/102.1	197.5 / -1.39	MILTON ON	WWIS
Well ID:	7261481			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	4/14/2016
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Abandoned-Other			Abandonment Rec:	Yes
Water Type:				Contractor:	7472
Casing Material:				Form Version:	7
Audit No:	Z227578			Owner:	
Tag:	A161404			Street Name:	DUNCAN LANE/CN TRACKS
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1005931193			Elevation:	198.76
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590934

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	4816318
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		17-FEB-16		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006029881			
Layer:		1			
Plug From:		0			
Plug To:		13.7			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006029880			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006029873			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006029878			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006029879			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1006029877			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
 <u>Hole Diameter</u>					
Hole ID:		1006029876			
Diameter:		5.2			
Depth From:		2			
Depth To:		13.7			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
 <u>Hole Diameter</u>					
Hole ID:		1006029875			
Diameter:		21			
Depth From:		0			
Depth To:		2			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				

40	1 of 1	SSE/108.1	197.8 / -1.00	ON	WWIS
Well ID:	7269754			Data Entry Status:	Yes
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	8/23/2016
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:				Abandonment Rec:	
Water Type:				Contractor:	7215
Casing Material:				Form Version:	8
Audit No:	C27794			Owner:	
Tag:	A177017			Street Name:	
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1006225813			Elevation:	198.65
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	591123
Code OB Desc:				North83:	4816350
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	20-NOV-14			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
41	1 of 1	NNW/117.8	199.8 / 1.00	Milton ON	WWIS
Well ID: 7180497 Construction Date: Primary Water Use: Monitoring and Test Hole Sec. Water Use: 0 Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z147158 Tag: A125661 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Data Entry Status: Data Src: Date Received: 5/10/2012 Selected Flag: Yes Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: Street Name: 500 BRONTE ST County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1003757081 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 19-MAR-12 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: 199.53 Elevrc: Zone: 17 East83: 590899 North83: 4816758 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1004298071 Layer: 2 Color: 6 General Color: BROWN Mat1: 34 Most Common Material: TILL Mat2: 06 Other Materials: SILT Mat3: Other Materials: Formation Top Depth: 6 Formation End Depth: 11					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004298072			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Other Materials:		SILT			
Mat3:					
Other Materials:					
Formation Top Depth:		11			
Formation End Depth:		17			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004298070			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		6			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004298080			
Layer:		1			
Plug From:		17			
Plug To:		11			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004298081			
Layer:		2			
Plug From:		11			
Plug To:		6			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004298082			
Layer:		3			
Plug From:		6			
Plug To:		0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004298079			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004298069			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004298075			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		12			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1004298076			
Layer:		1			
Slot:		10			
Screen Top Depth:		12			
Screen End Depth:		17			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.75			
<u>Water Details</u>					
Water ID:		1004298074			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1004298073			
Diameter:		3.25			
Depth From:		0			
Depth To:		17			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
42	1 of 2	SSW/132.1	196.8 / -2.00	Milton ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7220157			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	5/12/2014
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7472
Casing Material:				Form Version:	7
Audit No:	Z185031			Owner:	
Tag:	A161403			Street Name:	DUNCAN LANE CN TRACKS
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1004750957			Elevation:	198.48
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590917
Code OB Desc:				North83:	4816292
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	24-MAR-14			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005161682				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	08				
Most Common Material:	FINE SAND				
Mat2:	06				
Other Materials:	SILT				
Mat3:	05				
Other Materials:	CLAY				
Formation Top Depth:	4.6				
Formation End Depth:	10.7				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005161683				
Layer:	3				
Color:	2				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		08			
Other Materials:		FINE SAND			
Mat3:		11			
Other Materials:		GRAVEL			
Formation Top Depth:		10.7			
Formation End Depth:		13.7			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005161681			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		08			
Most Common Material:		FINE SAND			
Mat2:		06			
Other Materials:		SILT			
Mat3:		66			
Other Materials:		DENSE			
Formation Top Depth:		0			
Formation End Depth:		4.6			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005161690			
Layer:		1			
Plug From:		0			
Plug To:		10.4			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005161691			
Layer:		2			
Plug From:		10.4			
Plug To:		13.7			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1005161689			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1005161680			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1005161686			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		10.7			
Casing Diameter:		5.2			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005161687			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.7			
Screen End Depth:		13.7			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.4			
<u>Water Details</u>					
Water ID:		1005161685			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005161684			
Diameter:		15			
Depth From:		0			
Depth To:		13.7			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

42	2 of 2	SSW/132.1	196.8 / -2.00	MILTON ON	WWIS
Well ID:	7261480			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	4/14/2016
Sec. Water Use:				Selected Flag:	Yes
Final Well Status:	Abandoned-Other			Abandonment Rec:	Yes
Water Type:				Contractor:	7472
Casing Material:				Form Version:	7
Audit No:	Z227572			Owner:	
Tag:	A161403			Street Name:	DUNCAN LANE/CN TRACKS
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Nothing NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Flowing (Y/N): Flow Rate: Clear/Cloudy:				Zone: UTM Reliability:	
<u>Bore Hole Information</u>					
Bore Hole ID:	1005931190		Elevation:	198.48	
DP2BR:			Elevrc:		
Spatial Status:			Zone:	17	
Code OB:			East83:	590917	
Code OB Desc:			North83:	4816292	
Open Hole:			Org CS:	UTM83	
Cluster Kind:			UTMRC:	4	
Date Completed:	17-FEB-16		UTMRC Desc:	margin of error : 30 m - 100 m	
Remarks:			Location Method:	wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006029872				
Layer:	1				
Plug From:	0				
Plug To:	13.7				
Plug Depth UOM:	m				
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	1006029871				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1006029864				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1006029869				
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:	cm				
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1006029870				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer: Slot: Screen Top Depth: Screen End Depth: Screen Material: Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter:					
<u>Water Details</u>					
Water ID: 1006029868 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1006029867 Diameter: 5.2 Depth From: 2 Depth To: 13.7 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1006029866 Diameter: 21 Depth From: 0 Depth To: 2 Hole Depth UOM: m Hole Diameter UOM: cm					
43	1 of 1	NW/137.2	198.9 / 0.03	Milton ON	WWIS
Well ID: 7286332 Construction Date: Primary Water Use: Test Hole Sec. Water Use: Monitoring Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z254274 Tag: A221628 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:					
Data Entry Status: Data Src: Date Received: 5/11/2017 Selected Flag: Yes Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: Street Name: 510 BRONTE ST S County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1006441932			Elevation:	199.17
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590841
Code OB Desc:				North83:	4816717
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	19-APR-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:	1006671272				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Other Materials:	GRAVEL				
Mat3:					
Other Materials:					
Formation Top Depth:	0				
Formation End Depth:	3				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:	1006671273				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	05				
Other Materials:	CLAY				
Mat3:	34				
Other Materials:	TILL				
Formation Top Depth:	3				
Formation End Depth:	17				
Formation End Depth UOM:	ft				
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:	1006671283				
Layer:	3				
Plug From:	6				
Plug To:	17				
Plug Depth UOM:	ft				
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1006671282			
Layer:		2			
Plug From:		1			
Plug To:		6			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671281			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006671280			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006671271			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006671276			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		7			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006671277			
Layer:		1			
Slot:		10			
Screen Top Depth:		7			
Screen End Depth:		17			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
 <u>Water Details</u>					
Water ID:		1006671275			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006671274			
Diameter:		2.25			
Depth From:		0			
Depth To:		17			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
44	1 of 8	ENE/147.4	199.8 / 1.00	MILTON DISTRICT HOSPITAL DERRY RD. MILTON TOWN ON	CA
Certificate #:		8-3084-85-866			
Application Year:		85			
Issue Date:		7/25/86			
Approval Type:		Industrial air			
Status:		Received in 1985, Issued in 1986			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:		ONE INCINERATOR			
Contaminants:		Hydrogen Chloride, Suspended Particulate Matter, Nitrogen Oxides, Chlorinated Dibenzo-Dioxins And -Furans			
Emission Control:					
44	2 of 8	ENE/147.4	199.8 / 1.00	MILTON DISTRICT HOSPITAL 30 DERRY RD.E., PT.LOT 10/C-2 MILTON ON	CA
Certificate #:		8-3306-98-			
Application Year:		98			
Issue Date:		8/11/1998			
Approval Type:		Industrial air			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:		REPLACEMENT ETO STERILIZER			
Contaminants:		Ethylene Oxide			
Emission Control:		Catalytic Incineration			
44	3 of 8	ENE/147.4	199.8 / 1.00	MILTON DISTRICT HOSPITAL 26-041 30 DERRY ROAD EAST MILTON ON L9T 2X5	GEN
Generator No:	ON0377400			PO Box No:	
Status:				Country:	
Approval Years:	94,95,96			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	8611				
SIC Description:		GENERAL HOSPITALS			
<u>--Details--</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Code: Waste Description: 146 OTHER SPECIFIED INORGANICS					
Waste Code: Waste Description: 213 PETROLEUM DISTILLATES					
Waste Code: Waste Description: 252 WASTE OILS & LUBRICANTS					
Waste Code: Waste Description: 312 PATHOLOGICAL WASTES					
44	4 of 8	ENE/147.4	199.8 / 1.00	MILTON DISTRICT HOSPITAL DERRY ROAD - MILTON HALTON ON L9T 2X5	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description: ON0377400 86,87,88,89,90 8611 GENERAL HOSPITALS					
PO Box No: Country: Choice of Contact: Co Admin: Phone No Admin:					
--Details-- Waste Code: Waste Description: 312 PATHOLOGICAL WASTES					
44	5 of 8	ENE/147.4	199.8 / 1.00	MILTON DISTRICT HOSPITAL 30 DERRY ROAD EAST MILTON ON L9T 2X5	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description: ON0377400 92,93,97,98,99,00,01,02,03,04,05,06,07,08 8611 GENERAL HOSPITALS					
PO Box No: Country: Choice of Contact: Co Admin: Phone No Admin:					
--Details-- Waste Code: Waste Description: 212 ALIPHATIC SOLVENTS					
Waste Code: Waste Description: 212 ALIPHATIC SOLVENTS					
Waste Code: Waste Description: 331 WASTE COMPRESSED GASES					
Waste Code: Waste Description: 251 OIL SKIMMINGS & SLUDGES					
Waste Code: Waste Description: 331 WASTE COMPRESSED GASES					
Waste Code: Waste Description: 145 PAINT/PIGMENT/COATING RESIDUES					
Waste Code: Waste Description: 112 ACID WASTE - HEAVY METALS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			
Waste Code:		261			
Waste Description:		PHARMACEUTICALS			
Waste Code:		321			
Waste Description:		EXPLOSIVE MANUFACTURING WASTES			
Waste Code:		211			
Waste Description:		AROMATIC SOLVENTS			
Waste Code:		146			
Waste Description:		OTHER SPECIFIED INORGANICS			
Waste Code:		148			
Waste Description:		INORGANIC LABORATORY CHEMICALS			
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
Waste Code:		263			
Waste Description:		ORGANIC LABORATORY CHEMICALS			
Waste Code:		312			
Waste Description:		PATHOLOGICAL WASTES			
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			
44	6 of 8	ENE/147.4	199.8 / 1.00	MILTON DISTRICT HOSPITAL (PATHOLOGICAL) 30 DERRY ROAD EAST MILTON ON L9T 2X5	GEN
Generator No:	A210313			PO Box No:	
Status:				Country:	
Approval Years:	86			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	011				
SIC Description:					
44	7 of 8	ENE/147.4	199.8 / 1.00	MILTON DISTRICT HOSPITAL (PATHOLOGICAL) 30 DERRY ROAD EAST MILTON ON L9T 2X5	REC
Rec Op Div:					
Co Admin:					
Phone No Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Rec Div: Rec Op Name: Choice of Contact: Site Bldg: Site PO Box: Receiver #: A210313 Facility Type: INCINERATION Approval Yrs: 87,88,89,90,92,93,94,95,96,97,98					
44	8 of 8	ENE/147.4	199.8 / 1.00	MILTON DISTRICT HOSPITAL 30 DERRY ROAD EAST MILTON ON L9T 2X5	REC
Rec Op Div: Co Admin: Phone No Admin: Rec Div: Rec Op Name: Choice of Contact: Site Bldg: Site PO Box: Receiver #: A210313 Facility Type: INCINERATION Approval Yrs: 99,00,01,02,03,04,05,06,07,08					
--Details-- Waste Code: 312 Waste Description: PATHOLOGICAL WASTES					
45	1 of 1	NW/162.1	199.7 / 0.83	Milton ON	WWIS
Well ID: 7286327 Construction Date: Primary Water Use: Test Hole Sec. Water Use: Monitoring Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z254254 Tag: A185577 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:					
Data Entry Status: Data Src: Date Received: 5/11/2017 Selected Flag: Yes Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: Street Name: 570 BRONTE ST County: HALTON Municipality: MILTON TOWN (TRAFALGAR) Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1006441877 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole:					
Elevation: 199.23 Elevrc: Zone: 17 East83: 590834 North83: 4816748 Org CS: UTM83					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:			UTMRC:		4
Date Completed:	20-APR-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1006670945					
Layer: 2					
Color: 2					
General Color: GREY					
Mat1: 05					
Most Common Material: CLAY					
Mat2: 06					
Other Materials: SILT					
Mat3: 34					
Other Materials: TILL					
Formation Top Depth: 3					
Formation End Depth: 22					
Formation End Depth UOM: ft					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1006670944					
Layer: 1					
Color: 6					
General Color: BROWN					
Mat1: 28					
Most Common Material: SAND					
Mat2: 11					
Other Materials: GRAVEL					
Mat3:					
Other Materials:					
Formation Top Depth: 0					
Formation End Depth: 3					
Formation End Depth UOM: ft					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID: 1006670953					
Layer: 1					
Plug From: 0					
Plug To: 1					
Plug Depth UOM: ft					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID: 1006670954					
Layer: 2					
Plug From: 1					
Plug To: 11					
Plug Depth UOM: ft					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006670955			
Layer:		3			
Plug From:		11			
Plug To:		22			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006670952			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006670943			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006670948			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		12			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006670949			
Layer:		1			
Slot:		10			
Screen Top Depth:		12			
Screen End Depth:		22			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1006670947			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006670946			
Diameter:		7.25			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0			
Depth To:		22			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
46	1 of 1	NW/171.1	198.9 / 0.00	Milton ON	WWIS
Well ID:	7286328			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Test Hole			Date Received:	5/11/2017
Sec. Water Use:	Monitoring			Selected Flag:	Yes
Final Well Status:	Monitoring and Test Hole			Abandonment Rec:	
Water Type:				Contractor:	7241
Casing Material:				Form Version:	7
Audit No:	Z254253			Owner:	
Tag:	A186366			Street Name:	510 BRONTE ST
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006441880			Elevation:	199.06
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590800
Code OB Desc:				North83:	4816720
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	20-APR-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006670976				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Other Materials:	GRAVEL				
Mat3:					
Other Materials:					
Formation Top Depth:	0				
Formation End Depth:	3				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006670978			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Other Materials:		SILT			
Mat3:		34			
Other Materials:		TILL			
Formation Top Depth:		3			
Formation End Depth:		17			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671024			
Layer:		3			
Plug From:		6			
Plug To:		17			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671021			
Layer:		2			
Plug From:		1			
Plug To:		6			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671019			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006670996			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006670971			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1006670986			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		7			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006670988			
Layer:		1			
Slot:		10			
Screen Top Depth:		7			
Screen End Depth:		17			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1006670985			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006670982			
Diameter:		2.25			
Depth From:		0			
Depth To:		17			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

47	1 of 12	E/178.4	200.0 / 1.19	Halton Healthcare Services Corporation 7030 Derry Road Milton Regional Municipality of Halton L9T 7H6 TOWN OF MILTON ON	EBR
EBR Registry No:	012-8720		Proposal Date:	September 27, 2016	
Ministry Ref. No:	8959-AD4P7M		Notice Pub Date:	February 13, 2017	
Notice Type:	Instrument Decision		Year:	2016	
Company Name:	Halton Healthcare Services Corporation				
Proponent Name:					
Proponent Address:	7030 Derry Road, Milton Ontario, Canada L9T 7H6				
Instrument Type:	(EPA Part II.1-air) - Environmental Compliance Approval (project type: air)				
Location Other:					
URL:					
Location:					
7030 Derry Road Milton Regional Municipality of Halton L9T 7H6 TOWN OF MILTON					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
47	2 of 12	E/178.4	200.0 / 1.19	Halton Healthcare Services Corporation 7030 Derry Rd Milton ON L9T 7H6	ECA
Approval No: 0492-AJ7T8T Approval Date: 2017-02-07 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Halton Approval Type: ECA-AIR Project Type: AIR Address: 7030 Derry Rd Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/8959-AD4P7M-14.pdf		MOE District: Halton-Peel City: Milton Longitude: -79.87156 Latitude: 43.496916 Geometry X: Geometry Y:			
47	3 of 12	E/178.4	200.0 / 1.19	7030 Derry Rd Milton ON L9T7H6	EHS
Order No: 20130724030 Status: C Report Type: Custom Report Report Date: 02-AUG-13 Date Received: 24-JUL-13 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.868499 Y: 43.497085			
47	4 of 12	E/178.4	200.0 / 1.19	MILTON DISTRICT HOSPITAL 7030 DERRY ROAD EAST MILTON ON	GEN
Generator No: ON0377400 Status: Approval Years: 2010 Contam. Facility: MHSW Facility: SIC Code: 621990 SIC Description: All Other Ambulatory Health Care Services		PO Box No: Country: Choice of Contact: Co Admin: Phone No Admin:			
--Details--					
Waste Code: 212					
Waste Description: ALIPHATIC SOLVENTS					
Waste Code: 122					
Waste Description: ALKALINE WASTES - OTHER METALS					
Waste Code: 252					
Waste Description: WASTE OILS & LUBRICANTS					
Waste Code: 146					
Waste Description: OTHER SPECIFIED INORGANICS					
Waste Code: 312					
Waste Description: PATHOLOGICAL WASTES					
Waste Code: 331					
Waste Description: WASTE COMPRESSED GASES					
Waste Code: 261					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Description:		PHARMACEUTICALS			
Waste Code:		145			
Waste Description:		PAINT/PIGMENT/COATING RESIDUES			
Waste Code:		211			
Waste Description:		AROMATIC SOLVENTS			
Waste Code:		263			
Waste Description:		ORGANIC LABORATORY CHEMICALS			
Waste Code:		112			
Waste Description:		ACID WASTE - HEAVY METALS			
Waste Code:		148			
Waste Description:		INORGANIC LABORATORY CHEMICALS			
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			

47

5 of 12

E/178.4

200.0 / 1.19

MILTON DISTRICT HOSPITAL
7030 DERRY ROAD
MILTON ON L9T-7H6

GEN

Generator No:

Status:

Approval Years:

Contam. Facility:

MHSW Facility:

SIC Code:

SIC Description:

ON0377400
Registered
As of Dec 2018

PO Box No:

Country:

Choice of Contact:

Co Admin:

Phone No Admin:

Canada

--Details--

Waste Code:

Waste Description:

Waste Code:

Waste Description:

Waste Code:

Waste Description:

Waste Code:

Waste Description:

Waste Code:

Waste Description:

Waste Code:

Waste Description:

Waste Code:

Waste Description:

112 C
Acid solutions - containing heavy metals
122 A
Alkaline slutions - containing other metals and non-metals (not cyanide)
122 C
Alkaline slutions - containing other metals and non-metals (not cyanide)
122 L
Alkaline slutions - containing other metals and non-metals (not cyanide)
145 H
Wastes from the use of pigments, coatings and paints
146 T
Other specified inorganic sludges, slurries or solids
148 C
Misc. wastes and inorganic chemicals
148 I
Misc. wastes and inorganic chemicals
148 R
Misc. wastes and inorganic chemicals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Code:		211 H			
Waste Description:		Aromatic solvents and residues			
Waste Code:		212 B			
Waste Description:		Aliphatic solvents and residues			
Waste Code:		212 I			
Waste Description:		Aliphatic solvents and residues			
Waste Code:		212 L			
Waste Description:		Aliphatic solvents and residues			
Waste Code:		251 L			
Waste Description:		Waste oils/sludges (petroleum based)			
Waste Code:		252 L			
Waste Description:		Waste crankcase oils and lubricants			
Waste Code:		261 A			
Waste Description:		Pharmaceuticals			
Waste Code:		262 L			
Waste Description:		Detergents and soaps			
Waste Code:		263 C			
Waste Description:		Misc. waste organic chemicals			
Waste Code:		263 I			
Waste Description:		Misc. waste organic chemicals			
Waste Code:		263 L			
Waste Description:		Misc. waste organic chemicals			
Waste Code:		312 P			
Waste Description:		Pathological wastes			
Waste Code:		331 I			
Waste Description:		Waste compressed gases including cylinders			
47	6 of 12	E/178.4	200.0 / 1.19	MILTON DISTRICT HOSPITAL 7030 DERRY ROAD MILTON ON	GEN
Generator No:	ON0377400			PO Box No:	
Status:				Country:	
Approval Years:	2013			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	621990				
SIC Description:		ALL OTHER AMBULATORY HEALTH CARE SERVICES			
--Details--					
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		145			
Waste Description:		PAINT/PIGMENT/COATING RESIDUES			
Waste Code:		146			
Waste Description:		OTHER SPECIFIED INORGANICS			
Waste Code:		331			
Waste Description:		WASTE COMPRESSED GASES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
Waste Code:		263			
Waste Description:		ORGANIC LABORATORY CHEMICALS			
Waste Code:		312			
Waste Description:		PATHOLOGICAL WASTES			
Waste Code:		211			
Waste Description:		AROMATIC SOLVENTS			
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			
Waste Code:		261			
Waste Description:		PHARMACEUTICALS			
Waste Code:		148			
Waste Description:		INORGANIC LABORATORY CHEMICALS			
Waste Code:		212			
Waste Description:		ALIPHATIC SOLVENTS			
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
Waste Code:		112			
Waste Description:		ACID WASTE - HEAVY METALS			

47	7 of 12	<i>E/178.4</i>	<i>200.0 / 1.19</i>	MILTON DISTRICT HOSPITAL 7030 DERRY ROAD MILTON ON	GEN
Generator No:	ON0377400			PO Box No:	
Status:				Country:	
Approval Years:	2012			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	621990				
SIC Description:	All Other Ambulatory Health Care Services				
--Details--					
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
Waste Code:	263				
Waste Description:	ORGANIC LABORATORY CHEMICALS				
Waste Code:	211				
Waste Description:	AROMATIC SOLVENTS				
Waste Code:	212				
Waste Description:	ALIPHATIC SOLVENTS				
Waste Code:	122				
Waste Description:	ALKALINE WASTES - OTHER METALS				
Waste Code:	148				
Waste Description:	INORGANIC LABORATORY CHEMICALS				
Waste Code:	213				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
Waste Code:		146			
Waste Description:		OTHER SPECIFIED INORGANICS			
Waste Code:		261			
Waste Description:		PHARMACEUTICALS			
Waste Code:		112			
Waste Description:		ACID WASTE - HEAVY METALS			
Waste Code:		331			
Waste Description:		WASTE COMPRESSED GASES			
Waste Code:		145			
Waste Description:		PAINT/PIGMENT/COATING RESIDUES			
Waste Code:		312			
Waste Description:		PATHOLOGICAL WASTES			

47	8 of 12	E/178.4	200.0 / 1.19	MILTON DISTRICT HOSPITAL 7030 DERRY ROAD EAST MILTON ON	GEN
Generator No:	ON0377400	PO Box No:			
Status:		Country:			
Approval Years:	2009	Choice of Contact:			
Contam. Facility:		Co Admin:			
MHSW Facility:		Phone No Admin:			
SIC Code:	621990				
SIC Description:	All Other Ambulatory Health Care Services				
<u>--Details--</u>					
Waste Code:	146				
Waste Description:	OTHER SPECIFIED INORGANICS				
Waste Code:	145				
Waste Description:	PAINT/PIGMENT/COATING RESIDUES				
Waste Code:	148				
Waste Description:	INORGANIC LABORATORY CHEMICALS				
Waste Code:	211				
Waste Description:	AROMATIC SOLVENTS				
Waste Code:	212				
Waste Description:	ALIPHATIC SOLVENTS				
Waste Code:	213				
Waste Description:	PETROLEUM DISTILLATES				
Waste Code:	251				
Waste Description:	OIL SKIMMINGS & SLUDGES				
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
Waste Code:	261				
Waste Description:	PHARMACEUTICALS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Code:		263			
Waste Description:		ORGANIC LABORATORY CHEMICALS			
Waste Code:		312			
Waste Description:		PATHOLOGICAL WASTES			
Waste Code:		331			
Waste Description:		WASTE COMPRESSED GASES			
Waste Code:		112			
Waste Description:		ACID WASTE - HEAVY METALS			
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			

47	9 of 12	E/178.4	200.0 / 1.19	MILTON DISTRICT HOSPITAL 7030 DERRY ROAD MILTON ON	GEN
Generator No:	ON0377400			PO Box No:	
Status:				Country:	
Approval Years:	2011			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	621990				
SIC Description:	All Other Ambulatory Health Care Services				
--Details--					
Waste Code:	312				
Waste Description:	PATHOLOGICAL WASTES				
Waste Code:	145				
Waste Description:	PAINT/PIGMENT/COATING RESIDUES				
Waste Code:	251				
Waste Description:	OIL SKIMMINGS & SLUDGES				
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
Waste Code:	213				
Waste Description:	PETROLEUM DISTILLATES				
Waste Code:	146				
Waste Description:	OTHER SPECIFIED INORGANICS				
Waste Code:	211				
Waste Description:	AROMATIC SOLVENTS				
Waste Code:	112				
Waste Description:	ACID WASTE - HEAVY METALS				
Waste Code:	148				
Waste Description:	INORGANIC LABORATORY CHEMICALS				
Waste Code:	261				
Waste Description:	PHARMACEUTICALS				
Waste Code:	212				
Waste Description:	ALIPHATIC SOLVENTS				
Waste Code:	331				
Waste Description:	WASTE COMPRESSED GASES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Code:		263			
Waste Description:		ORGANIC LABORATORY CHEMICALS			
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			
47	10 of 12	E/178.4	200.0 / 1.19	MILTON DISTRICT HOSPITAL 7030 DERRY ROAD MILTON ON L9T-7H6	GEN
Generator No:		ON0377400		PO Box No:	
Status:				Country: Canada	
Approval Years:		2014		Choice of Contact: CO_ADMIN	
Contam. Facility:		No		Co Admin: Nancy White	
MHSW Facility:		No		Phone No Admin: 905-878-2383 Ext.7320	
SIC Code:		621990			
SIC Description:		ALL OTHER AMBULATORY HEALTH CARE SERVICES			
--Details--					
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
Waste Code:		211			
Waste Description:		AROMATIC SOLVENTS			
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		212			
Waste Description:		ALIPHATIC SOLVENTS			
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
Waste Code:		112			
Waste Description:		ACID WASTE - HEAVY METALS			
Waste Code:		148			
Waste Description:		INORGANIC LABORATORY CHEMICALS			
Waste Code:		312			
Waste Description:		PATHOLOGICAL WASTES			
Waste Code:		145			
Waste Description:		PAINT/PIGMENT/COATING RESIDUES			
Waste Code:		146			
Waste Description:		OTHER SPECIFIED INORGANICS			
Waste Code:		261			
Waste Description:		PHARMACEUTICALS			
Waste Code:		331			
Waste Description:		WASTE COMPRESSED GASES			
Waste Code:		263			
Waste Description:		ORGANIC LABORATORY CHEMICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
47	11 of 12	E/178.4	200.0 / 1.19	MILTON DISTRICT HOSPITAL 7030 DERRY ROAD MILTON ON L9T-7H6	GEN
Generator No: ON0377400 Status: Approval Years: 2016 Contam. Facility: No MHSW Facility: No SIC Code: 621990 SIC Description: ALL OTHER AMBULATORY HEALTH CARE SERVICES PO Box No: Country: Canada Choice of Contact: CO_ADMIN Co Admin: Nancy White Phone No Admin: 905-878-2383 Ext.7320					
--Details--					
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
Waste Code:		331			
Waste Description:		WASTE COMPRESSED GASES			
Waste Code:		312			
Waste Description:		PATHOLOGICAL WASTES			
Waste Code:		261			
Waste Description:		PHARMACEUTICALS			
Waste Code:		263			
Waste Description:		ORGANIC LABORATORY CHEMICALS			
Waste Code:		122			
Waste Description:		ALKALINE WASTES - OTHER METALS			
Waste Code:		251			
Waste Description:		OIL SKIMMINGS & SLUDGES			
Waste Code:		211			
Waste Description:		AROMATIC SOLVENTS			
Waste Code:		145			
Waste Description:		PAINT/PIGMENT/COATING RESIDUES			
Waste Code:		262			
Waste Description:		DETERGENTS/SOAPS			
Waste Code:		212			
Waste Description:		ALIPHATIC SOLVENTS			
Waste Code:		148			
Waste Description:		INORGANIC LABORATORY CHEMICALS			
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		146			
Waste Description:		OTHER SPECIFIED INORGANICS			
Waste Code:		112			
Waste Description:		ACID WASTE - HEAVY METALS			
47	12 of 12	E/178.4	200.0 / 1.19	MILTON DISTRICT HOSPITAL 7030 DERRY ROAD MILTON ON L9T-7H6	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:	ON0377400			PO Box No:	
Status:				Country:	Canada
Approval Years:	2015			Choice of Contact:	CO_ADMIN
Contam. Facility:	No			Co Admin:	Nancy White
MHSW Facility:	No			Phone No Admin:	905-878-2383 Ext.7320
SIC Code:	621990				
SIC Description:	ALL OTHER AMBULATORY HEALTH CARE SERVICES				
<u>--Details--</u>					
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
Waste Code:	263				
Waste Description:	ORGANIC LABORATORY CHEMICALS				
Waste Code:	122				
Waste Description:	ALKALINE WASTES - OTHER METALS				
Waste Code:	145				
Waste Description:	PAINT/PIGMENT/COATING RESIDUES				
Waste Code:	331				
Waste Description:	WASTE COMPRESSED GASES				
Waste Code:	112				
Waste Description:	ACID WASTE - HEAVY METALS				
Waste Code:	146				
Waste Description:	OTHER SPECIFIED INORGANICS				
Waste Code:	261				
Waste Description:	PHARMACEUTICALS				
Waste Code:	213				
Waste Description:	PETROLEUM DISTILLATES				
Waste Code:	251				
Waste Description:	OIL SKIMMINGS & SLUDGES				
Waste Code:	312				
Waste Description:	PATHOLOGICAL WASTES				
Waste Code:	148				
Waste Description:	INORGANIC LABORATORY CHEMICALS				
Waste Code:	212				
Waste Description:	ALIPHATIC SOLVENTS				
Waste Code:	211				
Waste Description:	AROMATIC SOLVENTS				

48

1 of 1

WNW/181.3

198.8 / 0.00

Milton ON

WWIS

Well ID: 7286331
Construction Date:
Primary Water Use: Test Hole
Sec. Water Use: Monitoring
Final Well Status: Monitoring and Test Hole
Water Type:
Casing Material:
Audit No: Z254275
Tag: A221672

Data Entry Status:
Data Src:
Date Received: 5/11/2017
Selected Flag: Yes
Abandonment Rec:
Contractor: 7241
Form Version: 7
Owner:
Street Name: 510 BRONTE ST S

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Method:			County:	HALTON	
Elevation (m):			Municipality:	MILTON TOWN (TRAFALGAR)	
Elevation Reliability:			Site Info:		
Depth to Bedrock:			Lot:		
Well Depth:			Concession:		
Overburden/Bedrock:			Concession Name:		
Pump Rate:			Easting NAD83:		
Static Water Level:			Northing NAD83:		
Flowing (Y/N):			Zone:		
Flow Rate:			UTM Reliability:		
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006441929		Elevation:	198.98	
DP2BR:			Elevrc:		
Spatial Status:			Zone:	17	
Code OB:			East83:	590774	
Code OB Desc:			North83:	4816704	
Open Hole:			Org CS:	UTM83	
Cluster Kind:			UTMRC:	4	
Date Completed:	19-APR-17		UTMRC Desc:	margin of error : 30 m - 100 m	
Remarks:			Location Method:	wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006671196				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	06				
Other Materials:	SILT				
Mat3:	34				
Other Materials:	TILL				
Formation Top Depth:	3				
Formation End Depth:	17				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006671195				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Other Materials:	GRAVEL				
Mat3:					
Other Materials:					
Formation Top Depth:	0				
Formation End Depth:	3				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671205			
Layer:		2			
Plug From:		1			
Plug To:		6			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671206			
Layer:		3			
Plug From:		6			
Plug To:		17			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671204			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006671203			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006671194			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006671199			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		7			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006671200			
Layer:		1			
Slot:		10			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Top Depth:	7				
Screen End Depth:	17				
Screen Material:	5				
Screen Depth UOM:	ft				
Screen Diameter UOM:	inch				
Screen Diameter:	1.5				
<u>Water Details</u>					
Water ID:	1006671198				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	ft				
<u>Hole Diameter</u>					
Hole ID:	1006671197				
Diameter:	2.25				
Depth From:	0				
Depth To:	17				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
49	1 of 3	NNW/184.8	199.9 / 1.02	MyHealthCentre 480 Bronte St South Suite 212 Milton ON L9T2X6	GEN
Generator No:	ON8273972			PO Box No:	
Status:	Registered			Country:	Canada
Approval Years:	As of Dec 2018			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:					
SIC Description:					
<u>--Details--</u>					
Waste Code:	312 P				
Waste Description:	Pathological wastes				
49	2 of 3	NNW/184.8	199.9 / 1.02	MyHealthCentre 480 Bronte St South Suite 212 Milton ON L9T2X6	GEN
Generator No:	ON8273972			PO Box No:	
Status:				Country:	Canada
Approval Years:	2016			Choice of Contact:	CO_OFFICIAL
Contam. Facility:	No			Co Admin:	Purie DeSouza
MHSW Facility:	No			Phone No Admin:	905-878-8831 Ext.329
SIC Code:	621510				
SIC Description:	MEDICAL AND DIAGNOSTIC LABORATORIES				
<u>--Details--</u>					
Waste Code:	312				
Waste Description:	PATHOLOGICAL WASTES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
49	3 of 3	NNW/184.8	199.9 / 1.02	My Safari Hygiene Inc. 480 Bronte Street South Milton ON L9T9A9	GEN
Generator No: ON7317666				PO Box No:	
Status: Registered				Country: Canada	
Approval Years: As of Dec 2018				Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:					
SIC Description:					
--Details--					
Waste Code:		312 P			
Waste Description:		Pathological wastes			
50	1 of 1	SSE/188.6	197.8 / -1.00	ON	WWIS
Well ID: 7259825				Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use: Test Hole				Date Received: 3/24/2016	
Sec. Water Use:				Selected Flag: Yes	
Final Well Status: 0				Abandonment Rec: Yes	
Water Type:				Contractor: 7577	
Casing Material:				Form Version: 7	
Audit No: Z230482				Owner:	
Tag:				Street Name: 6901 DERRY RD	
Construction Method:				County: HALTON	
Elevation (m):				Municipality: MILTON TOWN (TRAFALGAR)	
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1005913063				Elevation: 197.69	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 17	
Code OB:				East83: 591102	
Code OB Desc:				North83: 4816218	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:				UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006057515			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Other Materials:					
Mat3:					
Other Materials:					
Formation Top Depth:	0				
Formation End Depth:					
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006057522			
Layer:		1			
Plug From:		0			
Plug To:		10			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006057521			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006057514			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006057518			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0			
Depth To:		1			
Casing Diameter:		10			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006057519			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1006057517			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006057516			
Diameter:		10			
Depth From:		1			
Depth To:		10			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
51	1 of 1	WNW/191.3	198.9 / 0.00	Milton ON	WWIS
Well ID:	7286330			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Test Hole			Date Received:	5/11/2017
Sec. Water Use:	Monitoring			Selected Flag:	Yes
Final Well Status:	Monitoring and Test Hole			Abandonment Rec:	
Water Type:				Contractor:	7241
Casing Material:				Form Version:	7
Audit No:	Z254276			Owner:	
Tag:	A221673			Street Name:	510 BRONTE ST S
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006441886			Elevation:	199.03
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590774
Code OB Desc:				North83:	4816720
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	19-APR-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1006671119			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Other Materials:		GRAVEL			
Mat3:					
Other Materials:					
Formation Top Depth:		0			
Formation End Depth:		3			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006671120			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Other Materials:		SILT			
Mat3:		34			
Other Materials:		TILL			
Formation Top Depth:		3			
Formation End Depth:		17			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671131			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671133			
Layer:		3			
Plug From:		6			
Plug To:		17			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671132			
Layer:		2			
Plug From:		1			
Plug To:		6			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID:		1006671130			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006671118			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006671126			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		7			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006671127			
Layer:		1			
Slot:		10			
Screen Top Depth:		7			
Screen End Depth:		17			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1006671125			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006671122			
Diameter:		2.25			
Depth From:		0			
Depth To:		17			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

52

1 of 1

NW/200.9

198.8 / 0.00

Milton ON

WWIS

Well ID: 7286329
 Construction Date:
 Primary Water Use: Test Hole
 Sec. Water Use: Monitoring

Data Entry Status:
 Data Src:
 Date Received: 5/11/2017
 Selected Flag: Yes

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Monitoring and Test Hole			Abandonment Rec:	
Water Type:				Contractor:	7241
Casing Material:				Form Version:	7
Audit No:	Z254277			Owner:	
Tag:	A221674			Street Name:	510 BRONTE ST S
Construction Method:				County:	HALTON
Elevation (m):				Municipality:	MILTON TOWN (TRAFALGAR)
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1006441883			Elevation:	199.17
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590802
Code OB Desc:				North83:	4816770
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	19-APR-17			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006671032				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Other Materials:	SAND				
Mat3:					
Other Materials:					
Formation Top Depth:	0				
Formation End Depth:	3				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006671033				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	06				
Other Materials:	SILT				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		28			
Other Materials:		SAND			
Formation Top Depth:		3			
Formation End Depth:		22			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671041			
Layer:		1			
Plug From:		0			
Plug To:		1			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671042			
Layer:		2			
Plug From:		1			
Plug To:		11			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006671043			
Layer:		3			
Plug From:		11			
Plug To:		22			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006671040			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006671031			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006671036			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0			
Depth To:		12			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1006671037			
Layer:		1			
Slot:		10			
Screen Top Depth:		12			
Screen End Depth:		22			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1006671035			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006671034			
Diameter:		2.25			
Depth From:		0			
Depth To:		22			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
53	1 of 9	NW/214.1	199.8 / 0.97	PRIME CARE FAMILY HEALTH TEAM INC. 470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	GEN
Generator No:	ON8365577			PO Box No:	
Status:				Country:	Canada
Approval Years:	2016			Choice of Contact:	CO_OFFICIAL
Contam. Facility:	No			Co Admin:	Linda Gibson
MHSW Facility:	No			Phone No Admin:	905 878 1720 Ext.230
SIC Code:	621390				
SIC Description:	OFFICES OF ALL OTHER HEALTH PRACTITIONERS				
<u>--Details--</u>					
Waste Code:	312				
Waste Description:	PATHOLOGICAL WASTES				
53	2 of 9	NW/214.1	199.8 / 0.97	PRIME CARE FAMILY HEALTH TEAM 470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	GEN
Generator No:	ON8365577			PO Box No:	
Status:				Country:	
Approval Years:	2011			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	621390				
SIC Description:	Offices of All Other Health Practitioners				
<u>--Details--</u>					
Waste Code:	312				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Description:		PATHOLOGICAL WASTES			
53	3 of 9	NW/214.1	199.8 / 0.97	LifeLabs LP 470 Bronte Street S, Suite 106 Milton ON L9T 2J4	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:		ON4920338 Registered As of Dec 2018		PO Box No: Country: Canada Choice of Contact: Co Admin: Phone No Admin:	
--Details-- Waste Code: Waste Description:		312 P Pathological wastes			
53	4 of 9	NW/214.1	199.8 / 0.97	PRIME CARE FAMILY HEALTH TEAM INC. 470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:		ON8365577 Registered As of Dec 2018		PO Box No: Country: Canada Choice of Contact: Co Admin: Phone No Admin:	
--Details-- Waste Code: Waste Description:		312 P Pathological wastes			
53	5 of 9	NW/214.1	199.8 / 0.97	PRIME CARE FAMILY HEALTH TEAM 470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:		ON8365577 2012 621390 Offices of All Other Health Practitioners		PO Box No: Country: Choice of Contact: Co Admin: Phone No Admin:	
--Details-- Waste Code: Waste Description:		312 PATHOLOGICAL WASTES			
53	6 of 9	NW/214.1	199.8 / 0.97	PRIME CARE FAMILY HEALTH TEAM INC. 470 BRONTE ST. S, UNIT 110 MILTON ON	GEN
Generator No: Status:		ON8365577		PO Box No: Country:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:	2013 621390			Choice of Contact: Co Admin: Phone No Admin: OFFICES OF ALL OTHER HEALTH PRACTITIONERS	
--Details-- Waste Code: Waste Description:		312 PATHOLOGICAL WASTES			
53	7 of 9	NW/214.1	199.8 / 0.97	PRIME CARE FAMILY HEALTH TEAM 470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:	ON8365577 2010 621390			PO Box No: Country: Choice of Contact: Co Admin: Phone No Admin: Offices of All Other Health Practitioners	
--Details-- Waste Code: Waste Description:		312 PATHOLOGICAL WASTES			
53	8 of 9	NW/214.1	199.8 / 0.97	PRIME CARE FAMILY HEALTH TEAM INC. 470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:	ON8365577 2015 No No 621390			PO Box No: Country: Canada Choice of Contact: CO_OFFICIAL Co Admin: Linda Gibson Phone No Admin: 905 878 1720 Ext.230 OFFICES OF ALL OTHER HEALTH PRACTITIONERS	
--Details-- Waste Code: Waste Description:		312 PATHOLOGICAL WASTES			
53	9 of 9	NW/214.1	199.8 / 0.97	PRIME CARE FAMILY HEALTH TEAM INC. 470 BRONTE ST. S, UNIT 110 MILTON ON L9T2J4	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:	ON8365577 2014 No No 621390			PO Box No: Country: Canada Choice of Contact: CO_OFFICIAL Co Admin: Linda Gibson Phone No Admin: 905 878 1720 Ext.230 OFFICES OF ALL OTHER HEALTH PRACTITIONERS	
--Details-- Waste Code: Waste Description:		312 PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
54	1 of 25	NW/217.2	199.8 / 0.97	Adjacent to the north of 510 Bronte Street South Milton ON L9T 2X6	EHS
Order No:	20050321002			Nearest Intersection:	Derry Road and Bronte Street South
Status:	C			Municipality:	Halton
Report Type:				Client Prov/State:	ON
Report Date:	3/29/2005			Search Radius (km):	0.25
Date Received:	3/21/2005			X:	-79.876811
Previous Site Name:				Y:	43.499166
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Title Search				
54	2 of 25	NW/217.2	199.8 / 0.97	510 Bronte St. South Milton ON L9T 2X6	EHS
Order No:	20101221038			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Site Report			Client Prov/State:	DC
Report Date:	12/22/2010			Search Radius (km):	0.25
Date Received:	12/21/2010 6:31:15 PM			X:	-79.875657
Previous Site Name:				Y:	43.498863
Lot/Building Size:					
Additional Info Ordered:					
54	3 of 25	NW/217.2	199.8 / 0.97	RELIANCE PRODUCTS DIVISION OF 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	GEN
Generator No:	ON0384200			PO Box No:	
Status:				Country:	
Approval Years:	04			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:					
SIC Description:					
54	4 of 25	NW/217.2	199.8 / 0.97	RELIANCE PRODUCTS DIVISION OF 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	GEN
Generator No:	ON0384200			PO Box No:	
Status:				Country:	
Approval Years:	99,00,01,03			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	1699				
SIC Description:	OTHER PLASTIC PROD.				
--Details--					
Waste Code:	213				
Waste Description:	PETROLEUM DISTILLATES				
Waste Code:	221				
Waste Description:	LIGHT FUELS				
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
54	5 of 25	NW/217.2	199.8 / 0.97	L.M.G. RELIANCE 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	GEN
Generator No:	ON1836900			PO Box No:	
Status:				Country:	
Approval Years:	94,95,96,97,98			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	2799				
SIC Description:	OTHER CONVERTED PAP.				
--Details--					
Waste Code:	148				
Waste Description:	INORGANIC LABORATORY CHEMICALS				
Waste Code:	263				
Waste Description:	ORGANIC LABORATORY CHEMICALS				
54	6 of 25	NW/217.2	199.8 / 0.97	Lawter International Inc. a Delaware Corporation Polymer Distribution Inc. 510 Bronte Street Milton ON L9T 3K5	GEN
Generator No:	ON7165465			PO Box No:	
Status:				Country:	
Approval Years:	05			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:					
SIC Description:					
--Details--					
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
54	7 of 25	NW/217.2	199.8 / 0.97	RELIANCE PRODUCTS DIVISION OF 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	GEN
Generator No:	ON0384200			PO Box No:	
Status:				Country:	
Approval Years:	02			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:					
SIC Description:					
54	8 of 25	NW/217.2	199.8 / 0.97	RELIANCE PRODUCTS LTD. 33-104 DIV OF LAWSON MARDON GROUP 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	GEN
Generator No:	ON0384200			PO Box No:	
Status:				Country:	
Approval Years:	94,95,96			Choice of Contact:	
Contam. Facility:				Co Admin:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility: SIC Code: SIC Description:	1699	OTHER PLASTIC PROD.		Phone No Admin:	
--Details-- Waste Code: Waste Description:		213 PETROLEUM DISTILLATES			
Waste Code: Waste Description:		221 LIGHT FUELS			
Waste Code: Waste Description:		252 WASTE OILS & LUBRICANTS			
54	9 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE ROAD SOUTH MILTON ON L9T 2X6	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:	ON0144016 02			PO Box No: Country: Choice of Contact: Co Admin: Phone No Admin:	
--Details-- Waste Code: Waste Description:		252 WASTE OILS & LUBRICANTS			
54	10 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE RD. S MILTON ON L9T 2X6	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:	ON0144016 2009 418990	All Other Wholesaler-Distributors		PO Box No: Country: Choice of Contact: Co Admin: Phone No Admin:	
--Details-- Waste Code: Waste Description:		252 WASTE OILS & LUBRICANTS			
54	11 of 25	NW/217.2	199.8 / 0.97	RELIANCE PRODUCTS LTD. 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	GEN
Generator No: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description:	ON0384200 86,87 1699	OTHER PLASTIC PROD.		PO Box No: Country: Choice of Contact: Co Admin: Phone No Admin:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		221			
Waste Description:		LIGHT FUELS			
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
54	12 of 25	NW/217.2	199.8 / 0.97	RELIANCE PRODUCTS LTD. DIV. OF LAWSON MARDON GROUP 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	GEN
Generator No:	ON0384200			PO Box No:	
Status:				Country:	
Approval Years:	92,93,97,98			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	1699				
SIC Description:		OTHER PLASTIC PROD.			
--Details--					
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		221			
Waste Description:		LIGHT FUELS			
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
54	13 of 25	NW/217.2	199.8 / 0.97	RELIANCE PRODUCTS LTD. DIV OF LAWSON MARDON GROUP 510 BRONTE STREET SOUTH MILTON ON L9T 2X6	GEN
Generator No:	ON0384200			PO Box No:	
Status:				Country:	
Approval Years:	88,89,90			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	1699				
SIC Description:		OTHER PLASTIC PROD.			
--Details--					
Waste Code:		213			
Waste Description:		PETROLEUM DISTILLATES			
Waste Code:		221			
Waste Description:		LIGHT FUELS			
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
54	14 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE RD. S	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				MILTON ON L9T 2X6	
Generator No:	ON0144016			PO Box No:	
Status:				Country:	
Approval Years:	03,04,05,06,07,08			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	418990				
SIC Description:	All Other Whl.				
--Details--					
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
54	15 of 25	NW/217.2	199.8 / 0.97	HONEY CONSUMER PRODUCTS 510 BRONTE ROAD SOUTH MILTON ON L9T 2X6	GEN
Generator No:	ON0144016			PO Box No:	
Status:				Country:	
Approval Years:	97,98,99,00,01			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	3379				
SIC Description:	OTHER ELECT. EQUIP.				
--Details--					
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
54	16 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE RD. S MILTON ON L9T 2X6	GEN
Generator No:	ON0144016			PO Box No:	
Status:				Country:	
Approval Years:	2010			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	418990				
SIC Description:	All Other Wholesaler-Distributors				
--Details--					
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
54	17 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE Street. S MILTON ON	GEN
Generator No:	ON0144016			PO Box No:	
Status:				Country:	
Approval Years:	2011			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	418990				
SIC Description:	All Other Wholesaler-Distributors				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
54	18 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE Street. S MILTON ON	GEN
Generator No:	ON0144016			PO Box No:	
Status:				Country:	
Approval Years:	2012			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	418990				
SIC Description:		All Other Wholesaler-Distributors			
--Details--					
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
54	19 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE Street South MILTON ON L9T 2X6	GEN
Generator No:	ON0144016			PO Box No:	
Status:				Country:	Canada
Approval Years:	2015			Choice of Contact:	CO_ADMIN
Contam. Facility:	No			Co Admin:	Kim N Wood
MHSW Facility:	No			Phone No Admin:	905-876-3130 Ext.4242
SIC Code:	418990				
SIC Description:		ALL OTHER WHOLESALER-DISTRIBUTORS			
--Details--					
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
54	20 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE Street South MILTON ON L9T 2X6	GEN
Generator No:	ON0144016			PO Box No:	
Status:				Country:	Canada
Approval Years:	2016			Choice of Contact:	CO_ADMIN
Contam. Facility:	No			Co Admin:	Kim N Wood
MHSW Facility:	No			Phone No Admin:	905-876-3130 Ext.4242
SIC Code:	418990				
SIC Description:		ALL OTHER WHOLESALER-DISTRIBUTORS			
--Details--					
Waste Code:		252			
Waste Description:		WASTE OILS & LUBRICANTS			
54	21 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE Street South	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MILTON ON L9T 2X6					
Generator No:	ON0144016			PO Box No:	
Status:				Country:	Canada
Approval Years:	2014			Choice of Contact:	CO_ADMIN
Contam. Facility:	No			Co Admin:	Kim N Wood
MHSW Facility:	No			Phone No Admin:	905-876-3130 Ext.242
SIC Code:	418990				
SIC Description:	ALL OTHER WHOLESALER-DISTRIBUTORS				
--Details--					
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
54	22 of 25	NW/217.2	199.8 / 0.97	KAZ CANADA INC. 510 BRONTE Street South MILTON ON	GEN
Generator No:	ON0144016			PO Box No:	
Status:				Country:	
Approval Years:	2013			Choice of Contact:	
Contam. Facility:				Co Admin:	
MHSW Facility:				Phone No Admin:	
SIC Code:	418990				
SIC Description:	ALL OTHER WHOLESALER-DISTRIBUTORS				
--Details--					
Waste Code:	252				
Waste Description:	WASTE OILS & LUBRICANTS				
54	23 of 25	NW/217.2	199.8 / 0.97	Kaz Canada Inc. 510 Bronte St S Milton ON L9T 2X6	SCT
Established:	01-JUN-02				
Plant Size (ft²):					
Employment:					
--Details--					
Description:	Plumbing, Heating and Air-Conditioning Equipment and Supplies Wholesaler-Distributors				
SIC/NAICS Code:	416120				
Description:	Electrical Wiring and Construction Supplies Wholesaler-Distributors				
SIC/NAICS Code:	416110				
54	24 of 25	NW/217.2	199.8 / 0.97	Honeywell Consumer Products (Canada) Inc. 510 Bronte St S Milton ON L9T 2X6	SCT
Established:	1993				
Plant Size (ft²):					
Employment:	7				
54	25 of 25	NW/217.2	199.8 / 0.97	HONEYWELL CONSUMER PRODUCTS 510 Bronte St S	SCT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Milton ON L9T 2X6					
Established:		1993			
Plant Size (ft²):		0			
Employment:		7			
--Details--					
Description:		Industrial and Commercial Fan and Blower and Air Purification Equipment Manufacturing			
SIC/NAICS Code:		333413			
Description:		Heating Equipment and Commercial Refrigeration Equipment Manufacturing			
SIC/NAICS Code:		333416			
Description:		Small Electrical Appliance Manufacturing			
SIC/NAICS Code:		335210			
55	1 of 1	NW/221.2	199.4 / 0.51	ADA Holding Co. Ltd. Bronte Street South, Milton, Ontario , (west side, adjacent to 510 Bronte Street ON	RSC
Reg No:	2024			Cert Date:	19-May-05
RA No:				Cert Prop Use No:	No CPU
RSC Type:				Intended Prop Use:	Commercial
Curr Property Use:	Agriculture/Other			Nm of Qual. Person:	Mr. Donald McFeely
District Office:	MILTON			Stratified (Y/N):	
Date Submitted:	28-Jul-05			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	Yes
Date Returned:				Accuracy Estimate:	6 to 10 meters
Restoration Type:				Telephone:	204-7836752
Soil Type:				Fax:	204-7839480
Criteria:				Email:	mcfeely.ada@mts.net
CPU Issued Sect 1686:	No				
Asmt Roll No:					
Prop. ID No:		24962-0090 (LT); 24962-0174 (LT); 24962-0173 (LT); 24962-0172 (LT)			
Property Municipal Address:		Bronte Street South, Milton, Ontario , (west side, adjacent to 510 Bronte Street South)			
Mailing Address:		985 POWELL AVE, WINNIPEG, MB, R3H 0H4			
Latitude & Latitude:		43.49861340N 79.87688340W (converted from UTM)			
UTM Coordinates:		NAD83 17-590800-4816800			
Consultant:					
Filing Owner:					
Legal Desc:		Pt Lt 11, Con 1 Traf NS, Pts 1 to 3, 20R16063, Milton, S/T 60685; Pt Lt 11, Con 1 NS Traf, Pts 4, 5 & 6, 20R16063, Milton. S/T 60685; Pt Lt 11, Con 1 NS Traf, Pt 1, 20R16095, Milton. T/W Ease HR389112 over Pts 2 & 3, 20R16095; Pt Lt 11, Con 1 NS Traf, Pts 2 & 3, 20R16095, Milton. S/T 60685. S/T Ease HR389112 over Pts 2 & 3, 20R16095 in fav of Pt 1, 20R16095.			
Measurement Method:		Interpolation from a map			
Applicable Standards:		Full Depth Site Conditions Standard, with Potable Ground Water, Coarse Textured Soil, for Industrial/Commercial/Community property use			
RSC PDF:					

Unplottable Summary

Total: **37** Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	HYDROGROWERS CORP.	BRONTE ST.	MILTON ON	
CA	KINGSWAY PLASTERING LIMITED	BRONTE STREET	MILTON TOWN ON	
CA	KINGSWAY PLASTERING LIMITED	BRONTE ST.	MILTON TOWN ON	
CA	BRONTE INDUSTRIAL PARK LTD.	BRONTE ST.	MILTON TOWN ON	
CA	MILTON COMMUNITY HOMES INC.	STORMWATER MANAGEM. BRONTE ST.	MILTON TOWN ON	
CA	DIBLASIO GROUP INC.-PRIVATE IND. BUILDIN	DIBLASIO SITE-BRONTE ST.	MILTON TOWN ON	
CA	MILTON COMMUNITY HOMES INC.	STORMWATER MANAGEMENT BRONTE S	MILTON TOWN ON	
CA	The Regional Municipality of Halton	Derry Road (Reg. Rd.7)	Milton ON	
CA	Petro-Canada	Derry Road	Milton ON	
CA	South Derry Developments Limited	Derry Road	Milton ON	
CA	The Regional Municipality of Halton	Derry Road (Regional Road No.7)	Milton ON	
CA	RICENBERG DEVELOPMENTS LTD.	DERRY ROAD WEST	MILTON TOWN ON	
CA	DIBLASIO GROUP INC. INDUSTRIAL BUILDING	DIBLASIO SITE/BRONTE ST.	MILTON TOWN ON	
CA	South Derry Developments Limited	Part of Lot 11, Concession 1, Township of Trafalgar	Milton ON	
CA	South Derry Developments Limited	Lots 11 and 12, Concession 1	Milton ON	
CA	LARRY SPENCER	ROTARY SQUARE BRONTE ST.	MILTON TOWN ON	

CA	Mattamy (Milton West) Limited	Hawthorne Village on the Escarpment - Phase 4B of Biason Lots 9 and 10, Concessi	Milton ON	
CA	North Derry Developments Limited	Lots 11 and 12, Concession 1	Milton ON	
CA	South Derry Developments Limited	Lots 11 and 12, Concession 1	Milton ON	
ECA	The Corporation of the Town of Milton	Bronte St	Milton ON	L9T 6Z5
ECA	Petro-Canada	Derry Road	Milton ON	L6L 6N5
ECA	Mattamy (Milton West) Limited	Hawthorne Village on the Escarpment - Phase 4B of Biason , Lots 9 and 10, Concession 1, Geographic Township of Trafalgar , Milton Town, Regional Munic	Milton ON	L6H 6M5
ECA	Mattamy (Milton West) Limited	Hawthorne Village on the Escarpment - Phase 4B of Biason , Lots 9 and 10, Concession 1, Geographic Township of Trafalgar , Milton Town, Regional Munic	Milton ON	L6H 6M5
ECA	South Derry Developments Limited	Derry Road	Milton ON	M2N 5R5
ECA	The Corporation of the Town of Milton	Bronte St Between Concession 1 and 2	Milton ON	L9T 6Z5
ECA	The Regional Municipality of Halton	Derry Road	Milton ON	L6M 3L1
ECA	The Regional Municipality of Halton	Road allowance between Lots 10 and 11, Concession 1, geographic township of Trafalgar	Milton ON	L6M 3L1
ECA	The Regional Municipality of Halton	Road allowance between Lots 10 and 11, Concession 1, geographic township of Trafalgar	Milton ON	L6M 3L1
ECA	The Regional Municipality of Halton	Road allowance between Lots 10 and 11, Concession 1, geographic township of Trafalgar	Milton ON	L6M 3L1
EHS		Derry Rd	Milton ON	
GEN	MILTON HYDRO ELECTRIC COMMISSION	DERRY ROAD, LOT 11, CONC. 1	HALTON ON	L9T 4N9
GEN	MILTON HYDRO ELECTRIC COMMISSION 25-506	DERRY ROAD, LOT 11, CONC. 1	MILTON ON	L9T 4N9
HINC		McCREADY, LOT 91 L	MILTON ON	
PRT	ERIC REID UNITED CO-OPERATIVES OF ONTARIO	TOWN OF HALTON HWY 7	ON	
WWIS		lot 11	ON	
WWIS		con 2	ON	
WWIS		lot 10	ON	

Unplottable Report

Site: HYDROGROWERS CORP.
BRONTE ST. MILTON ON

Database:
CA

Certificate #: 7-0489-85-006
Application Year: 85
Issue Date: 7/10/85
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: KINGSWAY PLASTERING LIMITED
BRONTE STREET MILTON TOWN ON

Database:
CA

Certificate #: 7-1915-87-
Application Year: 87
Issue Date: 1/12/1988
Approval Type: Municipal water
Status: Approved in 1988
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: KINGSWAY PLASTERING LIMITED
BRONTE ST. MILTON TOWN ON

Database:
CA

Certificate #: 3-2270-87-
Application Year: 87
Issue Date: 1/12/1988
Approval Type: Municipal sewage
Status: Approved in 1988
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: BRONTE INDUSTRIAL PARK LTD.
BRONTE ST. MILTON TOWN ON

Database:
CA

Certificate #: 7-1982-88-

Application Year: 88
Issue Date: 5/4/1989
Approval Type: Municipal water
Status: Approved in 1989
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MILTON COMMUNITY HOMES INC.
STORMWATER MANAGEM. BRONTE ST. MILTON TOWN ON

Database:
CA

Certificate #: 3-1444-89-
Application Year: 89
Issue Date: 8/25/1989
Approval Type: Municipal sewage
Status: Cancelled
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: DIBLASIO GROUP INC.-PRIVATE IND. BUILDIN
DIBLASIO SITE-BRONTE ST. MILTON TOWN ON

Database:
CA

Certificate #: 3-0692-90-
Application Year: 90
Issue Date: 5/10/1990
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MILTON COMMUNITY HOMES INC.
STORMWATER MANAGEMENT BRONTE S MILTON TOWN ON

Database:
CA

Certificate #: 3-1385-89-
Application Year: 89
Issue Date: 8/18/1989
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *The Regional Municipality of Halton*
 Derry Road (Reg. Rd.7) Milton ON

Database:
CA

Certificate #: 0568-76JPGU
Application Year: 2007
Issue Date: 8/30/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Petro-Canada*
 Derry Road Milton ON

Database:
CA

Certificate #: 2336-78XLMD
Application Year: 2007
Issue Date: 11/14/2007
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *South Derry Developments Limited*
 Derry Road Milton ON

Database:
CA

Certificate #: 1383-6MPSQZ
Application Year: 2006
Issue Date: 3/12/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *The Regional Municipality of Halton*
 Derry Road (Regional Road No.7) Milton ON

Database:
CA

Certificate #: 7954-82QP3Z
Application Year: 2010
Issue Date: 2/17/2010
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:

Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *RICENBERG DEVELOPMENTS LTD.
DERRY ROAD WEST MILTON TOWN ON*

Database:
CA

Certificate #: 3-0450-90-
Application Year: 90
Issue Date: 3/21/1990
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *DIBLASIO GROUP INC. INDUSTRIAL BUILDING
DIBLASIO SITE/BRONTE ST. MILTON TOWN ON*

Database:
CA

Certificate #: 7-2071-89-
Application Year: 89
Issue Date: 1/10/1990
Approval Type: Municipal water
Status: Approved in 1990
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *South Derry Developments Limited
Part of Lot 11, Concession 1, Township of Trafalgar Milton ON*

Database:
CA

Certificate #: 2978-6QXH5P
Application Year: 2006
Issue Date: 8/2/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *South Derry Developments Limited
Lots 11 and 12, Concession 1 Milton ON*

Database:
CA

Certificate #: 0270-6W3SZ9
Application Year: 2006

Issue Date: 12/20/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **LARRY SPENCER**
ROTARY SQUARE BRONTE ST. MILTON TOWN ON

Database:
CA

Certificate #: 7-0729-89-
Application Year: 89
Issue Date: 5/12/1989
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Mattamy (Milton West) Limited**
Hawthorne Village on the Escarpment - Phase 4B of Biason Lots 9 and 10, Concessi Milton ON

Database:
CA

Certificate #: 4795-7D6KLJ
Application Year: 2008
Issue Date: 4/2/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **North Derry Developments Limited**
Lots 11 and 12, Concession 1 Milton ON

Database:
CA

Certificate #: 0621-77LQ4R
Application Year: 2007
Issue Date: 10/3/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *South Derry Developments Limited*
Lots 11 and 12, Concession 1 Milton ON

Database:
CA

Certificate #: 3044-6TVMJT
Application Year: 2006
Issue Date: 9/22/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *The Corporation of the Town of Milton*
Bronte St Milton ON L9T 6Z5

Database:
ECA

Approval No: 3788-AAGNVT
Approval Date: 2016-06-02
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Address: Bronte St
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/3758-AACJMT-14.pdf>

MOE District:
City: Milton
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *Petro-Canada*
Derry Road Milton ON L6L 6N5

Database:
ECA

Approval No: 2336-78XLMD
Approval Date: 2007-11-14
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Address: Derry Road
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/3326-727TFQ-14.pdf>

MOE District:
City: Milton
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *Mattamy (Milton West) Limited*
Hawthorne Village on the Escarpment - Phase 4B of Biason , Lots 9 and 10, Concession 1, Geographic Township of Trafalgar , Milton Town, Regional Munic Milton ON L6H 6M5

Database:
ECA

Approval No: 4795-7D6KLJ
Approval Date: 2008-04-02
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Address: Hawthorne Village on the Escarpment - Phase 4B of Biason , Lots 9 and 10, Concession 1, Geographic Township of Trafalgar , Milton Town, Regional Munic
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/9963-7CQGDN-14.pdf>

MOE District:
City: Milton
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *Mattamy (Milton West) Limited*
Hawthorne Village on the Escarpment - Phase 4B of Biason , Lots 9 and 10, Concession 1, Geographic Township of
Trafalgar , Milton Town, Regional Munic Milton ON L6H 6M5

Database:
ECA

Approval No: 0061-7D6KT3
Approval Date: 2008-04-02
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Address: Hawthorne Village on the Escarpment - Phase 4B of Biason , Lots 9 and 10, Concession 1, Geographic Township of Trafalgar , Milton Town, Regional Munic

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Full Address:
Full PDF Link:

Site: *South Derry Developments Limited*
Derry Road Milton ON M2N 5R5

Database:
ECA

Approval No: 1383-6MPSQZ
Approval Date: 2006-03-12
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Address: Derry Road
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/6854-6MMQGH-14.pdf>

MOE District:
City: Milton
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *The Corporation of the Town of Milton*
Bronte St Between Concession 1 and 2 Milton ON L9T 6Z5

Database:
ECA

Approval No: 1159-B24PV9
Approval Date: 6/29/2018
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Address: Bronte St Between Concession 1 and 2
Full Address:
Full PDF Link:

MOE District:
City:
Longitude: 0
Latitude: 0
Geometry X:
Geometry Y:

Site: *The Regional Municipality of Halton*
Derry Road Milton ON L6M 3L1

Database:
ECA

Approval No: 9108-7LQKQD
Approval Date: 2008-11-27
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Address: Derry Road
Full Address:
Full PDF Link:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *The Regional Municipality of Halton*
Road allowance between Lots 10 and 11, Concession 1, geographic township of Trafalgar Milton ON L6M 3L1

Database:
ECA

Approval No: 7575-9DKL9L
Approval Date: 2013-12-18
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Address: Road allowance between Lots 10 and 11, Concession 1, geographic township of Trafalgar
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/6546-9AZP58-14.pdf>

MOE District:
City: Milton
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *The Regional Municipality of Halton*
Road allowance between Lots 10 and 11, Concession 1, geographic township of Trafalgar Milton ON L6M 3L1

Database:
ECA

Approval No: 3989-972L3A
Approval Date: 2013-04-30
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Address: Road allowance between Lots 10 and 11, Concession 1, geographic township of Trafalgar
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/6334-94QQZ2-14.pdf>

MOE District:
City: Milton
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *The Regional Municipality of Halton*
Road allowance between Lots 10 and 11, Concession 1, geographic township of Trafalgar Milton ON L6M 3L1

Database:
ECA

Approval No: 7832-98DKBL
Approval Date: 2013-08-30
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Address: Road allowance between Lots 10 and 11, Concession 1, geographic township of Trafalgar
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/0997-979P2V-14.pdf>

MOE District:
City: Milton
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *Derry Rd Milton ON*

Database:
EHS

Order No: 20120725017
Status: C
Report Type: Custom Report
Report Date: 01-AUG-12
Date Received: 25-JUL-12
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .5
X: -79.791475
Y: 1

Site: *MILTON HYDRO ELECTRIC COMMISSION*
DERRY ROAD, LOT 11, CONC. 1 HALTON ON L9T 4N9

Database:
GEN

Generator No: ON0516802
Status:
Approval Years: 88,89
Contam. Facility:
MHSW Facility:
SIC Code: 9951
SIC Description: DISINF./EXTERM. SERV

PO Box No:
Country:
Choice of Contact:
Co Admin:
Phone No Admin:

--Details--

Waste Code: 122
Waste Description: ALKALINE WASTES - OTHER METALS

Waste Code: 251
Waste Description: OIL SKIMMINGS & SLUDGES

Site: MILTON HYDRO ELECTRIC COMMISSION 25-506
DERRY ROAD, LOT 11, CONC. 1 MILTON ON L9T 4N9

Database:
GEN

Generator No: ON0516802
Status:
Approval Years: 92,93,94,95,96,97,98
Contam. Facility:
MHSW Facility:
SIC Code: 9951
SIC Description: DISINF./EXTERM. SERV

PO Box No:
Country:
Choice of Contact:
Co Admin:
Phone No Admin:

--Details--

Waste Code: 122
Waste Description: ALKALINE WASTES - OTHER METALS

Waste Code: 251
Waste Description: OIL SKIMMINGS & SLUDGES

Site: McCREADY, LOT 91 L MILTON ON

Database:
HINC

External File Num: FS INC 0807-04140
Fuel Occurrence Type: Pipeline Strike
Date of Occurrence: 7/23/2008
Fuel Type Involved: Natural Gas
Status Desc: Completed - Causal Analysis(End)
Job Type Desc: Incident/Near-Miss Occurrence (FS)
Oper. Type Involved: Construction Site (pipeline strike)
Service Interruptions: No
Property Damage: No
Fuel Life Cycle Stage: Transmission, Distribution and Transportation
Root Cause: Root Cause: Equipment/Material/Component:No Procedures:No Maintenance:No Design:No Training:No
Management:Yes Human Factors:Yes

Reported Details:
Fuel Category: Gaseous Fuel
Occurrence Type: Incident
Affiliation: Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.)
County Name: Halton
Approx. Quant. Rel:
Nearby body of water:
Enter Drainage Syst.:
Approx. Quant. Unit:
Environmental Impact:

Site: ERIC REID UNITED CO-OPERATIVES OF ONTARIO
TOWN OF HALTON HWY 7 ON

Database:
PRT

Location ID: 17826
Type: retail
Expiry Date: 1990-05-31
Capacity (L): 0
Licence #: 0000015300

Site:
 lot 11 ON

Database:
 WWIS

Well ID:	2808961	Data Entry Status:	
Construction Date:		Data Src:	1
Primary Water Use:	Domestic	Date Received:	4/1/1999
Sec. Water Use:		Selected Flag:	Yes
Final Well Status:	Water Supply	Abandonment Rec:	
Water Type:		Contractor:	3406
Casing Material:		Form Version:	1
Audit No:	195948	Owner:	
Tag:		Street Name:	
Construction Method:		County:	HALTON
Elevation (m):		Municipality:	MILTON TOWN (NASSAGAWEYA)
Elevation Reliability:		Site Info:	
Depth to Bedrock:		Lot:	011
Well Depth:		Concession:	
Overburden/Bedrock:		Concession Name:	CON
Pump Rate:		Easting NAD83:	
Static Water Level:		Northing NAD83:	
Flowing (Y/N):		Zone:	
Flow Rate:		UTM Reliability:	
Clear/Cloudy:			

Bore Hole Information

Bore Hole ID:	10155218	Elevation:	
DP2BR:	38	Elevrc:	
Spatial Status:		Zone:	17
Code OB:	r	East83:	
Code OB Desc:	Bedrock	North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	29-AUG-98	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID: 931453683
Layer: 2
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 11
Other Materials: GRAVEL
Mat3:
Other Materials:
Formation Top Depth: 11
Formation End Depth: 38
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931453684
Layer: 3
Color: 8
General Color: BLACK
Mat1: 26
Most Common Material: ROCK
Mat2: 85
Other Materials: SOFT
Mat3:
Other Materials:
Formation Top Depth: 38
Formation End Depth: 40
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931453685
Layer: 4
Color:
General Color:
Mat1: 15
Most Common Material: LIMESTONE
Mat2:
Other Materials:
Mat3:
Other Materials:
Formation Top Depth: 40
Formation End Depth: 98
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931453682
Layer: 1
Color: 7
General Color: RED
Mat1: 05
Most Common Material: CLAY
Mat2:
Other Materials:
Mat3:
Other Materials:
Formation Top Depth: 0
Formation End Depth: 11
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933140369
Layer: 1
Plug From: 0
Plug To: 40
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 962808961
Method Construction Code: 2

Method Construction: Rotary (Convent.)
Other Method Construction:

Pipe Information

Pipe ID: 10703788
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930264133
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To: 98
Casing Diameter: 6
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930264132
Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From:
Depth To: 40
Casing Diameter: 6
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pump Test ID: 992808961
Pump Set At:
Static Level: 11
Final Level After Pumping: 12
Recommended Pump Depth: 43
Pumping Rate: 5
Flowing Rate:
Recommended Pump Rate: 5
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 1
Water State After Test: CLEAR
Pumping Test Method: 1
Pumping Duration HR: 1
Pumping Duration MIN:
Flowing: N

Draw Down & Recovery

Pump Test Detail ID: 934977474
Test Type: Draw Down
Test Duration: 60
Test Level: 12
Test Level UOM: ft

Water Details

Water ID: 933613006

Layer: 2
Kind Code: 5
Kind: Not stated
Water Found Depth: 84
Water Found Depth UOM: ft

Water Details

Water ID: 933613007
Layer: 3
Kind Code: 5
Kind: Not stated
Water Found Depth: 94
Water Found Depth UOM: ft

Water Details

Water ID: 933613005
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 76
Water Found Depth UOM: ft

Site:
con 2 ON

Database:
[WWIS](#)

Well ID: 2809386
Construction Date:
Primary Water Use: Domestic
Sec. Water Use:
Final Well Status: Water Supply
Water Type:
Casing Material:
Audit No: 218063
Tag:
Construction Method:
Elevation (m):
Elevation Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Flowing (Y/N):
Flow Rate:
Clear/Cloudy:

Data Entry Status:
Data Src: 1
Date Received: 6/7/2001
Selected Flag: Yes
Abandonment Rec:
Contractor: 1737
Form Version: 1
Owner:
Street Name:
County: HALTON
Municipality: MILTON TOWN (TRAFALGAR)
Site Info:
Lot:
Concession: 02
Concession Name: DS N
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10155640
DP2BR: 15
Spatial Status:
Code OB: r
Code OB Desc: Bedrock
Open Hole:
Cluster Kind:
Date Completed: 26-FEB-01
Remarks:
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 17
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

**Overburden and Bedrock
Materials Interval**

Formation ID: 931455361
Layer: 1
Color: 6
General Color: BROWN
Mat1: 05
Most Common Material: CLAY
Mat2: 11
Other Materials: GRAVEL
Mat3: 85
Other Materials: SOFT
Formation Top Depth: 0
Formation End Depth: 15
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931455362
Layer: 2
Color: 7
General Color: RED
Mat1: 17
Most Common Material: SHALE
Mat2: 74
Other Materials: LAYERED
Mat3: 85
Other Materials: SOFT
Formation Top Depth: 15
Formation End Depth: 125
Formation End Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 962809386
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction:

Pipe Information

Pipe ID: 10704210
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930264776
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To:
Casing Diameter: 6
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930264775

Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From:
Depth To:
Casing Diameter: 6
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pump Test ID: 992809386
Pump Set At:
Static Level: 48
Final Level After Pumping: 73
Recommended Pump Depth: 120
Pumping Rate: 1
Flowing Rate:
Recommended Pump Rate: 1
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 2
Water State After Test: CLOUDY
Pumping Test Method: 1
Pumping Duration HR: 2
Pumping Duration MIN:
Flowing: N

Draw Down & Recovery

Pump Test Detail ID: 934458155
Test Type: Recovery
Test Duration: 30
Test Level: 61
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934175759
Test Type: Recovery
Test Duration: 15
Test Level: 66
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934716653
Test Type: Recovery
Test Duration: 45
Test Level: 58
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934978014
Test Type: Recovery
Test Duration: 60
Test Level: 56
Test Level UOM: ft

Water Details

Water ID: 933613575
Layer: 1

Kind Code: 1
Kind: FRESH
Water Found Depth: 96
Water Found Depth UOM: ft

Site:
lot 10 ON

Database:
[WWIS](#)

Well ID:	2808959	Data Entry Status:	
Construction Date:		Data Src:	1
Primary Water Use:	Domestic	Date Received:	4/1/1999
Sec. Water Use:		Selected Flag:	Yes
Final Well Status:	Water Supply	Abandonment Rec:	
Water Type:		Contractor:	3406
Casing Material:		Form Version:	1
Audit No:	195950	Owner:	
Tag:		Street Name:	
Construction Method:		County:	HALTON
Elevation (m):		Municipality:	MILTON TOWN (NASSAGAWEYA)
Elevation Reliability:		Site Info:	
Depth to Bedrock:		Lot:	010
Well Depth:		Concession:	
Overburden/Bedrock:		Concession Name:	CON
Pump Rate:		Easting NAD83:	
Static Water Level:		Northing NAD83:	
Flowing (Y/N):		Zone:	
Flow Rate:		UTM Reliability:	
Clear/Cloudy:			

Bore Hole Information

Bore Hole ID:	10155216	Elevation:	
DP2BR:	42	Elevrc:	
Spatial Status:		Zone:	17
Code OB:	v	East83:	
Code OB Desc:	Overburden below Bedrock	North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	30-AUG-98	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock
Materials Interval

Formation ID: 931453676
Layer: 5
Color:
General Color:
Mat1: 15
Most Common Material: LIMESTONE
Mat2:
Other Materials:
Mat3:
Other Materials:
Formation Top Depth: 54
Formation End Depth: 55
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931453672
Layer: 1
Color: 7
General Color: RED
Mat1: 05
Most Common Material: CLAY
Mat2:
Other Materials:
Mat3:
Other Materials:
Formation Top Depth: 0
Formation End Depth: 23
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931453673
Layer: 2
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2: 11
Other Materials: GRAVEL
Mat3: 74
Other Materials: LAYERED
Formation Top Depth: 23
Formation End Depth: 42
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931453678
Layer: 7
Color:
General Color:
Mat1: 15
Most Common Material: LIMESTONE
Mat2:
Other Materials:
Mat3:
Other Materials:
Formation Top Depth: 61
Formation End Depth: 124
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931453677
Layer: 6
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2:
Other Materials:
Mat3:
Other Materials:
Formation Top Depth: 55
Formation End Depth: 61
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931453675
Layer: 4
Color: 2
General Color: GREY
Mat1: 05
Most Common Material: CLAY
Mat2:
Other Materials:
Mat3:
Other Materials:
Formation Top Depth: 43
Formation End Depth: 54
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931453674
Layer: 3
Color:
General Color:
Mat1: 15
Most Common Material: LIMESTONE
Mat2:
Other Materials:
Mat3:
Other Materials:
Formation Top Depth: 42
Formation End Depth: 43
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933140367
Layer: 1
Plug From: 0
Plug To: 62
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 962808959
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction:

Pipe Information

Pipe ID: 10703786
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930264128
Layer: 1
Material: 1
Open Hole or Material: STEEL

Depth From:
Depth To: 62
Casing Diameter: 6
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930264129
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To: 124
Casing Diameter: 6
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pump Test ID: 992808959
Pump Set At:
Static Level: 14
Final Level After Pumping: 15
Recommended Pump Depth: 52
Pumping Rate: 6
Flowing Rate:
Recommended Pump Rate: 6
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 1
Water State After Test: CLEAR
Pumping Test Method: 1
Pumping Duration HR: 1
Pumping Duration MIN: 0
Flowing: N

Draw Down & Recovery

Pump Test Detail ID: 934977472
Test Type: Draw Down
Test Duration: 60
Test Level: 15
Test Level UOM: ft

Water Details

Water ID: 933613002
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 120
Water Found Depth UOM: ft

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial [AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial [AGR](#)

The Ontario Ministry of Natural Resources maintains a database of all active pits and quarries. The database provides information regarding the registered owner/operator, location name, operation type, approval type, and maximum annual tonnage.

Government Publication Date: Up to Sep 2018

Abandoned Mine Information System:

Provincial [AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Nov 2016

Anderson's Waste Disposal Sites:

Private [ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Automobile Wrecking & Supplies:

Private [AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Jan 31, 2019

Borehole:

Provincial [BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2014

Certificates of Approval:

Provincial [CA](#)

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Commercial Fuel Oil Tanks:

Provincial

CFOT

List of commercial underground fuel oil tanks made available by the Fuels Safety Program of the Technical Standards & Safety Authority (TSSA). Ontario Regulation 213/01 of the Technical Standards and Safety Act (2000) requires that all underground tanks be registered with the TSSA. Note: the Fuels Safety Division does not register waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of commercial fuel tanks in the province. The TSSA updates information in its system on an ongoing basis; this listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: Feb 28, 2017

Chemical Register:

Private

CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2019

Compressed Natural Gas Stations:

Private

CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 - Dec 2018

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial

COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial

CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Jan 2019

Certificates of Property Use:

Provincial

CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994-Feb 28, 2019

Drill Hole Database:

Provincial

DRL

The Ontario Drill Hole Database contains information on more than 113,000 percussion, overburden, sonic and diamond drill holes from assessment files on record with the department of Mines and Minerals. Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted to the MNDM. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Oct 2018

Dry Cleaning Facilities:

Federal

DRYCLEANERS

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2017

Environmental Activity and Sector Registry:

Provincial

EASR

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011-Feb 28, 2019

Environmental Registry:

Provincial

EBR

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994-Feb 28, 2019

Environmental Compliance Approval:

Provincial

ECA

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011-Feb 28, 2019

Environmental Effects Monitoring:

Federal

EEM

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

EHS

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Jan 31, 2019

Environmental Issues Inventory System:

Federal

EIIS

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Dec 31, 2016

List of TSSA Expired Facilities:

Provincial

EXP

List of facilities and tanks - for which there was once a registration - no longer registered with the Fuels Safety Program of the Technical Standards and Safety Authority (TSSA). Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc. Tanks which have been removed from the ground are included in the expired facilities inventory held by the TSSA. Notes: the Fuels Safety Division did not register private fuel underground/aboveground storage tanks prior to January of 1990, or furnace oil tanks prior to May 1, 2002; nor does the Division register waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province. The TSSA updates information in its system on an ongoing basis; this listing is hence limited by the record date provided here.

Government Publication Date: Feb 28, 2017

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government.

Government Publication Date: Jun 2000-Oct 2018

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2018

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks made available by the Fuels Safety Program of the Technical Standards & Safety Authority (TSSA). Ontario Regulation 213/01 of the Technical Standards and Safety Act (2000) requires that all underground tanks be registered with the TSSA. Notes: the Fuels Safety Division did not register private fuel underground/aboveground storage tanks prior to January of 1990, or furnace oil tanks prior to May 1, 2002; nor does the Division register waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of fuel storage tanks/tank facilities in the province. The TSSA updates information in its system on an ongoing basis; this listing is hence limited by the record date provided here.

Government Publication Date: Feb 28, 2017

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Dec 31, 2018

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Dec 2016

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

TSSA Incidents:

Provincial

INC

List of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC) and made available by the Technical Standards and Safety Authority (TSSA). Under the Technical Standards & Safety Act (2000), the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors, and equipment or appliances that use fuels. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province. The TSSA updates information in its system on an ongoing basis; this listing is hence limited by the record date provided here.

Government Publication Date: Feb 28, 2017

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the ministry compiles new and updated information. The inventory will include small and large landfills. Additionally, each year the ministry will request operators of the larger landfills complete a landfill data collection form that will be used to update LIMO and will include the following information from the previous operating year. This will include additional information such as estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills will include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Sep 30, 2017

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Environmental Penalty Annual Report:

Provincial

MISA PENALTY

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2017

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Jan 2018

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2016

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Apr 2018

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Sep 30, 2018

National Energy Board Wells:

Federal

NEBW

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

NEES

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets 'or Trends' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003*

National PCB Inventory:

Federal

NPCB

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008*

National Pollutant Release Inventory:

Federal

NPRI

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances.

Government Publication Date: 1993-May 2017

Oil and Gas Wells:

Private

OGW

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Feb 28, 2019

Ontario Oil and Gas Wells:

Provincial

OOGW

In 1998, the MNR handed over to the Ontario Oil, Gas and Salt Resources Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSRL Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database include well owner/operator, location, permit issue date, and well cap date, license No., status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provide for each well record.

Government Publication Date: 1800-May 2018

Inventory of PCB Storage Sites:

Provincial

OPCB

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013

Orders:

Provincial

ORD

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994-Feb 28, 2019

Canadian Pulp and Paper:

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks:

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial

PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: 1988-Sep 2018

TSSA Pipeline Incidents:

Provincial

PINC

List of pipeline incidents (strikes, leaks, spills) made available by the Technical Standards and Safety Authority (TSSA). Under the Technical Standards & Safety Act (2000), the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors, and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of pipeline incidents in the province. The TSSA updates information in its system on an ongoing basis; this listing is hence limited by the record date provided here.

Government Publication Date: Feb 28, 2017

Private and Retail Fuel Storage Tanks:

Provincial

PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial

PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994-Feb 28, 2019

Ontario Regulation 347 Waste Receivers Summary:

Provincial

REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-2016

Record of Site Condition:

Provincial

RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up.

RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09).

Government Publication Date: 1997-Sept 2001, Oct 2004-Jan 2019

Retail Fuel Storage Tanks:

Private

RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Jan 31, 2019

Scott's Manufacturing Directory:

Private

SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial

SPL

This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Dec 2018

Wastewater Discharger Registration Database:

Provincial

SRDS

Information under this heading is combination of the following 2 programs. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment maintained a database of all direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation; Mining; Petroleum Refining; Organic Chemicals; Inorganic Chemicals; Pulp & Paper; Metal Casting; Iron & Steel; and Quarries. All sampling information is now collected and stored within the Sample Result Data Store (SRDS).

Government Publication Date: 1990-Dec 31, 2016

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970-Aug 2018

TSSA Variances for Abandonment of Underground Storage Tanks:

Provincial

VAR

List of variances granted for abandoned tanks. Under the Technical Standards and Safety Authority (TSSA) Liquid Fuels Handling Code and Fuel Oil Code, all underground storage tanks must be removed within two years of disuse. If removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of tank variances in the province. The TSSA updates information in its system on an ongoing basis; this listing is hence limited by the record date provided here.

Government Publication Date: Feb 28, 2017

Waste Disposal Sites - MOE CA Inventory:

Provincial

[WDS](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011-Feb 28, 2019

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

[WDSH](#)

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

[WWIS](#)

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Dec 31, 2017

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX B

Regulatory Responses

From: Public Information Services
To: [Noble, Jaime](#)
Subject: RE: 19120170 Derry Road TSSA Database Search
Date: March 19, 2019 2:11:48 PM
Attachments: [image004.png](#)
[image005.png](#)
[image006.png](#)
[image002.png](#)

EXTERNAL EMAIL

Good afternoon Jaime,

Thank you for your request for confirmation of public information.

We confirm that there are no records in our database of any fuel storage tanks at the subject addresses. For a further search in our archives please complete our release of public information form found at https://www.tssa.org/en/about-tssa/release-of-public-information.aspx?_mid_=392 and email the completed form to publicinformationsservices@tssa.org or through mail along with a fee of \$56.50 (including HST) per location. The fee is payable with credit card (Visa or MasterCard) or with a Cheque made payable to TSSA.

Although TSSA believes the information provided pursuant to your request is accurate, please note that TSSA does not warrant this information in any way whatsoever.

Kind regards,

Sarah



Sarah Quibell | Public Information Agent

Facilities

345 Carlingview Drive

Toronto, Ontario M9W 6N9

Tel: +1-877-682-8772 | Fax: +1-416-231-6183 | E-Mail: squibell@tssa.org

www.tssa.org



From: Noble, Jaime <Jaime_Noble@golder.com>

Sent: March 19, 2019 2:09 PM

To: Public Information Services <publicinformationsservices@tssa.org>

Subject: 19120170 Derry Road TSSA Database Search

Good Afternoon,

May you please perform a TSSA database record search for any underground storage tanks, registered fuel tanks, outstanding instructions, incident reports, fuel oil spills or contaminations records for the following locations. We found additional information that lead us to this address:

- 6901 Derry Road, Milton, Ontario
- 6911 Derry Road, Milton, Ontario
- 6921 Derry Road, Milton, Ontario

- 6941 Derry Road, Milton, Ontario
- 6951 Derry Road, Milton, Ontario

Jaime

Jaime Noble (B.A. Hons.)

Environmental Technician

100 Scotia Court, Whitby, Ontario, Canada L1N 8Y6

T: +1 905 723 2727 | **D:** +1 (905) 723-2727 x6612 | golder.com

[LinkedIn](#) | [Facebook](#) | [Twitter](#)

Work Safe, Home Safe

This email transmission is confidential and may contain proprietary information for the exclusive use of the intended recipient. Any use, distribution or copying of this transmission, other than by the intended recipient, is strictly prohibited. If you are not the intended recipient, please notify the sender and delete all copies. Electronic media is susceptible to unauthorized modification, deterioration, and incompatibility. Accordingly, the electronic media version of any work product may not be relied upon.

Golder and the G logo are trademarks of Golder Associates Corporation

Please consider the environment before printing this email.

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

APPENDIX C

Site Photographs



Photo 1 – General view of the Site, facing southeast.



Photo 2 – Generally view of the 6941 Derry Road, facing northeast

CLIENT

First Capital Asset Management LP

CONSULTANT



YYYY-MM-DD 2020-10-02

TAKEN BY JB

CHECKED BY EH

PROJECT

6901-6951 Derry Road, Milton, Ontario

TITLE

Photographic Record

PROJECT No. 20373198

FIGURE

C1



Photo 3 – General view of the area of the former building associated with 6901 Derry Road.



Photo 4 – General view of the pad mounted transformer located on the north side of 6941 Derry Road.

CLIENT

First Capital Asset Management LP

PROJECT

6901-6951 Derry Road, Milton, Ontario

CONSULTANT



YYYY-MM-DD 2020-10-20

TAKEN BY JB

CHECKED BY EH

TITLE

Photographic Record

PROJECT No. 20373198

FIGURE

C2



Photo 5 – General view of the grease bin associated with Pho Mo located on the north side of 6941 Derry Road.



Photo 6 – General view of the cooking oil drum associated with Pita Nutso located on the north side of 6941 Derry Road.

CLIENT

First Capital Asset Management LP

CONSULTANT



YYYY-MM-DD 2020-10-02

TAKEN BY JB

CHECKED BY EH

PROJECT

6901-6951 Derry Road, Milton, Ontario

TITLE

Photographic Record

PROJECT No. 20373198

FIGURE

C3



Photo 7 – View of the hydraulic oil reservoir associated with the elevator located in the building at 6941 Derry Road.



Photo 8 – View of the x-ray equipment in Derry Road Animal Clinic located in 6941 Derry Road West

CLIENT

First Capital Asset Management LP

PROJECT

6901-6951 Derry Road, Milton, Ontario

CONSULTANT



YYYY-MM-DD 2020-10-02

TAKEN BY JB

CHECKED BY EH

TITLE

Photographic Record

PROJECT No. 20373198

FIGURE

C4



Photo 9 – View facing south of the Site, taken from the southeast portion of the Site.



Photo 10 – View facing north of the Site, taken from the northeast portion of the Site.

CLIENT

First Capital Asset Management LP

CONSULTANT



YYYY-MM-DD 2020-10-20

TAKEN BY JB

CHECKED BY EH

PROJECT

6901-6951 Derry Road, Milton, Ontario

TITLE

Photographic Record

PROJECT No. 20373198

FIGURE

C5



golder.com