

PROJECT NO.: SM 220141-E

MAY 26, 2023

**PHASE ONE ENVIRONMENTAL SITE ASSESSMENT
388 MAIN STREET EAST, 395-409 PEARL STREET & 17 PRINCE STREET
MILTON, ONTARIO**

PREPARED FOR:

MIKMADA HOMES



BY

**SOIL-MAT ENGINEERS & CONSULTANTS LTD.
401 GRAYS ROAD
HAMILTON, ONTARIO
L8E 2Z3**

PROJECT NO.: SM 220141-E



MAY 26, 2023

**PHASE ONE ENVIRONMENTAL SITE ASSESSMENT
388 MAIN STREET EAST, 395-409 PEARL STREET & 17 PRINCE STREET
MILTON, ONTARIO**

PREPARED FOR:

MIKMADA HOMES

BY

**SOIL-MAT ENGINEERS & CONSULTANTS LTD.
401 GRAYS ROAD
HAMILTON, ONTARIO
L8E 2Z3**

1.0 EXECUTIVE SUMMARY

The Phase One Environmental Site Assessment [ESA] conducted for this property consisted of a historical records review, interviews and a reconnaissance of the Phase One Property. The research and reporting were conducted in accordance with Ontario Regulation 153/04 [as amended] in order to support the future filing of a Record of Site Condition [RSC] for the Phase One Property.

At the time of this Report, the Phase One Property was comprised of six [6] adjoining parcels of land that together form an irregular shaped parcel of land located on the south side of Main Street East between Prince Street and Bruce Street in the Town of Milton, Ontario. Specifically, the Phase One Property was comprised of the following parcels of land:

- 388 Main Street East: This portion of the Phase One Property was occupied by a two-storey, basementless, five [5] unit, mixed commercial and residential building. The building was occupied by the following tenants:
 - Slessor Quality Automobiles / Right Choice Auto Sales, who also occupy the storage unit on the southwestern portion of the building;
 - An apartment unit [Unit 1];
 - The World of My Baby (WOMB) [Unit 2];
 - An apartment unit [Unit 3], and;
 - Golden Fish and Chips / Sushi Yama [Unit 4].
- 17 Prince Street: This portion of the Phase One Property was occupied by a 1^{1/2}-storey dwelling, with a basement level, and a single-storey, basementless, attached garage located immediately east of the dwelling;
- 395 Pearl Street: This portion of the Phase One Property was occupied by a 1^{1/2}-storey, basementless, dwelling;
- 399 Pearl Street: This portion of the Phase One Property was occupied by a 1^{1/2}-storey dwelling, with a basement level;
- 405 Pearl Street: This portion of the Phase One Property was occupied by a single-storey, basementless, dwelling, and;
- 409 Pearl Street: This portion of the Phase One Property was occupied by a single-storey, basementless, dwelling.

The remainder of the Phase One Property was comprised of a mixture of an asphaltic-concrete covered parking lot areas and landscaped yard areas.

The Phase One research revealed four [4] potentially contaminating activities [PCAs] on the Phase One Property, including the following:

- Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the '17 Prince Street' portion of the Phase One Property;
- Information contained in the Vernon City Directory Series, and the title search of the Phase One Property, revealed a commercial automotive repair facility formerly operated on the '388 Main Street East' portion of the Phase One Property. Of note, this was also confirmed via an interview with Mr. Laffin [Property Manager for the Phase One Property];

- Information provided by Mr. Laffin revealed an underground storage tank [UST] was formerly located immediately north of the dwelling on the '405 Pearl Street' portion of the Phase One Property, and;
- Information contained in available aerial photographs, topographic maps, and a Fire Insurance Plan from 1927 revealed three [3] buildings were demolished on the '388 Main Street East' portion of the Phase One Property, including on each on the western, northern and eastern portion of this property.

The neighbouring and nearby lands are comprised of a mixture of residential, commercial, and institutional use lands. The current and historic operations on properties located in the Phase One Study Area revealed six [6] PCAs that are considered likely to cause an area of potential environmental concern [APEC] on the Phase One Property, including the following:

- Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the property recognised as '409 Main Street East', which is located approximately 15 metres northwest [up-gradient] of the Phase One Property;
- Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the property recognised as '420 Main Street East', which is located approximately 10 metres northeast [up-gradient] of the Phase One Property;
- Information contained in the EcoLog ERIS database search revealed fuel storage tanks on the property recognised as '383 Main Street East', which is located approximately 55 metres northwest [up-gradient] of the Phase One Property;
- Information contained in the Vernon City Directory Series revealed a print shop formerly operated on the property recognised as '361 Main Street East', which is located approximately 50 metres west-southwest [trans-gradient/down-gradient] of the Phase One Property;
- Our visual observations of the Phase One Study Area revealed an active print shop on the property recognised as '357 Main Street East', which is located approximately 55 metres southwest [trans-gradient/down-gradient] of the Phase One Property, and;
- Information contained in the aerial photographs, an acknowledged Record of Site Condition [RSC ID# 79919], and the EcoLog ERIS database search revealed a paperboard container manufacturing facility that formerly operated on the property recognised as '383 Main Street East', which is located approximately 55 metres northwest [up-gradient] of the Phase One Property.

The specific PCAs, and associated APECs, in connection with the above identified environmental concerns include the following:

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Locations of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC #1	The historic automotive repair facility on the '17 Prince Street' portion of the Phase One Property.	10. Commercial Autobody Shop [PCA A]	On-Site	Metals, Petroleum Hydrocarbons [PHCs], Volatile Organic Compounds [VOCs], Polycyclic Aromatic Hydrocarbons [PAHs], Polychlorinated Biphenyls [PCBs] and Benzene, Toluene, Ethylbenzene and Xylenes [BTEX]	Soil and Groundwater
APEC #2	The historic automotive repair facility on the '388 Main Street East' portion of the Phase One Property.	10. Commercial Autobody Shop [PCA B]	On-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater
APEC #3	To the north of the dwelling on the '405 Pearl Street' portion of the Phase One Property.	28. Gasoline and Associated Products Storage in Fixed Tanks [PCA C]	On-Site	PHCs, PAHs and BTEX	Soil and Groundwater
APEC #4	In the immediate vicinity of the three [3] former structures on the '388 Main Street East' portion of the Phase One Property.	30. Importation of Fill Material of Unknown Quality [PCA D]	On-Site	Metals, PHCs and BTEX	Soil
APEC #5	The northeastern limit of the Phase One Property.	10. Commercial Autobody Shop [PCA E]	Off-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater
APEC #6	The eastern limit of the Phase One Property.	10. Commercial Autobody Shop [PCA F]	Off-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Locations of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC #7	The northern limit of the Phase One Property.	28. Gasoline and Associated Products Storage in Fixed Tanks [PCA G]	Off-Site	PHCs, PAHs, and BTEX	Soil and Groundwater
APEC #8	The western limit of the Phase One Property.	31. Ink Manufacturing, Processing and Bulk Storage [PCA H]	Off-Site	Metals, PHCs, VOCs, and BTEX.	Soil
APEC #9	The western limit of the Phase One Property.	31. Ink Manufacturing, Processing and Bulk Storage [PCA I]	Off-Site	Metals, PHCs, VOCs, and BTEX.	Soil
APEC #10	The northern limit of the Phase One Property.	45. Pulp, Paper, and Paperboard Manufacturing and Processing [PCA J]	Off-Site	Metals, VOCs, PHCs and PAHs.	Soil and Groundwater

Based on the findings of the Phase One Environmental Site Assessment, SOIL-MAT ENGINEERS & CONSULTANTS LTD. find the potential of Site contamination to be considered **MEDIUM** and therefore recommend that additional investigations **ARE** required at this time.

To reduce SOIL-MAT ENGINEERS' degree of uncertainty associated with the identified PCAs, and associated APECs, further assessment activities are recommended.

Each potential environmental liability, and our rationale for further assessment activities, is provided in table format below:

Area of Potential Environmental Concern	Environmental Liability	Recommendation	Rationale
APEC #1	1. PCA No.: 10: Commercial Autobody Shop [PCA A]	Advance two [2] to four [4] boreholes, each equipped with a groundwater monitoring well, inside and in the vicinity of the garage at 17 Prince Street. The contaminants of potential concern [COPCs] should include Metals, PHCs, VOCs, PAHs, and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the 17 Prince Street property.
APEC #2	2. PCA No.: 10: Commercial Autobody Shop [PCA B]	Advance two [2] to four [4] boreholes, each equipped with a groundwater monitoring well, in the vicinity of the former automotive repair facility on the 388 Main Street portion of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, PAHs, and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the 388 Main Street East property.
APEC #3	3. PCA No.: 28: Gasoline and Associated Products Storage in Fixed Tanks [PCA C]	Advance two [2] boreholes, each equipped with a groundwater monitoring well, north of the building on the 405 Pearl Street portion of the Phase One Property. The COPCs should include PHCs and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the former UST on the 405 Pearl Street portion of the Phase One Property.
APEC #4	4. PCA No.: 30: Importation of Fill Material of Unknown Quality [PCA D]	Advance a series of boreholes in the immediate vicinity of the former buildings on the 388 Main Street East portion of the Phase One Property. The COPCs should include Metals, PHCs and BTEX.	Assess the potential of adverse impacts to the soil medium as a result of the three [3] former buildings on the 388 Main Street East portion of the Phase One Property.
APEC #5	5. PCA No.: 10: Commercial Autobody Shop [PCA E]	Advance three [3] boreholes, each equipped with a groundwater monitoring well, along the northeastern limit of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, PAHs, and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the nearby 409 Main Street East property.
APEC #6	6. PCA No.: 10: Commercial Autobody Shop [PCA F]	Advance three [3] boreholes, each equipped with a groundwater monitoring well, along the eastern limit of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, PAHs, and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the nearby 420 Main Street East property.

Area of Potential Environmental Concern	Environmental Liability	Recommendation	Rationale
APEC #7	7. PCA No.: 28: Gasoline and Associated Products Storage in Fixed Tanks [PCA G]	Advance three [3] boreholes, each equipped with a groundwater monitoring well, along the northern limit of the Phase One Property. The COPCs should include PHCs and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the fuel storage tanks on the nearby 383 Main Street East property.
APEC #8	8. PCA No.: 31: Ink Manufacturing, Processing and Bulk Storage [PCA H]	Advance three [3] boreholes along the western limit of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, and BTEX.	Assess the potential of adverse impacts to the soil medium as a result of the historical operations on the nearby 361 Main Street East property.
APEC #9	9. PCA No.: 31: Ink Manufacturing, Processing and Bulk Storage [PCA I]	Advance three [3] boreholes along the western limit of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, and BTEX.	Assess the potential of adverse impacts to the soil medium as a result of the current operations on the nearby 357 Main Street East property.
APEC #10	10. PCA No.: 45: Pulp, Paper, and Paperboard Manufacturing and Processing [PCA J]	Advance three [3] boreholes, each equipped with a groundwater monitoring well, along the northern limit of the Phase One Property. The COPCs should include Metals, PHCs, and PAHs.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the nearby 383 Main Street East property.

Although not considered an environmental liability to the Site, given the construction date of the buildings, it is possible that designated substances, such as asbestos containing materials, and ozone depleting substances, may be present in the buildings. As such, it is recommended that a non-intrusive designated substance survey of the buildings be undertaken before any planned demolition activities that may disturb building materials to identify where possible, designated substances that may be present in the buildings.

In addition to the above, this Office should be contacted if a suspected groundwater well is encountered during future construction activities to make arrangements for the water well to be abandoned as per Ontario Regulation 903 – Water Wells.

2.0 INTRODUCTION

MIKMADA HOMES retained SOIL-MAT ENGINEERS & CONSULTANTS LTD. [SOIL-MAT ENGINEERS] to conduct a Phase One Environmental Site Assessment for the group of properties recognised with the municipal addresses of '388 Main Street East', '17 Prince Street' and '395 to 409 Pearl Street' in the Town of Milton, Ontario. Of note, the Phase One ESA research and reporting were conducted in accordance with Ontario Regulation 153/04 [as amended] in order to support the future filing of a Record of Site Condition for the Phase One Property.

For the purpose of this Report, the lands subject to the specific Phase One ESA research are hereinafter referred to as the Phase One Property and/or the 'Site'.

2(a) PHASE ONE PROPERTY INFORMATION

The Phase One Property is comprised of the following parcels of land:

1. 388 Main Street East, Milton, Ontario. The property identification number [PIN] is '24954-0139'. The registered owner of the Site is Slessor Motors (Milton) Inc.;
2. 17 Prince Street, Milton, Ontario. The PIN is '24954-0140'. The registered owner of the Site is Beverly Allan Slessor;
3. 395 Pearl Street, Milton, Ontario. The PIN is '24954-0142'. The registered owner of the Site is Kim Slessor;
4. 399 Pearl Street, Milton, Ontario. The PIN is '24954-0143'. The registered owner of the Site is Milton Motor Sales Limited;
5. 405 Pearl Street, Milton, Ontario. The PIN is '24954-0144'. The registered owner of the Site is Beverly Allan Slessor, and;
6. 409 Pearl Street, Milton, Ontario. The PIN is '24954-0145'. The registered owner of the Site is Beverly Slessor.

At the time of this Report, the Phase One Property was comprised of six [6] adjoining parcels of land that together form an irregular shaped parcel of land located on the south side of Main Street East between Prince Street and Bruce Street in the Town of Milton, Ontario. Specifically, the Phase One Property was comprised of the following parcels of land:

- 388 Main Street East: This portion of the Phase One Property was occupied by a two-storey, basementless, five [5] unit, mixed commercial and residential building. The building was occupied by the following tenants:
 - Slessor Quality Automobiles / Right Choice Auto Sales, who also occupy the storage unit on the southwestern portion of the building;
 - An apartment unit [Unit 1];
 - The World of My Baby (WOMB) [Unit 2];
 - An apartment unit [Unit 3], and;
 - Golden Fish and Chips / Sushi Yama [Unit 4].
- 17 Prince Street: This portion of the Phase One Property was occupied by a 1^{1/2}-storey dwelling, with a basement level, and a single-storey, basementless, attached garage located immediately east of the dwelling;

- 395 Pearl Street: This portion of the Phase One Property was occupied by a 1^{1/2}-storey, basementless, dwelling;
- 399 Pearl Street: This portion of the Phase One Property was occupied by a 1^{1/2}-storey dwelling, with a basement level;
- 405 Pearl Street: This portion of the Phase One Property was occupied by a single-storey, basementless, dwelling, and;
- 409 Pearl Street: This portion of the Phase One Property was occupied by a single-storey, basementless, dwelling.

The remainder of the Phase One Property was comprised of a mixture of an asphaltic-concrete covered parking lot areas and landscaped yard areas.

The Site was bounded to the north by Main Street East, to the east by Bruce Street, to the south by Pearl Street and residential lands, and to the west by Prince Street and residential lands.

For descriptive purposes, Main Street East has been designated as having an east-west alignment.

The legal descriptions of the Site include the following:

1. PIN 24954-0139 [388 Main Street East]: "Lot 6, Block 14, Plan 9, Lot 7, Block 14, Plan 9, Lot 8, Block 14, Plan 9, Lot 9, Block 14, Plan 9, as known as Teetzel's Survey, south of Main Street; Milton; save and except Part Lot 6 taken for road widening purposes, designated as Parcel County Road 36-1, Section D-8, as in 218689";
2. PIN 24954-0140 [17 Prince Street]: "Part Lot 7, Block 14, Plan 9, as known as Teetzel's Survey, north of Pearl Street, as in 501695, together with 75793; Milton; Subject to Execution 93-05166, if enforceable. Subject to Execution 93-05167, if enforceable. Subject to Execution 93-05168, if enforceable";
3. PIN 24954-0142 [395 Pearl Street]: "Lot 6, Block 14, Plan 9, as known as Teetzel's Survey, north of Pearl Street; Milton";
4. PIN 24954-0143 [399 Pearl Street]: "Lot 5, Block 14, Plan 9, as known as Teetzel's Survey, north of Pearl Street; Milton";
5. PIN 24954-0144 [405 Pearl Street]: "Part Lot 4, Block 14, Plan 9, as known as Teetzel's Survey, north of Pearl Street, as in 518468, together with 518468; Milton; Subject to Execution 93-05166, if enforceable. Subject to Execution 93-05167, if enforceable. Subject to Execution 93-05168, if enforceable", and;
6. PIN 24954-0145 [409 Pearl Street]: "Part Lot 4, Block 14, Plan 9, as known as Teetzel's Survey, north of Pearl Street, as in 371921, subject to 371921; Milton."

The geographic coordinates of the Site, recorded using a hand held global positioning unit, are [NAD 83] 17T 590645E/ 4818818N.

A general site location drawing and overview of the Phase One Study Area are included in Appendix 'A' for reference.

2(b) DESCRIPTION OF ADJACENT LAND USE

The adjacent properties are comprised of a mixture of residential and community use lands.

A description of the adjacent properties, based on visual observations recorded from the Site, is presented below:

	North	East	South	West
Adjoining Property/ Operation	Main Street East	Bruce Street	Pearl Street / Residential	Prince Street / Residential
Potential Hazardous Materials	None observed	None observed	None observed	None observed
Potential Storage Tanks	None observed	None observed	None observed	None observed
Direction with respect to the inferred ground water flow	Up-gradient	Trans-gradient	Down-gradient	Trans-gradient
General Vicinity	Commercial [Subway, Javanut, Play It Again Sports] / Railway Line and Residential	Commercial [Master Mechanic Milton, Minuteman Press, The Salvation Army Thrift Store]	Commercial [Wakefield Family Dentistry] / Institutional [Milton Christian School] and Residential	Commercial [FastSigns, Bombay Grill Restaurant] / Institutional [Grace Anglican Church] / Residential and Forest

With respect to the existing railway line, given the location of the property to the Site with respect to the inferred groundwater flow direction [up-gradient] and the distance between the property and the Site [approximately 155 metres northwest of the Site], the operations associated with the railway line are not considered a PCA likely to cause an APEC on the Site.

With respect to Master Mechanic Milton, given the location of the property to the Site with respect to the inferred groundwater flow direction [trans-gradient] and the distance between the property and the Site [approximately 215 metres north-northeast of the Site], the operations associated with the property are not considered a PCA likely to cause an APEC on the Site.

With respect to Minuteman Press, given the location of the property to the Site with respect to the inferred groundwater flow direction [trans-gradient] and the distance between the property and the Site [approximately 240 metres north-northeast of the Site], the operations associated with the property are not considered a PCA likely to cause an APEC on the Site.

With respect to FastSigns, given the location of the property to the Site with respect to the inferred groundwater flow direction [trans-gradient] and the distance between the property and the Site [approximately 55 metres southwest of the Site], the operations conducted on this property are considered a PCA likely to cause an APEC on the Site.

With the exception of the above, the visual observations of the adjoining lands did not reveal any obvious PCAs that are considered likely to cause an APEC on the Phase One Property.

3.0 SCOPE OF INVESTIGATION

The Phase One ESA follows the protocol outlined in *Ontario Regulation 153/04 [as amended]*, which suggests a four-step approach to Phase One Environmental Site Assessments, including the following;

1. RECORDS REVIEW: including aerial photographs, property use records, title search, previous Phase One ESA reports, regulatory agency documentation, company records, Site specific geotechnical reports and any other relevant material;
2. SITE VISITATION: including a visual reconnaissance of the Site, suspect adjacent properties, and the different land uses within the vicinity of the Site;
3. INTERVIEWS: including persons that may have pertinent information with regard to the Site, including contacts from the Town of Milton, Ministry of Environment, Conservation and Parks [MOE], and current / previous land owners, etc.;
4. EVALUATIONS: Based on the information gathered, a professional evaluation of the property is presented in a final Phase One ESA Report.

Ontario Regulation 153/04 [as amended] lists fifty-nine [59] potentially contaminating activities that require intrusive assessment activities, i.e. a Phase Two ESA, to determine if an adverse environmental impact is present on the Site if a PCA is found to have occurred on the Phase One Property. In some circumstances a Phase Two ESA may be required if a PCA has occurred on a neighbouring or nearby property within the Phase One Study Area if deemed necessary by the Qualified Person [QP] overseeing the Phase One ESA. However, it is noted that under *Ontario Regulation 153/04 [as amended]* the mandatory Phase Two ESA activities apply only to properties that are subject to a Record of Site Condition. It is our understanding that this Phase One ESA report is required as a supporting document for the submission of an RSC for the Site.

4.0 RECORDS REVIEW

4(a)i PHASE ONE ESA STUDY AREA DETERMINATION

The Phase One Study Area consists of the lands generally in a 250-metre radius from the limits of the Phase One Property. These lands are primarily comprised of a mixture of residential, commercial, and institutional use lands.

The research undertaken during this Phase One ESA revealed information that suggests there are PCAs both on the Phase One Property and on lands located within the Phase One Study Area that are considered likely to cause an APEC on the Phase One Property.

Additional information, specific to the nature of the land use of the properties of interest in the Phase One Study Area, if any, is presented in Section 4a(iii), 4a(iv), 4a(v), 4a(vi), 4(b), 4(c), 5.0 and 6.0(b) of this Report.

4(a)ii FIRST DEVELOPED USE DETERMINATION

Based on the available information compiled during the completion of this Report, including City directories, aerial photographs, topographic and fire plans, etc., the first developed use of the Site was circa the 1890s as residential use lands.

4(a)iii FIRE INSURANCE PLANS

The Underwriter's Survey Bureau Limited Fire Insurance Plans were reviewed for the purpose of identifying structures, building materials and/ or underground storage tanks that may have been present on, or near the Site.

A summary of SOIL-MAT ENGINEERS' findings is present below:

Date of Plan	Findings
Aug 1880	The Credit Valley Railroad is located northwest of Main Street East, which is located approximately 155 metres northwest of the Site. Given the distance between this property and the Site and the location of the property to the Site with respect to the inferred groundwater flow direction [up-gradient], the presence of the railway line is not considered a PCA likely to cause an APEC on the Site.
May 1893	The Canadian National Railway is located northwest of Main Street East, which is located approximately 155 metres northwest of the Site. Given the distance between this property and the Site and the location of the property to the Site with respect to the inferred groundwater flow direction [up-gradient], the presence of the railway line is not considered a PCA likely to cause an APEC on the Site.
Mar 1927	The Canadian National Railway is located northwest of Main Street East, which is located approximately 155 metres northwest of the Site. Given the distance between this property and the Site and the location of the property to the Site with respect to the inferred groundwater flow direction [up-gradient], the presence of the railway line is not considered a PCA likely to cause an APEC on the Site.

Date of Plan	Findings
Mar 1927	The Milton Spinners Ltd. factory is located northwest of the Canadian National Railway, which is located approximately 215 metres northwest of the Site. Given the distance between this property and the Site and the location of the property to the Site with respect to the inferred groundwater flow direction [up-gradient], as well as the low permeability of the native soils in the vicinity of the Site, the presence of the factory is not considered a PCA likely to cause an APEC on the Site.
Mar 1927	A coal shed is located southeast of the Canadian National Railway, which is located approximately 125 metres northwest of the Site. Given the distance between this property and the Site and the location of the property to the Site with respect to the inferred groundwater flow direction [up-gradient], as well as the low permeability of the native soils in the vicinity of the Site, the presence of the coal shed is not considered a PCA likely to cause an APEC on the Site.
Mar 1927	A building was illustrated on 117, 103 and 97 Main Street East, which are all recognized as 388 Main Street East at the time of this Report. Historically, it was a common practise to demolish buildings and utilise the remaining construction debris and various fill materials to backfill the basement level of the structures, if present. As such, the demolition of the former structures on the 388 Main Street East portion of the Phase One Property is considered a PCA likely to cause an APEC on the Site.

4(a)iv CHAIN OF TITLE

A representative of SOIL-MAT ENGINEERS undertook a title search of the Site on the Ontario Land Registry Website [<https://www.onland.ca/ui/>].

The title search of the Site revealed Slessor Motors (Milton) Inc. [388 Main Street East] and Milton Motor Sales Ltd. [399 Pearl Street] as a past owners of the Site, which suggests PCAs were likely conducted on the Site. However, our review of available historical information, such as aerial photographs, topographic maps, etc. during their time periods, suggest the 399 Pearl Street was comprised of residential lands during this time period.

The Site was owned by the following at the time of the title search:

1. 388 Main Street East: Slessor Motors (Milton) Inc;
2. 17 Prince Street: Beverly Allan Slessor;
3. 395 Pearl Street: Kim Slessor;
4. 399 Pearl Street: Milton Motor Sales Limited;
5. 405 Pearl Street: Beverly Allan Slessor, and;
6. 409 Pearl Street: Beverly Slessor.

The chain of previous ownership is presented in table format on the following page:

388 Main Street East [PIN 24954-0139]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
May 31, 1989 to Present	Slessor Motors (Milton) Inc.	This portion of the Phase One Property was occupied by a multi-unit commercial and residential building.	Residential and Commercial	- Aerial photographs from 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
March 16, 1964 to May 31, 1989	Ivan Kingsley Slessor	This portion of the Phase One Property was occupied by a multi-unit commercial and residential building.	Residential and Commercial	- An aerial photograph from 1978 illustrates this portion of the Site as observed during our site reconnaissance. - A topographic map from 1972 illustrates this portion of the Site as a developed area with a building.
February 10, 1964 to March 16, 1964	William Ralph Morton	This portion of the Phase One Property was occupied by a multi-unit commercial and residential building.	Residential and Commercial	There were no readily available visual aids for the Phase One Property for this time period.
March 25, 1961 to February 10, 1964	Johnny G Laspoitis, Tom Laspoitis	This portion of the Phase One Property was occupied by a multi-unit commercial and residential building.	Residential and Commercial	There were no readily available visual aids for the Phase One Property for this time period.
June 27, 1951 to March 25, 1961	Raymond Joseph Waters	This portion of the Phase One Property was partially converted from residential lands to commercial lands circa 1954 to 1960.	Residential and Commercial	- An aerial photograph from 1960 illustrates the commercial/residential building and central parking lot as observed during our Site reconnaissance and the eastern dwelling with its own lawn on this portion of the Site. - An aerial photograph from 1954 illustrates two [2] dwellings and their respective lawns on this portion of the Site.
May 17, 1950 to June 27, 1951	William Frederick Johnson	This portion of the Phase One Property was occupied by two [2] dwellings from circa 1942 to 1954.	Residential	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
August 17, 1903 to May 17, 1950	Jacob Johnson, Mary Johnson	This portion of the Phase One Property was occupied by three [3] dwellings from circa 1909 to 1927 and two [2] dwellings from circa 1942 to 1954.	Residential	- A topographic map from 1942 illustrates two [2] buildings on this portion of the Site. - A Fire Insurance Plan from 1927 illustrates three [3] buildings on this portion of the Site. - A topographic map from 1909 illustrates three [3] buildings on this portion of the Site.
March 22, 1895 to August 17, 1903	Hannah Armstrong, Robert Armstrong	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
October 27, 1894 to March 22, 1895	Joseph Harley Borres	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
May 28, 1877 to October 27, 1894	John Stinson Hatton	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
May 28, 1860 to May 28, 1877	Kenny White	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 2, 1852 to May 28, 1860	Thomas Bowes	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
September 18, 1851 to July 2, 1852	Mathias Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to September 18, 1851	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

17 Prince Street [PIN 24954-0140]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
November 5, 1996 to Present	Beverly Allan Slessor	This portion of the Phase One Property was occupied by a dwelling with an attached garage.	Residential	- Aerial photographs from 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
May 11, 1979 to November 5, 1996	Gillian Slessor	This portion of the Phase One Property was occupied by a dwelling with an attached garage.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
April 7, 1976 to May 11, 1979	DV Parrott Co Ltd	This portion of the Phase One Property was occupied by a dwelling with an attached garage.	Residential	An aerial photograph from 1978 illustrates this portion of the Site as observed during our site reconnaissance.
April 11, 1972 to April 7, 1976	Ray Watter Fabianits, Mary Louise Fabianits	This portion of the Phase One Property was occupied by a dwelling with an attached garage.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
March 6, 1958 to April 11, 1972	Christina Fabianits	This portion of the Phase One Property was converted from a vacant lot to residential lands circa 1954 to 1960.	Residential	- A topographic map from 1972 illustrates this portion of the Site as a developed area. - An aerial photograph from 1960 illustrates this portion of the Site as observed during our site reconnaissance.
July 27, 1952 to March 6, 1958	Augustino Restiro	This portion of the Phase One Property was converted from a vacant lot to residential lands circa 1954 to 1960.	Residential	An aerial photograph from 1954 illustrates a vacant lot on this portion of the Site.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
November 26, 1943 to July 27, 1952	William Humphrey Neville	This portion of the Phase One Property was comprised of a vacant lot.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
September 8, 1941 to November 26, 1943	John Kitchen	This portion of the Phase One Property was comprised of a vacant lot.	Residential and Agriculture or Other	A topographic map from 1942 illustrates no buildings on this portion of the Site.
November 24, 1904 to September 8, 1941	John Morley	This portion of the Phase One Property was comprised of a vacant lot.	Residential and Agriculture or Other	- A Fire Insurance Plan from 1927 does not illustrate any buildings on this portion of the Site. - A topographic map from 1909 does not illustrate any buildings on this portion of the Site.
November 25, 1892 to November 24, 1904	Thomas Washington Crozier	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 11 1889 to November 25, 1892	Eliza Janet Robson	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
May 6, 1887 to March 11 1889	Walter M Johnson	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 12, 1887 to May 6, 1887	Daniel McCutcheur, Florence McCutcher	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
February 18, 1885 to January 12, 1887	John Hunter	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
October 27, 1852 to February 18, 1885	Mary Ann Bowes	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 12, 1852 to October 27, 1852	Charles F Teetzel	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to July 12, 1852	Kenny Kerfessau	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 20, 1823 to March 24, 1832	George Will	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
Up to January 20, 1823	Crown	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

395 Pearl Street [PIN 24954-0142]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
December 23, 1998 to Present	Kim Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	- Aerial photographs from 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - A topographic map from 2021 illustrates this portion of the Site as a developed area.
November 30, 1972 to December 23, 1998	Beverly Allan Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	- An aerial photograph from 1978 illustrates this portion of the Site as observed during our site reconnaissance. - A topographic map from 1998 illustrates this portion of the Site as a developed area.
July 17, 1956 to November 30, 1972	Angus Morrison, Grace Morrison	This portion of the Phase One Property was occupied by a dwelling.	Residential	- An aerial photograph from 1960 illustrates this portion of the Site as observed during our site reconnaissance. - A topographic map from 1972 illustrates this portion of the Site as a developed area.
August 12, 1941 to July 17, 1956	Samuel Smith	This portion of the Phase One Property was occupied by a dwelling.	Residential	- An aerial photograph from 1954 illustrates this portion of the Site as observed during our site reconnaissance. - A topographic map from 1942 does not illustrate any buildings on this portion of the Site.
November 28, 1921 to August 12, 1941	Edward Smith	This portion of the Phase One Property was occupied by a dwelling.	Residential	A Fire Insurance Plan from 1927 illustrates a building on this portion of the Site.
August 18, 1919 to November 28, 1921	Annie Fay	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
December 26, 1912 to August 18, 1919	Percy Allport	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
September 27, 1910 to December 26, 1912	John Sinclair McCannell	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
August 18, 1879 to September 27, 1910	Samuel Nixon	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1909 illustrates a building on this portion of the Site.
May 17, 1878 to August 18, 1879	Eliza Arthurs	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
August 26, 1874 to May 17, 1878	Duncan Devarr	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
November 27, 1873 to August 26, 1874	William Eaton Witchell	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 2, 1870 to November 27, 1873	Christina B Davis	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
November 3, 1852 to April 2, 1870	William Martin	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 12, 1852 to November 3, 1852	Charles F Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to July 12, 1852	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

399 Pearl Street [PIN 24954-0143]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
December 31, 1975 to Present	Milton Motor Sales Limited	This portion of the Phase One Property was occupied by a dwelling.	Residential	- Aerial photographs from 1978, 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
September 30, 1947 to December 31, 1975	John G Purdy, Marjorie A Purdy	This portion of the Phase One Property was occupied by a dwelling.	Residential	- A topographic map from 1972 illustrates this portion of the Site as a developed area. - Aerial photographs from 1954 and 1960 illustrate this portion of the Site as observed during our site reconnaissance.
May 28, 1921 to September 30, 1947	Henry Fay, Eva Ann Fay	This portion of the Phase One Property was occupied by a dwelling.	Residential	- A topographic map from 1942 illustrates a building on this portion of the Site. - A Fire Insurance Plan from 1927 illustrates a building on this portion of the Site.
February 23, 1918 to May 28, 1921	Samuel Henson	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
December 19, 1912 to February 23, 1918	William Sloan	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
September 27, 1910 to December 19, 1912	John Sinclair McCannell	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
August 18, 1879 to September 27, 1910	Samuel Nixon	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1909 illustrates a building on this portion of the Site.
May 17, 1878 to August 18, 1879	Eliza Arthurs	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
August 26, 1874 to May 17, 1878	Duncan Devarr	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
November 27, 1873 to August 26, 1874	William Eaton Witchell	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 2, 1870 to November 27, 1873	Christina B Davis	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 2, 1852 to April 2, 1870	Elizabeth Fetzsimon	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
September 18, 1851 to July 2, 1852	Mathias Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to September 18, 1851	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

405 Pearl Street [PIN 24954-0144]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
August 2, 1996 to Present	Beverly Allan Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	- Aerial photographs from 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
February 28, 1980 to August 2, 1996	Gillian Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
February 19, 1976 to February 28, 1980	Charles J Auger	This portion of the Phase One Property was occupied by a dwelling.	Residential	An aerial photograph from 1978 illustrates this portion of the Site as observed during our site reconnaissance.
October 30, 1950 to February 19, 1976	Susan P Auger	This portion of the Phase One Property was occupied by a dwelling.	Residential	- A topographic map from 1972 illustrates this portion of the Site as a developed area. - Aerial photographs from 1954 and 1960 illustrate this portion of the Site as observed during our site reconnaissance.
August 21, 1950 to October 30, 1950	Harold Raymond Sterling	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
April 20, 1942 to August 21, 1950	Rose Annie Sales	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
April 9, 1934 to April 20, 1942	Robert Wicks, Elizabeth Wicks	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1942 illustrates a building on this portion of the Site.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
May 4, 1912 to April 9, 1934	Jacob Johnson	This portion of the Phase One Property was occupied by a dwelling.	Residential	A Fire Insurance Plan from 1927 illustrates a building on this portion of the Site.
September 27, 1910 to May 4, 1912	John Sinclair McCannell	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
December 8, 1891 to September 27, 1910	Samuel Nixon	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1909 illustrates a building on this portion of the Site.
July 27, 1891 to December 8, 1891	William J Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 7, 1888 to July 27, 1891	Martha M Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 14, 1869 to April 7, 1888	James Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
December 16, 1862 to April 14, 1869	Joseph Graham	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
June 12, 1854 to December 16, 1862	William LP Eager	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 25, 1854 to June 12, 1854	William D Lyon	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 12, 1852 to March 25, 1854	Charles F Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
March 24, 1832 to July 12, 1852	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

409 Pearl Street [PIN 24954-0145]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
August 31, 1973 to Present	Beverly Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	- Aerial photographs from 1978, 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
December 17, 1948 to August 31, 1973	Richard Ferrier	This portion of the Phase One Property was occupied by a dwelling.	Residential	- A topographic map from 1972 illustrates this portion of the Site as a developed area. - Aerial photographs from 1954 and 1960 illustrate this portion of the Site as observed during our site reconnaissance.
August 6, 1941 to December 17, 1948	Charles Robertson	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1942 illustrates a building on this portion of the Site.
May 4, 1912 to August 6, 1941	Jacob Johnson	This portion of the Phase One Property was occupied by a dwelling.	Residential	A Fire Insurance Plan from 1927 illustrates a building on this portion of the Site.
September 27, 1910 to May 4, 1912	John Sinclair McCannell	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
December 8, 1891 to September 27, 1910	Samuel Nixon	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1909 illustrates a building on this portion of the Site.
July 27, 1891 to December 8, 1891	William J Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 7, 1888 to July 27, 1891	Martha M Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 14, 1869 to April 7, 1888	James Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
December 16, 1862 to April 14, 1869	Joseph Graham	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
June 12, 1854 to December 16, 1862	William LP Eager	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 25, 1854 to June 12, 1854	William D Lyon	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 12, 1852 to March 25, 1854	Charles F Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to July 12, 1852	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

A copy of the title search is included in Appendix 'B' for reference

4(a)v ENVIRONMENTAL REPORTS

SOIL-MAT ENGINEERS contacted the Town of Milton to request a copy of previous environmental reports for the Site that may be on file with the Town. However, the results were not available during the completion of this Report, and will be sent under a separate cover as soon as they are received in our Office.

In addition, a search of the MOE's *Brownfields Environmental Site Registry* did not reveal a previous Phase One ESA that may have been undertaken on the Site. Of note, Stantec Consulting Ltd. submitted a Record of Site Condition [RSC] to the Ministry of the Environment and Climate Change [MOE] in support of a residential development on the nearby 383 Main Street East, which is located approximately 55 metres northwest [up-gradient] of the Site. The RSC was acknowledged by the MOE and filed on the Ministry's Environmental Site Registry on June 10, 2010 [RSC ID #79919].

Our e-mail correspondence with the Town is included in Appendix 'C' of this Report for reference.

4(a)vi HISTORICAL SITE USE AND CONDITIONS/PAST LAND USES

The Vernon City Directory series were reviewed dating back to 1981 [the earliest available directory for the Site and surrounding area] to establish the general historical land use on and in the immediate vicinity of the Site. It is noted that the 1990 directory is the most recent readily available directory for the Site and surrounding area.

A summary of SOIL-MAT ENGINEERS' findings for the Site is provided below:

388 Main Street East:

Occupant	Years Occupied
Edward Roberts	1+ year[s] [1990 only year listed]
Golden Fish and Chips	1+ year[s] [1990 only year listed]
Humphries Auto Systems	1+ year[s] [1990 only year listed]
Kelso Travel	1+ year[s] [1990 only year listed]

Occupant	Years Occupied
Royal Lepage Real Estate Services Inc	1+ year[s] [1990 only year listed]
Slessor D	1+ year[s] [1990 only year listed]
Slessor Motors	1+ year[s] [1990 only year listed]
Varley K	1+ year[s] [1990 only year listed]
Super Shade II Ltd	1+ year[s] [1990 only year listed]
Not listed	4+ years [1981 – 1985]

17 Prince Street:

Occupant	Years Occupied
Bruce Shepard	1+ year[s] [1990 only year listed]
Dean's Automotive	1+ year[s] [1985 only year listed]
Bruce Shepard	1+ year[s] [1981 only year listed]

395 Pearl Street:

Occupant	Years Occupied
West P	1+ year[s] [1990 only year listed]
Rankin Bruce	1+ year[s] [1985 only year listed]
Mcleod C	1+ year[s] [1981 only year listed]

399 Pearl Street:

Occupant	Years Occupied
Blanchfield Ed	1+ year[s] [1990 only year listed]
Slessor B	1+ year[s] [1985 only year listed]
Not listed	1+ year[s] [1981 only year listed]

405 Pearl Street:

Occupant	Years Occupied
Not listed	1+ year[s] [1990 only year listed]
West P	1+ year[s] [1985 only year listed]
Auger Arthur	1+ year[s] [1981 only year listed]

409 Pearl Street:

Occupant	Years Occupied
Shaw W G	1+ year[s] [1990 only year listed]
Not listed	1+ year[s] [1985 only year listed]
Crewson Stuart	1+ year[s] [1981 only year listed]

The directories list 'Slessor Motors' and 'Dean's Automotive' as past occupants of the Site. These operations are considered PCAs that are likely to cause an APEC on the Site.

A summary of the historical occupants of interest on the adjoining and/or nearby properties is listed in table format on the following page:

Location	Property Use	Occupant	Years Occupied
295 Main Street East: Located ~ 225 metres southwest of the Site [Trans-gradient]	Commercial	Johnson Bros Garage	1+ year[s] [1985 only year listed]
300 Main Street East: Located ~ 220 metres southwest of the Site [Trans-gradient]	Commercial	Knight's Dry Cleaner	5 years [1985 – 1990]
361 Main Street East: Located ~ 50 metres west-southwest of the Site [Trans-gradient]	Commercial	Kwik Kopy Printing	1+ year[s] [1990 only year listed]
409 Main Street East: Located ~ 15 metres northwest of the Site [Up-gradient]	Commercial	Murray Wilson Pontiac Buick Cadillac Ltd	5 years [1985 – 1990]
420 Main Street East: Located ~ 10 metres northeast of the Site [Trans-gradient]	Commercial	Rick's Auto Repair	1+ year[s] [1981 only year listed]
45 Ontario Street North: Located ~ 210 metres north-northeast of the Site [Trans-gradient]	Commercial	Goodyear Certified Auto Service	1+ year[s] [1990 only year listed]

With respect to the 361, 409, and 420 Main Street East properties, given the location of the properties to the Site with respect to the inferred groundwater flow direction and the distance between the properties and the Site, the operations conducted on these properties are considered PCAs likely to cause an APEC on the Site.

With respect to the remaining properties, given the location of the properties to the Site with respect to the inferred groundwater flow direction and the distance between the properties and the Site, the operations on these properties are not considered a PCA likely to cause an APEC on the Site.

With the exception of the above, the directories do not list any current or past occupant of the adjacent lands that should be considered a potential environmental liability to the Site.

4(b) ENVIRONMENTAL SOURCE INFORMATION

1. National Pollutant Release Inventory: No records were found for the Site or properties within the Phase One Study Area.
2. A review of the Ministry of Environment and Energy's "Ontario Inventory of PCB Storage Sites", October, 1991, revealed the following Sites:

Company	Site Number	Address	Major/Minor Site	Distance to Site
Aimco Solrec Ltd	30289A114	425 Morobel Drive	Major	1.48km WNW
Milton Hydro	30283A023	55 Thompson Road	Minor	1.59km NE
Technical Coatings	30291A027	425 Morobel Drive	Minor	1.48km WNW

With respect to the properties listed above, given the location of the properties to the Site with respect to the inferred groundwater flow direction [trans-gradient] and the distance between the properties and the Site, the storage of PCBs on these properties is not considered a PCA likely to cause an APEC on the Site.

3. Environmental Compliance Approvals, Permit to Take Water, Certificate of Property Use: No records were found for the Site.
4. Coal Gasification Plants: No records were found for the Site or properties within the Phase One Study Area.
5. The Ministry of Environment's Freedom of Information and Protection of Privacy Office was contacted to determine if any spills have been reported in the area of the Site, if any buried tanks are recorded to be on-site, or if there are any orders and/or notices on file outstanding against the Owner of the Site. The results of the Ministry Search confirmed there were no records found within their database.

SOIL-MAT ENGINEERS' MOE database search results is attached in Appendix 'D' for reference.

6. Waste Management Records: No records were found for the Site but records of waste generation were found for the adjacent properties. Refer to the EcoLog ERIS Database Search in Section 4(b), Part 12 for more details.
7. Reports Submitted to the MOE: No records were found for the Site or adjacent properties.
8. Retail Fuel Storage Tanks: SOIL-MAT ENGINEERS contacted the T.S.S.A. to undertake a search of the Site and neighbouring properties for the registered presence of any underground storage tanks. The T.S.S.A. does not have records on file of any underground storage tanks located on the Site or in the Study Area.

It is however noted that the T.S.S.A. does not have records of USTs installed prior to 1987. In addition, "private use" USTs were not registered with the agency until 1990, and even then many owners of "private use" USTs do not register the tanks with T.S.S.A.

Our e-mail correspondence with the T.S.S.A is included in Appendix 'E' of this Report for reference.

9. Notices and Instruments Posted to the MOE Registry: No records were found for the Site.
10. Identification of Areas of Natural Significance [Ministry of Natural Resources]: No records were found for area(s) of natural significance on the Site or adjacent properties.
11. Landfill Information Maintained by the MOE: A review of the Ministry of Environment and Energy's "Waste Disposal Site Inventory", June 1991, did not reveal any active landfills site within a 2km radius of the Site. However, three [3] records of inactive landfills were found for properties located within a 2km radius of the Site.

A summary of the landfill properties is provided below in table format:

MOE Site No.	Municipality	Location	Date Closed	Class	Distance to Site
A 210302	Milton	Lot 12, Concession 3	1974	A6	1.22km NE
X 7042	Milton	Part Lot 12, Concession 2	1974	A4	1.28km SE
X 7043	Milton	Mid Part Lot 12, Concession 2	1950	A5	0.72km SE

With respect to the inactive waste disposal sites, class 'A5' sites are registered to receive municipal and domestic wastes and are located in an urban setting. In the case of the class 'A5' waste disposal site listed above, given the location of this property to the Site with respect to the inferred groundwater flow direction [down-gradient] and the distance between this property and the Site this inactive landfill site is not considered a PCA likely to cause an APEC on the Site.

With respect to the inactive waste disposal sites, class 'A4' and 'A6' sites are registered to receive municipal and domestic wastes and are located in a rural setting. In the case of the waste disposal sites listed above, given the location of the properties to the Site with respect to the inferred groundwater flow direction and the distance between the properties and the Site this inactive landfill site is not considered a PCA likely to cause an APEC on the Site.

It is noted that although the waste disposal site inventory is considered a comprehensive document not all of the inactive landfill sites are listed in the inventory.

In addition, no Municipal Coal Gasification Plants or Coal Tar Distillation Plants were in operation in the area.

12. EcoLog ERIS Database Search: A review of historical records and regulatory agency databases was completed for the Site and lands located within 250 metres from the boundaries of the Phase One Property. The report includes information from the following sources:
 - Abandoned Aggregate Inventory
 - Aggregate Inventory
 - Borehole
 - Certificates of Approval

- Environmental Registry
- ERIS Historical Searches
- Fuel Storage Tanks
- Ontario Regulation 347 Waste Generators Summary
- Private and Retail Fuel Storage Tanks
- Record of Site Conditions
- Ontario Spills
- Water Well Information Systems

The EcoLog ERIS database search report revealed limited PCAs on nearby properties, including the following:

300 Main Street East – the EcoLog ERIS database revealed the following:

- Seven [7] records of waste generation.

330 Main Street East – the EcoLog ERIS database revealed the following:

- One record of a commercial fuel oil tank;
- One record of a delisted fuel tank, and;
- Thirteen [13] records of waste generation.

383 Main Street East – the EcoLog ERIS database revealed the following:

- One record of a fuel storage tank;
- Two [2] records of historic fuel storage tanks;
- Two [2] records of waste generation;
- One record of a private and retail fuel storage tank;
- One Record of Site Condition, and;
- Three [3] records of the Scott's Manufacturing Directory for Other Paperboard Container Manufacturing.

400 Main Street East – the EcoLog ERIS database revealed the following:

- One record of Scott's Manufacturing Directory for Doll, Toy and Game Manufacturing.

409 Main Street East – the EcoLog ERIS database revealed the following:

- Three [3] records of waste generation.

420 Main Street East – the EcoLog ERIS database revealed the following:

- One record of waste generation, and;
- Two [2] records of the Scott's Manufacturing Directory for Material Handling Equipment Manufacturing, All Other Non-Metallic Mineral Product Manufacturing, Sign Manufacturing, Pottery, Ceramics and Plumbing Fixture Manufacturing.

55 Ontario Street South – the EcoLog ERIS database revealed the following:

- Twenty-four [24] records of waste generation;
- Eleven [11] records of the Pesticide Register;
- One record of the Scott's Manufacturing Directory for Coating, Engraving, Heat Treating and Allied Activities All Other Plastic Product Manufacturing, and;
- Four [4] records of Ontario Spills.

366 Pine Street – the EcoLog ERIS database revealed the following:

- Three [3] records of the Pesticide Register.

106 Wakefield Road – the EcoLog ERIS database revealed the following:

- Five [5] records of waste generation.

Childs Drive and Ontario Street South – the EcoLog ERIS database revealed the following:

- One record of fuel oil spills and leaks

With respect to 383 Main Street East listed above, given the location of the property to the Site with respect to the inferred groundwater flow direction [up-gradient] and the distance between the property and the Site [55 metres northwest], the operations conducted on the property are considered a PCA likely to cause an APEC on the Site.

With the exception of the above, given the location of the remaining records with respect to the inferred groundwater flow direction as well as the distance between the properties and the Site, an adverse environmental impact to the Site is considered remote.

A copy of the EcoLog ERIS Report is included in Appendix 'F' for reference.

4(c) PHYSICAL SETTING SOURCES

1. Aerial Photographs: Aerial photographs from 1954, 1960, 1978, 2004, 2013, 2019 and 2022 were available for the Site and surrounding lands and were reviewed by SOIL-MAT ENGINEERS.

A summary of information obtained from the photographs is presented below in table format:

Aerial Photo Year [Scale]	Site Description	Description of Adjacent Lands
1954 [1:6,000]	Six [6] buildings are present on the Site, including two [2] buildings on 388 Main Street East and one building each on the remaining properties [except 17 Prince Street, which was a vacant lot]. The remainder of the Site is comprised of an asphaltic-concrete covered parking lot and grass-covered areas. Of note, 395, 399, 405, and 409 Pearl Street appear as observed during our site reconnaissance.	The surrounding lands are comprised of a mixture of agricultural, residential, industrial and commercial use lands. In addition, a railway line is present to the northwest of the Site.
1960 [1:4,225]	The commercial and residential building on the northern portion of the Site [388 Main Street East] is now present. In addition, a dwelling and attached garage is present on 17 Prince Street, as observed during our site reconnaissance.	Commercial use lands are under development to the far northeast of the Site. There is additional residential development to the far southeast of the Site.

Aerial Photo Year [Scale]	Site Description	Description of Adjacent Lands
1978 [1:2,700]	The two [2] buildings on the western and eastern portions of the 388 Main Street East were demolished. This portion of the Site was converted into an asphaltic-concrete covered parking lot.	With the exception of commercial development to the far northwest of the Site, there are no significant changes to the surrounding lands.
2004 [1:2,950]	There are no significant changes to the Site.	Commercial use lands are present to the northeast and far north of the Site. There is additional residential development to the far northwest of the Site.
2013 [1:2,950]	There are no significant changes to the Site.	The industrial use land, northwest of the Site, was converted to a condominium. With the exception of the above, there are no significant changes to the surrounding lands.
2019 [1:2,950]	There are no significant changes to the Site.	An apartment was being developed far northwest of the Site. With the exception of the above, there are no significant changes to the surrounding lands.
2022 [1:2,950]	There are no significant changes to the Site.	There are no significant changes to the surrounding lands.

The review of the aerial photographs revealed two [2] buildings were demolished on the western and eastern portions of the 388 Main Street East portion of the Site. Historically, it was a common practise to demolish buildings and utilise the remaining construction debris and various fill materials to backfill the basement level of the structures, if present. As such, the demolition of these structures is considered a PCA likely to cause an APEC on the Site.

With respect to the industrial building located northwest of the Site, specifically at 383 Main Street East, given the location of the property to the Site with respect to the inferred groundwater flow direction [up-gradient] and the distance between the property and the Site [approximately 55 metres northwest], the operations conducted on this property are considered a PCA likely to cause an APEC on the Site.

With respect to the railway line, given the location of the railway line to the Site with respect to the inferred groundwater flow direction [up-gradient] and the distance between the property and the Site [approximately 155 metres northeast], the operations associated with the railway line are not considered a PCA likely to cause an APEC on the Site.

With the exception of the above, the review of the noted aerial photographs did not reveal any obvious PCAs that would suggest there is a potential environmental liability on the Site.

The aerial photographs are included in Appendix 'G' for reference.

2. Topography, Hydrology, Geology: Readily available topographic maps for the Site and Phase One Study Area were reviewed as part of this Phase One ESA and revealed the following information:

Map Year [Scale]	Site Description	Description of Surrounding Lands
1909 [1:63,360]	There are five [5] buildings illustrated on the Site.	The Phase One Study Area is comprised of moderately developed lands, except northwest of the Site, including a railway line to the far northwest of the Site.
1942 [1:63,360]	There are three [3] buildings illustrated on the Site.	The Phase One Study Area is comprised of moderately developed lands, including a railway line to the far northwest of the Site.
1972 [1:25,000]	There is one building illustrated on the Site. The Site is also located within the shaded area of the map which indicates a 'built up' or developed area.	The Phase One Study Area is comprised of developed lands, including a railway line to the far northwest of the Site.
1998 [1:50,000]	There are no buildings illustrated on the Site. However, the Site is located within the shaded area of the map which indicates a 'built up' or developed area.	The Phase One Study Area is comprised of developed lands, including a railway line to the far northwest of the Site.
2021 [1:17,500]	There are no buildings illustrated on the Site. However, the Site is located within the shaded area of the map which indicates a 'built up' or developed area.	The Phase One Study Area is comprised of developed lands, including a railway line to the far northwest of the Site.

With respect to the railway line, given the location of the railway line to the Site with respect to the inferred groundwater flow direction [up-gradient] and the distance between the property and the Site [approximately 155 metres northwest of the Site], the operations associated with the railway line are not considered a PCA likely to cause an APEC on the Site.

In addition to the above, the review of the topographic maps did not reveal any PCAs that are considered likely to cause an APEC on the Site.

A copy of the topographic maps is included in Appendix 'H' for reference.

In addition, a review of the Ministry of Northern Development and Mine's "Quaternary Geology of the Brampton Area, Southern Ontario Sheet Map P3171" and the "Paleozoic Geology of the Brampton Area, Southern Ontario Sheet Map M2337", revealed the Site to be underlain by glaciolacustrine massive to laminated clay and silt, in turn, underlain by Queenston Formation red shale bedrock. The depth to the groundwater table is anticipated to be approximately 6.9 metres below the ground surface elevation based on information obtained from groundwater well records for water wells located within the Phase One Study Area.

The topography of the Site is relatively flat and level with surface water being directed towards the catch basins surrounding the Site.

Regional groundwater flow is expected to the southeast towards Lake Ontario.

3. Fill Materials: The reconnaissance of the Site did not reveal any obvious visual evidence of suspected fill material on the Site.
4. Water Bodies and Areas of Natural Significance: Surface water was not encountered on the Phase One Property or on properties located within the Phase One Study Area. In addition, no areas of natural significance were identified on the Phase One Property or within the Phase One Study Area.
5. Well Records: The reconnaissance of the Site did not reveal any obvious visual evidence of a suspected groundwater well or cistern.

A review of the MOE's water well records revealed a record of twenty [20] groundwater monitoring wells located within the Phase One Study Area. The groundwater monitoring wells are reportedly located between 35 and 240 metres from the Site and reportedly terminate between 2.92 and 13 metres below the ground surface. In addition, our review of the MOE water well records did not reveal any records of potable groundwater wells on lands located within the Phase One Study Area.

4(d) SITE OPERATING RECORDS

1. Title of the Information Sheet or Document: Not Available
2. Description of Data, Analysis or Findings as the Information Sheet or Document relates to the Phase One Property: Not Available

5.0 INTERVIEWS

Mr. Norris Laffin [the property manager for the Site on behalf of Mikmada Homes] accompanied a representative of SOIL-MAT ENGINEERS during the reconnaissance of the Site. Mr. Laffin offered the following:

- The building(s) on each property were constructed as follows:
 - 388 Main Street East: ~1953;
 - 17 Prince Street: circa 1940s. However, based on the information gathered during this Phase One ESA it is the opinion of SOIL-MAT ENGINEERS that the building was constructed circa 1954 to 1960];
 - 395 Pearl Street: circa 1890s;
 - 399 Pearl Street: circa 1890s;
 - 405 Pearl Street: circa early 1900s, and;
 - 409 Pearl Street: circa 1930s.
- Mr. Laffin confirmed that Slessor Motors was permanently closed at the time of our Site reconnaissance;
- The representative of SOIL-MAT ENGINEERS was able to gain access to 388 Main Street East, 17 Prince Road, and 399 Pearl Street at the time of the Site visit, but not the other on-site properties. However, Mr. Laffin confirmed that the only properties with a basement level was 17 Prince Street and 399 Pearl Street;
- Mr. Laffin confirmed a 2,000-gallon UST was formerly located immediately north of the 405 Pearl Street building;
- Mr. Laffin confirmed that 388 Main Street was a Cadillac dealership in the 1950s, and confirmed that automotive repairs were conducted in the garage attached to 17 Prince Street, and;
- The garage attached to 17 Prince Street was used as a storage area by 388 Main Street East.

6.0 SITE RECONNAISSANCE

6.0 (a) GENERAL REQUIREMENTS:

Reporting Requirements	SOIL-MAT ENGINEERS' Details
Date and Time of the Reconnaissance	April 5, 2023 [10:00am to 11:00am]
Weather Conditions	The weather conditions did not limit the visual observations of the Site.
Duration of Site Visit	~1.0 hour
Enhanced Investigation Property	The Site is not considered an Enhanced Investigation property
Field Representative	Mr. Alex Lajkosz [qualifications included in the appendix]

6.0(b) SPECIFIC OBSERVATIONS AT PHASE ONE ESA PROPERTY

Reporting Requirements	SOIL-MAT ENGINEERS' Details
Description of Structures and Other Improvements	388 Main Street East: A two-storey mixed commercial and residential use building, with no basement level, was observed on the northern portion of the Site. The building is approximately 680 m² and was reportedly constructed in 1953. 17 Prince Street: A 1½-storey residential building, with a basement level, was observed on the western portion of the Site. A single-storey attached garage, with no basement level, was also observed immediately east of the dwelling. The building is approximately 185 m² and was reportedly constructed circa the 1940s. However, the information gathered during this Phase One ESA suggest this structure was constructed circa 1954 to 1960. 395 Pearl Street: A 1½-storey dwelling, with no basement level, was observed on the southern portion of the Site. The building is approximately 120 m² and was reportedly constructed circa the 1890s. 399 Pearl Street: A 1½-storey dwelling, with a basement level, was observed on the southern portion of the Site. The building is approximately 110 m² and was reportedly constructed circa the 1890s. 405 Pearl Street: A single-storey dwelling, with no basement level, was observed on the southeastern portion of the Site. The building is approximately 100 m² and was reportedly constructed circa the early 1900s. 409 Pearl Street: A single-storey dwelling, with no basement level, was observed on the southeastern portion of the Site. The building is approximately 95 m² and was reportedly constructed circa the 1930s.
Description of the Number, Age and Depth of Below-Ground Structures	None observed
Details of all tanks (aboveground and underground)	A 2,000-gallon UST was formerly located immediately north of the 405 Pearl Street building.
Details of any potable and non-potable water sources	The Site is serviced with a municipal water supply.

Reporting Requirements	SOIL-MAT ENGINEERS' Details
Buried Utilities	The Site is serviced with hydro, natural gas, water/sewer services, etc. The depths of these service trenches are not anticipated to affect contaminant distribution on the Site.
Existing Buildings: Exit/Entry Points	388 Main Street East: Access to the building is available via doors at the front [north end], as well as the east and west ends and a garage door on the west end. 17 Prince Street: Access to the building is available via doors at the front [west end], as well as the south end. Access to the garage is available via a door at the north end and a garage door at the south end. 395 Pearl Street: Access to the building is available via doors at the front [south end], as well as the west and east ends. 399 Pearl Street: Access to the building is available via doors at the front [south end], as well as the west and east ends. 405 Pearl Street: Access to the building is available via doors at the front [south end], as well as the east end. 409 Pearl Street: Access to the building is available via doors at the front [south end], as well as the east end.
Existing Buildings: Cooling / Heating System	All the buildings were heated with natural gas furnaces. In addition, all of the individual units and buildings were serviced with either wall-mounted or rooftop air conditioning units.
Existing Buildings: Drains, Pits, Sumps, etc.	Two [2] collection pits for water were observed at the central portion of the garage at 388 Main Street East.
Existing Buildings: Details of any unidentified substances	None observed
Existing Buildings: Details of Stains, Corrosion on Floors other than from Water	None observed
Details of Former and Current Wells	None observed
Details of Sewage Works	The area is serviced with a municipal sewer line.
Details of Ground Surface Cover	The northern portion of the Site is comprised of an asphaltic-concrete covered parking lot, while the southern portion of the Site is comprised of grass-covered lawns.
Details of Former or Current Railway Lines	None observed
Details of Stained Soil, Damaged Vegetation or Pavement	None observed
Details of Stressed Vegetation	None observed
Areas Where Fill and Debris Materials Appear to be Present	None observed

Reporting Requirements	SOIL-MAT ENGINEERS' Details
PCAs	PCA No.: 10 – Commercial Autobody Shops: associated with a commercial automotive repair facility that formerly operated on the '17 Prince Street' portion of the Phase One Property; PCA No.: 10 – Commercial Autobody Shops: associated with a commercial automotive repair facility that formerly operated on the '388 Main Street East' portion of the Phase One Property; PCA No.: 28 – Gasoline and Associated Products Storage in Fixed Tanks: associated with a UST formerly located immediately north of the dwelling on the '405 Pearl Street' portion of the Phase One Property; PCA No.: 30 – Importation of Fill Material of Unknown Quality: associated with the three [3] buildings that were demolished on the '388 Main Street East' portion of the Phase One Property, including on each on the western, northern and eastern portion of this property; PCA No.: 10 – Commercial Autobody Shops: associated with a commercial automotive repair facility that formerly operated on the property recognised as '409 Main Street East'; PCA No.: 10 – Commercial Autobody Shops: associated with a commercial automotive repair facility that formerly operated on the property recognised as '420 Main Street East'; PCA No.: 28 – Gasoline and Associated Products Storage in Fixed Tanks: associated with fuel storage tanks on the property recognised as '383 Main Street East'; PCA No.: 31 – Ink Manufacturing, Processing and Bulk Storage: associated with a print shop that formerly operated on the property recognised as '361 Main Street East'; PCA No.: 31 – Ink Manufacturing, Processing and Bulk Storage: associated with an active print shop on the property recognised as '357 Main Street East', and; PCA No.: 45 – Pulp, Paper, and Paperboard Manufacturing and Processing: associated a paperboard container manufacturing facility that formerly operated on the property recognised as '383 Main Street East'.

1. Enhanced Investigation Property

Reporting Requirements	SOIL-MAT ENGINEERS' Details
Details of the Operations at the Site	Not Applicable
Hazardous Materials Used/Stored on the Site	Not Applicable
Products Manufactured on the Site	Not Applicable
By-Products and Wastes at the Site	Not Applicable
Raw Materials, including the Handling and Storage	Not Applicable
Details of Drums, Totes, Bins	Not Applicable
Details of Oil/Water Separators	Not Applicable
Details of Vehicle and Equipment Maintenance Areas	Not Applicable
Details of Known Spills	Not Applicable
Details of Liquid Discharge Points	Not Applicable

Reporting Requirements	SOIL-MAT ENGINEERS' Details
Details of Operations at the Site [processing or manufacturing and equipment used]	Not Applicable
Details of Hydraulic Lift Equipment	Not Applicable

6.0 (C) WRITTEN DESCRIPTION OF INVESTIGATION

The information gathered during the completion of this Phase One ESA report revealed that the Site was first developed circa the 1890s as residential use lands. The first readily available visual aid for the Site is a topographic map from 1909 which illustrates the Site as residential use lands. Other visual aids, including aerial photographs from 1954, 1960, 1978, 2004, 2013, 2019, and 2022 and topographic maps from 1942, 1972, 1998, and 2021 and Fire Insurance Plans from 1880, 1893 and 1927 confirm the development timeline above.

The Phase One research revealed four [4] potentially contaminating activities [PCAs] on the Phase One Property, including the following:

- Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the '17 Prince Street' portion of the Phase One Property;
- Information contained in the Vernon City Directory Series, and the title search of the Phase One Property, revealed a commercial automotive repair facility formerly operated on the '388 Main Street East' portion of the Phase One Property. Of note, this was also confirmed via an interview with Mr. Laffin [Property Manager for the Phase One Property];
- Information provided by Mr. Laffin revealed an underground storage tank [UST] was formerly located immediately north of the dwelling on the '405 Pearl Street' portion of the Phase One Property, and;
- Information contained in available aerial photographs, topographic maps, and a Fire Insurance Plan from 1927 revealed three [3] buildings were demolished on the '388 Main Street East' portion of the Phase One Property, including on each on the western, northern and eastern portion of this property.

The neighbouring and nearby lands are comprised of a mixture of residential, commercial, and institutional use lands. The current and historic operations on properties located in the Phase One Study Area revealed six [6] PCAs that are considered likely to cause an area of potential environmental concern [APEC] on the Phase One Property, including the following:

- Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the property recognised as '409 Main Street East', which is located approximately 15 metres northwest [up-gradient] of the Phase One Property;
- Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the property recognised as '420 Main Street East', which is located approximately 10 metres northeast [up-gradient] of the Phase One Property;

- Information contained in the EcoLog ERIS database search revealed fuel storage tanks on the property recognised as '383 Main Street East', which is located approximately 55 metres northwest [up-gradient] of the Phase One Property;
- Information contained in the Vernon City Directory Series revealed a print shop formerly operated on the property recognised as '361 Main Street East', which is located approximately 50 metres west-southwest [trans-gradient/down-gradient] of the Phase One Property;
- Our visual observations of the Phase One Study Area revealed an active print shop on the property recognised as '357 Main Street East', which is located approximately 55 metres southwest [trans-gradient/down-gradient] of the Phase One Property, and;
- Information contained in the aerial photographs, an acknowledged Record of Site Condition [RSC ID# 79919], and the EcoLog ERIS database search revealed a paperboard container manufacturing facility that formerly operated on the property recognised as '383 Main Street East', which is located approximately 55 metres northwest [up-gradient] of the Phase One Property.

7.0 REVIEW AND EVALUATION OF INFORMATION

- (i) Current and Past Uses: SOIL-MAT ENGINEERS' Table of Current and Past Uses is included in Appendix 'I' of this Report.
- (ii) Potential Contaminating Activity: Four [4] PCAs were identified on the Site and six [6] PCAs were identified in the Phase One Study Area that are considered likely to cause an APEC on the Site, including the following:

PCA No.: 10 – Commercial Autobody Shops: associated with a commercial automotive repair facility that formerly operated on the '17 Prince Street' portion of the Phase One Property;

PCA No.: 10 – Commercial Autobody Shops: associated with a commercial automotive repair facility that formerly operated on the '388 Main Street East' portion of the Phase One Property;

PCA No.: 28 – Gasoline and Associated Products Storage in Fixed Tanks: associated with a UST formerly located immediately north of the dwelling on the '405 Pearl Street' portion of the Phase One Property;

PCA No.: 30 – Importation of Fill Material of Unknown Quality: associated with the three [3] buildings that were demolished on the '388 Main Street East' portion of the Phase One Property, including on each on the western, northern and eastern portion of this property;

PCA No.: 10 – Commercial Autobody Shops: associated with a commercial automotive repair facility that formerly operated on the property recognised as '409 Main Street East';

PCA No.: 10 – Commercial Autobody Shops: associated with a commercial automotive repair facility that formerly operated on the property recognised as '420 Main Street East';

PCA No.: 28 – Gasoline and Associated Products Storage in Fixed Tanks: associated with fuel storage tanks on the property recognised as '383 Main Street East';

PCA No.: 31 – Ink Manufacturing, Processing and Bulk Storage: associated with a print shop that formerly operated on the property recognised as '361 Main Street East';

PCA No.: 31 – Ink Manufacturing, Processing and Bulk Storage: associated with an active print shop on the property recognised as '357 Main Street East', and;

PCA No.: 45 – Pulp, Paper, and Paperboard Manufacturing and Processing: associated a paperboard container manufacturing facility that formerly operated on the property recognised as '383 Main Street East'.

(iii) Areas of Potential Environmental Concern: SOIL-MAT ENGINEERS' APEC table is presented below:

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Locations of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC #1	The historic automotive repair facility on the '17 Prince Street' portion of the Phase One Property.	10. Commercial Autobody Shop [PCA A]	On-Site	Metals, Petroleum Hydrocarbons [PHCs], Volatile Organic Compounds [VOCs], Polycyclic Aromatic Hydrocarbons [PAHs], Polychlorinated Biphenyls [PCBs] and Benzene, Toluene, Ethylbenzene and Xylenes [BTEX]	Soil and Groundwater
APEC #2	The historic automotive repair facility on the '388 Main Street East' portion of the Phase One Property.	10. Commercial Autobody Shop [PCA B]	On-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater
APEC #3	To the north of the dwelling on the '405 Pearl Street' portion of the Phase One Property.	28. Gasoline and Associated Products Storage in Fixed Tanks [PCA C]	On-Site	PHCs, PAHs and BTEX	Soil and Groundwater
APEC #4	In the immediate vicinity of the three [3] former structures on the '388 Main Street East' portion of the Phase One Property.	30. Importation of Fill Material of Unknown Quality [PCA D]	On-Site	Metals, PHCs and BTEX	Soil
APEC #5	The northeastern limit of the Phase One Property.	10. Commercial Autobody Shop [PCA E]	Off-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Locations of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC #6	The eastern limit of the Phase One Property.	10. Commercial Autobody Shop [PCA F]	Off-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater
APEC #7	The northern limit of the Phase One Property.	28. Gasoline and Associated Products Storage in Fixed Tanks [PCA G]	Off-Site	PHCs, PAHs, and BTEX	Soil and Groundwater
APEC #8	The western limit of the Phase One Property.	31. Ink Manufacturing, Processing and Bulk Storage [PCA H]	Off-Site	Metals, PHCs, VOCs, and BTEX.	Soil
APEC #9	The western limit of the Phase One Property.	31. Ink Manufacturing, Processing and Bulk Storage [PCA I]	Off-Site	Metals, PHCs, VOCs, and BTEX.	Soil
APEC #10	The northern limit of the Phase One Property.	45. Pulp, Paper, and Paperboard Manufacturing and Processing [PCA J]	Off-Site	Metals, VOCs, PHCs and PAHs.	Soil and Groundwater

- (i) Phase One Conceptual Site Model: SOIL-MAT ENGINEERS' Phase One CSM is included in Appendix 'J' for reference.

8.0 CONCLUSIONS

The Phase One Environmental Site Assessment [ESA] conducted for this property consisted of a historical records review, interviews and a reconnaissance of the Phase One Property. The research and reporting were conducted in accordance with Ontario Regulation 153/04 [as amended] in order to support the future filing of a Record of Site Condition [RSC] for the Phase One Property.

At the time of this Report, the Phase One Property was comprised of six [6] adjoining parcels of land that together form an irregular shaped parcel of land located on the south side of Main Street East between Prince Street and Bruce Street in the Town of Milton, Ontario. Specifically, the Phase One Property was comprised of the following parcels of land:

- 388 Main Street East: This portion of the Phase One Property was occupied by a two-storey, basementless, five [5] unit, mixed commercial and residential building. The building was occupied by the following tenants:
 - Slessor Quality Automobiles / Right Choice Auto Sales, who also occupy the storage unit on the southwestern portion of the building;
 - An apartment unit [Unit 1];
 - The World of My Baby (WOMB) [Unit 2];
 - An apartment unit [Unit 3], and;
 - Golden Fish and Chips / Sushi Yama [Unit 4].
- 17 Prince Street: This portion of the Phase One Property was occupied by a 1^{1/2}-storey dwelling, with a basement level, and a single-storey, basementless, attached garage located immediately east of the dwelling;
- 395 Pearl Street: This portion of the Phase One Property was occupied by a 1^{1/2}-storey, basementless, dwelling;
- 399 Pearl Street: This portion of the Phase One Property was occupied by a 1^{1/2}-storey dwelling, with a basement level;
- 405 Pearl Street: This portion of the Phase One Property was occupied by a single-storey, basementless, dwelling, and;
- 409 Pearl Street: This portion of the Phase One Property was occupied by a single-storey, basementless, dwelling.

The remainder of the Phase One Property was comprised of a mixture of an asphaltic-concrete covered parking lot areas and landscaped yard areas.

The Phase One research revealed four [4] potentially contaminating activities [PCAs] on the Phase One Property, including the following:

- Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the '17 Prince Street' portion of the Phase One Property;
- Information contained in the Vernon City Directory Series, and the title search of the Phase One Property, revealed a commercial automotive repair facility formerly operated on the '388 Main Street East' portion of the Phase One Property. Of note, this was also confirmed via an interview with Mr. Laffin [Property Manager for the Phase One Property];

- Information provided by Mr. Laffin revealed an underground storage tank [UST] was formerly located immediately north of the dwelling on the '405 Pearl Street' portion of the Phase One Property, and;
- Information contained in available aerial photographs, topographic maps, and a Fire Insurance Plan from 1927 revealed three [3] buildings were demolished on the '388 Main Street East' portion of the Phase One Property, including on each on the western, northern and eastern portion of this property.

The neighbouring and nearby lands are comprised of a mixture of residential, commercial, and institutional use lands. The current and historic operations on properties located in the Phase One Study Area revealed six [6] PCAs that are considered likely to cause an area of potential environmental concern [APEC] on the Phase One Property, including the following:

- Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the property recognised as '409 Main Street East', which is located approximately 15 metres northwest [up-gradient] of the Phase One Property;
- Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the property recognised as '420 Main Street East', which is located approximately 10 metres northeast [up-gradient] of the Phase One Property;
- Information contained in the EcoLog ERIS database search revealed fuel storage tanks on the property recognised as '383 Main Street East', which is located approximately 55 metres northwest [up-gradient] of the Phase One Property;
- Information contained in the Vernon City Directory Series revealed a print shop formerly operated on the property recognised as '361 Main Street East', which is located approximately 50 metres west-southwest [trans-gradient/down-gradient] of the Phase One Property;
- Our visual observations of the Phase One Study Area revealed an active print shop on the property recognised as '357 Main Street East', which is located approximately 55 metres southwest [trans-gradient/down-gradient] of the Phase One Property, and;
- Information contained in the aerial photographs, an acknowledged Record of Site Condition [RSC ID# 79919], and the EcoLog ERIS database search revealed a paperboard container manufacturing facility that formerly operated on the property recognised as '383 Main Street East', which is located approximately 55 metres northwest [up-gradient] of the Phase One Property.

The specific PCAs, and associated APECs, in connection with the above identified environmental concerns include the following:

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Locations of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC #1	The historic automotive repair facility on the '17 Prince Street' portion of the Phase One Property.	10. Commercial Autobody Shop [PCA A]	On-Site	Metals, Petroleum Hydrocarbons [PHCs], Volatile Organic Compounds [VOCs], Polycyclic Aromatic Hydrocarbons [PAHs], Polychlorinated Biphenyls [PCBs] and Benzene, Toluene, Ethylbenzene and Xylenes [BTEX]	Soil and Groundwater
APEC #2	The historic automotive repair facility on the '388 Main Street East' portion of the Phase One Property.	10. Commercial Autobody Shop [PCA B]	On-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater
APEC #3	To the north of the dwelling on the '405 Pearl Street' portion of the Phase One Property.	28. Gasoline and Associated Products Storage in Fixed Tanks [PCA C]	On-Site	PHCs, PAHs and BTEX	Soil and Groundwater
APEC #4	In the immediate vicinity of the three [3] former structures on the '388 Main Street East' portion of the Phase One Property.	30. Importation of Fill Material of Unknown Quality [PCA D]	On-Site	Metals, PHCs and BTEX	Soil
APEC #5	The northeastern limit of the Phase One Property.	10. Commercial Autobody Shop [PCA E]	Off-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater
APEC #6	The eastern limit of the Phase One Property.	10. Commercial Autobody Shop [PCA F]	Off-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Locations of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC #7	The northern limit of the Phase One Property.	28. Gasoline and Associated Products Storage in Fixed Tanks [PCA G]	Off-Site	PHCs, PAHs, and BTEX	Soil and Groundwater
APEC #8	The western limit of the Phase One Property.	31. Ink Manufacturing, Processing and Bulk Storage [PCA H]	Off-Site	Metals, PHCs, VOCs, and BTEX.	Soil
APEC #9	The western limit of the Phase One Property.	31. Ink Manufacturing, Processing and Bulk Storage [PCA I]	Off-Site	Metals, PHCs, VOCs, and BTEX.	Soil
APEC #10	The northern limit of the Phase One Property.	45. Pulp, Paper, and Paperboard Manufacturing and Processing [PCA J]	Off-Site	Metals, VOCs, PHCs and PAHs.	Soil and Groundwater

Based on the findings of the Phase One Environmental Site Assessment, SOIL-MAT ENGINEERS & CONSULTANTS LTD. find the potential of Site contamination to be considered **MEDIUM** and therefore recommend that additional investigations **ARE** required at this time.

To reduce SOIL-MAT ENGINEERS' degree of uncertainty associated with the identified PCAs, and associated APECs, further assessment activities are recommended.

Each potential environmental liability, and our rationale for further assessment activities, is provided in table format below:

Area of Potential Environmental Concern	Environmental Liability	Recommendation	Rationale
APEC #1	11. PCA No.: 10: Commercial Autobody Shop [PCA A]	Advance two [2] to four [4] boreholes, each equipped with a groundwater monitoring well, inside and in the vicinity of the garage at 17 Prince Street. The contaminants of potential concern [COPCs] should include Metals, PHCs, VOCs, PAHs, and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the 17 Prince Street property.
APEC #2	12. PCA No.: 10: Commercial Autobody Shop [PCA B]	Advance two [2] to four [4] boreholes, each equipped with a groundwater monitoring well, in the vicinity of the former automotive repair facility on the 388 Main Street portion of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, PAHs, and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the 388 Main Street East property.
APEC #3	13. PCA No.: 28: Gasoline and Associated Products Storage in Fixed Tanks [PCA C]	Advance two [2] boreholes, each equipped with a groundwater monitoring well, north of the building on the 405 Pearl Street portion of the Phase One Property. The COPCs should include PHCs and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the former UST on the 405 Pearl Street portion of the Phase One Property.
APEC #4	14. PCA No.: 30: Importation of Fill Material of Unknown Quality [PCA D]	Advance a series of boreholes in the immediate vicinity of the former buildings on the 388 Main Street East portion of the Phase One Property. The COPCs should include Metals, PHCs and BTEX.	Assess the potential of adverse impacts to the soil medium as a result of the three [3] former buildings on the 388 Main Street East portion of the Phase One Property.
APEC #5	15. PCA No.: 10: Commercial Autobody Shop [PCA E]	Advance three [3] boreholes, each equipped with a groundwater monitoring well, along the northeastern limit of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, PAHs, and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the nearby 409 Main Street East property.
APEC #6	16. PCA No.: 10: Commercial Autobody Shop [PCA F]	Advance three [3] boreholes, each equipped with a groundwater monitoring well, along the eastern limit of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, PAHs, and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the nearby 420 Main Street East property.

Area of Potential Environmental Concern	Environmental Liability	Recommendation	Rationale
APEC #7	17. PCA No.: 28: Gasoline and Associated Products Storage in Fixed Tanks [PCA G]	Advance three [3] boreholes, each equipped with a groundwater monitoring well, along the northern limit of the Phase One Property. The COPCs should include PHCs and BTEX.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the fuel storage tanks on the nearby 383 Main Street East property.
APEC #8	18. PCA No.: 31: Ink Manufacturing, Processing and Bulk Storage [PCA H]	Advance three [3] boreholes along the western limit of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, and BTEX.	Assess the potential of adverse impacts to the soil medium as a result of the historical operations on the nearby 361 Main Street East property.
APEC #9	19. PCA No.: 31: Ink Manufacturing, Processing and Bulk Storage [PCA I]	Advance three [3] boreholes along the western limit of the Phase One Property. The COPCs should include Metals, PHCs, VOCs, and BTEX.	Assess the potential of adverse impacts to the soil medium as a result of the current operations on the nearby 357 Main Street East property.
APEC #10	20. PCA No.: 45: Pulp, Paper, and Paperboard Manufacturing and Processing [PCA J]	Advance three [3] boreholes, each equipped with a groundwater monitoring well, along the northern limit of the Phase One Property. The COPCs should include Metals, PHCs, and PAHs.	Assess the potential of adverse impacts to the soil and groundwater mediums as a result of the historical operations on the nearby 383 Main Street East property.

Although not considered an environmental liability to the Site, given the construction date of the buildings, it is possible that designated substances, such as asbestos containing materials, and ozone depleting substances, may be present in the buildings. As such, it is recommended that a non-intrusive designated substance survey of the buildings be undertaken before any planned demolition activities that may disturb building materials to identify where possible, designated substances that may be present in the buildings.

In addition to the above, this Office should be contacted if a suspected groundwater well is encountered during future construction activities to make arrangements for the water well to be abandoned as per Ontario Regulation 903 – Water Wells.

9.0 REPORT LIMITATIONS

Achieving the objectives that are stated in this report has required SOIL-MAT ENGINEERS to derive conclusions based upon the best and most recent information currently available to SOIL-MAT ENGINEERS. No investigative method can completely eliminate the possibility of obtaining partially imprecise information. SOIL-MAT ENGINEERS has expressed professional judgement in gathering and analysing the information obtained and in the formulation of its conclusions.

Information in this report was obtained from sources deemed to be reliable, however, no representation or warranty is made as to the accuracy of this information. To the best of SOIL-MAT ENGINEERS' knowledge, the information gathered from outside sources contained in this report on which SOIL-MAT ENGINEERS has formulated its opinions and conclusions, are both true and correct. SOIL-MAT ENGINEERS assumes no responsibility for any misrepresentation of facts gathered from outside sources.

This report was prepared to assess and document evidence of potential environmental contamination, and not to judge the acceptability of the risks associated with such environmental contamination. Much of the information gathered for this report is only accurate at the time of collection and a change in the Site conditions may alter the interpretation of SOIL-MAT ENGINEERS' findings. Furthermore, the reader should note

that the Site reconnaissance described in this report was an environmental assessment of the Site, not a regulatory compliance or an environmental audit of the Site.

SOIL-MAT ENGINEERS & CONSULTANTS LTD. prepared this Report for the account of the MIKMADA HOMES. The material in it reflects SOIL-MAT ENGINEERS' best judgement in light of the information available to it at the time of preparation. Any use which a third party makes of this report, or any reliance on or decisions to be made based on it, are the responsibility of such third parties. SOIL-MAT ENGINEERS accepts no responsibility for damages, if any suffered by any third party as a result of decisions made or actions based on this report.

We trust that this Phase One Environmental Site Assessment is satisfactory for your purposes. Please feel free to contact the undersigned if you have any questions.

Sincerely,
SOIL-MAT ENGINEERS & CONSULTANTS LTD.



Alex Lajkosz, B.Sc.
Environmental Technician



Keith Gleadall, B.A., EA Dipl.
Environmental Manager



Stephen R. Sears, B. Eng. Mgmt., P. Eng., QP_{ESA}
Review Engineer




Distribution: MIKADA HOMES [2]

Enclosures:	Appendix 'A'	Site Plan Drawings
	Appendix 'B'	Chain of Title
	Appendix 'C'	Town of Milton Correspondence
	Appendix 'D'	MOE Database Search Results
	Appendix 'E'	T.S.S.A. Correspondence
	Appendix 'F'	Ecolog ERIS Report
	Appendix 'G'	Aerial Photographs
	Appendix 'H'	Topographic Maps
	Appendix 'I'	Table of Current and Past Uses
	Appendix 'J'	Phase One Conceptual Site Model
	Appendix 'K'	Site Photographs
	Appendix 'L'	Qualifications of Assessors

Appendix 'A'

1. Drawing No.: 1.: Site Plan;
2. Drawing No.: 1A.: APECs;
3. Drawing No.: 2: Study Area View, and;
4. Drawing No.: 3: Site Location

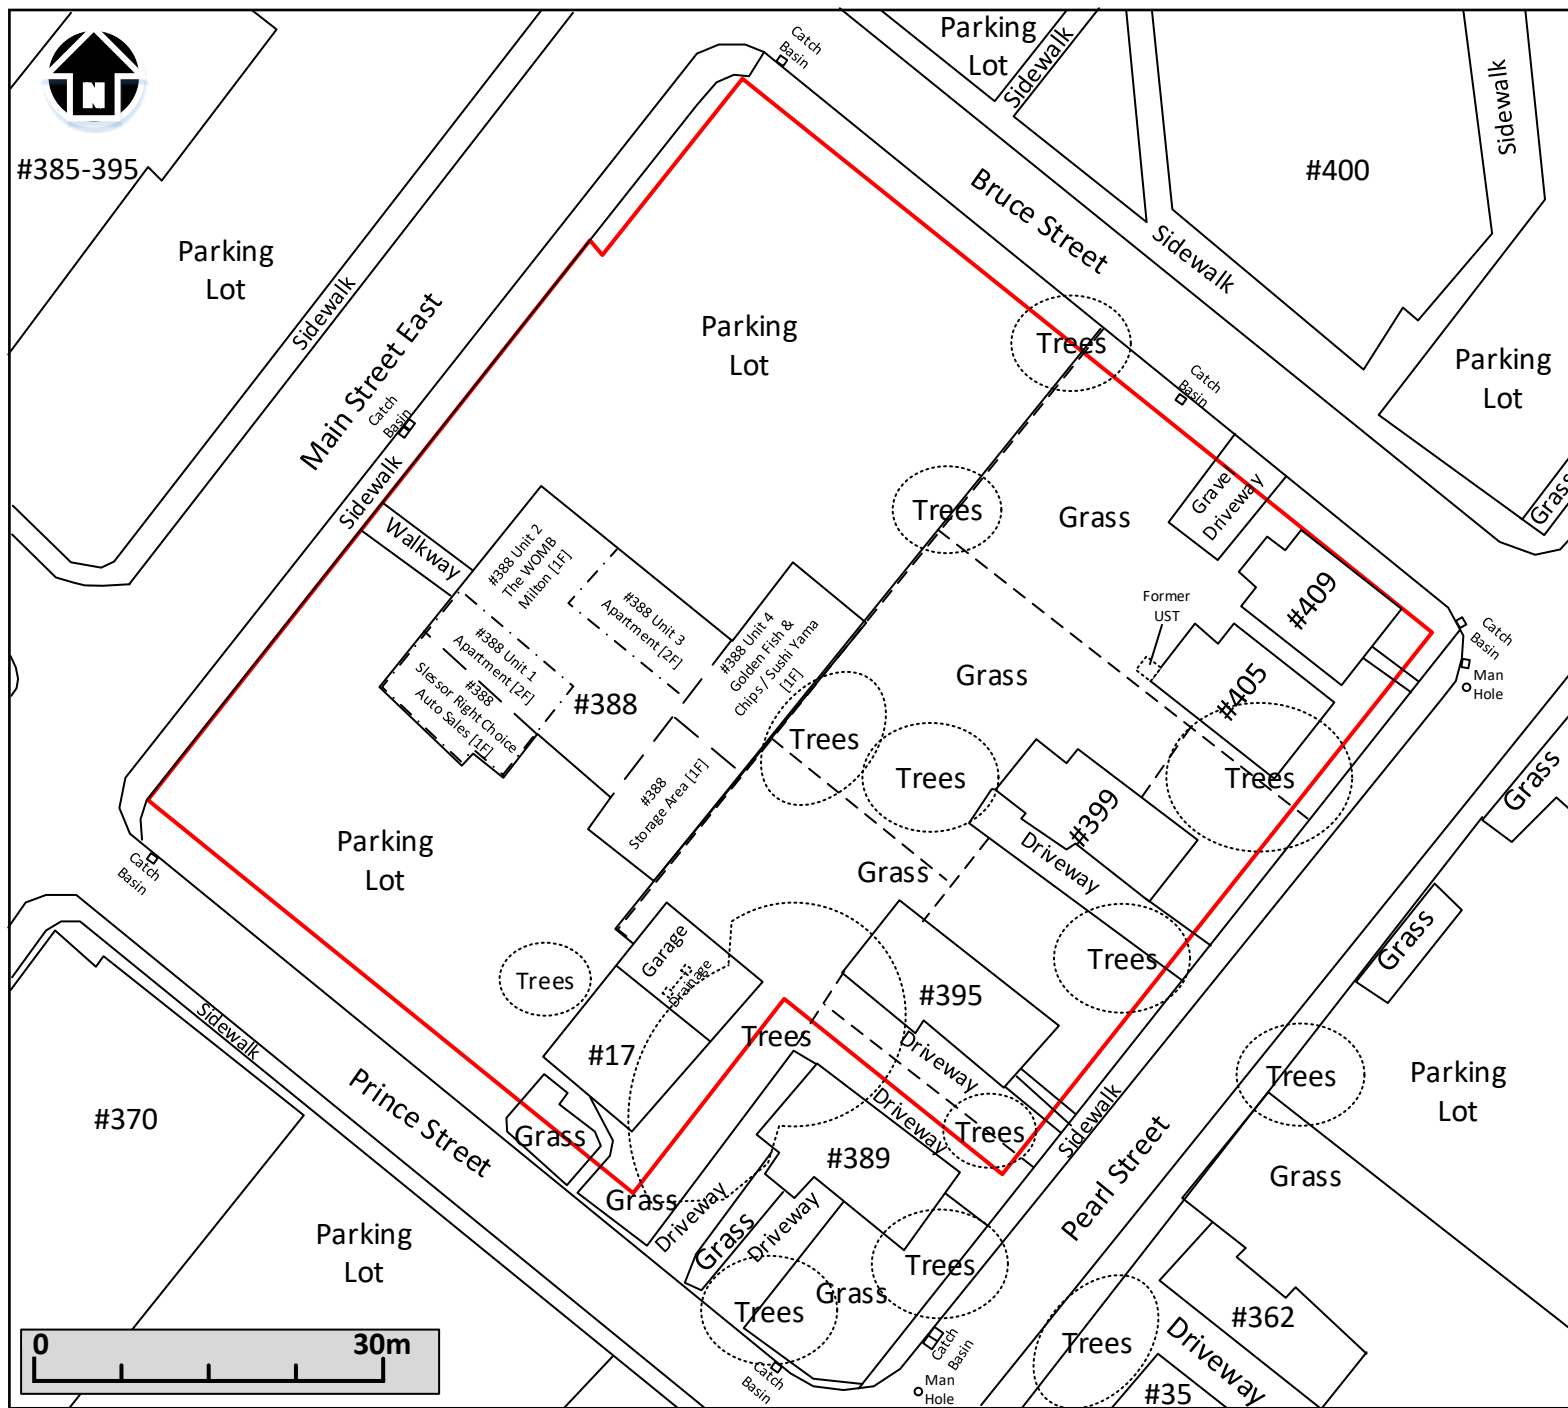

LEGEND

= Site Boundary

NOTES:

1. This map should be read in conjunction with Soil-Mat Engineers and Consultants Ltd. Report No.: SM 220141-E

Soil-Mat
Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE

Phase One Environmental Site Assessment
Main Street East and Prince Street
Milton, Ontario

DRAWING TITLE

Site Plan

PROJECT No. SM 220141-E

DATE March 2023

CHECKED KG

DRAWN AL

FILE NAME 220141 Site Plan.vsd

DRAWING No. 1



#385-395


APEC	PCA	PCA Description
7	28	Gasoline and Associated Products Storage in Fixed Tanks [PCA G]
10	45	Pulp, Paper, and Paperboard Manufacturing and Processing [PCA J]

Parking Lot

Main Street East

Prince Street

Parking Lot



APEC	PCA	PCA Description
4	30	Importation of Fill Material of Unknown Quality [PCAD]

APEC	PCA	PCA Description
2	10	Commercial Autobody Shop [PCAB]

APEC	PCA	PCA Description
3	28	Gasoline and Associated Products Storage in Fixed Tanks [PCA C]

APEC	PCA	PCA Description
1	10	Commercial Autobody Shop [PCA A]

APEC	PCA	PCA Description
8	31	Ink Manufacturing, Processing and Bulk Storage [PCA H]
9	31	Ink Manufacturing, Processing and Bulk Storage [PCA I]

APEC	PCA	PCA Description
5	10	Commercial Autobody Shop [PCA E]

APEC	PCA	PCA Description
6	10	Commercial Autobody Shop [PCA F]

LEGEND

- = Site Boundary
- = APEC #1
- = APEC #2
- = APEC #3
- = APEC #4
- = APEC #5
- = APEC #6
- = APEC #7
- = APEC #8
- = APEC #9
- = APEC #10

NOTES:

- This map should be read in conjunction with Soil-Mat Engineers and Consultants Ltd. Report No.: SM 220141-E

Soil-Mat

Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE


Phase One Environmental Site Assessment
Main Street East and Prince Street
Milton, Ontario

DRAWING TITLE

APECs

PROJECT No. SM 220141-E**DATE** April 2023**CHECKED** KG**DRAWN** AL**FILE NAME** 220141 Site Plan.vsd

DRAWING No. 1A

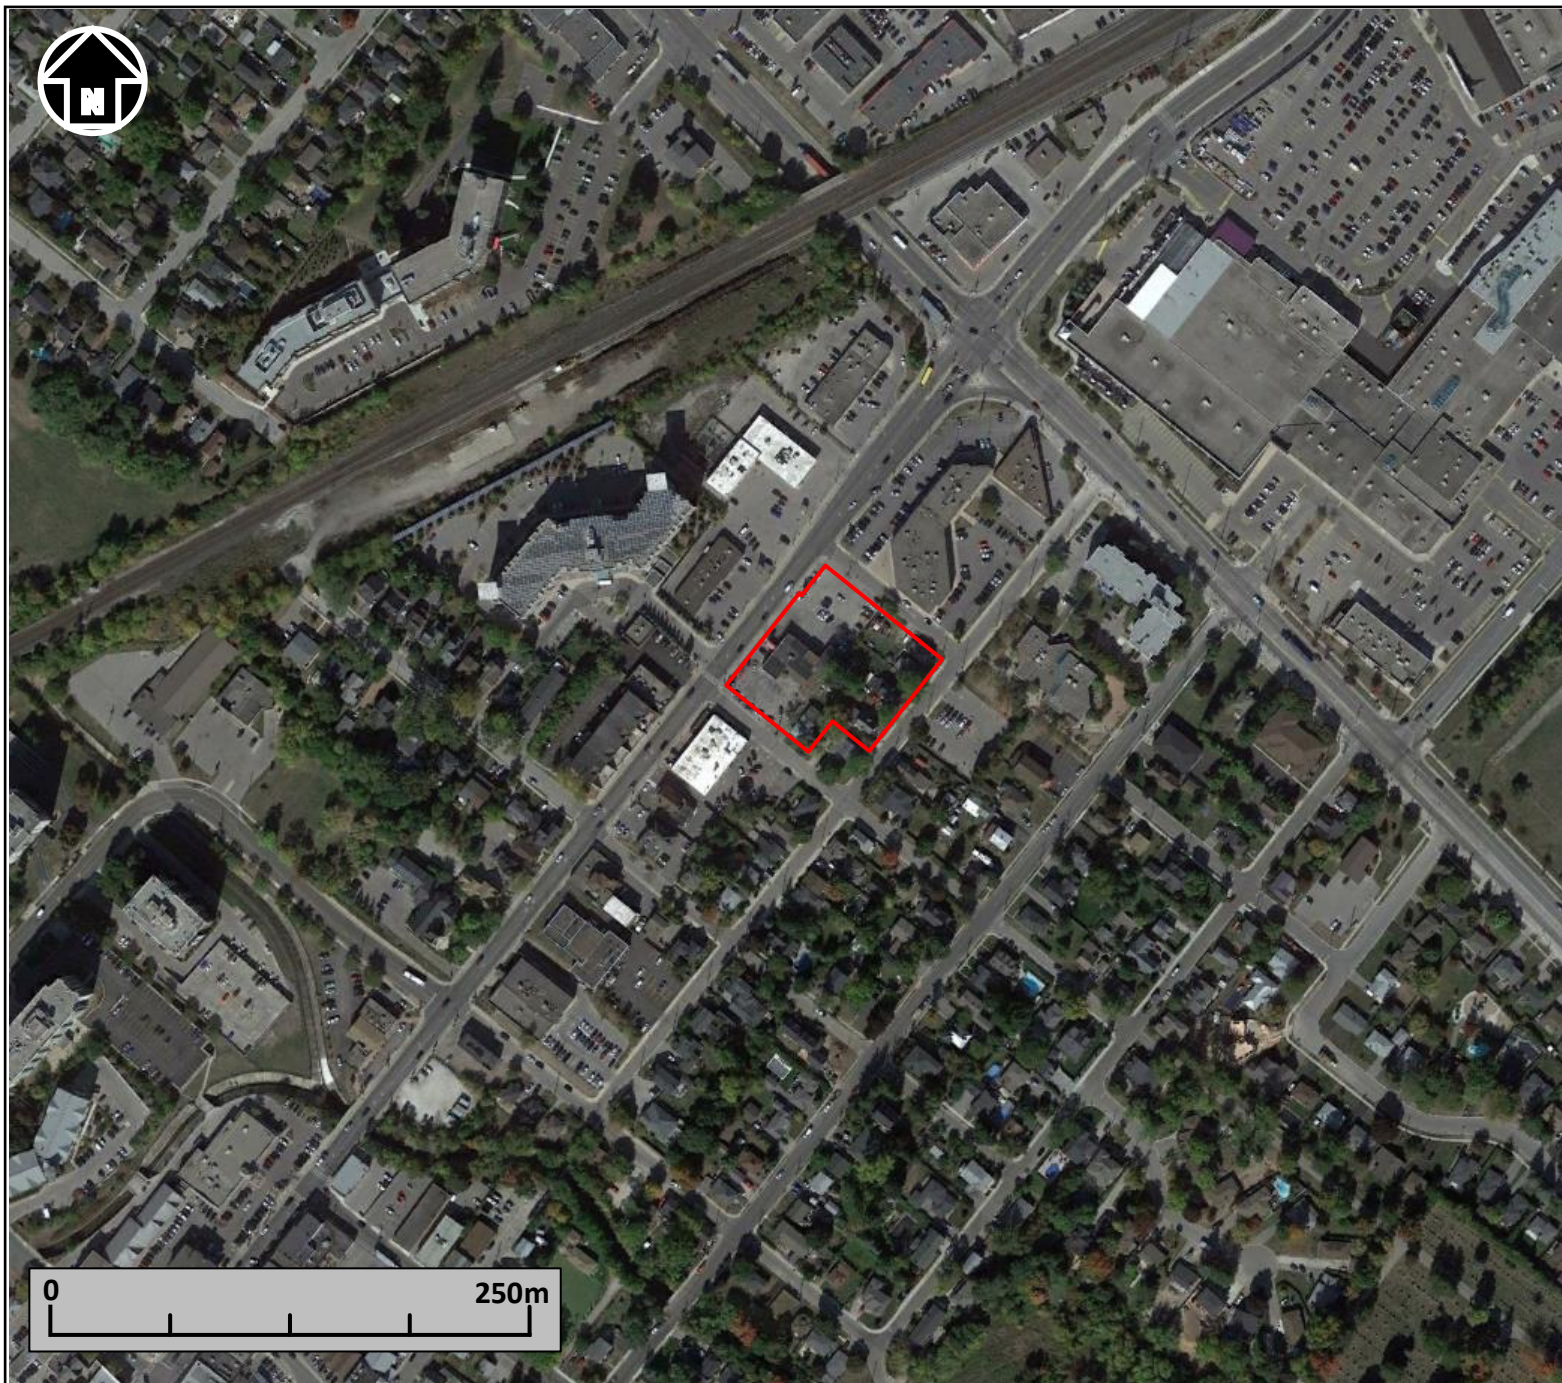

LEGEND



= Site Boundary

NOTES:

1. This map should be read in conjunction with Soil-Mat Engineers and Consultants Ltd. Report No.: SM 220141-E
2. Base map provided by:
© 2023 Google

Soil-Mat
Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE

Phase One Environmental Site Assessment
Main Street East and Prince Street
Milton, Ontario

DRAWING TITLE

Study Area View

PROJECT No. SM 220141-E

DATE March 2023

CHECKED KG

DRAWN AL

FILE NAME

220141 Site Plan 2.vsd

DRAWING No. 2



LEGEND



NOTES:

1. This map should be read in conjunction with Soil-Mat Engineers and Consultants Ltd. Report No.: SM 220141-E

2. Base map provided by:
© 2023 Mapquest

Soil-Mat
Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE

Phase One Environmental Site Assessment
Main Street East and Prince Street
Milton, Ontario

Site Location Plan

PROJECT No. SM 220141-E

DATE March 2023

CHECKED KG

DRAWN AL

FILE NAME
220141 Site Location.vsd

DRAWING No. 3

Appendix 'B'

1. Title Search Documents



BENO

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
834254	1995/01/30	ORDER		*** COMPLETELY DELETED ***		
850874	1996/04/16	CERT TAX ARREARS		*** COMPLETELY DELETED *** THE CORPORATION OF THE TOWN OF M ILTON		
852024	1996/05/23	DECLARATION		*** COMPLETELY DELETED *** THE CORPORATION OF THE TOWN OF M ILTON		
H646951	1996/09/30	CT TAX ARREAR CANC		SLESSOR, IVAN KINGSLEY		C
	REMARKS: S/T A	LIEN IN FAVOUR OF SLESSOR, IVAN KINGSLEY		AS IN H850874.		
H651830	1996/11/05	CHARGE		*** COMPLETELY DELETED *** SLESSOR MOTORS (MILTON) INC.	SLESSOR, GILLIAN	
H659474	1997/01/08	APL (GENERAL)		*** COMPLETELY DELETED *** SLESSOR MOTORS (MILTON) INC.		
	REMARKS: 834254					
H659846	1997/01/13	NOTICE AGREEMENT		SLESSOR MOTOR (MILTON) INC.	SLESSOR, IVAN KINGSLEY	C
	REMARKS: 719857					
H798765	1999/07/08	DISCH OF CHARGE		*** COMPLETELY DELETED *** SLESSOR, GILLIAN		
	REMARKS: RE: H651830					

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

PROPERTY DESCRIPTION:

PT LT 7, BLK 14, PL 9 , AKA TEETZEL'S SURVEY, N OF PEARL ST, AS IN 501695, T/W 75793 ; MILTON ; SUBJECT TO EXECUTION 93-05166, IF ENFORCEABLE. ; SUBJECT TO EXECUTION 93-05167, IF ENFORCEABLE. ; SUBJECT TO EXECUTION 93-05168, IF ENFORCEABLE. ;

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK

PIN CREATION DATE:

1996/05/27

OWNERS' NAMES

SLESSOR, BEVERLY ALLAN

CAPACITY SHARE

BENO

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/CHKD
EFFECTIVE 2000/07/29 THE NOTATION OF THE "BLOCK IMPLEMENTATION DATE" OF 1996/05/27 ON THIS PIN **WAS REPLACED WITH THE "PIN CREATION DATE" OF 1996/05/27** ** PRINTOUT INCLUDES ALL DOCUMENT TYPES AND DELETED INSTRUMENTS SINCE 1996/05/24 ** **SUBJECT, ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO: ** SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES * ** AND ESCHEATS OR FORFEITURE TO THE CROWN. ** THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF ** IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY ** CONVENTION. ** ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES. **DATE OF CONVERSION TO LAND TITLES: 1996/05/27 ** 5016951979/05/11TRANSFER*** COMPLETELY DELETED *** SLESSOR, GILLIAN 7660791991/06/27CHARGE*** COMPLETELY DELETED *** CANADA TRUSTCO MORTGAGE COMPANY 7660801991/06/27ASSIGNMENT GENERAL*** COMPLETELY DELETED *** 8264861994/08/02CT TAX ARREAR CANCEL REMARKS: CREATING A LIEN 8342581995/01/30ORDER*** COMPLETELY DELETED ***						
C						

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
H651827	1996/11/05	TRANSFER	\$126,000	SLESSOR, GILLIAN REMARKS: S/T EXECUTION NO. 93-05166, 93-05167, 93-05168- SLESSOR, GILLIAN, IF APPLICABLE	SLESSOR, BEVERLY ALLAN	C
H651828	1996/11/05	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN	SLESSOR, GILLIAN	
H659838	1997/01/13	APL COURT ORDER		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN		
		REMARKS: DELETE 834258				
H676829	1997/05/14	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN	LONDON LIFE INSURANCE COMPANY	
H676831	1997/05/14	POSTPONEMENT		*** COMPLETELY DELETED *** SLESSOR, GILLIAN	LONDON LIFE INSURANCE COMPANY	
		REMARKS: H651828 TO H676829				
H705950	1997/10/21	DISCH OF CHARGE		*** COMPLETELY DELETED *** CANADA TRUSTCO MORTGAGE COMPANY		
		REMARKS: RE: 766079				
H778389	1999/03/01	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN	ASSOCIATES MORTGAGE CORPORATION	
H778390	1999/03/01	NOTICE	SLESSOR, BEVERLY ALLAN	ASSOCIATES MORTGAGE CORPORATION	C	
		REMARKS: H778389 - RENTS				
H795344	1999/06/23	CHARGE		LONDON LIFE INSURANCE COMPANY	C	
H795345	1999/06/23	NOTICE		LONDON LIFE INSURANCE COMPANY	C	
		REMARKS: H795344				
H798766	1999/07/08	DISCH OF CHARGE		*** COMPLETELY DELETED *** SLESSOR, GILLIAN		
		REMARKS: RE: H651828				
H800776	1999/07/20	DISCH OF CHARGE		*** COMPLETELY DELETED *** ASSOCIATES MORTGAGE CORPORATION		
		REMARKS: RE: H778389				
H821779	1999/11/18	DISCH OF CHARGE		*** COMPLETELY DELETED *** LONDON LIFE INSURANCE COMPANY		
		REMARKS: RE: H676829				

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
HR336702	2004/11/18	LIEN		HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		C
HR1328318	2016/01/12	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: TAX LIEN						
HR1336067	2016/02/11	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: INCOME TAX LIEN						
HR1345475	2016/03/29	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: TAX LIEN						
HR1452670	2017/05/08	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: HR1336067.						
HR1546650	2018/05/31	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: HR1345475.						
HR1548735	2018/06/12	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: HR1328318.						

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

LAND
REGISTRY
OFFICE #20

24954-0142 (LT)

PAGE 1 OF 2
PREPARED FOR Alex
ON 2023/03/02 AT 16:04:01

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: LT 6, BLK 14, PL 9 , AKA TEETZEL'S SURVEY, N OF PEARL ST ; MILTON

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK

PIN CREATION DATE:

1996/05/27

OWNERS' NAMES

SLESSOR, KIM

CAPACITY SHARE

BENO

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
EFFECTIVE	2000/07/29	THE NOTATION OF THE	"BLOCK IMPLEMENTATION DATE" OF 1996/05/27 ON THIS PIN			
WAS REPLACED WITH THE	"PIN CREATION DATE"	OF 1996/05/27				
** PRINTOUT	INCLUDES ALL DOCUMENT TYPES AND	DELETED INSTRUMENTS SINCE 1996/05/24 **				
**SUBJECT,	ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO:					
**	SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES *					
**	AND ESCHEATS OR FORFEITURE TO THE CROWN.					
**	THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF					
**	IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY					
**	CONVENTION.					
**	ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES.					
**DATE OF CONVERSION TO	LAND TITLES: 1996/05/27 **					
53297	1956/07/17	AGREEMENT				C
350949	1972/11/30	TRANSFER		*** COMPLETELY DELETED ***	SLESSOR, BEVERLEY ALLAN	
708744	1988/12/16	CHARGE		*** COMPLETELY DELETED ***	CIBC MORTGAGE CORPORATION	
834257	1995/01/30	ORDER		*** COMPLETELY DELETED ***		
H651821	1996/11/05	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLEY ALLAN	SLESSOR, GILLIAN	
H659832	1997/01/13	APL COURT ORDER		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
		REMARKS: DELETE 834257				
H770758	1998/12/23	TRANSFER	\$164,900	SLESSOR, BEVERLEY ALLAN	SLESSOR, KIM	C
H770759	1998/12/23	CHARGE	\$162,529	SLESSOR, KIM	LONDON LIFE INSURANCE COMPANY	C
H774904	1999/02/03	DISCH OF CHARGE		*** COMPLETELY DELETED *** SLESSOR, GILLIAN		
		REMARKS: RE: H651821				
H792812	1999/06/07	DISCH OF CHARGE		*** COMPLETELY DELETED *** CIBC MORTGAGE CORPORATION		
		REMARKS: RE: 708744				

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

LAND
REGISTRY
OFFICE #20

24954-0143 (LT)

PAGE 1 OF 3
PREPARED FOR Alex
ON 2023/03/02 AT 16:09:49

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: LT 5, BLK 14, PL 9 , AKA TEETZEL'S SURVEY, N OF PEARL ST ; MILTON

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK

PIN CREATION DATE:

1996/05/27

OWNERS' NAMES

MILTON MOTOR SALES LIMITED

CAPACITY

SHARE

BENO

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
EFFECTIVE	2000/07/29	THE NOTATION OF THE	"BLOCK IMPLEMENTATION DATE" OF 1996/05/27 ON THIS PIN			
WAS REPLACED WITH THE	"PIN CREATION DATE"	OF 1996/05/27				
** PRINTOUT	INCLUDES ALL DOCUMENT TYPES AND	DELETED INSTRUMENTS SINCE 1996/05/24 **				
**SUBJECT,	ON FIRST REGISTRATION UNDER THE	LAND TITLES ACT, TO:				
**	SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES	*				
**	AND ESCHEATS OR FORFEITURE TO THE CROWN.					
**	THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF					
**	IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY					
**	CONVENTION.					
**	ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES.					
**DATE OF CONVERSION TO	LAND TITLES: 1996/05/27 **					
426349	1975/12/31	TRANSFER	\$2		MILTON MOTOR SALES LIMITED	C
655097	1986/11/28	CHARGE		*** COMPLETELY DELETED ***	ROYAL TRUST CORPORATION OF CANADA	
834256	1995/01/30	ORDER		*** COMPLETELY DELETED ***		
835836	1995/03/16	CERT TAX ARREARS		*** COMPLETELY DELETED ***		
850878	1996/04/16	CT TAX ARREAR CANC		*** COMPLETELY DELETED ***	THE CORPORATION OF THE TOWN OF MILTON	
	REMARKS: RE: 835836	"ABSTRACTED MAY 26 '99 J. MENARD"				
H636578	1996/07/04	CHARGE		*** COMPLETELY DELETED ***		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
H645106	1996/09/13	DISCH OF CHARGE		MILTON MOTOR SALES LIMITED *** COMPLETELY DELETED *** ROYAL TRUST CORPORATION OF CANADA	CANADA TRUSTCO MORTGAGE COMPANY	
	REMARKS: RE: 655097					
H650699	1996/10/30	CHARGE		*** COMPLETELY DELETED *** MILTON MOTOR SALES LIMITED	BENEFICIAL REALTY LTD.	
H650700	1996/10/30	NOTICE		*** COMPLETELY DELETED *** MILTON MOTOR SALES LIMITED	BENEFICIAL REALTY LTD.	
	REMARKS: ASSIGNMENT OF RENTS H650699					
H651819	1996/11/05	CHARGE		*** COMPLETELY DELETED *** MILTON MOTOR SALES LIMITED	SLESSOR, GILLIAN	
H659834	1997/01/13	APL COURT ORDER		*** COMPLETELY DELETED *** MILTON MOTOR SALES LIMITED		
	REMARKS: DELETE 834256					
H778393	1999/03/01	CHARGE		*** COMPLETELY DELETED *** MILTON MOTOR SALES LIMITED	ASSOCIATES MORTGAGE CORPORATION	
H778394	1999/03/01	NOTICE		*** COMPLETELY DELETED *** MILTON MOTOR SALES LIMITED	ASSOCIATES MORTGAGE CORPORATION	
	REMARKS: H778393 - RENTS					
H798762	1999/07/08	DISCH OF CHARGE		*** COMPLETELY DELETED *** SLESSOR, GILLIAN		
	REMARKS: RE: H651819					
H849678	2000/05/29	CHARGE		*** COMPLETELY DELETED *** MILTON MOTOR SALES LIMITED	LONDON LIFE INSURANCE COMPANY	
H849679	2000/05/29	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** MILTON MOTOR SALES LIMITED	LONDON LIFE INSURANCE COMPANY	
	REMARKS: H849678 - RENTS					
H849680	2000/05/29	POSTPONEMENT		*** COMPLETELY DELETED *** ASSOCIATES MORTGAGE CORPORATION	LONDON LIFE INSURANCE COMPANY	
	REMARKS: H778393 TO H849678					
HR110916	2002/04/09	DISCH OF CHARGE		*** COMPLETELY DELETED ***		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
		REMARKS: RE: H650699		ASSOCIATES MORTGAGE CORPORATION		
HR110918	2002/04/09	DISCH OF CHARGE		*** COMPLETELY DELETED *** CANADA TRUSTCO MORTGAGE COMPANY		
		REMARKS: RE: H636578				
HR123044	2002/06/10	CHARGE	\$168,000	MILTON MOTOR SALES LIMITED	CIBC MORTGAGES INC., TRADING AS FIRSTLINE MORTGAGES	C
HR123046	2002/06/10	NO ASSGN RENT GEN		MILTON MOTOR SALES LIMITED	CIBC MORTGAGES INC., TRADING AS FIRSTLINE MORTGAGES	C
		REMARKS: HR123044 - RENTS				
HR128549	2002/07/02	DISCH OF CHARGE		*** COMPLETELY DELETED *** LONDON LIFE INSURANCE COMPANY		
		REMARKS: RE: H849678				
HR164420	2002/12/05	DISCH OF CHARGE		*** COMPLETELY DELETED *** ASSOCIATES MORTGAGE CORPORATION		
		REMARKS: RE: H778393				
HR332656	2004/11/01	LIEN		HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		C

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

PROPERTY DESCRIPTION:

PT LT 4, BLK 14, PL 9 , AKA TEETZEL'S SURVEY, N OF PEARL ST, AS IN 518468, T/W 518468 ; MILTON ; SUBJECT TO EXECUTION 93-05166, IF ENFORCEABLE. ; SUBJECT TO EXECUTION 93-05167, IF ENFORCEABLE. ; SUBJECT TO EXECUTION 93-05168, IF ENFORCEABLE. ;

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK

PIN CREATION DATE:

1996/05/27

OWNERS' NAMES

SLESSOR, BEVERLY ALLAN

CAPACITY SHARE

BENO

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/CHKD
EFFECTIVE 2000/07/29 THE NOTATION OF THE "BLOCK IMPLEMENTATION DATE" OF 1996/05/27 ON THIS PIN **WAS REPLACED WITH THE "PIN CREATION DATE" OF 1996/05/27** ** PRINTOUT INCLUDES ALL DOCUMENT TYPES AND DELETED INSTRUMENTS SINCE 1996/05/24 ** **SUBJECT, ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO: ** SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES * ** AND ESCHEATS OR FORFEITURE TO THE CROWN. ** THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF ** IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY ** CONVENTION. ** ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES. **DATE OF CONVERSION TO LAND TITLES: 1996/05/27 ** 5184681980/02/28TRANSFER*** COMPLETELY DELETED *** 5184691980/02/28CHARGE*** COMPLETELY DELETED *** 7859991992/06/03CHARGE*** COMPLETELY DELETED *** H6403531996/08/02DISCH OF CHARGE*** COMPLETELY DELETED *** AUGER, CHARLES J. REMARKS: RE: 518469 H6403541996/08/02TRANSFER SLESSOR, GILLIAN REMARKS: S/T LEGAL AID NO. 93-5166, SLESSOR, GILLIAN (JILL)- IF APPLICABLE SLESSOR, GILLIAN SLESSOR, BEVERLY ALLAN C						

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
H640355	1996/08/02	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN	CANADA TRUSTCO MORTGAGE COMPANY	
H640356	1996/08/02	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN	CANADIAN IMPERIAL BANK OF COMMERCE	
H644882	1996/09/11	DISCH OF CHARGE		*** COMPLETELY DELETED *** CANADIAN IMPERIAL BANK OF COMMERCE		
	REMARKS: RE: 785999					
H651813	1996/11/05	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN	SLESSOR, GILLIAN	
H676834	1997/05/14	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN	LONDON LIFE INSURANCE COMPANY	
H676838	1997/05/14	POSTPONEMENT		*** COMPLETELY DELETED *** SLESSOR, GILLIAN	LONDON LIFE INSURANCE COMPANY	
	REMARKS: 651813 TO 676834					
H705951	1997/10/21	DISCH OF CHARGE		*** COMPLETELY DELETED *** CANADA TRUSTCO MORTGAGE COMPANY		
	REMARKS: RE: H640355					
H727966	1998/03/19	DISCH OF CHARGE		*** COMPLETELY DELETED *** CANADIAN IMPERIAL BANK OF COMMERCE		
	REMARKS: RE: H640356					
H778385	1999/03/01	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN	ASSOCIATES MORTGAGE CORPORATION	
H778386	1999/03/01	NOTICE		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN	ASSOCIATES MORTGAGE CORPORATION	
	REMARKS: H778385 - RENTS					
H798763	1999/07/08	DISCH OF CHARGE		*** COMPLETELY DELETED *** SLESSOR, GILLIAN		
	REMARKS: RE: H651813					
HR110029	2002/04/04	DISCH OF CHARGE		*** COMPLETELY DELETED *** ASSOCIATES MORTGAGE CORPORATION		
	REMARKS: RE: H778385					

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
HR110364	2002/04/05	CHARGE	\$112,000	SLESSOR, BEVERLY ALLAN	LONDON LIFE INSURANCE COMPANY	C
HR120022	2002/05/28	DISCH OF CHARGE		*** COMPLETELY DELETED *** LONDON LIFE INSURANCE COMPANY		
		REMARKS: RE: H676834				
HR907677	2011/02/11	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
HR908709	2011/02/16	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
HR1306940	2015/10/14	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
		REMARKS: HR907677.				
HR1328592	2016/01/13	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
		REMARKS: TAX LIEN				
HR1336067	2016/02/11	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
		REMARKS: INCOME TAX LIEN				
HR1345475	2016/03/29	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
		REMARKS: TAX LIEN				
HR1452670	2017/05/08	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
		REMARKS: HR1336067.				
HR1546650	2018/05/31	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
HR1548729	2018/06/12	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
HR1548770	2018/06/12	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

LAND
REGISTRY
OFFICE #20

24954-0145 (LT)

PAGE 1 OF 3
PREPARED FOR Alex
ON 2023/03/03 AT 08:16:17

ONLAND

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: PT LT 4, BLK 14, PL 9 , AKA TEETZEL'S SURVEY, N OF PEARL ST, AS IN 371921, S/T 371921 ; MILTON

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK

PIN CREATION DATE:

1996/05/27

OWNERS' NAMES

SLESSOR, BEVERLEY

CAPACITY

SHARE

BENO

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
EFFECTIVE 2000/07/29 THE NOTATION OF THE "BLOCK IMPLEMENTATION DATE" OF 1996/05/27 ON THIS PIN **WAS REPLACED WITH THE "PIN CREATION DATE" OF 1996/05/27** ** PRINTOUT INCLUDES ALL DOCUMENT TYPES AND DELETED INSTRUMENTS SINCE 1996/05/24 ** **SUBJECT, ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO: ** SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES * ** AND ESCHEATS OR FORFEITURE TO THE CROWN. ** THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF ** IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY ** CONVENTION. ** ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES. **DATE OF CONVERSION TO LAND TITLES: 1996/05/27 **						
371921	1973/08/31	TRANSFER	\$2		SLESSOR, BEVERLEY	C
751297	1990/09/21	CHARGE		*** COMPLETELY DELETED ***	HALTON COMMUNITY CREDIT UNION LIMITED	
834255	1995/01/30	ORDER		*** COMPLETELY DELETED ***		
H651814	1996/11/05	CHARGE		*** COMPLETELY DELETED *** SLESSOR, BEVERLEY	SLESSOR, GILLIAN	
H659833	1997/01/13	APL COURT ORDER		*** COMPLETELY DELETED *** SLESSOR, BEVERLY ALLAN		
		REMARKS: DELETE 834255				
H682914	1997/06/18	CERT TAX ARREARS		*** COMPLETELY DELETED ***		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
H749613	1998/08/11	CT TAX ARREAR CANC		THE CORPORATION OF THE TOWN OF MILTON *** COMPLETELY DELETED ***	THE CORPORATION OF THE TOWN OF MILTON	
REMARKS: RE: H682914						
H798764	1999/07/08	DISCH OF CHARGE		*** COMPLETELY DELETED *** SLESSOR, GILLIAN		
REMARKS: RE: H651814						
HR1176047	2014/04/22	DISCH OF CHARGE		*** COMPLETELY DELETED *** TANDEM FINANCIAL CREDIT UNION LIMITED		
REMARKS: 751297.						
HR1328318	2016/01/12	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: TAX LIEN						
HR1328592	2016/01/13	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: TAX LIEN						
HR1336067	2016/02/11	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: INCOME TAX LIEN						
HR1345475	2016/03/29	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: TAX LIEN						
HR1452670	2017/05/08	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: HR1336067.						
HR1546650	2018/05/31	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
REMARKS: HR1345475.						

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.



PARCEL REGISTER (ABBREVIATED) FOR PROPERTY IDENTIFIER

LAND
REGISTRY
OFFICE #20

24954-0145 (LT)

PAGE 3 OF 3

PREPARED FOR Alex

ON 2023/03/03 AT 08:16:17

ONLAND

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
HR1548729	2018/06/12	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
		REMARKS: HR1328592.				
HR1548735	2018/06/12	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF CANADA AS REPRESENTED BY THE MINISTER OF NATIONAL REVENUE		
		REMARKS: HR1328318.				

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

Appendix 'C'

1. Town of Milton Correspondence

Town of Milton GIS

Personal information contained on this form is collected under the Municipal Freedom of Information and Protection of Privacy Act and will be used to respond to your request. Questions about this collection should be directed to the GIS Technician 905-878-7252 ext 2355.

Contact Information

First Name: *

Alex

Last Name *

Lajkosz

Email Address: *

alajkosz@soilmat.ca

Phone number:

905 318-7440

Street Address:

Town

Postal Code:

Milton

Comments *

Hi there,

I was wondering if your department has any information on any past environmental site assessments for the following addresses:

388 Main Street East

17 Prince Street

395 Pearl Street

399 Pearl Street

405 Pearl Street

409 Pearl Street

Thanks,

Alex Lajkosz

Attachment (5MB max)

Thank You

**A copy of your form submission will be emailed to you using the address you have provided.
This email may take a few moments to process.**

Appendix 'D'

1. MOE Database Search Results

Ministry of the Environment,
Conservation and Parks

Ministère de l'Environnement, de la
Protection de la nature et des Parcs

Access and Privacy Office

Bureau de l'accès à l'information et
de la protection de la vie privée

12th Floor
40 St. Clair Avenue West
Toronto ON M4V 1M2
Tel: (416) 314-4075

12^e étage
40, avenue St. Clair ouest
Toronto ON M4V 1M2
Tél. : (416) 314-4075



March 8, 2023

Alex Lajkosz
Soil-Mat Engineers and Consultants
401 Grays Road
Hamilton, Ontario L8E 2Z3
alajkosz@soilmat.ca

Dear Alex Lajkosz:

RE: **MECP FOI A-2023-01357, Your Reference 220141 – Decision Letter**

This letter is in response to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to 388 Main Street East, 17 Prince Street, 395 Pearl Street and 409 Pearl Street, Milton.

After a thorough search through the files of the ministry's Halton Peel District Office, Environmental Assessment and Permissions Division (EAPD), Environmental Monitoring and Reporting Branch (EMRB), Environmental Investigations and Enforcement Branch (EIEB), and Safe Drinking Water Branch (SDW) no records were located responsive to your request. **This file is now closed.**

You may request a review of my decision within 30 days from the date of this letter by contacting the Information and Privacy Commissioner/Ontario at <http://www.ipc.on.ca>. Please note there may be a fee associated with submitting the appeal.

If you have any questions, please contact Tolani Abraham at
Tolani.Abraham2@ontario.ca.

Yours truly,

ORIGINAL SIGNED BY

Ryan Gunn
Manager (A), Access and Privacy Office

Appendix 'E'

1. T.S.S.A Correspondence

Alex Lajkosz

From: Public Information Services <publicinformationservices@tssa.org>
Sent: Thursday, March 9, 2023 1:34 PM
To: Alex Lajkosz
Subject: RE: Underground Fuel Tanks (Main St E and Prince St Development, Milton)

Please refrain from sending documents to head office. The Public Information (PI) team works remotely, mailing in applications will lengthen the overall processing time.

NO RECORD FOUND IN CURRENT DATABASE

Hello,

Thank you for your request for confirmation of public information. TSSA has performed a preliminary search of TSSA's current database.

- We confirm that there are no records in our current database of any fuel storage tanks at the subject address(es).

This is not a confirmation that there are no records in the archives. For a further search in our archives, please submit an application for release of public information (PI Form) through TSSA's new Service Prepayment Portal. The associated fee must be paid via credit card (Visa or MasterCard) through a secure site.

Please follow the steps below to access the new application(s) and Service Prepayment Portal:

1. Click [Release of Public Information - TSSA](#) - TSSA and click "need a copy of a document";
2. Select the appropriate application, download it and complete it in full; and
3. Proceed to page 3 of the application and click the link TSSA Service Prepayment Portal under payment options (the link will take you the secure site to pay for the release via credit card).

Accessing the Service Prepayment Portal:

1. Select new or existing customer (*if you are an existing customer, you will need your account # & postal code to access your account);
2. Select the program area: AD (Amusement Devices), BPV (Boilers and Pressure Vessels), ED (Elevating Devices), FS (Fuels Services), OE (Operating Engineers) or SKI (Ski Lifts) and click continue;
3. Enter the application form number (obtained from bottom left corner of application form) and click continue;
 - a. When selecting the application form number from the drop-down menu, please make sure you select the application that begins with "PI" (i.e. PI-FS, PI-BPV etc.);
4. Complete the primary contact information section;
5. Complete the fees section;
6. Upload your completed application; and
7. Upload supporting documents (if required) and click continue.

Once all steps have been successfully completed, you will receive your receipt via email.

Questions? Please contact TSSA's Public Information Release team at publicinformationservices@tssa.org.

Although TSSA believes the information provided pursuant to your request is accurate, please note that TSSA does not warrant this information in any way whatsoever.

Kind Regards,



Nicola Carty | Public Information Agent

Public Information
345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel: +1 416-734-3221 | E-Mail: ncarty@tssa.org
www.tssa.org



Winner of 2022 5-Star Safety Cultures Award

From: Alex Lajkosz <alajkosz@soilmat.ca>
Sent: Thursday, March 9, 2023 8:54 AM
To: Public Information Services <publicinformationservices@tssa.org>
Subject: Underground Fuel Tanks (Main St E and Prince St Development, Milton)

[CAUTION]: This email originated outside the organisation.
Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Hi there,

I'm looking for any records of underground fuel storage tanks located at the following addresses in Milton, Ontario:

388 Main St E
17 Prince St
395 Pearl St
399 Pearl St
405 Pearl St
409 Pearl St
389 Pearl St
370 Main St E
420 Main St E
395 Main St E

Thanks,



Alex Lajkosz
Environmental Technician
SOIL-MAT ENGINEERS & CONSULTANTS LTD.
401 Grays Road, Hamilton, ON L8E 2Z3
T: 905.318.7440 M: 905.330.9164 www.soil-mat.ca

This e-mail, including any attachments, is privileged, confidential and subject to copyright. Any unauthorized use or disclosure is prohibited. If you are not the intended recipient please notify the sender immediately by return e-mail and delete the message and any attachments from your system.

 Please consider the environment before printing this email

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

Appendix 'F'

1. Ecolog ERIS Report



DATABASE REPORT

Project Property: 220141-E-G 388 Main Street East, 395-409
Pearl Street & 17 Prince Street, Milton
388 Main Street East, 395-409 Pearl Street
& 17 Prince Street
Milton ON

Project No: 220141-E-G

Report Type: RSC Report (Urban)

Order No: 23030300040

Requested by: Soil-Mat Engineers & Consultants Ltd.

Date Completed: March 3, 2023

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	6
Executive Summary: Site Report Summary - Surrounding Properties.....	7
Executive Summary: Summary By Data Source.....	27
Map.....	52
Aerial.....	53
Topographic Map.....	54
Detail Report.....	55
Unplottable Summary.....	238
Unplottable Report.....	241
Appendix: Database Descriptions.....	262
Definitions.....	271

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: 220141-E-G 388 Main Street East, 395-409 Pearl Street & 17 Prince Street, Milton
388 Main Street East, 395-409 Pearl Street & 17 Prince Street Milton ON

Project No: 220141-E-G

Order Information:

Order No: 23030300040
Date Requested: March 3, 2023
Requested by: Soil-Mat Engineers & Consultants Ltd.
Report Type: RSC Report (Urban)

Historical/Products:

ERIS Xplorer [ERIS Xplorer](#)
Topographic Map RSC Maps

Executive Summary: Report Summary

Database	Name	Searched	Project Property	Boundary to 0.30km	Total
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	0	0
CA	Certificates of Approval	Y	0	5	5
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	1	1
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	1	1
EASR	Environmental Activity and Sector Registry	Y	0	2	2
EBR	Environmental Registry	Y	0	0	0
ECA	Environmental Compliance Approval	Y	0	2	2
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	0	37	37
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	0	0
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	1	1
FSTH	Fuel Storage Tank - Historic	Y	0	2	2
GEN	Ontario Regulation 347 Waste Generators Summary	Y	0	113	113
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	0	0

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.30km</i>	<i>Total</i>
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0
INC	Fuel Oil Spills and Leaks	Y	0	1	1
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory	Y	0	1	1
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	14	14
PINC	Pipeline Incidents	Y	0	3	3
PRT	Private and Retail Fuel Storage Tanks	Y	0	1	1
PTTW	Permit to Take Water	Y	0	0	0
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	2	2
RST	Retail Fuel Storage Tanks	Y	0	0	0
SCT	Scott's Manufacturing Directory	Y	0	9	9
SPL	Ontario Spills	Y	0	12	12
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	0	42	42
Total:			0	249	249

Executive Summary: Site Report Summary - Project Property

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number

No records found in the selected databases for the project property.

Executive Summary: Site Report Summary - Surrounding Properties

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>1</u>	SCT	HEDSTROM CANADA	400 MAIN ST E MILTON ON L9T 4X5	NE/28.0	-0.94	<u>55</u>
<u>2</u>	WWIS		ON Well ID: 7384554	W/35.4	0.00	<u>55</u>
<u>3</u>	EHS		387 Main Street East Milton ON L9T 1P7	WNW/36.0	0.00	<u>56</u>
<u>3</u>	EHS		387 Main Street East Milton ON L9T 1P7	WNW/36.0	0.00	<u>56</u>
<u>3</u>	EHS		387 Main Street East Milton ON L9T 1P7	WNW/36.0	0.00	<u>56</u>
<u>4</u>	EHS		377 Main Street East Milton ON L9T 1P7	W/40.2	0.00	<u>56</u>
<u>4</u>	EHS		377 Main Street East Milton ON L9T 1P7	W/40.2	0.00	<u>57</u>
<u>4</u>	EHS		377 Main Street East Milton ON L9T 1P7	W/40.2	0.00	<u>57</u>
<u>5</u>	EHS		389 Main Street East Milton ON L9T 1P7	WNW/44.9	0.00	<u>57</u>
<u>5</u>	EHS		389 Main Street East Milton ON L9T 1P7	WNW/44.9	0.00	<u>57</u>
<u>5</u>	EHS		389 Main Street East Milton ON L9T 1P7	WNW/44.9	0.00	<u>57</u>
<u>6</u>	GEN	Animal Hospital of Milton	385 Main Stret East Milton ON L9T 1P7	WNW/45.6	0.00	<u>58</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
7	WWIS		ON Well ID: 7384553	W/50.9	0.00	58
8	WWIS		lot 13 con 2 ON Well ID: 7240691	NNE/52.1	-0.96	59
9	WWIS		ON Well ID: 7384552	W/58.5	0.00	60
10	EHS		409 Main Street East Milton ON L9T 1P7	NNW/58.7	0.00	61
10	GEN	The 2nd Step to Fitness Incorporated	409 Main Street East Milton ON L9T 1P7	NNW/58.7	0.00	61
10	GEN	CARMUR HOLDINGS LTD.	409 MAIN STREET EAST MILTON ON L9T 1P7	NNW/58.7	0.00	61
10	GEN	Carmur Holdings Ltd	409 Main Street East Milton ON L9T 1P7	NNW/58.7	0.00	62
11	WWIS		439 MAIN STREET EAS MILTON ON Well ID: 7262015	N/62.2	-0.70	62
12	WWIS		383 MAIN ST. Milton ON Well ID: 7107041	NW/67.4	0.00	65
13	EHS		407 Pine Street Milton ON L9T 1L3	ESE/68.6	-2.96	74
14	SPL	Union Gas Limited	362 Pearl St. Milton ON	S/72.3	-1.54	74
14	PINC	PIPELINE HIT 1 1/4"	362 PEARL ST.,MILTON,ON,L9T 1M7,CA ON	S/72.3	-1.54	74
15	EHS		425 Main Street East Milton ON	N/78.4	-0.13	75

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
16	EHS		425 - 429 Main Street East Milton ON	N/81.9	0.00	75
17	PRT	GRIEF CONTAINERS	383 MAIN ST MILTON ON L9T 1P7	WNW/83.4	0.00	75
17	SCT	GREIF CONTAINERS INC	383 MAIN ST E MILTON ON L9T 1P7	WNW/83.4	0.00	76
17	SCT	Greif Bros. Canada Inc.	383 Main St E Milton ON L9T 1P7	WNW/83.4	0.00	76
17	SCT	Greif Bros. Canada Inc.- Div. of Greif Bros. Corporation	383 Main St E Milton ON L9T 1P7	WNW/83.4	0.00	76
17	FSTH	GRIEF BROS CANADA INC	383 MAIN ST E MILTON ON L9T 1P7	WNW/83.4	0.00	76
17	EHS		383 Main Street Milton ON L9T 1P7	WNW/83.4	0.00	77
17	GEN	Greif Bros. Canada	383 Main Street East Milton ON L9T 1P7	WNW/83.4	0.00	77
17	FSTH	GRIEF BROS CANADA INC	383 MAIN ST E MILTON ON L9T 1P7	WNW/83.4	0.00	78
17	WWIS		383 MAIN ST. E. Milton ON Well ID: 7126539	WNW/83.4	0.00	78
17	RSC	DEL RIDGE (MAIN STREET) INC.	383 MAIN ST E, MILTON, ON, L9T 1P7 ON L9T 1P7	WNW/83.4	0.00	81
17	GEN	Delridge Homes	383 Main St. Milton ON L9T 1M4	WNW/83.4	0.00	82
17	FST	GRIEF BROS CANADA INC	383 MAIN ST E MILTON L9T 1P7 ON CA ON	WNW/83.4	0.00	82

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
18	WWIS		ON Well ID: 7270663	NE/91.0	-0.93	83
19	WWIS		ON Well ID: 7270664	NE/93.9	-0.94	84
20	EHS		425 - 439 Main Street East Milton ON	N/94.2	0.00	85
21	CA	R.M. OF HALTON	COURT ST/MAIN ST. MILTON TOWN ON	WSW/95.7	-1.38	85
21	CA	R.M. OF HALTON	COURT ST/MAIN ST. MILTON TOWN ON	WSW/95.7	-1.38	85
22	GEN	STREET PROPERTIES	425 MAIN STREET EAST MILTON ON L9T 1P7	N/96.9	-0.13	86
22	EHS		425 Main Street East Milton ON L9T 1P7	N/96.9	-0.13	86
22	EHS		425 Main Street East Milton ON L9T 1P7	N/96.9	-0.13	86
22	EHS		425 Main Street East Milton ON L9T 1P7	N/96.9	-0.13	86
23	EHS		18, 20 & 22 Ontario Street South Milton ON L9T 2M6	NE/97.3	-2.11	87
24	SCT	Materials Transportation Cda	420 Main St E Unit C Suite 584 Milton ON L9T 1P9	NE/100.2	-2.11	87
24	SCT	PGBELL	420 Main St E Suite 563 Milton ON L9T 1P9	NE/100.2	-2.11	87
24	GEN	Mayrose-Tycon Limited	420 Main Street East, Suite 598 Milton ON L9T 5G3	NE/100.2	-2.11	87

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
25	WWIS		ON Well ID: 7239049	NE/106.5	-1.33	88
26	WWIS		15 Court Street S lot 13 con 2 Milton ON Well ID: 7326515	SW/113.1	0.00	89
27	CA	MILTON TOWN - PINE ST/CONT.#PW-02-90	PINE ST/ONTARIO ST/BRUCE ST. MILTON TOWN ON	E/117.9	-4.08	91
28	WWIS		439 MAIN STREET EAST MILTON ON Well ID: 7262016	N/119.5	0.00	91
29	WWIS		ON Well ID: 7260653	NNE/120.2	-0.30	94
30	WWIS		439 MAIN STREET EAST MILTON ON Well ID: 7262017	N/123.9	0.00	95
31	CA	3176461 CANADA INC., NEXACOR REALTY	330 MAIN STREET MILTON ON	WSW/130.5	-2.31	98
31	GEN	BELL CANADA	330 MAIN STREET MILTON ON L9T 1P4	WSW/130.5	-2.31	98
31	GEN	Bell Canada	330 Main Street Milton ON	WSW/130.5	-2.31	99
31	GEN	Bell Canada	330 Main Street Milton ON	WSW/130.5	-2.31	99
31	GEN	Bell Canada	330 Main Street Milton ON	WSW/130.5	-2.31	99
31	GEN	Bell Canada	330 Main Street Milton ON	WSW/130.5	-2.31	100
31	GEN	Bell Canada	330 Main Street Milton ON	WSW/130.5	-2.31	100

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>31</u>	CFOT	BELL CANADA	330 MAIN ST E MILTON L9T 1P4 ON CA ON	WSW/130.5	-2.31	<u>101</u>
<u>31</u>	GEN	Bell Canada	330 Main Street Milton ON L9T 1P4	WSW/130.5	-2.31	<u>101</u>
<u>31</u>	GEN	Bell Canada	330 Main Street Milton ON L9T 1P4	WSW/130.5	-2.31	<u>102</u>
<u>31</u>	GEN	Bell Canada	330 Main Street Milton ON L9T 1P4	WSW/130.5	-2.31	<u>102</u>
<u>31</u>	GEN	Bell Canada	330 Main Street Milton ON L9T 1P4	WSW/130.5	-2.31	<u>103</u>
<u>31</u>	GEN	Bell Canada	330 Main Street Milton ON L9T 1P4	WSW/130.5	-2.31	<u>104</u>
<u>31</u>	DTNK	BELL CANADA	330 MAIN ST E MILTON L9T 1P4 ON CA ON	WSW/130.5	-2.31	<u>104</u>
<u>31</u>	GEN	Bell Canada	330 Main Street Milton ON L9T 1P4	WSW/130.5	-2.31	<u>105</u>
<u>31</u>	GEN	Bell Canada	330 Main Street Milton ON L9T 1P4	WSW/130.5	-2.31	<u>105</u>
<u>32</u>	EHS		335 Main Street East Milton ON L9T 1P5	WSW/132.5	-1.84	<u>106</u>
<u>32</u>	EHS		335 Main Street East Milton ON L9T 1P5	WSW/132.5	-1.84	<u>106</u>
<u>32</u>	EHS		335 Main Street East Milton ON L9T 1P5	WSW/132.5	-1.84	<u>106</u>
<u>33</u>	WWIS		446 PINE STREET Milton ON	E/140.0	-4.04	<u>107</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7288932			
34	PES	GUARANTEED GREEN	366 PINE ST MILTON ON L9T1K9	SSE/141.0	-4.01	109
34	PES	GUARANTEED GREEN	366 PINE ST MILTON ON L9T1K9	SSE/141.0	-4.01	110
34	PES	GUARANTEED GREEN	366 PINE ST MILTON ON L9T1K9	SSE/141.0	-4.01	110
35	ECA	The Regional Municipality of Halton	Main Street East and Ontario Street Right of Way Milton ON L6M 3L1	NNE/141.1	-1.06	110
36	EHS		Ontario St & Pine St Milton ON	E/151.6	-4.08	111
37	WWIS		55 ONTARIO STREET SOUTH MILTON ON Well ID: 2810303	ENE/159.7	-2.23	111
38	PINC	ENBRIDGE GAS INC	80 ONTARIO ST S,,MILTON,ON,L9T 2M7, CA ON	E/180.0	-3.99	113
39	WWIS		80 ONTARIO STREET NORTH MILTON ON Well ID: 7257999	NNW/188.8	0.00	113
40	EHS		310 Main St E Milton ON L9T1P4	SW/189.5	-5.11	116
40	GEN	Acclaim Health	310 Main Street East, Suite 104 Milton ON L9T 1P4	SW/189.5	-5.11	116
40	GEN	Acclaim Health	310 Main Street East, Suite 104 Milton ON L9T 1P4	SW/189.5	-5.11	117
40	GEN	Acclaim Health Milton Clinic	310 Main Street East, Suite 104 Milton ON L9T 1P4	SW/189.5	-5.11	117

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>40</u>	GEN	Acclaim Health Milton Clinic	310 Main Street East, Suite 104 Milton ON L9T 1P4	SW/189.5	-5.11	<u>117</u>
<u>40</u>	GEN	Acclaim Health Milton Clinic	310 Main Street East, Suite 104 Milton ON L9T 1P4	SW/189.5	-5.11	<u>118</u>
<u>40</u>	GEN	Acclaim Health Milton Clinic	310 Main Street East, Suite 104 Milton ON L9T 1P4	SW/189.5	-5.11	<u>118</u>
<u>41</u>	WWIS		55 ONTARIO ST SOUTH MILTON, ONT ON Well ID: 2810237	ENE/197.7	-1.58	<u>119</u>
<u>42</u>	WWIS		55 ONTARIO ST S lot 13 con 3 MILTON ON Well ID: 2810059	ENE/205.6	-0.93	<u>121</u>
<u>42</u>	WWIS		55 ONTARIO ST S lot 13 con 3 MILTON ON Well ID: 2810101	ENE/205.6	-0.93	<u>124</u>
<u>43</u>	WWIS		55 ONTARIO ST S lot 13 con 3 MILTON ON Well ID: 2810070	ENE/210.4	-1.14	<u>126</u>
<u>43</u>	WWIS		55 ONTARIO ST S MILTON ON Well ID: 2810181	ENE/210.4	-1.14	<u>130</u>
<u>44</u>	WWIS		80 Ontario Street North lot 14 con 2 Milton ON Well ID: 7370754	NW/210.7	-0.58	<u>132</u>
<u>45</u>	WWIS		80 ONTARIO STREET NORTH MILTON ON Well ID: 7257998	NW/213.3	-0.58	<u>134</u>
<u>46</u>	PES	LOBLAWS SUPERMARKETS LTD.	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>138</u>
<u>46</u>	SCT	Key Centres Ltd.	55 Ontario St S Milton ON L9T 2M3	ENE/220.1	-1.01	<u>138</u>
<u>46</u>	GEN	BLACK PHOTO CORPORATION	MILTON MALL, 55 ONTARIO ST. SOUTH C/O 371 GOUGH RD. MARKHAM ONT L3R 4B6 MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>138</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>46</u>	GEN	BLACK PHOTO CORPORATION	MILTON MALL, 55 ONTARIO ST. S. MILTON C/O 371 GOUGH RD. MARKHAM ON L9T 2M3	ENE/220.1	-1.01	<u>139</u>
<u>46</u>	GEN	BLACK PHOTO CORPORATION	55 ONTARIO STREET SOUTH MILTON MALL MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>139</u>
<u>46</u>	GEN	BLACK PHOTO CORPORATION 05-204	MILTON MALL, 55 ONTARIO ST. S.- MILTON C/O 371 GOUGH ROAD MARKHAM ON L9T 2M3	ENE/220.1	-1.01	<u>139</u>
<u>46</u>	GEN	BLACK PHOTO CORPORATION	MILTON MALL_ 55 ONTARIO STREET SOUTH____ MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>140</u>
<u>46</u>	GEN	BLACK PHOTO CORPORATION	MILTON MALL 55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>140</u>
<u>46</u>	GEN	PAT CAMPBELL DRUGS LTD.	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>141</u>
<u>46</u>	GEN	SHOPPERS DRUG MART	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>141</u>
<u>46</u>	GEN	PAT CAM(SEE & USE ON2530795)	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>141</u>
<u>46</u>	GEN	Towne Dental Group	55 Ontario St S Milton ON L9T 2M3	ENE/220.1	-1.01	<u>142</u>
<u>46</u>	GEN	Summit REIT	55 Ontario Street South Milton ON L9T 2M3	ENE/220.1	-1.01	<u>142</u>
<u>46</u>	PES	ZELLERS STORE #166 - MILTON MALL	55 ONTARIO ST S MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>143</u>
<u>46</u>	PES	SHOPPERS DRUG MART #0710 (MILTON DRUG MART)	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>143</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
46	GEN	Towne Dental	55 Ontario St S Milton ON L9T 2M3	ENE/220.1	-1.01	143
46	SPL	Hudson's Bay Company	1 - 55 Ontario St N Milton ON L9T 2T2	ENE/220.1	-1.01	144
46	SPL		55 Ontario Street Milton ON	ENE/220.1	-1.01	144
46	GEN	Westpen Properties Ltd.	55 Ontario Street South Toronto ON L9T 2M3	ENE/220.1	-1.01	145
46	PES	ZELLERS STORE #166 - MILTON MALL	55 ONTARIO ST S MILTON ON L9T 2M3	ENE/220.1	-1.01	145
46	CA	Westpen Properties Ltd./Les Proprietes Westpen Ltee	55 Ontario St S Milton ON L9T 2M3	ENE/220.1	-1.01	145
46	GEN	Westpen Properties	55 Ontario St. South Milton ON L9T 2M3	ENE/220.1	-1.01	146
46	GEN	Westpen Properties Ltd.	55 Ontario Street South Milton ON L9T 2M3	ENE/220.1	-1.01	146
46	EHS		55 Ontario Street South Milton ON L9T 2M3	ENE/220.1	-1.01	146
46	EASR	TARGET CANADA CO.	55 ONTARIO ST S MILTON ON L9T 2M3	ENE/220.1	-1.01	147
46	EASR	TARGET CANADA CO.	55 ONTARIO ST S MILTON ON L9T 2M3	ENE/220.1	-1.01	147
46	GEN	Westpen Properties	55 Ontario St. South Milton ON L9T 2M3	ENE/220.1	-1.01	147
46	GEN	Westpen Properties	55 Ontario St. South Milton ON L9T 2M3	ENE/220.1	-1.01	148

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>46</u>	PES	TARGET CANADA CO. STORE# T3572	55 ONTARIO ST S MILTON ON L9T2M3	ENE/220.1	-1.01	<u>148</u>
<u>46</u>	GEN	The Prime Partnerships	55 Ontario Street South Milton ON	ENE/220.1	-1.01	<u>148</u>
<u>46</u>	NPRI	ZELLERS	1 1-55 ONTARIO Street North MILTON ON L9T2M3	ENE/220.1	-1.01	<u>149</u>
<u>46</u>	GEN	Delta Elevator Co Ltd	55 Ontario Street Milton ON	ENE/220.1	-1.01	<u>151</u>
<u>46</u>	GEN	The Prime Partnerships	55 Ontario Street South Milton ON	ENE/220.1	-1.01	<u>151</u>
<u>46</u>	GEN	Target Canada Co.	55 Ontario Street, South Milton ON	ENE/220.1	-1.01	<u>152</u>
<u>46</u>	SPL	Bentall Kennedy (Canada) Limited	55 Ontario St S Milton ON L9T 2M3	ENE/220.1	-1.01	<u>153</u>
<u>46</u>	SPL		55 Ontario Street South Milton ON	ENE/220.1	-1.01	<u>153</u>
<u>46</u>	ECA	Westpen Properties Ltd./Les Proprietes Westpen Ltee	55 Ontario St S Milton ON M4V 1L5	ENE/220.1	-1.01	<u>154</u>
<u>46</u>	GEN	The Prime Partnerships	55 Ontario Street South Milton ON L9T 2M3	ENE/220.1	-1.01	<u>154</u>
<u>46</u>	GEN	The Prime Partnerships	55 Ontario Street South Milton ON L9T 2M3	ENE/220.1	-1.01	<u>155</u>
<u>46</u>	GEN	Target Canada Co.	55 Ontario Street, South Milton ON L9T 2M3	ENE/220.1	-1.01	<u>155</u>
<u>46</u>	GEN	Target Canada Co.	55 Ontario Street, South Milton ON L9T 2M3	ENE/220.1	-1.01	<u>156</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>46</u>	GEN	The Prime Partnerships	55 Ontario Street South Milton ON L9T 2M3	ENE/220.1	-1.01	<u>157</u>
<u>46</u>	GEN	Lowe's Home Centres (CANADA) Inc.	55 Ontario Street Milton ON L9T 2M3	ENE/220.1	-1.01	<u>157</u>
<u>46</u>	GEN	The Prime Partnerships	55 Ontario Street South Milton ON L9T 2M3	ENE/220.1	-1.01	<u>158</u>
<u>46</u>	PES	LOWE'S COMPANIES CANADA, ULC	55 ONTARIO ST S MILTON ON L9T2M3	ENE/220.1	-1.01	<u>158</u>
<u>46</u>	GEN	Towne Dental	55 Ontario Street South Unit #C3 Milton ON L9T 2M3	ENE/220.1	-1.01	<u>159</u>
<u>46</u>	PES	ZELLERS LIMITED #166	MILTON MALL SHOP. CENTRE 55 ONT ST S MILTON ON L9T2M3	ENE/220.1	-1.01	<u>159</u>
<u>46</u>	PES	LOBLAWS SUPERMARKETS LTD.	55 ONTARIO STREET SOUTH MILTON ON L9T2M4	ENE/220.1	-1.01	<u>160</u>
<u>46</u>	PES	ZELLERS STORE #166 - MILTON MALL	55 ONTARIO ST S MILTON ON L9T3J5	ENE/220.1	-1.01	<u>160</u>
<u>46</u>	PES	SHOPPERS DRUG MART #0710 (MILTON DRUG MART)	55 ONTARIO STREET SOUTH MILTON ON L9T2M3	ENE/220.1	-1.01	<u>160</u>
<u>46</u>	GEN	Towne Dental	55 Ontario Street South Unit #C3 Milton ON L9T 2M3	ENE/220.1	-1.01	<u>161</u>
<u>46</u>	RSC	FP MILTON MALL INC.	55 ONTARIO STREET SOUTH, MILTON, ON L9T 2M3 Milton ON	ENE/220.1	-1.01	<u>161</u>
<u>46</u>	GEN	Towne Dental	55 Ontario Street South Unit #C3 Milton ON L9T 2M3	ENE/220.1	-1.01	<u>162</u>
<u>46</u>	PES		55 ONTARIO ST S MILTON ON L9T 2M3	ENE/220.1	-1.01	<u>163</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
46	SPL	Coras<UNOFFICIAL>	55 Ontario Street South Milton ON	ENE/220.1	-1.01	163
46	GEN	Towne Dental	55 Ontario Street South Unit #C3 Milton ON L9T 2M3	ENE/220.1	-1.01	163
47	EHS		64 Ontario St N Milton ON L9T2T1	NNW/221.5	0.00	164
48	GEN	KNIGHTS CLEANERS, A DIV OF 632767	ONTARIO LIMITED, 300 MAIN ST., MILTON C/O 166 GUELPH ST. GEORGETOWN ON L7G 4A6	SW/225.3	-7.45	164
48	GEN	KNIGHT'S DRY CLEANERS INC.	300 MAIN STREET EAST MILTON ON L9T 1P3	SW/225.3	-7.45	164
48	GEN	KNIGHTS CLEANERS, A DIV OF 632767 23-373	ONTARIO LIMITED, 300 MAIN ST., MILTON C/O 166 GUELPH ST. GEORGETOWN ON L7G 4A6	SW/225.3	-7.45	165
48	GEN	KNIGHT'S DRY CLEANERS INC.	300 MAIN STREET EAST MILTON ON L9T 1P3	SW/225.3	-7.45	165
48	GEN	KNIGHT'S DRY CLEANERS INC.	300 MAIN ST. E. MILTON ON L9T 1P3	SW/225.3	-7.45	165
48	GEN	KNIGHT'S (SEE&USE ON0378901)	300 MAIN ST. E. MILTON ON L9T 1P3	SW/225.3	-7.45	166
48	GEN	KNIGHT'S (SEE&USE ON0378901) 23-241	300 MAIN ST. E. MILTON ON L9T 1P3	SW/225.3	-7.45	166
49	WWIS		ON Well ID: 7358774	ESE/229.4	-5.10	166
50	WWIS		106 Walekeld Rd Milton ON Well ID: 7364923	ESE/230.3	-5.10	167

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>51</u>	EHS		80 Ontario Street North Milton ON	NW/231.6	-2.77	<u>170</u>
<u>52</u>	WWIS		80 ONTARIO ST N Milton ON Well ID: 7346211	NNW/235.7	0.19	<u>171</u>
<u>53</u>	WWIS		80 ONTARIO STREET NROTH MILTON ON Well ID: 7257996	NNW/235.7	0.14	<u>173</u>
<u>54</u>	EHS		45 Ontario Street North Milton ON L9T 2T2	N/236.6	0.00	<u>176</u>
<u>55</u>	WWIS		80 Ontario Street North Milton ON Well ID: 7340816	WNW/238.3	-3.11	<u>176</u>
<u>56</u>	SPL		Childs Drive and Ontario St Milton ON	E/240.0	-4.01	<u>179</u>
<u>56</u>	INC		CHILDS DR & ONTARIO ST, MILTON ON	E/240.0	-4.01	<u>179</u>
<u>57</u>	GEN	Dr. John Kim Chiropractic Professional Corporation	106 Wakefield Road Milton ON L9T 2L8	ESE/240.3	-5.07	<u>180</u>
<u>57</u>	GEN	Dr. Strohan's Office	106 Wakefield Road Milton ON L9T 2L8	ESE/240.3	-5.07	<u>180</u>
<u>57</u>	GEN	Dr. John Kim Chiropractic Professional Corporation	106 Wakefield Road Milton ON L9T 2L8	ESE/240.3	-5.07	<u>180</u>
<u>57</u>	GEN	Dr. John Kim Chiropractic Professional Corporation	106 Wakefield Road Milton ON L9T 2L8	ESE/240.3	-5.07	<u>181</u>
<u>57</u>	GEN	Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	ESE/240.3	-5.07	<u>181</u>
<u>57</u>	GEN	Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	ESE/240.3	-5.07	<u>182</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>57</u>	GEN	Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	ESE/240.3	-5.07	<u>182</u>
<u>57</u>	SPL	Union Gas Limited	106 Wakefield Dr Milton ON	ESE/240.3	-5.07	<u>182</u>
<u>57</u>	GEN	Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	ESE/240.3	-5.07	<u>183</u>
<u>57</u>	GEN	PINCHIN LTD	106 WAKEFIELD ROAD MILTON ON L9T 2L8	ESE/240.3	-5.07	<u>183</u>
<u>57</u>	GEN	Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	ESE/240.3	-5.07	<u>183</u>
<u>57</u>	GEN	Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	ESE/240.3	-5.07	<u>184</u>
<u>58</u>	EHS		106 Wakefield Road Milton ON	ESE/240.3	-5.07	<u>184</u>
<u>59</u>	EHS		51 Millside Drive Milton ON L9T	W/244.9	-0.64	<u>184</u>
<u>60</u>	EHS		51 Millside Drive Milton ON L9T 1S8	W/247.3	-0.20	<u>185</u>
<u>61</u>	EHS		295 Main Street East Milton ON L9T 1P1	WSW/250.6	-7.93	<u>185</u>
<u>62</u>	SPL		Near Pine Street and Fulton Street Milton ON	SSW/250.9	-8.22	<u>185</u>
<u>63</u>	SPL	CHEMLAWN	337 OAK ST. TANK TRUCK (CARGO) MILTON TOWN ON L9T 1H8	S/253.1	-7.36	<u>186</u>
<u>64</u>	GEN	Gearhead Bike Shop	295 Main St E Milton ON L9T 1P1	WSW/255.5	-7.83	<u>186</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
65	EHS		296 Main Street East Milton ON L9T 1P3	SW/255.9	-7.78	186
66	WWIS		55 ONTARIO ST S MILTON MALL Milton ON Well ID: 7255423	NE/257.1	0.00	187
67	WWIS		80 ONTARIO ST N Milton ON Well ID: 7346212	WNW/258.2	-4.07	189
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	191
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	192
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	192
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	193
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	193
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON	NNE/258.8	0.00	193
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	194
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	194
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	194
68	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	195

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>68</u>	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	<u>195</u>
<u>68</u>	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	<u>195</u>
<u>68</u>	GEN	Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	NNE/258.8	0.00	<u>196</u>
<u>69</u>	GEN	Lowe's Home Centres (CANADA) Inc.	55 Ontario Street Milton ON L9T 2M3	N/258.9	0.00	<u>196</u>
<u>69</u>	GEN	Lowe's Home Centres (CANADA) Inc.	55 Ontario Street Milton ON L9T 2M3	N/258.9	0.00	<u>197</u>
<u>69</u>	GEN	Lowe's Home Centres (CANADA) Inc.	55 Ontario Street Milton ON L9T 2M3	N/258.9	0.00	<u>198</u>
<u>70</u>	WWIS		ON Well ID: 2801699	NNE/260.3	0.00	<u>198</u>
<u>71</u>	WWIS		80 ONTARIO STREET NORTH MILTON ON Well ID: 7257997	WNW/262.3	-4.57	<u>201</u>
<u>72</u>	EHS		50 Ontario St S Milton ON	ENE/264.1	-0.64	<u>204</u>
<u>73</u>	EHS		25 Ontario Street South Milton ON	ENE/264.3	-0.26	<u>205</u>
<u>74</u>	SPL	PRIVATE OWNER	80 ONTARIO STREET MOTOR VEHICLE (OPERATING FLUID) MILTON TOWN ON	NW/266.9	-3.66	<u>205</u>
<u>74</u>	GEN	CATHERTON CHARITABLE FOUNDATION	80 ONTARIO STREET NORTH MILTON ON L9T 4Z6	NW/266.9	-3.66	<u>205</u>
<u>74</u>	EHS		80 Ontario Street North Milton ON L9T 4Z6	NW/266.9	-3.66	<u>206</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>74</u>	GEN	Catherton Charitable Foundation	80 Ontario Street North Milton ON L9T 4Z6	NW/266.9	-3.66	<u>206</u>
<u>74</u>	GEN	Melloul-Blamey Construction	80 Ontario St N Milton ON L9T4Z6	NW/266.9	-3.66	<u>206</u>
<u>75</u>	WWIS		MILTON MALL ONTARIO ST. & CHILDS DR. MILTON ON Well ID: 7114860	E/269.7	-2.04	<u>207</u>
<u>76</u>	WWIS		ON Well ID: 7351859	WNW/270.4	-4.14	<u>210</u>
<u>77</u>	WWIS		80 ONTARIO ST N Milton ON Well ID: 7346209	WNW/270.6	-4.63	<u>211</u>
<u>78</u>	SCT	The Reliance Machine Works Co.	45 Ontario St N Unit 2C Milton ON L9T 2T2	NNE/272.9	0.00	<u>213</u>
<u>79</u>	WWIS		88 ONTARIO ST N Milton ON Well ID: 7229623	NNW/277.8	-2.36	<u>213</u>
<u>80</u>	WWIS		80 Ontario Street Norrth Milton ON Well ID: 7340815	WNW/279.4	-5.09	<u>216</u>
<u>81</u>	WWIS		55 ONTARIO ST S Milton ON Well ID: 7311350	ENE/286.1	0.00	<u>219</u>
<u>82</u>	WWIS		80 ONTARIO ST N Milton ON Well ID: 7346210	NNW/291.3	-0.88	<u>222</u>
<u>83</u>	EHS		82 Millside Drive Milton ON	WSW/293.1	-9.60	<u>224</u>
<u>84</u>	PINC	PIPELINE HIT - 1/2"	101 WAKEFIELD ROAD,,MILTON,ON,L9T 2L7,CA ON	ESE/293.6	-3.94	<u>224</u>
<u>84</u>	SPL		101 Wakefield drive, Milton Milton ON	ESE/293.6	-3.94	<u>224</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>85</u>	WWIS		80 ONTARIO STREET NORTH MILTON ON Well ID: 7257995	NW/294.7	-0.30	<u>225</u>
<u>86</u>	GEN	BIG ARN'S SPORTS WHOLESALE & REPAIR	88 ONTARIO STREET NORTH MILTON ON L9T 2T2	NNW/295.7	-2.49	<u>228</u>
<u>86</u>	GEN	2016789 ontario inc.	88 ontario street MILTON ON L9T 2T1	NNW/295.7	-2.49	<u>229</u>
<u>86</u>	GEN	2016789 ontario inc.	88 ontario street MILTON ON L9T 2T1	NNW/295.7	-2.49	<u>229</u>
<u>86</u>	GEN	2016789 ontario inc.	88 ontario street MILTON ON	NNW/295.7	-2.49	<u>229</u>
<u>86</u>	GEN	Enterprise Rent A Car Canada Company	88 Ontario Street North # 2 Milton ON	NNW/295.7	-2.49	<u>230</u>
<u>86</u>	GEN	Enterprise Rent A Car Canada Company	88 Ontario Street North # 2 Milton ON L9T2T1	NNW/295.7	-2.49	<u>230</u>
<u>86</u>	GEN	2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	NNW/295.7	-2.49	<u>231</u>
<u>86</u>	GEN	Enterprise Rent A Car Canada Company	88 Ontario Street North # 2 Milton ON L9T2T1	NNW/295.7	-2.49	<u>231</u>
<u>86</u>	GEN	2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	NNW/295.7	-2.49	<u>231</u>
<u>86</u>	GEN	2016789 ontario inc.	88 ontario street MILTON ON L9T 2T1	NNW/295.7	-2.49	<u>232</u>
<u>86</u>	GEN	Enterprise Rent A Car Canada Company	88 Ontario Street North # 2 Milton ON L9T2T1	NNW/295.7	-2.49	<u>232</u>
<u>86</u>	GEN	2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	NNW/295.7	-2.49	<u>232</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>86</u>	GEN	2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	NNW/295.7	-2.49	<u>233</u>
<u>86</u>	GEN	2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	NNW/295.7	-2.49	<u>233</u>
<u>86</u>	GEN	2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	NNW/295.7	-2.49	<u>233</u>
<u>87</u>	WWIS		332 OAK ST. Milton ON Well ID: 7135386	S/295.9	-9.49	<u>234</u>
<u>88</u>	SCT	APPLIED WIRING ASSEMBLIES INC.	505 MAIN ST E MILTON ON L9T 3J2	NNE/297.5	0.00	<u>237</u>
<u>88</u>	GEN	APPLIED WIRING ASSEMBLIES INC.	505 MAIN STREET EAST MILTON ON L9T 3J2	NNE/297.5	0.00	<u>237</u>

Executive Summary: Summary By Data Source

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 5 CA site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
R.M. OF HALTON	COURT ST/MAIN ST. MILTON TOWN ON	95.7	<u>21</u>
R.M. OF HALTON	COURT ST/MAIN ST. MILTON TOWN ON	95.7	<u>21</u>
MILTON TOWN - PINE ST/CONT.#PW-02-90	PINE ST/ONTARIO ST/BRUCE ST. MILTON TOWN ON	117.9	<u>27</u>
3176461 CANADA INC., NEXACOR REALTY	330 MAIN STREET MILTON ON	130.5	<u>31</u>
Westpen Properties Ltd./Les Proprietes Westpen Ltee	55 Ontario St S Milton ON L9T 2M3	220.1	<u>46</u>

CFOT - Commercial Fuel Oil Tanks

A search of the CFOT database, dated Feb 28, 2022 has found that there are 1 CFOT site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
BELL CANADA	330 MAIN ST E MILTON L9T 1P4 ON CA ON	130.5	<u>31</u>

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Feb 28, 2022 has found that there are 1 DTNK site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
BELL CANADA	330 MAIN ST E MILTON L9T 1P4 ON CA ON	130.5	<u>31</u>

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011- Jan 31, 2023 has found that there are 2 EASR site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
TARGET CANADA CO.	55 ONTARIO ST S MILTON ON L9T 2M3	220.1	<u>46</u>
TARGET CANADA CO.	55 ONTARIO ST S MILTON ON L9T 2M3	220.1	<u>46</u>

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011- Jan 31, 2023 has found that there are 2 ECA site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
The Regional Municipality of Halton	Main Street East and Ontario Street Right of Way Milton ON L6M 3L1	141.1	<u>35</u>
Westpen Properties Ltd./Les Proprietes Westpen Ltee	55 Ontario St S Milton ON M4V 1L5	220.1	<u>46</u>

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Dec 31, 2022 has found that there are 37 EHS site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	387 Main Street East Milton ON L9T 1P7	36.0	<u>3</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	387 Main Street East Milton ON L9T 1P7	36.0	<u>3</u>
	387 Main Street East Milton ON L9T 1P7	36.0	<u>3</u>
	377 Main Street East Milton ON L9T 1P7	40.2	<u>4</u>
	377 Main Street East Milton ON L9T 1P7	40.2	<u>4</u>
	377 Main Street East Milton ON L9T 1P7	40.2	<u>4</u>
	389 Main Street East Milton ON L9T 1P7	44.9	<u>5</u>
	389 Main Street East Milton ON L9T 1P7	44.9	<u>5</u>
	389 Main Street East Milton ON L9T 1P7	44.9	<u>5</u>
	409 Main Street East Milton ON L9T 1P7	58.7	<u>10</u>
	407 Pine Street Milton ON L9T 1L3	68.6	<u>13</u>
	425 Main Street East Milton ON	78.4	<u>15</u>
	425 - 429 Main Street East Milton ON	81.9	<u>16</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	383 Main Street Milton ON L9T 1P7	83.4	<u>17</u>
	425 - 439 Main Street East Milton ON	94.2	<u>20</u>
	425 Main Street East Milton ON L9T 1P7	96.9	<u>22</u>
	425 Main Street East Milton ON L9T 1P7	96.9	<u>22</u>
	425 Main Street East Milton ON L9T 1P7	96.9	<u>22</u>
	18, 20 & 22 Ontario Street South Milton ON L9T 2M6	97.3	<u>23</u>
	335 Main Street East Milton ON L9T 1P5	132.5	<u>32</u>
	335 Main Street East Milton ON L9T 1P5	132.5	<u>32</u>
	335 Main Street East Milton ON L9T 1P5	132.5	<u>32</u>
	Ontario St & Pine St Milton ON	151.6	<u>36</u>
	310 Main St E Milton ON L9T1P4	189.5	<u>40</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	55 Ontario Street South Milton ON L9T 2M3	220.1	<u>46</u>
	64 Ontario St N Milton ON L9T2T1	221.5	<u>47</u>
	80 Ontario Street North Milton ON	231.6	<u>51</u>
	45 Ontario Street North Milton ON L9T 2T2	236.6	<u>54</u>
	106 Wakefield Road Milton ON	240.3	<u>58</u>
	51 Millside Drive Milton ON L9T	244.9	<u>59</u>
	51 Millside Drive Milton ON L9T 1S8	247.3	<u>60</u>
	295 Main Street East Milton ON L9T 1P1	250.6	<u>61</u>
	296 Main Street East Milton ON L9T 1P3	255.9	<u>65</u>
	50 Ontario St S Milton ON	264.1	<u>72</u>
	25 Ontario Street South Milton ON	264.3	<u>73</u>
	80 Ontario Street North Milton ON L9T 4Z6	266.9	<u>74</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	82 Millside Drive Milton ON	293.1	<u>83</u>

FST - Fuel Storage Tank

A search of the FST database, dated Feb 28, 2022 has found that there are 1 FST site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
GRIEF BROS CANADA INC	383 MAIN ST E MILTON L9T 1P7 ON CA ON	83.4	<u>17</u>

FSTH - Fuel Storage Tank - Historic

A search of the FSTH database, dated Pre-Jan 2010* has found that there are 2 FSTH site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
GRIEF BROS CANADA INC	383 MAIN ST E MILTON ON L9T 1P7	83.4	<u>17</u>
GRIEF BROS CANADA INC	383 MAIN ST E MILTON ON L9T 1P7	83.4	<u>17</u>

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Oct 31, 2022 has found that there are 113 GEN site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Animal Hospital of Milton	385 Main Stret East Milton ON L9T 1P7	45.6	<u>6</u>
The 2nd Step to Fitness Incorporated	409 Main Street East Milton ON L9T 1P7	58.7	<u>10</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CARMUR HOLDINGS LTD.	409 MAIN STREET EAST MILTON ON L9T 1P7	58.7	<u>10</u>
Carmur Holdings Ltd	409 Main Street East Milton ON L9T 1P7	58.7	<u>10</u>
Greif Bros. Canada	383 Main Street East Milton ON L9T 1P7	83.4	<u>17</u>
Delridge Homes	383 Main St. Milton ON L9T 1M4	83.4	<u>17</u>
STREET PROPERTIES	425 MAIN STREET EAST MILTON ON L9T 1P7	96.9	<u>22</u>
Mayrose-Tycon Limited	420 Main Street East, Suite 598 Milton ON L9T 5G3	100.2	<u>24</u>
BELL CANADA	330 MAIN STREET MILTON ON L9T 1P4	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON	130.5	<u>31</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Bell Canada	330 Main Street Milton ON	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON L9T 1P4	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON L9T 1P4	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON L9T 1P4	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON L9T 1P4	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON L9T 1P4	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON L9T 1P4	130.5	<u>31</u>
Bell Canada	330 Main Street Milton ON L9T 1P4	130.5	<u>31</u>
Acclaim Health	310 Main Street East, Suite 104 Milton ON L9T 1P4	189.5	<u>40</u>
Acclaim Health	310 Main Street East, Suite 104 Milton ON L9T 1P4	189.5	<u>40</u>
Acclaim Health Milton Clinic	310 Main Street East, Suite 104 Milton ON L9T 1P4	189.5	<u>40</u>
Acclaim Health Milton Clinic	310 Main Street East, Suite 104 Milton ON L9T 1P4	189.5	<u>40</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Acclaim Health Milton Clinic	310 Main Street East, Suite 104 Milton ON L9T 1P4	189.5	<u>40</u>
Acclaim Health Milton Clinic	310 Main Street East, Suite 104 Milton ON L9T 1P4	189.5	<u>40</u>
BLACK PHOTO CORPORATION	MILTON MALL, 55 ONTARIO ST. SOUTH C/O 371 GOUGH RD. MARKHAM ONT L3R 4B6 MILTON ON L9T 2M3	220.1	<u>46</u>
BLACK PHOTO CORPORATION	MILTON MALL, 55 ONTARIO ST. S. MILTON C/O 371 GOUGH RD. MARKHAM ON L9T 2M3	220.1	<u>46</u>
BLACK PHOTO CORPORATION	55 ONTARIO STREET SOUTH MILTON MALL MILTON ON L9T 2M3	220.1	<u>46</u>
BLACK PHOTO CORPORATION 05- 204	MILTON MALL, 55 ONTARIO ST. S.- MILTON C/O 371 GOUGH ROAD MARKHAM ON L9T 2M3	220.1	<u>46</u>
BLACK PHOTO CORPORATION	MILTON MALL_ 55 ONTARIO STREET SOUTH__ MILTON ON L9T 2M3	220.1	<u>46</u>
BLACK PHOTO CORPORATION	MILTON MALL 55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	220.1	<u>46</u>
PAT CAMPBELL DRUGS LTD.	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	220.1	<u>46</u>
SHOPPERS DRUG MART	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	220.1	<u>46</u>
PAT CAM(SEE & USE ON2530795)	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	220.1	<u>46</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Towne Dental Group	55 Ontario St S Milton ON L9T 2M3	220.1	<u>46</u>
Summit REIT	55 Ontario Street South Milton ON L9T 2M3	220.1	<u>46</u>
Towne Dental	55 Ontario St S Milton ON L9T 2M3	220.1	<u>46</u>
Westpen Properties Ltd.	55 Ontario Street South Toronto ON L9T 2M3	220.1	<u>46</u>
Westpen Properties	55 Ontario St. South Milton ON L9T 2M3	220.1	<u>46</u>
Westpen Properties Ltd.	55 Ontario Street South Milton ON L9T 2M3	220.1	<u>46</u>
Westpen Properties	55 Ontario St. South Milton ON L9T 2M3	220.1	<u>46</u>
Westpen Properties	55 Ontario St. South Milton ON L9T 2M3	220.1	<u>46</u>
The Prime Partnerships	55 Ontario Street South Milton ON	220.1	<u>46</u>
Delta Elevator Co Ltd	55 Ontario Street Milton ON	220.1	<u>46</u>
The Prime Partnerships	55 Ontario Street South Milton ON	220.1	<u>46</u>
Target Canada Co.	55 Ontario Street, South Milton ON	220.1	<u>46</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
The Prime Partnerships	55 Ontario Street South Milton ON L9T 2M3	220.1	<u>46</u>
The Prime Partnerships	55 Ontario Street South Milton ON L9T 2M3	220.1	<u>46</u>
Target Canada Co.	55 Ontario Street, South Milton ON L9T 2M3	220.1	<u>46</u>
Target Canada Co.	55 Ontario Street, South Milton ON L9T 2M3	220.1	<u>46</u>
The Prime Partnerships	55 Ontario Street South Milton ON L9T 2M3	220.1	<u>46</u>
Lowe's Home Centres (CANADA) Inc.	55 Ontario Street Milton ON L9T 2M3	220.1	<u>46</u>
The Prime Partnerships	55 Ontario Street South Milton ON L9T 2M3	220.1	<u>46</u>
Towne Dental	55 Ontario Street South Unit #C3 Milton ON L9T 2M3	220.1	<u>46</u>
Towne Dental	55 Ontario Street South Unit #C3 Milton ON L9T 2M3	220.1	<u>46</u>
Towne Dental	55 Ontario Street South Unit #C3 Milton ON L9T 2M3	220.1	<u>46</u>
Towne Dental	55 Ontario Street South Unit #C3 Milton ON L9T 2M3	220.1	<u>46</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
KNIGHTS CLEANERS, A DIV OF 632767	ONTARIO LIMITED, 300 MAIN ST., MILTON C/O 166 GUELPH ST. GEORGETOWN ON L7G 4A6	225.3	<u>48</u>
KNIGHT'S DRY CLEANERS INC.	300 MAIN STREET EAST MILTON ON L9T 1P3	225.3	<u>48</u>
KNIGHTS CLEANERS, A DIV OF 632767 23-373	ONTARIO LIMITED, 300 MAIN ST., MILTON C/O 166 GUELPH ST. GEORGETOWN ON L7G 4A6	225.3	<u>48</u>
KNIGHT'S DRY CLEANERS INC.	300 MAIN STREET EAST MILTON ON L9T 1P3	225.3	<u>48</u>
KNIGHT'S DRY CLEANERS INC.	300 MAIN ST. E. MILTON ON L9T 1P3	225.3	<u>48</u>
KNIGHT'S (SEE&USE ON0378901)	300 MAIN ST. E. MILTON ON L9T 1P3	225.3	<u>48</u>
KNIGHT'S (SEE&USE ON0378901) 23- 241	300 MAIN ST. E. MILTON ON L9T 1P3	225.3	<u>48</u>
Dr. John Kim Chiropractic Professional Corporation	106 Wakefield Road Milton ON L9T 2L8	240.3	<u>57</u>
Dr. Strohan's Office	106 Wakefield Road Milton ON L9T 2L8	240.3	<u>57</u>
Dr. John Kim Chiropractic Professional Corporation	106 Wakefield Road Milton ON L9T 2L8	240.3	<u>57</u>
Dr. John Kim Chiropractic Professional Corporation	106 Wakefield Road Milton ON L9T 2L8	240.3	<u>57</u>
Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	240.3	<u>57</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	240.3	<u>57</u>
PINCHIN LTD	106 WAKEFIELD ROAD MILTON ON L9T 2L8	240.3	<u>57</u>
Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	240.3	<u>57</u>
Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	240.3	<u>57</u>
Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	240.3	<u>57</u>
Dr. Susan Bermingham Dentistry PC	106 Wakefield Road #1 Milton ON L9T 2L8	240.3	<u>57</u>
Gearhead Bike Shop	295 Main St E Milton ON L9T 1P1	255.5	<u>64</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Animal Hospital Milton	491 Main Street East Milton ON L9T 1R1	258.8	<u>68</u>
Lowe's Home Centres (CANADA) Inc.	55 Ontario Street Milton ON L9T 2M3	258.9	<u>69</u>
Lowe's Home Centres (CANADA) Inc.	55 Ontario Street Milton ON L9T 2M3	258.9	<u>69</u>
Lowe's Home Centres (CANADA) Inc.	55 Ontario Street Milton ON L9T 2M3	258.9	<u>69</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CATHERTON CHARITABLE FOUNDATION	80 ONTARIO STREET NORTH MILTON ON L9T 4Z6	266.9	<u>74</u>
Catherton Charitable Foundation	80 Ontario Street North Milton ON L9T 4Z6	266.9	<u>74</u>
Melloul-Blamey Construction	80 Ontario St N Milton ON L9T4Z6	266.9	<u>74</u>
BIG ARN'S SPORTS WHOLESALE & REPAIR	88 ONTARIO STREET NORTH MILTON ON L9T 2T2	295.7	<u>86</u>
2016789 ontario inc.	88 ontario street MILTON ON L9T 2T1	295.7	<u>86</u>
2016789 ontario inc.	88 ontario street MILTON ON L9T 2T1	295.7	<u>86</u>
2016789 ontario inc.	88 ontario street MILTON ON	295.7	<u>86</u>
Enterprise Rent A Car Canada Company	88 Ontario Street North # 2 Milton ON	295.7	<u>86</u>
Enterprise Rent A Car Canada Company	88 Ontario Street North # 2 Milton ON L9T2T1	295.7	<u>86</u>
2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	295.7	<u>86</u>
Enterprise Rent A Car Canada Company	88 Ontario Street North # 2 Milton ON L9T2T1	295.7	<u>86</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	295.7	<u>86</u>
2016789 ontario inc.	88 ontario street MILTON ON L9T 2T1	295.7	<u>86</u>
Enterprise Rent A Car Canada Company	88 Ontario Street North # 2 Milton ON L9T2T1	295.7	<u>86</u>
2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	295.7	<u>86</u>
2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	295.7	<u>86</u>
2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	295.7	<u>86</u>
2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	295.7	<u>86</u>
2016789 ontario inc.	88 Ontario Street MILTON ON L9T 2T1	295.7	<u>86</u>
APPLIED WIRING ASSEMBLIES INC.	505 MAIN STREET EAST MILTON ON L9T 3J2	297.5	<u>88</u>

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated Feb 28, 2022 has found that there are 1 INC site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	CHILDS DR & ONTARIO ST, MILTON ON	240.0	<u>56</u>

NPRI - National Pollutant Release Inventory

A search of the NPRI database, dated 1993-May 2017 has found that there are 1 NPRI site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
ZELLERS	1 1-55 ONTARIO Street North MILTON ON L9T2M3	220.1	46

PES - Pesticide Register

A search of the PES database, dated Oct 2011- Jan 31, 2023 has found that there are 14 PES site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
GUARANTEED GREEN	366 PINE ST MILTON ON L9T1K9	141.0	34
GUARANTEED GREEN	366 PINE ST MILTON ON L9T1K9	141.0	34
GUARANTEED GREEN	366 PINE ST MILTON ON L9T1K9	141.0	34
ZELLERS STORE #166 - MILTON MALL	55 ONTARIO ST S MILTON ON L9T 2M3	220.1	46
SHOPPERS DRUG MART #0710 (MILTON DRUG MART)	55 ONTARIO STREET SOUTH MILTON ON L9T2M3	220.1	46
ZELLERS STORE #166 - MILTON MALL	55 ONTARIO ST S MILTON ON L9T3J5	220.1	46
LOBLAWS SUPERMARKETS LTD.	55 ONTARIO STREET SOUTH MILTON ON L9T2M4	220.1	46
LOBLAWS SUPERMARKETS LTD.	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	220.1	46

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	55 ONTARIO ST S MILTON ON L9T 2M3	220.1	<u>46</u>
SHOPPERS DRUG MART #0710 (MILTON DRUG MART)	55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	220.1	<u>46</u>
ZELLERS STORE #166 - MILTON MALL	55 ONTARIO ST S MILTON ON L9T 2M3	220.1	<u>46</u>
TARGET CANADA CO. STORE# T3572	55 ONTARIO ST S MILTON ON L9T2M3	220.1	<u>46</u>
LOWE'S COMPANIES CANADA, ULC	55 ONTARIO ST S MILTON ON L9T2M3	220.1	<u>46</u>
ZELLERS LIMITED #166	MILTON MALL SHOP. CENTRE 55 ONT ST S MILTON ON L9T2M3	220.1	<u>46</u>

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 3 PINC site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PIPELINE HIT 1 1/4"	362 PEARL ST,,MILTON,ON,L9T 1M7,CA ON	72.3	<u>14</u>
ENBRIDGE GAS INC	80 ONTARIO ST S,,MILTON,ON,L9T 2M7,CA ON	180.0	<u>38</u>
PIPELINE HIT - 1/2"	101 WAKEFIELD ROAD,,MILTON,ON,L9T 2L7,CA ON	293.6	<u>84</u>

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 1 PRT site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
GRIEF CONTAINERS	383 MAIN ST MILTON ON L9T 1P7	83.4	17

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-Dec 2022 has found that there are 2 RSC site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
DEL RIDGE (MAIN STREET) INC.	383 MAIN ST E, MILTON, ON, L9T 1P7 ON L9T 1P7	83.4	17
FP MILTON MALL INC.	55 ONTARIO STREET SOUTH, MILTON, ON L9T 2M3 Milton ON	220.1	46

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 9 SCT site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
HEDSTROM CANADA	400 MAIN ST E MILTON ON L9T 4X5	28.0	1
Greif Bros. Canada Inc.- Div. of Greif Bros. Corporation	383 Main St E Milton ON L9T 1P7	83.4	17
Greif Bros. Canada Inc.	383 Main St E Milton ON L9T 1P7	83.4	17
GREIF CONTAINERS INC	383 MAIN ST E MILTON ON L9T 1P7	83.4	17
PGBELL	420 Main St E Suite 563 Milton ON L9T 1P9	100.2	24

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Materials Transportation Cda	420 Main St E Unit C Suite 584 Milton ON L9T 1P9	100.2	<u>24</u>
Key Centres Ltd.	55 Ontario St S Milton ON L9T 2M3	220.1	<u>46</u>
The Reliance Machine Works Co.	45 Ontario St N Unit 2C Milton ON L9T 2T2	272.9	<u>78</u>
APPLIED WIRING ASSEMBLIES INC.	505 MAIN ST E MILTON ON L9T 3J2	297.5	<u>88</u>

SPL - Ontario Spills

A search of the SPL database, dated 1988-Sep 2020; Dec 2020-Mar 2021 has found that there are 12 SPL site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Union Gas Limited	362 Pearl St. Milton ON	72.3	<u>14</u>
Coras<UNOFFICIAL>	55 Ontario Street South Milton ON	220.1	<u>46</u>
	55 Ontario Street South Milton ON	220.1	<u>46</u>
	55 Ontario Street Milton ON	220.1	<u>46</u>
Hudson's Bay Company	1 - 55 Ontario St N Milton ON L9T 2T2	220.1	<u>46</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Bentall Kennedy (Canada) Limited	55 Ontario St S Milton ON L9T 2M3	220.1	<u>46</u>
	Childs Drive and Ontario St Milton ON	240.0	<u>56</u>
Union Gas Limited	106 Wakefield Dr Milton ON	240.3	<u>57</u>
	Near Pine Street and Fulton Street Milton ON	250.9	<u>62</u>
CHEMLAWN	337 OAK ST. TANK TRUCK (CARGO) MILTON TOWN ON L9T 1H8	253.1	<u>63</u>
PRIVATE OWNER	80 ONTARIO STREET MOTOR VEHICLE (OPERATING FLUID) MILTON TOWN ON	266.9	<u>74</u>
	101 Wakefield drive, Milton Milton ON	293.6	<u>84</u>

WWIS - Water Well Information System

A search of the WWIS database, dated Jun 30 2022 has found that there are 42 WWIS site(s) within approximately 0.30 kilometers of the project property.


<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON <i>Well ID: 7384554</i>	35.4	<u>2</u>
	ON <i>Well ID: 7384553</i>	50.9	<u>7</u>
	lot 13 con 2 ON	52.1	<u>8</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7240691		
	ON	58.5	<u>9</u>
	Well ID: 7384552		
	439 MAIN STREET EAS MILTON ON	62.2	<u>11</u>
	Well ID: 7262015		
	383 MAIN ST. Milton ON	67.4	<u>12</u>
	Well ID: 7107041		
	383 MAIN ST. E. Milton ON	83.4	<u>17</u>
	Well ID: 7126539		
	ON	91.0	<u>18</u>
	Well ID: 7270663		
	ON	93.9	<u>19</u>
	Well ID: 7270664		
	ON	106.5	<u>25</u>
	Well ID: 7239049		
	15 Court Street S lot 13 con 2 Milton ON	113.1	<u>26</u>
	Well ID: 7326515		
	439 MAIN STREET EAST MILTON ON	119.5	<u>28</u>
	Well ID: 7262016		
	ON	120.2	<u>29</u>
	Well ID: 7260653		
	439 MAIN STREET EAST MILTON ON	123.9	<u>30</u>
	Well ID: 7262017		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	446 PINE STREET Milton ON <i>Well ID: 7288932</i>	140.0	<u>33</u>
	55 ONTARIO STREET SOUTH MILTON ON <i>Well ID: 2810303</i>	159.7	<u>37</u>
	80 ONTARIO STREET NORTH MILTON ON <i>Well ID: 7257999</i>	188.8	<u>39</u>
	55 ONTARIO ST SOUTH MILTON, ONT ON <i>Well ID: 2810237</i>	197.7	<u>41</u>
	55 ONTARIO ST S lot 13 con 3 MILTON ON <i>Well ID: 2810059</i>	205.6	<u>42</u>
	55 ONTARIO ST S lot 13 con 3 MILTON ON <i>Well ID: 2810101</i>	205.6	<u>42</u>
	55 ONTARIO ST S lot 13 con 3 MILTON ON <i>Well ID: 2810070</i>	210.4	<u>43</u>
	55 ONTARIO ST S MILTON ON <i>Well ID: 2810181</i>	210.4	<u>43</u>
	80 Ontario Street North lot 14 con 2 Milton ON <i>Well ID: 7370754</i>	210.7	<u>44</u>
	80 ONTARIO STREET NORTH MILTON ON <i>Well ID: 7257998</i>	213.3	<u>45</u>
	ON <i>Well ID: 7358774</i>	229.4	<u>49</u>
	106 Walekeld Rd Milton ON	230.3	<u>50</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7364923		
	80 ONTARIO ST N Milton ON	235.7	<u>52</u>
	Well ID: 7346211		
	80 ONTARIO STREET NROTH MILTON ON	235.7	<u>53</u>
	Well ID: 7257996		
	80 Ontario Street Norrth Milton ON	238.3	<u>55</u>
	Well ID: 7340816		
	55 ONTARIO ST S MILTON MALL Milton ON	257.1	<u>66</u>
	Well ID: 7255423		
	80 ONTARIO ST N Milton ON	258.2	<u>67</u>
	Well ID: 7346212		
	ON	260.3	<u>70</u>
	Well ID: 2801699		
	80 ONTARIO STREET NORTH MILTON ON	262.3	<u>71</u>
	Well ID: 7257997		
	MILTON MALL ONTARIO ST. & CHILDS DR. MILTON ON	269.7	<u>75</u>
	Well ID: 7114860		
	ON	270.4	<u>76</u>
	Well ID: 7351859		
	80 ONTARIO ST N Milton ON	270.6	<u>77</u>
	Well ID: 7346209		
	88 ONTARIO ST N Milton ON	277.8	<u>79</u>
	Well ID: 7229623		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	80 Ontario Street North Milton ON <i>Well ID:</i> 7340815	279.4	<u>80</u>
	55 ONTARIO ST S Milton ON <i>Well ID:</i> 7311350	286.1	<u>81</u>
	80 ONTARIO ST N Milton ON <i>Well ID:</i> 7346210	291.3	<u>82</u>
	80 ONTARIO STREET NORTH MILTON ON <i>Well ID:</i> 7257995	294.7	<u>85</u>
	332 OAK ST. Milton ON <i>Well ID:</i> 7135386	295.9	<u>87</u>

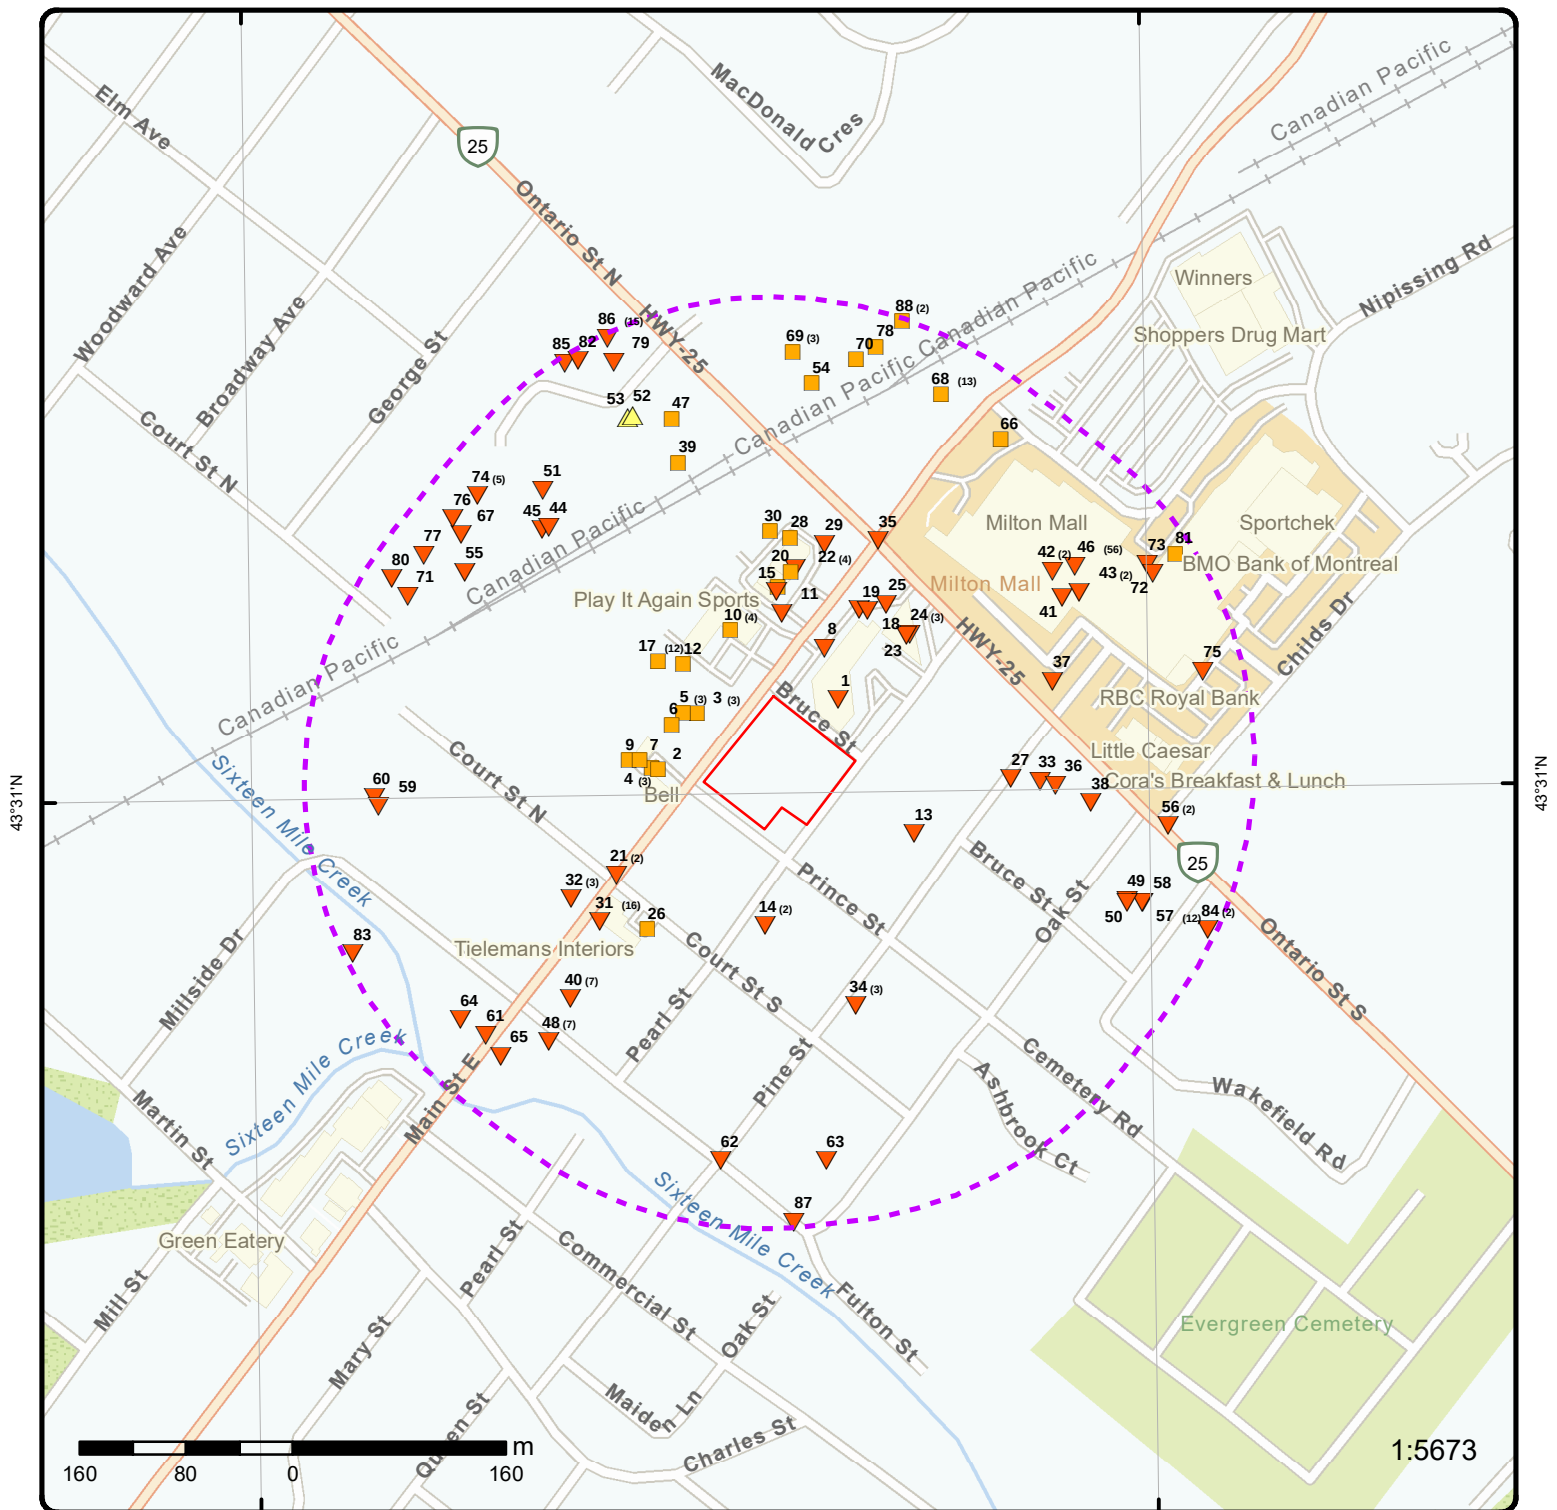


Map: 0.3 Kilometer Radius

Order Number: 23030300040

Address: 388 Main Street East, 395-409 Pearl Street & 17 Prince Street, Milton, ON



Project Property	Freeways; Highways	Beach	Shopping & Sports Area
Buffer Outline	Traffic Circle; Ramp	Airport	University/College
Eris Sites with Higher Elevation	Major Arterial; Minor Arterial	Industrial Area	Cemetery; Golf Course
Eris Sites with Same Elevation	Local Road	Military Base	Parkt (National)
Eris Sites with Lower Elevation	Service Road; Traffic Circle; Ramp	Aircraft Roads	Park (City/County)
Eris Sites with Unknown Elevation	Rail	Native Reservation	
		Hospital	

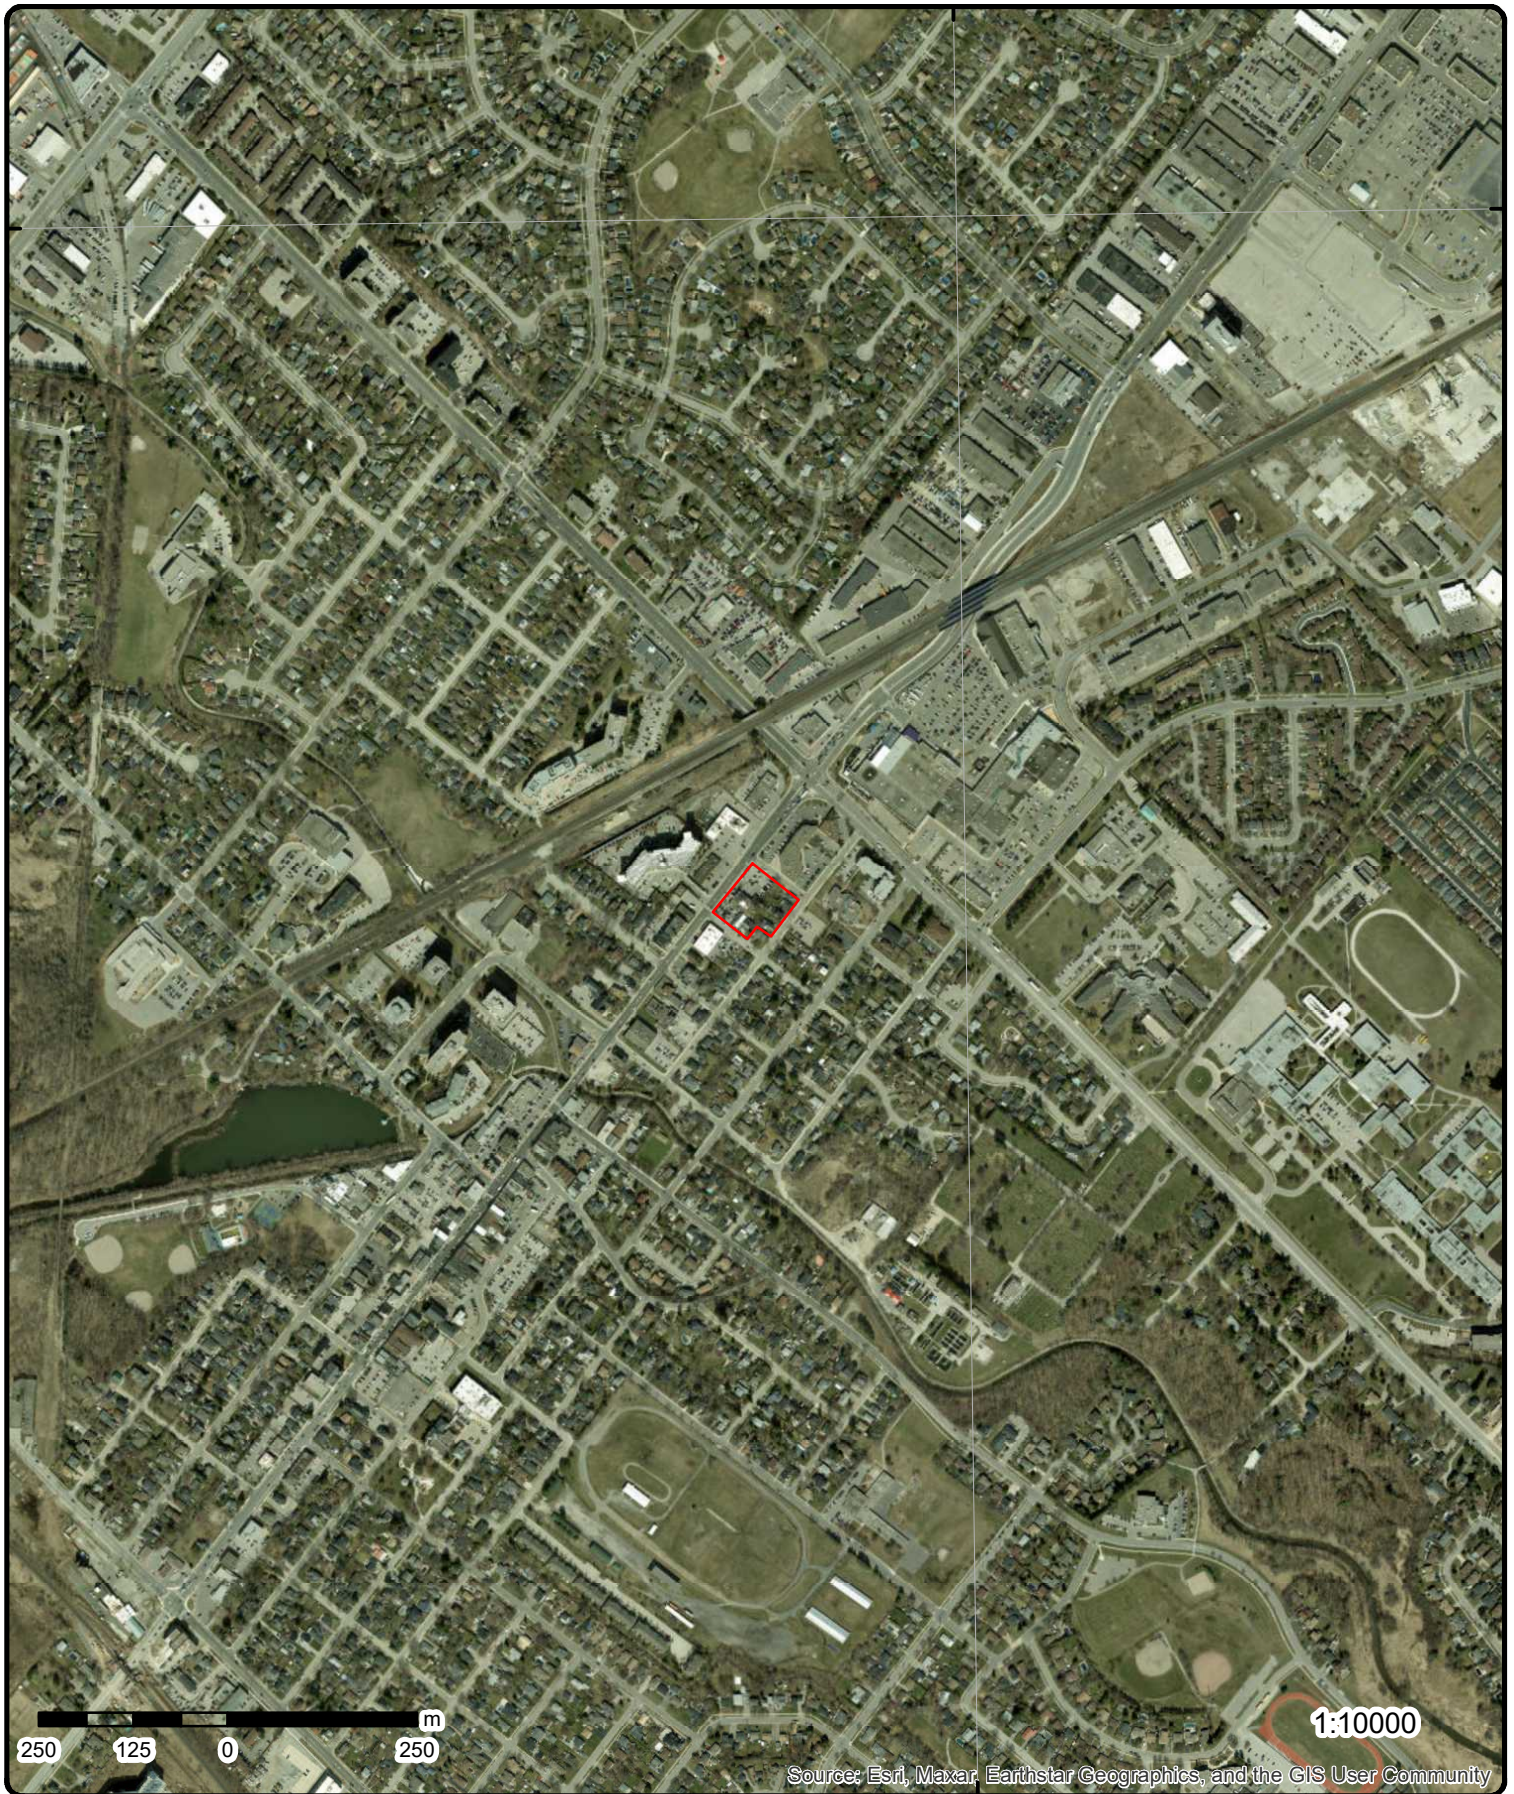

Aerial

Year: 2021

Order Number: 23030300040

Address: 388 Main Street East, 395-409 Pearl Street & 17 Prince Street, Milton,



Source: ESRI World Imagery

© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 1	NE/28.0	198.9 / -0.94	HEDSTROM CANADA 400 MAIN ST E MILTON ON L9T 4X5	SCT
Established: 1990 Plant Size (ft²): 0 Employment: 6					
--Details-- Description: Doll, Toy and Game Manufacturing SIC/NAICS Code: 339930					
2	1 of 1	W/35.4	199.9 / 0.00	ON	WWIS
Well ID: 7384554 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z347656 Tag: A304850 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MILTON TOWN (MILTON) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 08-Apr-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6946 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Bore Hole Information Bore Hole ID: 1008645383 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 17-Mar-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment:					
Elevation: Elevrc: Zone: 17 East83: 590554.00 North83: 4818821.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
Links					
Bore Hole ID:	1008645383			Tag No:	A304850
Depth M:				Contractor:	6946
Year Completed:	2021			Path:	738\7384554.pdf
Well Completed Dt:	2021/03/17			Latitude:	43.5168373960976
Audit No:	Z347656			Longitude:	-79.8795891076509
3	1 of 3	WNW/36.0	199.9 / 0.00	387 Main Street East Milton ON L9T 1P7	EHS
Order No:	22040600001			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	11-APR-22			Search Radius (km):	.25
Date Received:	06-APR-22			X:	-79.8792174
Previous Site Name:				Y:	43.5172119
Lot/Building Size:					
Additional Info Ordered:	Topographic Maps; Aerial Photos				
3	2 of 3	WNW/36.0	199.9 / 0.00	387 Main Street East Milton ON L9T 1P7	EHS
Order No:	22040600001			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	11-APR-22			Search Radius (km):	.25
Date Received:	06-APR-22			X:	-79.8792174
Previous Site Name:				Y:	43.5172119
Lot/Building Size:					
Additional Info Ordered:	Topographic Maps; Aerial Photos				
3	3 of 3	WNW/36.0	199.9 / 0.00	387 Main Street East Milton ON L9T 1P7	EHS
Order No:	22040600001			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	11-APR-22			Search Radius (km):	.25
Date Received:	06-APR-22			X:	-79.8792174
Previous Site Name:				Y:	43.5172119
Lot/Building Size:					
Additional Info Ordered:	Topographic Maps; Aerial Photos				
4	1 of 3	W/40.2	199.9 / 0.00	377 Main Street East Milton ON L9T 1P7	EHS
Order No:	21021100311			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	12-FEB-21			Search Radius (km):	.25
Date Received:	11-FEB-21			X:	-79.8796457
Previous Site Name:				Y:	43.5168502
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Aerial Photos				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
4	2 of 3	W/40.2	199.9 / 0.00	377 Main Street East Milton ON L9T 1P7	EHS
Order No: 21021100311 Status: C Report Type: Standard Report Report Date: 12-FEB-21 Date Received: 11-FEB-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; Aerial Photos					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.8796457 Y: 43.5168502					
4	3 of 3	W/40.2	199.9 / 0.00	377 Main Street East Milton ON L9T 1P7	EHS
Order No: 21021100311 Status: C Report Type: Standard Report Report Date: 12-FEB-21 Date Received: 11-FEB-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; Aerial Photos					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.8796457 Y: 43.5168502					
5	1 of 3	WNW/44.9	199.9 / 0.00	389 Main Street East Milton ON L9T 1P7	EHS
Order No: 22020700699 Status: C Report Type: Standard Report Report Date: 10-FEB-22 Date Received: 07-FEB-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.879351 Y: 43.5172208					
5	2 of 3	WNW/44.9	199.9 / 0.00	389 Main Street East Milton ON L9T 1P7	EHS
Order No: 22020700699 Status: C Report Type: Standard Report Report Date: 10-FEB-22 Date Received: 07-FEB-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.879351 Y: 43.5172208					
5	3 of 3	WNW/44.9	199.9 / 0.00	389 Main Street East Milton ON L9T 1P7	EHS
Order No: 22020700699 Status: C Report Type: Standard Report Report Date: 10-FEB-22 Date Received: 07-FEB-22 Previous Site Name: Lot/Building Size:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.879351 Y: 43.5172208					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
6	1 of 1	WNW/45.6	199.9 / 0.00	Animal Hospital of Milton 385 Main Stret East Milton ON L9T 1P7	GEN
Generator No:		ON3120892			
SIC Code:					
SIC Description:					
Approval Years:		02,03,04			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
7	1 of 1	W/50.9	199.9 / 0.00	ON	WWIS
Well ID:		7384553		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	
Water Type:				Selected Flag:	
Casing Material:				Abandonment Rec:	
Audit No:		Z346285		Contractor:	
Tag:		A318457		Form Version:	
Constructn Method:				Owner:	
Elevation (m):				County:	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (MILTON)			
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1008645380		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		17-Mar-2021 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
				margin of error : 30 m - 100 m	
				wwr	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Links					
Bore Hole ID:	1008645380			Tag No:	A318457
Depth M:				Contractor:	6946
Year Completed:	2021			Path:	738\7384553.pdf
Well Completed Dt:	2021/03/17			Latitude:	43.5169021110829
Audit No:	Z346285			Longitude:	-79.879761129003
8	1 of 1	NNE/52.1	198.9 / -0.96	lot 13 con 2 ON	WWIS
Well ID:	7240691			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	27-Apr-2015 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C24760			Contractor:	7464
Tag:	A159848			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	013
Depth to Bedrock:				Concession:	02
Well Depth:				Concession Name:	NS
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:	2014/11/25				
Year Completed:	2014				
Depth (m):					
Latitude:	43.517641462947				
Longitude:	-79.8780276124187				
Path:					
Bore Hole Information					
Bore Hole ID:	1005330613			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590679.00
Code OB Desc:				North83:	4818912.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	25-Nov-2014 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Links</u>					
Bore Hole ID:	1005330613			Tag No:	A159848
Depth M:				Contractor:	7464
Year Completed:	2014			Path:	
Well Completed Dt:	2014/11/25			Latitude:	43.517641462947
Audit No:	C24760			Longitude:	-79.8780276124187

9	1 of 1	W/58.5	199.9 / 0.00	ON	WWIS
Well ID:		7384552		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	08-Apr-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z346287		Contractor:	6946
Tag:		A318458		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (MILTON)			
Site Info:					

Bore Hole Information

Bore Hole ID:	1008645377	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590532.00
Code OB Desc:		North83:	4818828.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	17-Mar-2021 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:		on Water Well Record	
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Links

Bore Hole ID:	1008645377	Tag No:	A318458

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth M: Year Completed: 2021 Well Completed Dt: 2021/03/17 Audit No: Z346287				Contractor: 6946 Path: 738\7384552.pdf Latitude: 43.5169030807601 Longitude: -79.8798600932804	
10	1 of 4	NNW/58.7	199.9 / 0.00	409 Main Street East Milton ON L9T 1P7	EHS
Order No: 20011121006 Status: C Report Type: Site Report Report Date: 11/22/01 Date Received: 11/21/01 Previous Site Name: Lot/Building Size: Additional Info Ordered:				Nearest Intersection: Main Street East and Ontario Street North Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -79.878468 Y: 43.517717	
10	2 of 4	NNW/58.7	199.9 / 0.00	The 2nd Step to Fitness Incorporated 409 Main Street East Milton ON L9T 1P7	GEN
Generator No: ON1223837 SIC Code: SIC Description: Approval Years: 02,03,04 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
10	3 of 4	NNW/58.7	199.9 / 0.00	CARMUR HOLDINGS LTD. 409 MAIN STREET EAST MILTON ON L9T 1P7	GEN
Generator No: ON8494087 SIC Code: 9999 SIC Description: OTHER SERVICES Approval Years: 01 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
10	4 of 4	NNW/58.7	199.9 / 0.00	Carmur Holdings Ltd 409 Main Street East Milton ON L9T 1P7	GEN
Generator No: ON8494087 SIC Code: SIC Description: Approval Years: 02,03,04 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252					
Waste Class Name: WASTE OILS & LUBRICANTS					
11	1 of 1	N/62.2	199.2 / -0.70	439 MAIN STREET EAS MILTON ON	WWIS
Well ID: 7262015 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z231601 Tag: A198004 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MILTON TOWN (TRAFALGAR) Site Info: WKQ-008807 A0-A02					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 25-Apr-2016 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2016/03/31 Year Completed: 2016 Depth (m): 4.572 Latitude: 43.5178794133438 Longitude: -79.8784191382017 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1005938393					
DP2BR:					
Spatial Status:					
		Elevation:			
		Elevrc:			
		Zone:		17	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	590647.00
Code OB Desc:				North83:	4818938.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	31-Mar-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006051781			
Layer:		1			
Color:		3			
General Color:		BLUE			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006051782			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		34			
Mat3 Desc:		TILL			
Formation Top Depth:		3.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006051792			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006051790			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		15.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006051791			
Layer:		2			
Plug From:		4.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006051789			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006051780			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006051785			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006051786			
Layer:		1			
Slot:		0.1			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006051784			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1006051783			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1005938393			Tag No:	A198004
Depth M:	4.572			Contractor:	7241
Year Completed:	2016			Path:	726\7262015.pdf
Well Completed Dt:	2016/03/31			Latitude:	43.5178794133438
Audit No:	Z231601			Longitude:	-79.8784191382017
12	1 of 1	NW/67.4	199.9 / 0.00	383 MAIN ST. Milton ON	WWIS
Well ID:	7107041			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	25-Jun-2008 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	M01746			Contractor:	6607
Tag:	A067327			Form Version:	5
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (MILTON)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7107041.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2008/04/12				
Year Completed:	2008				
Depth (m):					
Latitude:	43.6805356047122				
Longitude:	-79.4713194901174				
Path:	710\7107041.pdf				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7107041.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2008/04/11				
Year Completed:	2008				
Depth (m):	7.6				
Latitude:	43.5176094327981				
Longitude:	-79.8793521085551				
Path:	710\7107041.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7107041.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2008/04/11			
Year Completed:		2008			
Depth (m):					
Latitude:		43.5176085839396			
Longitude:		-79.8792655138171			
Path:		710\7107041.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7107041.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2008/04/12			
Year Completed:		2008			
Depth (m):					
Latitude:		43.5175462937057			
Longitude:		-79.8793409042865			
Path:		710\7107041.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002710640	Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone:		17	
Code OB:		East83:		623217.00	
Code OB Desc:		North83:		4837527.00	
Open Hole:		Org CS:		UTM83	
Cluster Kind:	This is a record from cluster log sheet	UTMRC:		3	
Date Completed:	12-Apr-2008 00:00:00	UTMRC Desc:		margin of error : 10 - 30 m	
Remarks:		Location Method:		wwr	
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1002710644				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1002710643				
Method Construction Code:					
Method Construction:					
Other Method Construction:	BORING				
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID: Casing No: Comment: Alt Name:		1002710645 0			
<u>Construction Record - Casing</u>					
Casing ID: Layer: Material: Open Hole or Material: Depth From: Depth To: Casing Diameter: Casing Diameter UOM: Casing Depth UOM:		1002710647 5 PLASTIC 6.0 m			
<u>Construction Record - Screen</u>					
Screen ID: Layer: Slot: Screen Top Depth: Screen End Depth: Screen Material: Screen Depth UOM: Screen Diameter UOM: Screen Diameter:		1002710646 6.0 7.599999904632568 m			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc: Pump Test ID: Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:		1002710648			
<u>Hole Diameter</u>					
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM:		1002710642 21.0 7.599999904632568 m cm			
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR:	1002710630			Elevation: Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	17
Code OB:				East83:	590579.00
Code OB Desc:				North83:	4818907.00
Open Hole:				Org CS:	UTM83
Cluster Kind:		This is a record from cluster log sheet		UTMRC:	3
Date Completed:		11-Apr-2008 00:00:00		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002710635			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002710634			
Method Construction Code:					
Method Construction:					
Other Method Construction:		BORING			
<u>Pipe Information</u>					
Pipe ID:		1002710636			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002710638			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		5.0			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002710637			
Layer:					
Slot:					
Screen Top Depth:		5.0			
Screen End Depth:		6.5			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1002710639				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1002710632				
Diameter:	21.0				
Depth From:					
Depth To:	6.5				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Bore Hole Information</u>					
Bore Hole ID:	1001626521			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590572.00
Code OB Desc:				North83:	4818907.00
Open Hole:	No			Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	11-Apr-2008 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1002710665				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	34				
Most Common Material:	TILL				
Mat2:	06				
Mat2 Desc:	SILT				
Mat3:	28				
Mat3 Desc:	SAND				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		4.5			
Formation End Depth:		6.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002710666			
Layer:		4			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		6.0			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002710664			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.5			
Formation End Depth:		4.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002710662			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002710668			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002710669			
Layer:		2			
Plug From:		0.5			
Plug To:		6.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002710670			
Layer:		3			
Plug From:		6.0			
Plug To:		7.599999904632568			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002710674			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002710661			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002710671			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		7.599999904632568			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002710672			
Layer:		1			
Slot:		20			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID:		1002710667			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		7.599999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1002710649			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590573.00
Code OB Desc:				North83:	4818900.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	12-Apr-2008 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1002710653				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
 <u>Method of Construction & Well Use</u>					
Method Construction ID:	1002710652				
Method Construction Code:					
Method Construction:					
Other Method Construction:	BORING				
 <u>Pipe Information</u>					
Pipe ID:	1002710654				
Casing No:	0				
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:	1002710656				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	5.599999904632568				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:	1002710655				
Layer:					
Slot:					
Screen Top Depth:	5.599999904632568				
Screen End Depth:	8.0				
Screen Material:					
Screen Depth UOM:	m				
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1002710658				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1002710651				
Diameter:	21.0				
Depth From:					
Depth To:	8.0				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Links</u>					
Bore Hole ID:	1002710649			Tag No:	A067327
Depth M:				Contractor:	6607
Year Completed:	2008			Path:	710\7107041.pdf
Well Completed Dt:	2008/04/12			Latitude:	43.5175462937057
Audit No:	M01746			Longitude:	-79.8793409042865
<u>Links</u>					
Bore Hole ID:	1002710640			Tag No:	A067327
Depth M:				Contractor:	6607
Year Completed:	2008			Path:	710\7107041.pdf
Well Completed Dt:	2008/04/12			Latitude:	43.6805356047122
Audit No:	M01746			Longitude:	-79.4713194901174
<u>Links</u>					
Bore Hole ID:	1001626521			Tag No:	A067327

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth M: Year Completed: Well Completed Dt: Audit No:	7.6 2008 2008/04/11 M01746			Contractor: Path: Latitude: Longitude:	6607 710\7107041.pdf 43.5176094327981 -79.8793521085551
Links					
Bore Hole ID: Depth M: Year Completed: Well Completed Dt: Audit No:	1002710630 2008 2008/04/11 M01746			Tag No: Contractor: Path: Latitude: Longitude:	A067327 6607 710\7107041.pdf 43.5176085839396 -79.8792655138171
13	1 of 1	ESE/68.6	196.9 / -2.96	407 Pine Street Milton ON L9T 1L3	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20041222006 C Basic Report 12/30/04 12/22/04 			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON 0.25 -79.876968 43.516342
14	1 of 2	S/72.3	198.3 / -1.54	Union Gas Limited 362 Pearl St. Milton ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed:	6603-B49LQ9 NA 2018/09/03 Leak/Break 35 NATURAL GAS (METHANE) 1075 Air No 2018/09/03 Operator/Human Error Line Strike Site<UNOFFICIAL> Regional Municipality of Halton Union Gas: 1.25" Plastic IP Line Strike, Under Repair 0 other - see incident description			Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	 2 - Minor Environment Corporation Miscellaneous Communal 362 Pearl St. Halton-Peel Central Milton 4818691.11 590638.74 TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Pipeline/Components
14	2 of 2	S/72.3	198.3 / -1.54	PIPELINE HIT 1 1/4" 362 PEARL ST,,MILTON,ON,L9T 1M7,CA ON	PINC

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Id: Incident No: 2390268 Incident Reported Dt: 9/5/2018 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT 1 1/4" Incident Address: 362 PEARL ST,,MILTON,ON,L9T 1M7,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes: Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
15	1 of 1	N/78.4	199.7 / -0.13	425 Main Street East Milton ON	EHS
Order No: 20150817010 Status: C Report Type: Custom Report Report Date: 20-AUG-15 Date Received: 17-AUG-15 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.878469 Y: 43.518029					
16	1 of 1	N/81.9	199.9 / 0.00	425 - 429 Main Street East Milton ON	EHS
Order No: 20180314070 Status: C Report Type: Standard Report Report Date: 15-MAR-18 Date Received: 14-MAR-18 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.878453 Y: 43.51806					
17	1 of 12	WNW/83.4	199.9 / 0.00	GRIEF CONTAINERS 383 MAIN ST MILTON ON L9T 1P7	PRT
Location ID: 8849 Type: private Expiry Date: Capacity (L): 13638.00 Licence #: 0001037845					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
17	2 of 12	WNW/83.4	199.9 / 0.00	GREIF CONTAINERS INC 383 MAIN ST E MILTON ON L9T 1P7	SCT
Established:		1877			
Plant Size (ft²):		0			
Employment:		35			
--Details--					
Description:		FIBER CANS, TUBES, DRUMS, AND SIMILAR PRODUCTS			
SIC/NAICS Code:		2655			
Description:		Other Paperboard Container Manufacturing			
SIC/NAICS Code:		322219			
17	3 of 12	WNW/83.4	199.9 / 0.00	Greif Bros. Canada Inc. 383 Main St E Milton ON L9T 1P7	SCT
Established:		1877			
Plant Size (ft²):					
Employment:					
--Details--					
Description:		Other Paperboard Container Manufacturing			
SIC/NAICS Code:		322219			
17	4 of 12	WNW/83.4	199.9 / 0.00	Greif Bros. Canada Inc.- Div. of Greif Bros. Corporation 383 Main St E Milton ON L9T 1P7	SCT
Established:		1877			
Plant Size (ft²):					
Employment:		35			
--Details--					
Description:		Other Paperboard Container Manufacturing			
SIC/NAICS Code:		322219			
17	5 of 12	WNW/83.4	199.9 / 0.00	GRIEF BROS CANADA INC 383 MAIN ST E MILTON ON L9T 1P7	FSTH
License Issue Date:		11/8/1990			
Tank Status:		Licensed			
Tank Status As Of:		August 2007			
Operation Type:		Private Fuel Outlet			
Facility Type:		Gasoline Station - Self Serve			
--Details--					
Status:		Active			
Year of Installation:		1983			
Corrosion Protection:					
Capacity:		13638			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Diesel			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
17	6 of 12	WNW/83.4	199.9 / 0.00	383 Main Street Milton ON L9T 1P7	EHS
Order No:		20080204019		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Complete Report		Client Prov/State: ON	
Report Date:		2/8/2008		Search Radius (km): 0.25	
Date Received:		2/4/2008		X: -79.87992	
Previous Site Name:				Y: 43.517343	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps And /or Site Plans			
17	7 of 12	WNW/83.4	199.9 / 0.00	Greif Bros. Canada 383 Main Street East Milton ON L9T 1P7	GEN
Generator No:		ON9409021			
SIC Code:					
SIC Description:					
Approval Years:		06,07,08			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
17	8 of 12	WNW/83.4	199.9 / 0.00	GRIEF BROS CANADA INC 383 MAIN ST E MILTON ON L9T 1P7	FSTH
License Issue Date:		11/8/1990			
Tank Status:		Licensed			
Tank Status As Of:		December 2008			
Operation Type:		Private Fuel Outlet			
Facility Type:		Gasoline Station - Self Serve			
--Details--					
Status:		Active			
Year of Installation:		1983			
Corrosion Protection:					
Capacity:		13638			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Diesel			
17	9 of 12	WNW/83.4	199.9 / 0.00	383 MAIN ST. E. Milton ON	WWIS
Well ID:		7126539		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	
Water Type:				29-Jul-2009 00:00:00	
Casing Material:				Selected Flag:	
Audit No:		Z100225		TRUE	
Tag:		A087227		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				7241	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				HALTON	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		MILTON TOWN (MILTON)		Concession Name:	
Site Info:				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/712\7126539.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2009/06/18			
Year Completed:		2009			
Depth (m):		4.8768			
Latitude:		43.517566602536			
Longitude:		-79.8795756137305			
Path:		712\7126539.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1002581064		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
				East83:	
				590554.00	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	4818902.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		18-Jun-2009 00:00:00		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002648841			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		12.0			
Formation End Depth:		16.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002648838			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		26			
Mat2 Desc:		ROCK			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002648839			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		4.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002648840			
Layer:		3			
Color:		7			
General Color:		RED			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		8.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002648845			
Layer:		3			
Plug From:		3.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002648843			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002648844			
Layer:		2			
Plug From:		1.0			
Plug To:		3.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002648851			
Method Construction Code:		H			
Method Construction:		Geoprobe			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002648837			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1002648847			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1002648848			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.0			
Screen End Depth:		16.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1002648846			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1002648842			
Diameter:		10.920000076293945			
Depth From:		0.0			
Depth To:		16.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1002581064			Tag No:	A087227
Depth M:	4.8768			Contractor:	7241
Year Completed:	2009			Path:	712\7126539.pdf
Well Completed Dt:	2009/06/18			Latitude:	43.517566602536
Audit No:	Z100225			Longitude:	-79.8795756137305
17	10 of 12	WNW/83.4	199.9 / 0.00	DEL RIDGE (MAIN STREET) INC. 383 MAIN ST E, MILTON, ON, L9T 1P7 ON L9T 1P7	RSC
RSC ID:	79919			Cert Date:	13-Apr-10
RA No:				Cert Prop Use No:	No CPU
RSC Type:				Intended Prop Use:	Residential
Curr Property Use:	Industrial			Qual Person Name:	David de Sylva
Ministry District:	MILTON			Stratified (Y/N):	
Filing Date:	10-Jun-10			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	Yes
Date Returned:				Accuracy Estimate:	6 to 10 meters

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Restoration Type: Soil Type: Criteria: CPU Issued Sect 1686: Asmt Roll No: Prop ID No (PIN): Property Municipal Address: Mailing Address: Latitude & Longitude: UTM Coordinates: Consultant: Legal Desc: No 010 003 01000 0000 24950-0043 LT, 24950-0045 LT 383 MAIN ST E, MILTON, ON, L9T 1P7 Suite 18, 1151 DENISON ST, MARKHAM, ON, L3R 3Y4 43.51750000N 79.88000000W NAD83 17-590520-4818894 (converted from Latitude & Longitude) PT LT 14, CON 2 TRAFALGAR NEW SURVEY, AS IN 75840, 143003, 206665, 213086, 83218 EXCEPT EASEMENTS IN 143003, 75840 S/T 213086, 48949; MILTON/TRAFALGAR PT LT 14, CON 2 TRAFALGAR NEW SURVEY, PART 1, 20R5891; MILTON/TRAFALGAR Digitized from a map Full Depth Site Conditions Standard, with Potable Ground Water, Medium/Fine Textured Soil, for Residential/Parkland/Institutional property use Telephone: Fax: Email: 905-4795448 905-4792934 howland@bellnet.ca Measurement Method: Applicable Standards: RSC PDF: 					
17	11 of 12	WNW/83.4	199.9 / 0.00	Delridge Homes 383 Main St. Milton ON L9T 1M4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: ON3625284 236110 Residential Building Construction 2010 					
Detail(s) Waste Class: Waste Class Name: 252 WASTE OILS & LUBRICANTS					
17	12 of 12	WNW/83.4	199.9 / 0.00	GRIEF BROS CANADA INC 383 MAIN ST E MILTON L9T 1P7 ON CA ON	FST
Instance No: Status: Cont Name: Instance Type: Item: Item Description: Tank Type: Install Date: Install Year: Years in Service: Model: Description: Capacity: Tank Material: Corrosion Protect: Overfill Protect: Facility Type: 10849599 FS Liquid Fuel Tank FS Liquid Fuel Tank Single Wall UST 10/31/1990 1983 NULL 13638 Fiberglass (FRP) Fiberglass FS Liquid Fuel Tank Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Fuel Type2: Fuel Type3: Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue: Diesel NULL NULL 					

Detail(s)
Waste Class:
Waste Class Name:

252
WASTE OILS & LUBRICANTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Parent Facility Type:		Fuels Safety Private Fuel Outlet - Self Serve			
Facility Location:					
Device Installed Location:		383 MAIN ST E MILTON L9T 1P7 ON CA			
<u>Liquid Fuel Tank Details</u>					
Overfill Protection:					
Owner Account Name:		GRIEF BROS CANADA INC			
Item:		FS LIQUID FUEL TANK			

[18](#) 1 of 1 NE/91.0 198.9 / -0.93 ON [WWIS](#)

Well ID:	7270663	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	08-Sep-2016 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	C29374	Contractor:	7215
Tag:		Form Version:	8
Constructn Method:		Owner:	
Elevation (m):		County:	HALTON
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	MILTON TOWN (TRAFALGAR)		
Site Info:			

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date:	2015/05/15
Year Completed:	2015
Depth (m):	
Latitude:	43.5178993797022
Longitude:	-79.8777011354626
Path:	

Bore Hole Information

Bore Hole ID:	1006234886	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590705.00
Code OB Desc:		North83:	4818941.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	15-May-2015 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
Links					
Bore Hole ID:	1006234886			Tag No:	
Depth M:				Contractor:	7215
Year Completed:	2015			Path:	
Well Completed Dt:	2015/05/15			Latitude:	43.5178993797022
Audit No:	C29374			Longitude:	-79.8777011354626

19	1 of 1	NE/93.9	198.9 / -0.94	ON	WWIS
Well ID:	7270664			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	08-Sep-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C29375			Contractor:	7215
Tag:	A178745			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					
PDF URL (Map):					

Additional Detail(s) (Map)

Well Completed Date: 2015/05/15
 Year Completed: 2015
 Depth (m):
 Latitude: 43.5178896484961
 Longitude: -79.8776270779741
 Path:

Bore Hole Information

Bore Hole ID:	1006234889	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590711.00
Code OB Desc:		North83:	4818940.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	15-May-2015 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Links</u>					
Bore Hole ID:	1006234889			Tag No:	A178745
Depth M:				Contractor:	7215
Year Completed:	2015			Path:	
Well Completed Dt:	2015/05/15			Latitude:	43.5178896484961
Audit No:	C29375			Longitude:	-79.8776270779741
<u>20</u>	1 of 1	N/94.2	199.9 / 0.00	425 - 439 Main Street East Milton ON	EHS
Order No:	20160309035			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	14-MAR-16			Search Radius (km):	.25
Date Received:	09-MAR-16			X:	-79.878336
Previous Site Name:				Y:	43.518162
Lot/Building Size:					
Additional Info Ordered:					
<u>21</u>	1 of 2	WSW/95.7	198.5 / -1.38	R.M. OF HALTON COURT ST/MAIN ST. MILTON TOWN ON	CA
Certificate #:	3-0233-95-				
Application Year:	95				
Issue Date:	3/14/1995				
Approval Type:	Municipal sewage				
Status:	Approved				
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
<u>21</u>	2 of 2	WSW/95.7	198.5 / -1.38	R.M. OF HALTON COURT ST/MAIN ST. MILTON TOWN ON	CA
Certificate #:	7-0167-95-				
Application Year:	95				
Issue Date:	3/14/1995				
Approval Type:	Municipal water				
Status:	Approved				
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
22	1 of 4	N/96.9	199.7 / -0.13	STREET PROPERTIES 425 MAIN STREET EAST MILTON ON L9T 1P7	GEN
Generator No:		ON8826420			
SIC Code:		541990			
SIC Description:		ALL OTHER PROFESSIONAL, SCIENTIFIC AND TECHNICAL SERVICES			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
Detail(s)					
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
22	2 of 4	N/96.9	199.7 / -0.13	425 Main Street East Milton ON L9T 1P7	EHS
Order No:		20200220011		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		25-FEB-20		Search Radius (km): .25	
Date Received:		20-FEB-20		X: -79.8782896	
Previous Site Name:				Y: 43.5181806	
Lot/Building Size:					
Additional Info Ordered:					
22	3 of 4	N/96.9	199.7 / -0.13	425 Main Street East Milton ON L9T 1P7	EHS
Order No:		20200220011		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		25-FEB-20		Search Radius (km): .25	
Date Received:		20-FEB-20		X: -79.8782896	
Previous Site Name:				Y: 43.5181806	
Lot/Building Size:					
Additional Info Ordered:					
22	4 of 4	N/96.9	199.7 / -0.13	425 Main Street East Milton ON L9T 1P7	EHS
Order No:		20200220011		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		25-FEB-20		Search Radius (km): .25	
Date Received:		20-FEB-20		X: -79.8782896	
Previous Site Name:				Y: 43.5181806	
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
23	1 of 1	NE/97.3	197.7 / -2.11	18, 20 & 22 Ontario Street South Milton ON L9T 2M6	EHS
Order No: 22090900544 Status: C Report Type: Standard Report Report Date: 14-SEP-22 Date Received: 09-SEP-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.8772665 Y: 43.5177153			
24	1 of 3	NE/100.2	197.7 / -2.11	Materials Transportation Cda 420 Main St E Unit C Suite 584 Milton ON L9T 1P9	SCT
Established: 01-AUG-96 Plant Size (ft²): 2800 Employment:					
--Details-- Description: Material Handling Equipment Manufacturing SIC/NAICS Code: 333920					
24	2 of 3	NE/100.2	197.7 / -2.11	PGBELL 420 Main St E Suite 563 Milton ON L9T 1P9	SCT
Established: 01-AUG-40 Plant Size (ft²): Employment:					
--Details-- Description: All Other Non-Metallic Mineral Product Manufacturing SIC/NAICS Code: 327990					
Description: Sign Manufacturing SIC/NAICS Code: 339950					
Description: Pottery, Ceramics and Plumbing Fixture Manufacturing SIC/NAICS Code: 327110					
24	3 of 3	NE/100.2	197.7 / -2.11	Mayrose-Tycon Limited 420 Main Street East, Suite 598 Milton ON L9T 5G3	GEN
Generator No: ON2638684 SIC Code: 562910 SIC Description: REMEDIATION SERVICES Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: Ahmed Al-Temimi Choice of Contact: CO_ADMIN Phone No Admin: 4164104333 Ext.201 Contaminated Facility: No MHSW Facility: No					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
25	1 of 1	NE/106.5	198.5 / -1.33	ON	WWIS
Well ID:	7239049			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	30-Mar-2015 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C18505			Contractor:	7383
Tag:	A166546			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2014/10/27			
Year Completed:		2014			
Depth (m):					
Latitude:		43.5179329607968			
Longitude:		-79.8774530532416			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1005317792			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590725.00
Code OB Desc:				North83:	4818945.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-Oct-2014 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Links</u>					
Bore Hole ID:	1005317792			Tag No:	A166546

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth M:				Contractor:	7383
Year Completed:	2014			Path:	
Well Completed Dt:	2014/10/27			Latitude:	43.5179329607968
Audit No:	C18505			Longitude:	-79.8774530532416

26	1 of 1	SW/113.1	199.9 / 0.00	15 Court Street S lot 13 con 2 Milton ON	WWIS
Well ID:	7326515			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	14-Jan-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z280409			Contractor:	6178
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliability:				Lot:	013
Depth to Bedrock:				Concession:	02
Well Depth:				Concession Name:	NS
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2018/12/20
Year Completed: 2018
Depth (m):
Latitude: 43.5157580598738
Longitude: -79.8797080601152
Path:

Bore Hole Information

Bore Hole ID: 1007345508
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 20-Dec-2018 00:00:00
Remarks:
Loc Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 17
East83: 590546.00
North83: 4818701.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Annular Space/Abandonment Sealing Record

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007746886			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007749568			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007741172			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007750840			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		9.5			
Depth To:		0.0			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007753108			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Links</u>					
Bore Hole ID:	1007345508			Tag No:	
Depth M:				Contractor:	6178
Year Completed:	2018			Path:	732\7326515.pdf
Well Completed Dt:	2018/12/20			Latitude:	43.5157580598738
Audit No:	Z280409			Longitude:	-79.8797080601152

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
27	1 of 1	E/117.9	195.8 / -4.08	MILTON TOWN - PINE ST/CONT.#PW-02-90 PINE ST/ONTARIO ST/BRUCE ST. MILTON TOWN ON	CA
Certificate #: 3-1284-90- Application Year: 90 Issue Date: 7/16/1990 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
28	1 of 1	N/119.5	199.9 / 0.00	439 MAIN STREET EAST MILTON ON	WWIS
Well ID: 7262016 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z231602 Tag: A183334 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info: MILTON TOWN (TRAFALGAR) WKQ-008807 A0-A02 Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 25-Apr-2016 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): <u>Additional Detail(s) (Map)</u> Well Completed Date: 2016/03/31 Year Completed: 2016 Depth (m): 6.096 Latitude: 43.5183918301149 Longitude: -79.8783354072752 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1005938396 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Elevation: Elevrc: Zone: 17 East83: 590653.00 North83: 4818995.00 Org CS: UTM83 UTMRC: 4					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Completed:		31-Mar-2016 00:00:00		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006051795			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		34			
Mat3 Desc:		TILL			
Formation Top Depth:		3.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006051794			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006051803			
Layer:		1			
Plug From:		20.0			
Plug To:		9.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006051804			
Layer:		2			
Plug From:		9.0			
Plug To:		0.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006051805			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006051802			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006051793			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006051798			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006051799			
Layer:		1			
Slot:		.10			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006051797			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006051796			
Diameter:		6.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1005938396			Tag No:	A183334
Depth M:	6.096			Contractor:	7241
Year Completed:	2016			Path:	726\7262016.pdf
Well Completed Dt:	2016/03/31			Latitude:	43.5183918301149
Audit No:	Z231602			Longitude:	-79.8783354072752

29	1 of 1	NNE/120.2	199.6 / -0.30	ON	WWIS
Well ID:	7260653			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	04-Apr-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C30439			Contractor:	7383
Tag:	A195002			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2015/12/05
Year Completed: 2015
Depth (m):
Latitude: 43.5183436612668
Longitude: -79.8780145998097
Path:

Bore Hole Information

Bore Hole ID:	1005921321	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590679.00
Code OB Desc:		North83:	4818990.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	05-Dec-2015 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Links</u>					
Bore Hole ID:	1005921321			Tag No:	A195002
Depth M:				Contractor:	7383
Year Completed:	2015			Path:	
Well Completed Dt:	2015/12/05			Latitude:	43.5183436612668
Audit No:	C30439			Longitude:	-79.8780145998097
30	1 of 1	N/123.9	199.9 / 0.00	439 MAIN STREET EAST MILTON ON	WWIS
Well ID:	7262017			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	25-Apr-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z229493			Contractor:	7241
Tag:	A183377			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (TRAFALGAR)				
Site Info:	WKQ-008807 A0-A02				
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2016/03/31				
Year Completed:	2016				
Depth (m):	6.096				
Latitude:	43.5184386632696				
Longitude:	-79.8785201359912				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1005938399			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590638.00
Code OB Desc:				North83:	4819000.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	31-Mar-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006051808			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		34			
Mat3 Desc:		TILL			
Formation Top Depth:		3.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006051807			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006051816			
Layer:		1			
Plug From:		20.0			
Plug To:		9.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006051817			
Layer:		2			
Plug From:		9.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006051818			
Layer:		3			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006051815			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006051806			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006051811			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006051812			
Layer:		1			
Slot:		.10			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1006051810			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006051809			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	1005938399			Tag No:	A183377
Depth M:	6.096			Contractor:	7241
Year Completed:	2016			Path:	726\7262017.pdf
Well Completed Dt:	2016/03/31			Latitude:	43.5184386632696
Audit No:	Z229493			Longitude:	-79.8785201359912
<u>31</u>	1 of 16	WSW/130.5	197.5 / -2.31	3176461 CANADA INC., NEXACOR REALTY 330 MAIN STREET MILTON ON	CA
Certificate #:	8-3482-98-				
Application Year:	98				
Issue Date:	11/25/1998				
Approval Type:	Industrial air				
Status:	Approved				
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:	EMERGENCY POWER FOR BELL TELECOM NETWORK				
Contaminants:	Nitrogen Oxides				
Emission Control:	No Controls				
<u>31</u>	2 of 16	WSW/130.5	197.5 / -2.31	BELL CANADA 330 MAIN STREET MILTON ON L9T 1P4	GEN
Generator No:	ON0033978				
SIC Code:	4821				
SIC Description:	TELECOMMUN. CARRRIERS				
Approval Years:	99,00,01,02,03,04,05,06				
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
Waste Class:	121				
Waste Class Name:	ALKALINE WASTES - HEAVY METALS				
Waste Class:	148				
Waste Class Name:	INORGANIC LABORATORY CHEMICALS				
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
Waste Class:	263				
Waste Class Name:	ORGANIC LABORATORY CHEMICALS				
Waste Class:	331				
Waste Class Name:	WASTE COMPRESSED GASES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
31	3 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON4957692 517110, 517210, 517510 Wired Telecommunications Carriers, Wireless Telecommunications Carriers (except Satellite), Cable and Other Program Distribution 2009			
<u>Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
31	4 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON4957692 517110, 517210, 517510 Wired Telecommunications Carriers, Wireless Telecommunications Carriers (except Satellite), Cable and Other Program Distribution 2010			
<u>Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
31	5 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON	GEN
Generator No: SIC Code: SIC Description: Approval Years:		ON4957692 517110, 517210, 517510 Wired Telecommunications Carriers, Wireless Telecommunications Carriers (except Satellite), Cable and Other Program Distribution 2011			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
Waste Class: Waste Class Name:		121 ALKALINE WASTES - HEAVY METALS			
31	6 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON	GEN
Generator No: SIC Code: SIC Description:		ON4957692 517110, 517210, 517510 Wired Telecommunications Carriers, Wireless Telecommunications Carriers (except Satellite), Cable and Other Program Distribution			
Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		2012			
Detail(s)					
Waste Class: Waste Class Name:		121 ALKALINE WASTES - HEAVY METALS			
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
31	7 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON	GEN
Generator No: SIC Code: SIC Description:		ON4957692 517110, 517210, 517510 WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE)			
Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		2013			
Detail(s)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
31	8 of 16	WSW/130.5	197.5 / -2.31	BELL CANADA 330 MAIN ST E MILTON L9T 1P4 ON CA ON	CFOT
Licence No:				Item Description:	Fuel Oil Tank
Registration No:				Instance Type:	
Posse File No:				Facility Type:	
Posse Reg No:				Fuel Type:	
Status Name:				Distributor:	
Tank Type:	Double Wall UST			Letter Sent:	
Tank Size:	5000			Comments:	
Tank Material:	Fiberglass (FRP)			Corrosion Protect:	
Instance No:	64689595			Province:	
Inst Creation Date:	6/2/2015 10:08:02 AM			Nbr:	
Inst Install Date:	6/2/2015 10:08:02 AM			Context:	FS Fuel Oil Tank
Item:	FS FUEL OIL TANK				
Tank Age (as of 05/1992):					
Device Installed Location:	330 MAIN ST E MILTON L9T 1P4 ON CA				
Description:	Veeder-Root leak detection system. Brine interstitial monitoring				
Contact Name:					
Contact Address:					
Contact Address2:					
Contact Suite:					
Contact City:					
Contact Prov:					
Contact Postal:					
31	9 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON L9T 1P4	GEN
Generator No:	ON4957692				
SIC Code:	517110, 517210, 517510				
SIC Description:	WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510				
Approval Years:	2016				
PO Box No:					
Country:	Canada				
Status:					
Co Admin:	Chloe Lamothe-Luneau				
Choice of Contact:	CO_ADMIN				
Phone No Admin:	514-391-1021 Ext.				
Contaminated Facility:	No				
MHSW Facility:	No				
<u>Detail(s)</u>					
Waste Class:	113				
Waste Class Name:	ACID WASTE - OTHER METALS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		331 WASTE COMPRESSED GASES			
Waste Class: Waste Class Name:		243 PCBS			
Waste Class: Waste Class Name:		121 ALKALINE WASTES - HEAVY METALS			
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			

<u>31</u>	10 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON L9T 1P4	GEN

Generator No: ON4957692
SIC Code: 517110, 517210, 517510
SIC Description: WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510
Approval Years: 2015
PO Box No:
Country: Canada
Status:
Co Admin: Julie Labelle
Choice of Contact: CO_OFFICIAL
Phone No Admin: 514-870-0688 Ext.
Contaminated Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Class: 113
Waste Class Name: ACID WASTE - OTHER METALS

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

<u>31</u>	11 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON L9T 1P4	GEN

Generator No: ON4957692
SIC Code: 517110, 517210, 517510
SIC Description: WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510
Approval Years: 2014
PO Box No:
Country: Canada
Status:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		Julie Labelle CO_OFFICIAL 514-870-0688 Ext. No No			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
Waste Class: Waste Class Name:		121 ALKALINE WASTES - HEAVY METALS			
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
Waste Class: Waste Class Name:		113 ACID WASTE - OTHER METALS			
Waste Class: Waste Class Name:		331 WASTE COMPRESSED GASES			
31	12 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON L9T 1P4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON4957692 As of Dec 2018 Canada Registered			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		113 C Acid solutions - containing other metals and non-metals			
Waste Class: Waste Class Name:		113 L Acid solutions - containing other metals and non-metals			
Waste Class: Waste Class Name:		121 C Alkaline slutions - containing heavy metals			
Waste Class: Waste Class Name:		146 C Other specified inorganic sludges, slurries or solids			
Waste Class: Waste Class Name:		243 D PCB			
Waste Class: Waste Class Name:		252 L Waste crankcase oils and lubricants			
Waste Class: Waste Class Name:		331 I Waste compressed gases including cylinders			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
31	13 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON L9T 1P4	GEN
Generator No: ON4957692 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: 252 L Waste Class Name: Waste crankcase oils and lubricants Waste Class: 113 C Waste Class Name: Acid solutions - containing other metals and non-metals Waste Class: 121 C Waste Class Name: Alkaline slutions - containing heavy metals Waste Class: 331 I Waste Class Name: Waste compressed gases including cylinders Waste Class: 146 C Waste Class Name: Other specified inorganic sludges, slurries or solids Waste Class: 113 L Waste Class Name: Acid solutions - containing other metals and non-metals Waste Class: 243 D Waste Class Name: PCB					
31	14 of 16	WSW/130.5	197.5 / -2.31	BELL CANADA 330 MAIN ST E MILTON L9T 1P4 ON CA ON	DTNK
Delisted Fuel Storage Tank					
Instance No: 64689595 Status: Active Instance Type: Fuel Type: Cont Name: Capacity: 5000 Tank Material: Fiberglass (FRP) Corrosion Prot: Fiberglass Tank Type: Double Wall UST Install Year: 2016 Facility Type: FS FUEL OIL TANK Device Installed Loc: Fuel Type 2: Fuel Type 3: Item:					
Creation Date: 6/2/2015 10:13:35 AM Overfill Prot Type: Facility Location: 330 MAIN ST E MILTON L9T 1P4 ON CA Piping SW Steel: Piping SW Galvan: Tanks SW Steel: Piping Underground: No Underground: Max Hazard Rank: NULL Max Hazard Rank 1: NULL Nxt Period Start Dt: NULL Program Area 1: NULL Program Area 2: NULL Nxt Period Strt Dt 2: NULL Risk Based Periodic: NULL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Item Description:	Fuel Oil Tank			Vol of Directives:	NULL
Model:	NULL			Years in Service:	NULL
Description:	Veeder-Root leak detection system. Brine interstitial monitoring			Created Date:	NULL
Instance Creation Dt:	6/2/2015 10:08:02 AM			Federal Device:	NULL
Instance Install Dt:	6/2/2015 10:08:02 AM			Periodic Exempt:	NULL
Manufacturer:	NULL			Statutory Interval:	NULL
Serial No:	NULL			Rcomnd Insp Interval:	NULL
ULC Standard:	NULL			Recommended Toler:	NULL
Quantity:	1			Panam Venue Name:	NULL
Unit of Measure:	EA			External Identifier:	NULL
Parent Fac Type:					
TSSA Base Sched Cycle 1:	NULL				
TSSA Base Sched Cycle 2:	NULL				
Original Source:	FST				
Record Date:	31-MAY-2021				

<u>31</u>	15 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON L9T 1P4	GEN
Generator No:	ON4957692				
SIC Code:					
SIC Description:					
Approval Years:	As of Nov 2021				
PO Box No:					
Country:	Canada				
Status:	Registered				
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
 <u>Detail(s)</u>					
Waste Class:	121 C				
Waste Class Name:	Alkaline slutions - containing heavy metals				
Waste Class:	146 C				
Waste Class Name:	Other specified inorganic sludges, slurries or solids				
Waste Class:	331 I				
Waste Class Name:	Waste compressed gases including cylinders				
Waste Class:	113 L				
Waste Class Name:	Acid solutions - containing other metals and non-metals				
Waste Class:	252 L				
Waste Class Name:	Waste crankcase oils and lubricants				
Waste Class:	113 C				
Waste Class Name:	Acid solutions - containing other metals and non-metals				
Waste Class:	243 D				
Waste Class Name:	PCB				

<u>31</u>	16 of 16	WSW/130.5	197.5 / -2.31	Bell Canada 330 Main Street Milton ON L9T 1P4	GEN
Generator No:	ON4957692				
SIC Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description: Approval Years:As of Oct 2022 PO Box No: Country:Canada Status:Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		113 C			
Waste Class Name:		ACID WASTE - OTHER METALS			
Waste Class:		243 D			
Waste Class Name:		PCBS			
Waste Class:		121 C			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		146 C			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		331 I			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		113 L			
Waste Class Name:		ACID WASTE - OTHER METALS			

32	1 of 3	WSW/132.5	198.0 / -1.84	335 Main Street East Milton ON L9T 1P5	EHS
Order No:		21060300600		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:ON	
Report Date:		08-JUN-21		Search Radius (km):.25	
Date Received:		03-JUN-21		X:-79.8804113	
Previous Site Name:				Y:43.5159695	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; Topographic Maps; City Directory; Aerial Photos			

32	2 of 3	WSW/132.5	198.0 / -1.84	335 Main Street East Milton ON L9T 1P5	EHS
Order No:		21060300600		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:ON	
Report Date:		08-JUN-21		Search Radius (km):.25	
Date Received:		03-JUN-21		X:-79.8804113	
Previous Site Name:				Y:43.5159695	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; Topographic Maps; City Directory; Aerial Photos			

32	3 of 3	WSW/132.5	198.0 / -1.84	335 Main Street East Milton ON L9T 1P5	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No:	21060300600			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	08-JUN-21			Search Radius (km):	.25
Date Received:	03-JUN-21			X:	-79.8804113
Previous Site Name:				Y:	43.5159695
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Topographic Maps; City Directory; Aerial Photos				

33	1 of 1	E/140.0	195.8 / -4.04	446 PINE STREET Milton ON	WWIS
Well ID:	7288932			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	23-Jun-2017 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z257563			Contractor:	7383
Tag:	A211840			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (TRAFALGAR)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/728\7288932.pdf				

Additional Detail(s) (Map)

Well Completed Date: 2017/01/26
 Year Completed: 2017
 Depth (m):
 Latitude: 43.5167215241383
 Longitude: -79.8760402755136
 Path: 728\7288932.pdf

Bore Hole Information

Bore Hole ID:	1006563476	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590841.00
Code OB Desc:		North83:	4818812.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	26-Jan-2017 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006782499			
Layer:					
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006782507			
Layer:		2			
Plug From:		0.0			
Plug To:		9.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006782506			
Layer:		1			
Plug From:					
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006782508			
Layer:		3			
Plug From:		9.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006782505			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006782498			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1006782502			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006782503			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Water Details</u>					
Water ID:		1006782501			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006782500			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1006563476			Tag No:	A211840
Depth M:				Contractor:	7383
Year Completed:	2017			Path:	728\7288932.pdf
Well Completed Dt:	2017/01/26			Latitude:	43.5167215241383
Audit No:	Z257563			Longitude:	-79.8760402755136
34	1 of 3	SSE/141.0	195.8 / -4.01	GUARANTEED GREEN 366 PINE ST MILTON ON L9T1K9	PES
Detail Licence No:	02-01-03113-0			Operator Box:	
Licence No:	03113			Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:	Legacy Licenses (Excluding TS)			Oper Area Code:	905
Licence Type:	Operator			Oper Phone No:	8788873
Licence Type Code:	02			Operator Ext:	
Licence Class:	01			Operator Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:	0 3 28			Oper Concession: Operator Region: 3 Operator District: Operator County: 28 Op Municipality: Post Office Box: MOE District: SWP Area Name:	
34	2 of 3	SSE/141.0	195.8 / -4.01	GUARANTEED GREEN 366 PINE ST MILTON ON L9T1K9	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:	06506 Legacy Licenses (Excluding TS) Operator 02 01			Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 8788873 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:	
34	3 of 3	SSE/141.0	195.8 / -4.01	GUARANTEED GREEN 366 PINE ST MILTON ON L9T1K9	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:	03113 Legacy Licenses (Excluding TS) Operator 01 06			Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 8788873 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:	
35	1 of 1	NNE/141.1	198.8 / -1.06	The Regional Municipality of Halton Main Street East and Ontario Street Right of Way Milton ON L6M 3L1	ECA

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval No: 9785-AKHKRB Approval Date: 2017-03-17 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: The Regional Municipality of Halton Address: Main Street East and Ontario Street Right of Way Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/1211-AKEPR6-14.pdf PDF Site Location:					
36	1 of 1	E/151.6	195.8 / -4.08	Ontario St & Pine St Milton ON	EHS
Order No: 20161117110 Status: C Report Type: Custom Report Report Date: 24-NOV-16 Date Received: 17-NOV-16 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.8759 Y: 43.516698					
37	1 of 1	ENE/159.7	197.6 / -2.23	55 ONTARIO STREET SOUTH MILTON ON	WWIS
Well ID: 2810303 Construction Date: Use 1st: Use 2nd: Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z32267 Tag: A010194 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MILTON TOWN (TRAFALGAR) Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 22-Jul-2005 00:00:00 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 6607 Form Version: 3 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810303.pdf					
Additional Detail(s) (Map)					
Well Completed Date: 2005/07/05 Year Completed: 2005 Depth (m): Latitude: 43.5173956198469 Longitude: -79.8759164060678 Path: 281\2810303.pdf					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	11319258			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590850.00
Code OB Desc:				North83:	4818887.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05-Jul-2005 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	933273351				
Layer:	2				
Plug From:	0.30000001192092896				
Plug To:	6.199999809265137				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	933273352				
Layer:	1				
Plug From:	0.0				
Plug To:	0.30000001192092896				
Plug Depth UOM:	m				
<u>Method of Construction & Well Use</u>					
Method Construction ID:	962810303				
Method Construction Code:	6				
Method Construction:	Boring				
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	11334113				
Casing No:	1				
Comment:					
Alt Name:					
<u>Water Details</u>					
Water ID:	934062473				
Layer:	1				
Kind Code:					
Kind:					
Water Found Depth:	6.199999809265137				
Water Found Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		11537835			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		6.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11319258			Tag No:	A010194
Depth M:				Contractor:	6607
Year Completed:	2005			Path:	281\2810303.pdf
Well Completed Dt:	2005/07/05			Latitude:	43.5173956198469
Audit No:	Z32267			Longitude:	-79.8759164060678
38	1 of 1	E/180.0	195.9 / -3.99	ENBRIDGE GAS INC 80 ONTARIO ST S,,MILTON,ON,L9T 2M7,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:	2843788			Fuel Category:	
Incident Reported Dt:	5/5/2020			Health Impact:	
Type:	FS-Pipeline Incident			Environment Impact:	
Status Code:				Property Damage:	
Tank Status:	Pipeline Damage Reason Est			Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:	ENBRIDGE GAS INC				
Incident Address:	80 ONTARIO ST S,,MILTON,ON,L9T 2M7,CA				
Operation Type:					
Pipeline Type:					
Regulator Type:					
Summary:					
Reported By:					
Affiliation:					
Occurrence Desc:					
Damage Reason:					
Notes:					
39	1 of 1	NNW/188.8	199.9 / 0.00	80 ONTARIO STREET NORTH MILTON ON	WWIS
Well ID:	7257999			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	17-Feb-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z225982			Contractor:	7241
Tag:	A183388			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
		MILTON TOWN (TRAFALGAR) WKQ-008610 A0-A 04			
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:		2016/01/07 2016 8.2296 43.5189061632447 -79.8793652261192			
Bore Hole Information					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:		1005889188 07-Jan-2016 00:00:00 on Water Well Record		Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	 17 590569.00 4819051.00 UTM83 4 margin of error : 30 m - 100 m wwr
Overburden and Bedrock Materials Interval					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Mat2 Desc: Mat3: Mat3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:		1005987267 1 6 BROWN 06 SILT 28 SAND 66 DENSE 0.0 17.0 ft			
Overburden and Bedrock Materials Interval					
Formation ID: Layer: Color: General Color:		1005987268 2 7 RED			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		17.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987276			
Layer:		1			
Plug From:		27.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987278			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987277			
Layer:		2			
Plug From:		16.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005987275			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005987266			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005987271			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		17.0			
Casing Diameter:		2.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005987272			
Layer:		1			
Slot:		.10			
Screen Top Depth:		17.0			
Screen End Depth:		27.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1005987270			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1005987269			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		27.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:		1005889188		Tag No:	A183388
Depth M:		8.2296		Contractor:	7241
Year Completed:		2016		Path:	725\7257999.pdf
Well Completed Dt:		2016/01/07		Latitude:	43.5189061632447
Audit No:		Z225982		Longitude:	-79.8793652261192
40	1 of 7	SW/189.5	194.7 / -5.11	310 Main St E Milton ON L9T1P4	EHS
Order No:		20151022099		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	ON
Report Date:		29-OCT-15		Search Radius (km):	.25
Date Received:		22-OCT-15		X:	-79.880343
Previous Site Name:				Y:	43.515288
Lot/Building Size:					
Additional Info Ordered:					
40	2 of 7	SW/189.5	194.7 / -5.11	Acclaim Health 310 Main Street East, Suite 104 Milton ON L9T 1P4	GEN
Generator No:		ON6817027			
SIC Code:		621610			
SIC Description:		621610			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Michele Swanson Choice of Contact: CO_ADMIN Phone No Admin: 9058278800 Ext.2011 Contaminated Facility: No MHSW Facility: No <u>Detail(s)</u> Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
40	3 of 7	SW/189.5	194.7 / -5.11	Acclaim Health 310 Main Street East, Suite 104 Milton ON L9T 1P4	GEN
Generator No: ON6817027 SIC Code: 621610 SIC Description: 621610 Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: Michele Swanson Choice of Contact: CO_ADMIN Phone No Admin: 9058278800 Ext.2011 Contaminated Facility: No MHSW Facility: No <u>Detail(s)</u> Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
40	4 of 7	SW/189.5	194.7 / -5.11	Acclaim Health Milton Clinic 310 Main Street East, Suite 104 Milton ON L9T 1P4	GEN
Generator No: ON6817027 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: <u>Detail(s)</u> Waste Class: 312 P Waste Class Name: Pathological wastes					
40	5 of 7	SW/189.5	194.7 / -5.11	Acclaim Health Milton Clinic 310 Main Street East, Suite 104	GEN

118 erisinfo.com | Environmental Risk Information Services Order No: 23030300040

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
41	1 of 1	ENE/197.7	198.3 / -1.58	55 ONTARIO ST SOUTH MILTON, ONT ON	WWIS
Well ID:		2810237		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Not Used		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	
Water Type:				20-May-2005 00:00:00	
Casing Material:				Selected Flag:	
Audit No:		Z27419		TRUE	
Tag:		A015013		Abandonment Rec:	
Constructn Method:				Yes	
Elevation (m):				Contractor:	
Elevatn Reliabilty:				7230	
Depth to Bedrock:				Form Version:	
Well Depth:				3	
Overburden/Bedrock:				Owner:	
Pump Rate:				County:	
Static Water Level:				HALTON	
Clear/Cloudy:				Lot:	
Municipality:		MILTON TOWN (TRAFALGAR)		Concession:	
Site Info:				Concession Name:	
				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810237.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2005/04/06			
Year Completed:		2005			
Depth (m):					
Latitude:		43.5179619281754			
Longitude:		-79.875819281095			
Path:		281\2810237.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11319192		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				590857.00	
Cluster Kind:				North83:	
Date Completed:		06-Apr-2005 00:00:00		4818950.00	
Remarks:				Org CS:	
Loc Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933269116			
Laver:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		7.800000190734863			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		962810237			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11334047			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930860190			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.5			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933412741			
Layer:		1			
Slot:		010			
Screen Top Depth:		4.5			
Screen End Depth:		7.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		5.300000190734863			
<u>Water Details</u>					
Water ID:		934060112			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		3.4000000953674316			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11537763			
Diameter:		12.5			
Depth From:		0.0			
Depth To:		7.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	11319192			Tag No:	A015013
Depth M:				Contractor:	7230
Year Completed:	2005			Path:	281\2810237.pdf
Well Completed Dt:	2005/04/06			Latitude:	43.5179619281754
Audit No:	Z27419			Longitude:	-79.875819281095
42	1 of 2	ENE/205.6	198.9 / -0.93	55 ONTARIO ST S lot 13 con 3 MILTON ON	WWIS
Well ID:	2810059			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	1
Final Well Status:	Observation Wells			Date Received:	17-Sep-2004 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z17042			Contractor:	6607
Tag:	A010184			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	013
Depth to Bedrock:				Concession:	03
Well Depth:				Concession Name:	NS
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810059.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2004/07/31				
Year Completed:	2004				
Depth (m):	13				
Latitude:	43.518142830368				
Longitude:	-79.8759025333681				
Path:	281\2810059.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11174676			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590850.00
Code OB Desc:				North83:	4818970.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	31-Jul-2004 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932974916			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932974918			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		17			
Mat3 Desc:		SHALE			
Formation Top Depth:		11.0			
Formation End Depth:		13.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932974917			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		06			
Mat3 Desc:		SILT			
Formation Top Depth:		5.0			
Formation End Depth:		11.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933255921			
Layer:		1			
Plug From:		0.0			
Plug To:		10.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: 962810059					
Method Construction Code: 6					
Method Construction: Boring					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 11183195					
Casing No: 1					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 930845982					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 10.699999809265137					
Casing Diameter: 5.0					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 933409576					
Layer: 1					
Slot: 10					
Screen Top Depth: 10.699999809265137					
Screen End Depth: 13.0					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 6.400000095367432					
<u>Water Details</u>					
Water ID: 934052444					
Layer: 1					
Kind Code:					
Kind:					
Water Found Depth: 13.0					
Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 11308276					
Diameter: 15.0					
Depth From: 0.0					
Depth To: 13.0					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 11174676		Tag No: A010184			
Depth M: 13		Contractor: 6607			
Year Completed: 2004		Path: 281\2810059.pdf			
Well Completed Dt: 2004/07/31		Latitude: 43.518142830368			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	Z17042			Longitude:	-79.8759025333681
42	2 of 2	ENE/205.6	198.9 / -0.93	55 ONTARIO ST S lot 13 con 3 MILTON ON	WWIS
Well ID:	2810101			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Not Used			Data Entry Status:	
Use 2nd:				Data Src:	1
Final Well Status:	Abandoned-Other			Date Received:	17-Nov-2004 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z19554			Contractor:	6607
Tag:				Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	013
Depth to Bedrock:				Concession:	03
Well Depth:				Concession Name:	NS
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810101.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2004/11/01				
Year Completed:	2004				
Depth (m):					
Latitude:	43.518142830368				
Longitude:	-79.8759025333681				
Path:	281\2810101.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11174718			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590850.00
Code OB Desc:				North83:	4818970.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	01-Nov-2004 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	933256010				
Layer:	2				
Plug From:	0.6000000238418579				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		6.75			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933256011			
Layer:		3			
Plug From:		6.75			
Plug To:		8.25			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933256009			
Layer:		1			
Plug From:		0.0			
Plug To:		0.6000000238418579			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		962810101			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		11183237			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930846023			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		1.5			
Depth To:		6.75			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		933409598			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.75			
Screen End Depth:		8.25			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		934052476			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		3.0			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11308319			
Diameter:		24.0			
Depth From:		0.0			
Depth To:		1.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11174718			Tag No:	
Depth M:				Contractor:	6607
Year Completed:	2004			Path:	281\2810101.pdf
Well Completed Dt:	2004/11/01			Latitude:	43.518142830368
Audit No:	Z19554			Longitude:	-79.8759025333681

43	1 of 2	ENE/210.4	198.7 / -1.14	55 ONTARIO ST S lot 13 con 3 MILTON ON	WWIS
Well ID:	2810070			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Livestock			Data Entry Status:	
Use 2nd:				Data Src:	1
Final Well Status:	Test Hole			Date Received:	06-Oct-2004 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z15080			Contractor:	7230
Tag:	A015013			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	013
Depth to Bedrock:				Concession:	03
Well Depth:				Concession Name:	NS
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (TRAFALGAR)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810070.pdf				

Additional Detail(s) (Map)

Well Completed Date: 2004/08/12
 Year Completed: 2004
 Depth (m): 7.8
 Latitude: 43.5179963568339
 Longitude: -79.8756577928392
 Path: 281\2810070.pdf

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	11174687			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590870.00
Code OB Desc:				North83:	4818954.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	12-Aug-2004 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	932974944				
Layer:	3				
Color:	6				
General Color:	BROWN				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	06				
Mat2 Desc:	SILT				
Mat3:	28				
Mat3 Desc:	SAND				
Formation Top Depth:	1.2000000476837158				
Formation End Depth:	2.9000000953674316				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	932974942				
Layer:	1				
Color:	8				
General Color:	BLACK				
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	0.10000000149011612				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	932974945				
Layer:	4				
Color:	2				
General Color:	GREY				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	06				
Mat2 Desc:	SILT				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		2.9000000953674316			
Formation End Depth:		3.700000047683716			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932974946			
Layer:		5			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		28			
Mat3 Desc:		SAND			
Formation Top Depth:		3.700000047683716			
Formation End Depth:		7.199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932974943			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.10000000149011612			
Formation End Depth:		1.2000000476837158			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932974947			
Layer:		6			
Color:		7			
General Color:		RED			
Mat1:		34			
Most Common Material:		TILL			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		7.199999809265137			
Formation End Depth:		7.800000190734863			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933255941			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.10000000149011612			
Plug To:		3.3499999046325684			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933255940			
Layer:		1			
Plug From:		0.0			
Plug To:		0.10000000149011612			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		962810070			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11183206			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930845992			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.5			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933409583			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.5			
Screen End Depth:		7.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		5.300000190734863			
<u>Water Details</u>					
Water ID:		934052453			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		6.400000095367432			
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		11308287			
Diameter:		12.5			
Depth From:		0.0			
Depth To:		7.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11174687			Tag No:	A015013
Depth M:	7.8			Contractor:	7230
Year Completed:	2004			Path:	281\2810070.pdf
Well Completed Dt:	2004/08/12			Latitude:	43.5179963568339
Audit No:	Z15080			Longitude:	-79.8756577928392
43	2 of 2	ENE/210.4	198.7 / -1.14	55 ONTARIO ST S MILTON ON	WWIS
Well ID:	2810181			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Not Used			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	08-Mar-2005 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z25173			Contractor:	7230
Tag:	A015013			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810181.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2005/02/14				
Year Completed:	2005				
Depth (m):					
Latitude:	43.5179963568339				
Longitude:	-79.8756577928392				
Path:	281\2810181.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11319136			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590870.00
Code OB Desc:				North83:	4818954.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	14-Feb-2005 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:		Location Method:			www
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933266695			
Layer:		1			
Plug From:		0.0			
Plug To:		7.800000190734863			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		962810181			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11333991			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930860129			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.5			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933412186			
Layer:		1			
Slot:		100			
Screen Top Depth:		4.5			
Screen End Depth:		7.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		5.300000190734863			
<u>Water Details</u>					
Water ID:		934058763			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		1.899999976158142			
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		11537695			
Diameter:		12.5			
Depth From:		0.0			
Depth To:		7.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	11319136			Tag No:	A015013
Depth M:				Contractor:	7230
Year Completed:	2005			Path:	281\2810181.pdf
Well Completed Dt:	2005/02/14			Latitude:	43.5179963568339
Audit No:	Z25173			Longitude:	-79.8756577928392
44	1 of 1	NW/210.7	199.3 / -0.58	80 Ontario Street North lot 14 con 2 Milton ON	WWIS
Well ID:	7370754			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	09-Oct-2020 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	8ULS3EIQ			Contractor:	7732
Tag:	_NO_TAG			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	014
Depth to Bedrock:				Concession:	02
Well Depth:				Concession Name:	NS
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (TRAFALGAR)				
Site Info:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1008473524			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590472.00
Code OB Desc:				North83:	4819003.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	21-Sep-2020 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008473635			
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008473712			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008473742			
Layer:		1			
Plug From:		0.0			
Plug To:		8.300000190734863			
Plug Depth UOM:		m			
<u>Pipe Information</u>					
Pipe ID:		1008473566			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008473659			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.199999809265137			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1008473681			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Slot:					
Screen Top Depth:		5.199999809265137			
Screen End Depth:		8.300000190734863			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
Results of Well Yield Testing					
Pumping Test Method Desc:					
Pump Test ID:		1008473567			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
Water Details					
Water ID:		1008473601			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		6.900000095367432			
Water Found Depth UOM:		m			
Links					
Bore Hole ID:	1008473524			Tag No:	_NO_TAG
Depth M:				Contractor:	7732
Year Completed:	2020			Path:	737\7370754.pdf
Well Completed Dt:	2020/09/21			Latitude:	43.518485797022
Audit No:	8ULS3EIQ			Longitude:	-79.880573197639
45	1 of 1	NW/213.3	199.3 / -0.58	80 ONTARIO STREET NORTH MILTON ON	WWIS
Well ID:	7257998			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	17-Feb-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z225981			Contractor:	7241
Tag:	A183330			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
		MILTON TOWN (TRAFALGAR) WKQ-008610 A0-A 04			
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2016/01/06			
Year Completed:		2016			
Depth (m):		8.2296			
Latitude:		43.5184683975587			
Longitude:		-79.8806353848316			
Path:					
Bore Hole Information					
Bore Hole ID:		1005889185		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590467.00
Code OB Desc:				North83:	4819001.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		06-Jan-2016 00:00:00		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1005987241			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.25			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1005987240			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.25			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005987243			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		20.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005987242			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		2.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987252			
Layer:		2			
Plug From:		16.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987251			
Layer:		1			
Plug From:		27.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1005987253			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005987250			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005987239			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005987246			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		17.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005987247			
Layer:		1			
Slot:		.10			
Screen Top Depth:		17.0			
Screen End Depth:		27.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1005987245			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1005987244			
Diameter:		6.0			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		27.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
Links					
Bore Hole ID:	1005889185			Tag No:	A183330
Depth M:	8.2296			Contractor:	7241
Year Completed:	2016			Path:	725\7257998.pdf
Well Completed Dt:	2016/01/06			Latitude:	43.5184683975587
Audit No:	Z225981			Longitude:	-79.8806353848316
46	1 of 56	ENE/220.1	198.8 / -1.01	LOBLAWS SUPERMARKETS LTD. 55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	
Licence Type:		Vendor		Oper Phone No:	
Licence Type Code:				Operator Ext:	
Licence Class:				Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					
46	2 of 56	ENE/220.1	198.8 / -1.01	Key Centres Ltd. 55 Ontario St S Milton ON L9T 2M3	SCT
Established:		1978			
Plant Size (ft²):					
Employment:					
--Details--					
Description:		All Other Plastic Product Manufacturing			
SIC/NAICS Code:		326198			
Description:		Coating, Engraving, Heat Treating and Allied Activities			
SIC/NAICS Code:		332810			
46	3 of 56	ENE/220.1	198.8 / -1.01	BLACK PHOTO CORPORATION MILTON MALL, 55 ONTARIO ST. SOUTH C/O 371 GOUGH RD. MARKHAM ONT L3R 4B6 MILTON ON L9T 2M3	GEN
Generator No:		ON0074332			
SIC Code:		6571			
SIC Description:		CAMERA/PHOTO. SUPPLY			
Approval Years:		86,87			
PO Box No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
46	4 of 56	ENE/220.1	198.8 / -1.01	BLACK PHOTO CORPORATION MILTON MALL, 55 ONTARIO ST. S. MILTON C/O 371 GOUGH RD. MARKHAM ON L9T 2M3	GEN
Generator No:		ON0074332			
SIC Code:		6571			
SIC Description:		CAMERA/PHOTO. SUPPLY			
Approval Years:		88,89,90			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
46	5 of 56	ENE/220.1	198.8 / -1.01	BLACK PHOTO CORPORATION 55 ONTARIO STREET SOUTH MILTON MALL MILTON ON L9T 2M3	GEN
Generator No:		ON0074332			
SIC Code:		6571			
SIC Description:		CAMERA/PHOTO. SUPPLY			
Approval Years:		92,93,97			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
46	6 of 56	ENE/220.1	198.8 / -1.01	BLACK PHOTO CORPORATION 05-204 MILTON MALL, 55 ONTARIO ST. S.- MILTON C/O 371 GOUGH ROAD	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MARKHAM ON L9T 2M3					
Generator No:		ON0074332			
SIC Code:		6571			
SIC Description:		CAMERA/PHOTO. SUPPLY			
Approval Years:		94,95,96			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
46	7 of 56	ENE/220.1	198.8 / -1.01	BLACK PHOTO CORPORATION MILTON MALL_ 55 ONTARIO STREET SOUTH__ MILTON ON L9T 2M3	GEN
Generator No:		ON0074332			
SIC Code:		6571			
SIC Description:		CAMERA/PHOTO. SUPPLY			
Approval Years:		98			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
46	8 of 56	ENE/220.1	198.8 / -1.01	BLACK PHOTO CORPORATION MILTON MALL 55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	GEN
Generator No:		ON0074332			
SIC Code:		6571			
SIC Description:		CAMERA/PHOTO. SUPPLY			
Approval Years:		99,00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		264 PHOTOPROCESSING WASTES			
46	9 of 56	ENE/220.1	198.8 / -1.01	PAT CAMPBELL DRUGS LTD. 55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	GEN
Generator No:		ON2534000			
SIC Code:		6031			
SIC Description:		PHARMACIES			
Approval Years:		99			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
46	10 of 56	ENE/220.1	198.8 / -1.01	SHOPPERS DRUG MART 55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	GEN
Generator No:		ON2530795			
SIC Code:		6031			
SIC Description:		PHARMACIES			
Approval Years:		00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
46	11 of 56	ENE/220.1	198.8 / -1.01	PAT CAM(SEE & USE ON2530795) 55 ONTARIO STREET SOUTH MILTON ON L9T 2M3	GEN
Generator No:		ON2534000			
SIC Code:		6031			
SIC Description:		PHARMACIES			
Approval Years:		00,01			
PO Box No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
46	12 of 56	ENE/220.1	198.8 / -1.01	Towne Dental Group 55 Ontario St S Milton ON L9T 2M3	GEN
Generator No:		ON5794362			
SIC Code:					
SIC Description:					
Approval Years:		02,03,04			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
46	13 of 56	ENE/220.1	198.8 / -1.01	Summit REIT 55 Ontario Street South Milton ON L9T 2M3	GEN
Generator No:		ON9079169			
SIC Code:					
SIC Description:					
Approval Years:		04,05			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

143 erisinfo.com | Environmental Risk Information Services Order No: 23030300040

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:	148				
Waste Class Name:	INORGANIC LABORATORY CHEMICALS				
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
46	17 of 56	ENE/220.1	198.8 / -1.01	Hudson's Bay Company 1 - 55 Ontario St N Milton ON L9T 2T2	SPL
Ref No:	8872-6C3KPL			Discharger Report:	0
Site No:				Material Group:	Oil
Incident Dt:	4/27/2005			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	Other Discharges			Sector Type:	Transport Truck
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:	DIESEL FUEL			Site Address:	
Contaminant Limit 1:				Site District Office:	Halton-Peel
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Not Anticipated			Site Municipality:	Milton
Nature of Impact:				Site Lot:	
Receiving Medium:	Land			Site Conc:	
Receiving Env:				Northing:	NA
MOE Response:				Easting:	NA
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	5/4/2005			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:	Spill			Source Type:	
Site Name:	Milton Mall Shopping Centre				
Site County/District:					
Municipality No:					
Site Geo Ref Meth:					
Incident Summary:	HBC: MVA, Diesel to PL, cln				
Contaminant Qty:					
46	18 of 56	ENE/220.1	198.8 / -1.01	55 Ontario Street Milton ON	SPL
Ref No:	1365-74JR3U			Discharger Report:	
Site No:				Material Group:	Chemicals
Incident Dt:				Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:				Sector Type:	Other
Incident Event:				Agency Involved:	
Contaminant Code:	54			Nearest Watercourse:	
Contaminant Name:	MANGANESE-54 200			Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Confirmed			Site Municipality:	Milton
Nature of Impact:	Surface Water Pollution			Site Lot:	
Receiving Medium:	Water			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	6/26/2007			Site Map Datum:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Dt Document Closed: 8/15/2007 Incident Reason: Site Name: Shopping Centre<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: Milton: Manganese to sewer, 2 weeks ago Contaminant Qty: 20 ppm SAC Action Class: Source Type:					
46	19 of 56	ENE/220.1	198.8 / -1.01	Westpen Properties Ltd. 55 Ontario Street South Toronto ON L9T 2M3	GEN
Generator No: ON2754178 SIC Code: 531390 SIC Description: Other Activities Related to Real Estate Approval Years: 07,08 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
46	20 of 56	ENE/220.1	198.8 / -1.01	ZELLERS STORE #166 - MILTON MALL 55 ONTARIO ST S MILTON ON L9T 2M3	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Vendor Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
46	21 of 56	ENE/220.1	198.8 / -1.01	Westpen Properties Ltd./Les Proprietes Westpen Ltee 55 Ontario St S Milton ON L9T 2M3	CA
Certificate #: 2452-7WDKA7 Application Year: 2009					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Issue Date: 10/5/2009 Approval Type: Air Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
46	22 of 56	ENE/220.1	198.8 / -1.01	Westpen Properties 55 Ontario St. South Milton ON L9T 2M3	GEN
Generator No: ON3596758 SIC Code: 531310 SIC Description: Real Estate Property Managers Approval Years: 2009 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
46	23 of 56	ENE/220.1	198.8 / -1.01	Westpen Properties Ltd. 55 Ontario Street South Milton ON L9T 2M3	GEN
Generator No: ON5750085 SIC Code: 531310 SIC Description: Real Estate Property Managers Approval Years: 2009 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
46	24 of 56	ENE/220.1	198.8 / -1.01	55 Ontario Street South Milton ON L9T 2M3	EHS
Order No: 20120224017 Status: C Nearest Intersection: Municipality: Milton					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type: Standard Report Report Date: 3/5/2012 11:24:16 AM Date Received: 2/24/2012 11:20:12 AM Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Client Prov/State: ON Search Radius (km): 0.25 X: -79.876013 Y: 43.518392					
46	25 of 56	ENE/220.1	198.8 / -1.01	TARGET CANADA CO. 55 ONTARIO ST S MILTON ON L9T 2M3	EASR
Approval No: R-003-7240046635 Status: REGISTERED Date: 2012-10-25 Record Type: EASR Link Source: MOFA Project Type: Heating System Full Address: Approval Type: EASR-Heating System SWP Area Name: PDF URL: PDF Site Location:					
MOE District: Municipality: MILTON Latitude: Longitude: Geometry X: Geometry Y:					
46	26 of 56	ENE/220.1	198.8 / -1.01	TARGET CANADA CO. 55 ONTARIO ST S MILTON ON L9T 2M3	EASR
Approval No: R-002-2250931594 Status: REGISTERED Date: 2012-10-26 Record Type: EASR Link Source: MOFA Project Type: Standby Power System Full Address: Approval Type: EASR-Standby Power System SWP Area Name: PDF URL: PDF Site Location:					
MOE District: Municipality: MILTON Latitude: Longitude: Geometry X: Geometry Y:					
46	27 of 56	ENE/220.1	198.8 / -1.01	Westpen Properties 55 Ontario St. South Milton ON L9T 2M3	GEN
Generator No: ON3596758 SIC Code: 531310 SIC Description: Real Estate Property Managers Approval Years: 2010 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
46	28 of 56	ENE/220.1	198.8 / -1.01	Westpen Properties 55 Ontario St. South Milton ON L9T 2M3	GEN
Generator No: ON3596758 SIC Code: 531310 SIC Description: Real Estate Property Managers Approval Years: 2011 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
46	29 of 56	ENE/220.1	198.8 / -1.01	TARGET CANADA CO. STORE# T3572 55 ONTARIO ST S MILTON ON L9T2M3	PES
Detail Licence No: Licence No: 16351 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 8755671 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
46	30 of 56	ENE/220.1	198.8 / -1.01	The Prime Partnerships 55 Ontario Street South Milton ON	GEN
Generator No: ON3596758 SIC Code: 531310 SIC Description: Real Estate Property Managers Approval Years: 2012 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
46	31 of 56	ENE/220.1	198.8 / -1.01	ZELLERS 1 1-55 ONTARIO Street North MILTON ON L9T2M3	NPRI
NPRI ID:	8800000611			Org ID:	
Other ID:				Submit Date:	
No Other ID:				Last Modified:	
Track ID:				Contact ID:	
Report ID:				Cont Type:	MED
Report Type:				Contact Title:	Mr.
Rpt Type ID:				Cont First Name:	FRED
Report Year:	2004			Cont Last Name:	WARE
Not-Current Rpt?:				Contact Position:	SENIOR MANAGER ENERGY ENVIRONMENT SOURCING INITIATIVES
Yr of Last Filed Rpt:				Contact Fax:	
Fac ID:				Contact Ph.:	
Fac Name:	ZELLERS STORE, #166 MILTON MALL			Cont Area Code:	416
Fac Address1:				Contact Tel.:	8614938
Fac Address2:				Contact Ext.:	
Fac Postal Zip:				Cont Fax Area Cde:	416
Facility Lat:				Contact Fax:	8616619
Facility Long:				Contact Email:	
DLS (Last Filed Rpt):				Latitude:	
Facility DLS:				Longitude:	
Datum:				UTM Zone:	
Facility Cmnts:				UTM Northing:	
URL:				UTM Easting:	
No of Empl.:	20			Waste Streams:	
Parent Co.:				No Streams:	
No Parent Co.:				Waste Off Sites:	
Pollut Prev Cmnts:				No Off Sites:	
Stacks:				Shutdown:	
No of Stacks:				No of Shutdown:	
Canadian SIC Code (2 digit):					
Canadian SIC Code:					
SIC Code Description:					
American SIC Code:					
NAICS Code (2 digit):	53				
NAICS 2 Description:	Real Estate and Rental and Leasing				
NAICS Code (4 digit):	5311				
NAICS 4 Description:	Lessors of Real Estate				
NAICS Code (6 digit):	531120				
NAICS 6 Description:	Lessors of Non-Residential Buildings (except Mini-Warehouses)				
<u>Substance Release Report</u>					
CAS No:	7446-09-5				
Report ID:					
Rpt Period:	2004				
Subst Released:	Sulphur dioxide				
Air:					
Water:					
Land:					
Total Releases:					
Units:	tonnes				
CAS No:	NA - M16				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report ID:			2004		
Rpt Period:					
Subst Released:			Volatile Organic Compounds (VOCs)		
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		124-38-9			
Report ID:					
Rpt Period:			2004		
Subst Released:			Carbon dioxide		
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		NA - M09			
Report ID:					
Rpt Period:			2004		
Subst Released:			PM10 - Particulate Matter <= 10 Microns		
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		NA - M08			
Report ID:					
Rpt Period:			2004		
Subst Released:			PM - Total Particulate Matter		
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		11104-93-1			
Report ID:					
Rpt Period:			2004		
Subst Released:			Nitrogen oxides (expressed as NO2)		
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		630-08-0			
Report ID:					
Rpt Period:			2004		
Subst Released:			Carbon monoxide		
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		74-82-8			
Report ID:					
Rpt Period:			2004		
Subst Released:			Methane		
Air:					
Water:					
Land:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Total Releases:					
Units:		tonnes			
CAS No:		811-97-2			
Report ID:					
Rpt Period:		2004			
Subst Released:		HFC-134a Hydrofluorocarbon			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		10024-97-2			
Report ID:					
Rpt Period:		2004			
Subst Released:		Nitrous oxide			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		NA - M10			
Report ID:					
Rpt Period:		2004			
Subst Released:		PM2.5 - Particulate Matter <= 2.5 Microns			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
46	32 of 56	ENE/220.1	198.8 / -1.01	Delta Elevator Co Ltd 55 Ontario Street Milton ON	GEN
Generator No:		ON6559724			
SIC Code:		238291			
SIC Description:		ELEVATOR AND ESCALATOR INSTALLATION CONTRACTORS			
Approval Years:		2013			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
46	33 of 56	ENE/220.1	198.8 / -1.01	The Prime Partnerships 55 Ontario Street South Milton ON	GEN
Generator No:		ON3596758			
SIC Code:		531310			
SIC Description:		REAL ESTATE PROPERTY MANAGERS			
Approval Years:		2013			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
Waste Class: Waste Class Name:		145 PAINT/PIGMENT/COATING RESIDUES			
46	34 of 56	ENE/220.1	198.8 / -1.01	Target Canada Co. 55 Ontario Street, South Milton ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON3022787 452112 2013			
Detail(s)					
Waste Class: Waste Class Name:		263 ORGANIC LABORATORY CHEMICALS			
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
Waste Class: Waste Class Name:		212 ALIPHATIC SOLVENTS			
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
Waste Class: Waste Class Name:		331 WASTE COMPRESSED GASES			
Waste Class: Waste Class Name:		269 NON-HALOGENATED PESTICIDES			
Waste Class: Waste Class Name:		262 DETERGENTS/SOAPS			
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
Waste Class: Waste Class Name:		242 HALOGENATED PESTICIDES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
46	35 of 56	ENE/220.1	198.8 / -1.01	Bentall Kennedy (Canada) Limited 55 Ontario St S Milton ON L9T 2M3	SPL
Ref No:	0525-A66SLQ			Discharger Report:	
Site No:	5246-7VSPCX			Material Group:	
Incident Dt:	2016/01/14			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:				Sector Type:	Miscellaneous Industrial
Incident Event:	Leak/Break			Agency Involved:	
Contaminant Code:	15			Nearest Watercourse:	
Contaminant Name:	HYDRAULIC OIL			Site Address:	55 Ontario St S
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	L9T 2M3
Contaminant UN No 1:				Site Region:	
Environment Impact:				Site Municipality:	Milton
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Land			Northing:	NA
MOE Response:	No			Easting:	NA
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	NA
MOE Reported Dt:	2016/01/14			Site Map Datum:	NA
Dt Document Closed:				SAC Action Class:	Land Spills
Incident Reason:	Unknown / N/A			Source Type:	
Site Name:	55 Ontario Street South				
Site County/District:					
Municipality No:					
Site Geo Ref Meth:	NA				
Incident Summary:	Bentall Kennedy- 10L Hydraulic Oil to Parking Lot				
Contaminant Qty:	10 L				
46	36 of 56	ENE/220.1	198.8 / -1.01	55 Ontario Street South Milton ON	SPL
Ref No:	3153-A7VUWC			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	2016/03/09			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:				Sector Type:	Unknown / N/A
Incident Event:	Leak/Break			Agency Involved:	
Contaminant Code:	13			Nearest Watercourse:	
Contaminant Name:	DIESEL FUEL			Site Address:	55 Ontario Street South
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Surface Water MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2016/03/09 Dt Document Closed: Incident Reason: Unknown / N/A Site Name: Milton Mall<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: 10 -100 metres eg. Topographic Map Incident Summary: Teti Excavation: ukn amount of diesel to lot and cb Contaminant Qty: 0 other - see incident description					
Site Municipality: Milton Site Lot: Site Conc: Northing: 4818976 Easting: 590920 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Watercourse Spills Source Type:					
46	37 of 56	ENE/220.1	198.8 / -1.01	Westpen Properties Ltd./Les Proprietes Westpen Ltee 55 Ontario St S Milton ON M4V 1L5	ECA
Approval No: 2452-7WDKA7 Approval Date: 2009-10-05 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Halton Approval Type: ECA-AIR Project Type: AIR Business Name: Westpen Properties Ltd./Les Proprietes Westpen Ltee Address: 55 Ontario St S Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/0509-7VSPCE-14.pdf PDF Site Location:					
MOE District: Halton-Peel City: Longitude: -79.87794 Latitude: 43.518875 Geometry X: Geometry Y:					
46	38 of 56	ENE/220.1	198.8 / -1.01	The Prime Partnerships 55 Ontario Street South Milton ON L9T 2M3	GEN
Generator No: ON3596758 SIC Code: 531310 SIC Description: REAL ESTATE PROPERTY MANAGERS Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: Cindy King Choice of Contact: CO_OFFICIAL Phone No Admin: 416-674-4191 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
46	39 of 56	ENE/220.1	198.8 / -1.01	The Prime Partnerships 55 Ontario Street South Milton ON L9T 2M3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON3596758 531310 REAL ESTATE PROPERTY MANAGERS 2016 Canada CO_OFFICIAL No No			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		145 PAINT/PIGMENT/COATING RESIDUES			
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
46	40 of 56	ENE/220.1	198.8 / -1.01	Target Canada Co. 55 Ontario Street, South Milton ON L9T 2M3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON3022787 452112 452112 2015 Canada Carolyn Bue CO_ADMIN 800-587-2228 Ext. No No			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		269 NON-HALOGENATED PESTICIDES			
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
Waste Class: Waste Class Name:		148 INORGANIC LABORATORY CHEMICALS			
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
Waste Class: Waste Class Name:		262 DETERGENTS/SOAPS			
Waste Class:		263			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		242			
Waste Class Name:		HALOGENATED PESTICIDES			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			

[46](#)

41 of 56

ENE/220.1

198.8 / -1.01

**Target Canada Co.
55 Ontario Street, South
Milton ON L9T 2M3**

GEN

Generator No: ON3022787
SIC Code: 452112
SIC Description: 452112
Approval Years: 2014
PO Box No:
Country: Canada
Status:
Co Admin: Carolyn Bue
Choice of Contact: CO_ADMIN
Phone No Admin: 800-587-2228 Ext.
Contaminated Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 269
Waste Class Name: NON-HALOGENATED PESTICIDES

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Class: 262
Waste Class Name: DETERGENTS/SOAPS

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 122
Waste Class Name: ALKALINE WASTES - OTHER METALS

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Class: 263

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		242			
Waste Class Name:		HALOGENATED PESTICIDES			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
46	42 of 56	ENE/220.1	198.8 / -1.01	The Prime Partnerships 55 Ontario Street South Milton ON L9T 2M3	GEN
Generator No:		ON3596758			
SIC Code:		531310			
SIC Description:		REAL ESTATE PROPERTY MANAGERS			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Cindy King			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		416-674-4191 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
46	43 of 56	ENE/220.1	198.8 / -1.01	Lowe's Home Centres (CANADA) Inc. 55 Ontario Street Milton ON L9T 2M3	GEN
Generator No:		ON7690950			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		221 I			
Waste Class Name:		Light fuels			
Waste Class:		242 T			
Waste Class Name:		Halogenated pesticides and herbicides			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		331 L			
Waste Class Name:		Waste compressed gases including cylinders			
46	44 of 56	ENE/220.1	198.8 / -1.01	The Prime Partnerships 55 Ontario Street South Milton ON L9T 2M3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		146 L			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
46	45 of 56	ENE/220.1	198.8 / -1.01	LOWE'S COMPANIES CANADA, ULC 55 ONTARIO ST S MILTON ON L9T2M3	PES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Detail Licence No: Licence No: 18081 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL: Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
46	46 of 56	ENE/220.1	198.8 / -1.01	Towne Dental 55 Ontario Street South Unit #C3 Milton ON L9T 2M3	GEN
Generator No: ON4445093 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 P Waste Class Name: Pathological wastes					
46	47 of 56	ENE/220.1	198.8 / -1.01	ZELLERS LIMITED #166 MILTON MALL SHOP. CENTRE 55 ONT ST S MILTON ON L9T2M3	PES
Detail Licence No: Licence No: 07791 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Retail Vendor Class 03 Licence Type Code: 21 Licence Class: 03 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 416 Oper Phone No: 8788178 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL:					
46	48 of 56	ENE/220.1	198.8 / -1.01	LOBLAWS SUPERMARKETS LTD. 55 ONTARIO STREET SOUTH MILTON ON L9T2M4	PES
Detail Licence No: Licence No: 08636 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Retail Vendor Class 03 Licence Type Code: 21 Licence Class: 03 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 416 Oper Phone No: 8213796 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
46	49 of 56	ENE/220.1	198.8 / -1.01	ZELLERS STORE #166 - MILTON MALL 55 ONTARIO ST S MILTON ON L9T3J5	PES
Detail Licence No: Licence No: 12608 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 8788178 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
46	50 of 56	ENE/220.1	198.8 / -1.01	SHOPPERS DRUG MART #0710 (MILTON DRUG MART) 55 ONTARIO STREET SOUTH MILTON ON L9T2M3	PES
Detail Licence No: Licence No: 13148 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 905 Oper Phone No: 8784521 Operator Ext:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:	01			Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:	
46	51 of 56	ENE/220.1	198.8 / -1.01	Towne Dental 55 Ontario Street South Unit #C3 Milton ON L9T 2M3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:	ON4445093 As of Jul 2020 Canada Registered				
Detail(s)					
Waste Class: Waste Class Name:	312 P Pathological wastes				
46	52 of 56	ENE/220.1	198.8 / -1.01	FP MILTON MALL INC. 55 ONTARIO STREET SOUTH, MILTON, ON L9T 2M3 Milton ON	RSC
RSC ID: RA No: RSC Type: Curr Property Use: Ministry District: Filing Date: Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect 1686: Asmt Roll No: Prop ID No (PIN): Property Municipal Address: Mailing Address: Latitude & Latitude: UTM Coordinates: Consultant: Legal Desc: Measurement Method: Applicable Standards:	226824 Phase 1 RSC Commercial Halton-Peel District Office 2020/05/29 2409010002690000000 24945-0196 (LT) 55 ONTARIO STREET SOUTH, MILTON, ON L9T 2M3			Cert Date: Cert Prop Use No: Intended Prop Use: Qual Person Name: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Accuracy Estimate: Telephone: Fax: Email:	Institutional ROBERT DACIW

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
RSC PDF:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=128584&fileName=BROWNFIELDS-E.pdf			
<u>Document(s) Detail</u>					
Document Heading:		Supporting Documents			
Document Name:		Certificate of Status - FP Milton Mall Inc.pdf			
Document Type:		Certificate of Status			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=128582&fileName=Certificate+of+Status+-+FP+Milton+Mall+Inc.pdf			
Document Heading:		Supporting Documents			
Document Name:		Phase One Conceptual Site Model_v2.pdf			
Document Type:		Phase 1 Conceptual Site Model			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=128588&fileName=Phase+One+Conceptual+Site+Model_v2.pdf			
Document Heading:		Supporting Documents			
Document Name:		Survey.pdf			
Document Type:		A Current plan of Survey			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=128580&fileName=Survey.pdf			
Document Heading:		Supporting Documents			
Document Name:		RSC Letter - Milton Mall - 4837-5067-8447 4.pdf			
Document Type:		Lawyer's letter consisting of a legal description of the property			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=128581&fileName=RSC+Letter+-+Milton+Mall+-+4837-5067-8447+4.pdf			
Document Heading:		Supporting Documents			
Document Name:		Transfers.pdf			
Document Type:		Copy of any deed(s), transfer(s) or other document(s)			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=129582&fileName=Transfers.pdf			
Document Heading:		Supporting Documents			
Document Name:		CPTable.pdf			
Document Type:		Table of Current and Past Property Use			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=129583&fileName=CPTable.pdf			
46	53 of 56	ENE/220.1	198.8 / -1.01	Towne Dental 55 Ontario Street South Unit #C3 Milton ON L9T 2M3	GEN
Generator No:		ON4445093			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
46	54 of 56	ENE/220.1	198.8 / -1.01	55 ONTARIO ST S MILTON ON L9T 2M3	PES
Detail Licence No: Licence No: L-232-6159591544 Status: Active Approval Date: January 12, 2022 Report Source: PEST-Limited Vendor Licence Type: Limited Vendor Licence Type Code: Licence Class: Licence Control: Latitude: 43.51861111 Longitude: -79.87472222 Lot: Concession: Region: District: County: Trade Name: PDF URL: http://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=2557471 Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: Halton-Peel SWP Area Name: Halton					
46	55 of 56	ENE/220.1	198.8 / -1.01	Coras<UNOFFICIAL> 55 Ontario Street South Milton ON	SPL
Ref No: 1864-BYRTBU Site No: NA Incident Dt: 2021/03/03 Year: Incident Cause: Incident Event: Overflow/Surcharge Contaminant Code: 44 Contaminant Name: SEWAGE,RAW UNCHLORINATED Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: n/a Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2021/03/03 Dt Document Closed: 2021/09/22 Incident Reason: Blockage Site Name: Coras Breakfast and Lunch<UNOFFICIAL> Site County/District: Regional Municipality of Halton Municipality No: Site Geo Ref Meth: Incident Summary: Coras: sani manhole surcharge to grass Contaminant Qty: 1 other - see incident description Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Sector Type: Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address: 55 Ontario Street South Site District Office: Halton-Peel Site Postal Code: Site Region: Central Site Municipality: Milton Site Lot: Site Conc: Northing: 4819015.8 Easting: 590934.19 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: Sewer (Private or Municipal)					
46	56 of 56	ENE/220.1	198.8 / -1.01	Towne Dental 55 Ontario Street South Unit #C3 Milton ON L9T 2M3	GEN
Generator No: ON4445093 SIC Code: SIC Description: Approval Years: As of Oct 2022 PO Box No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		Canada Registered			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		312 P PATHOLOGICAL WASTES			
47	1 of 1	NNW/221.5	199.9 / 0.00	64 Ontario St N Milton ON L9T2T1	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20170510055 C Standard Report 11-MAY-17 10-MAY-17 Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	
				ON .25 -79.879417 43.519206	
48	1 of 7	SW/225.3	192.4 / -7.45	KNIGHTS CLEANERS, A DIV OF 632767 ONTARIO LIMITED, 300 MAIN ST., MILTON C/O 166 GUELPH ST. GEORGETOWN ON L7G 4A6	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON0378901 9721 POWER LAUND./CLEANER 89,90			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		241 HALOGENATED SOLVENTS			
48	2 of 7	SW/225.3	192.4 / -7.45	KNIGHT'S DRY CLEANERS INC. 300 MAIN STREET EAST MILTON ON L9T 1P3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact:		ON0378901 9721 POWER LAUND./CLEANER 92,93,97,98			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		241 HALOGENATED SOLVENTS			
48	3 of 7	SW/225.3	192.4 / -7.45	KNIGHTS CLEANERS, A DIV OF 632767 23-373 ONTARIO LIMITED, 300 MAIN ST., MILTON C/O 166 GUELPH ST. GEORGETOWN ON L7G 4A6	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON0378901 9721 POWER LAUND./CLEANER 94,95,96			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		241 HALOGENATED SOLVENTS			
48	4 of 7	SW/225.3	192.4 / -7.45	KNIGHT'S DRY CLEANERS INC. 300 MAIN STREET EAST MILTON ON L9T 1P3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON0378901 9721 POWER LAUND./CLEANERS 99,00,01			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		241 HALOGENATED SOLVENTS			
48	5 of 7	SW/225.3	192.4 / -7.45	KNIGHT'S DRY CLEANERS INC. 300 MAIN ST. E. MILTON ON L9T 1P3	GEN
Generator No: SIC Code: SIC Description:		ON0790400 9724 VALET SERV., ETC.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 86,87,88 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
48	6 of 7	SW/225.3	192.4 / -7.45	KNIGHT'S (SEE&USE ON0378901) 300 MAIN ST. E. MILTON ON L9T 1P3	GEN
Generator No: ON0790400 SIC Code: 9724 SIC Description: VALET SERV., ETC. Approval Years: 89,90 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
48	7 of 7	SW/225.3	192.4 / -7.45	KNIGHT'S (SEE&USE ON0378901) 23-241 300 MAIN ST. E. MILTON ON L9T 1P3	GEN
Generator No: ON0790400 SIC Code: 9724 SIC Description: VALET SERV., ETC. Approval Years: 92,93,94,95,96,97,98 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
49	1 of 1	ESE/229.4	194.8 / -5.10	ON	WWIS
Well ID: 7358774 Construction Date: Use 1st: Use 2nd: Final Well Status:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 20-May-2020 00:00:00					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type: Casing Material: Audit No: Z316656 Tag: A291723 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MILTON TOWN (TRAFALGAR) Site Info: PDF URL (Map): Additional Detail(s) (Map) Well Completed Date: 2020/04/24 Year Completed: 2020 Depth (m): Latitude: 43.515912390435 Longitude: -79.8752510779657 Path: Bore Hole Information Bore Hole ID: 1008280744 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 24-Apr-2020 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Bore Hole ID: 1008280744 Depth M: Year Completed: 2020 Well Completed Dt: 2020/04/24 Audit No: Z316656 Elevation: Elevrc: Zone: 17 East83: 590906.00 North83: 4818723.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
Bore Hole ID: 1008280744 Depth M: Year Completed: 2020 Well Completed Dt: 2020/04/24 Audit No: Z316656 Tag No: A291723 Contractor: 7241 Path: Latitude: 43.515912390435 Longitude: -79.8752510779657					
50	1 of 1	ESE/230.3	194.8 / -5.10	106 Walekeld Rd Milton ON	WWIS
Well ID: 7364923 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 14-Aug-2020 00:00:00					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z338108			Contractor:	7241
Tag:	A295949			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					

Bore Hole Information

Bore Hole ID:	1008431777	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590906.00
Code OB Desc:		North83:	4818721.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	25-May-2020 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1008672971
Layer:	2
Color:	2
General Color:	GREY
Mat1:	05
Most Common Material:	CLAY
Mat2:	34
Mat2 Desc:	TILL
Mat3:	
Mat3 Desc:	
Formation Top Depth:	6.0
Formation End Depth:	35.0
Formation End Depth UOM:	ft

Overburden and Bedrock Materials Interval

Formation ID:	1008672970
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	28
Most Common Material:	SAND
Mat2:	11
Mat2 Desc:	GRAVEL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008673098			
Layer:		3			
Plug From:		24.0			
Plug To:		35.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008673096			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008673097			
Layer:		2			
Plug From:		1.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008673276			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008672857			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008673327			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		25.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1008673380			
Layer:		1			
Slot:		10			
Screen Top Depth:		25.0			
Screen End Depth:		35.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		Inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008673439			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008673228			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		35.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1008431777			Tag No:	A295949
Depth M:	10.668			Contractor:	7241
Year Completed:	2020			Path:	736\7364923.pdf
Well Completed Dt:	2020/05/25			Latitude:	43.5158943853603
Audit No:	Z338108			Longitude:	-79.8752514124215
51	1 of 1	NW/231.6	197.1 / -2.77	80 Ontario Street North Milton ON	EHS
Order No:	20151029030			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	03-NOV-15			Search Radius (km):	.25
Date Received:	29-OCT-15			X:	-79.880621
Previous Site Name:				Y:	43.518735
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
52	1 of 1	NNW/235.7	200.0 / 0.19	80 ONTARIO ST N Milton ON	WWIS
Well ID: 7346211 Construction Date: Use 1st: Use 2nd: Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z319477 Tag: A183329 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MILTON TOWN (MILTON) Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 31-Oct-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7215 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2019/09/26 Year Completed: 2019 Depth (m): Latitude: 43.5192343770541 Longitude: -79.8797798415789 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007700056 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 26-Sep-2019 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 590535.00 North83: 4819087.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1008209767 Layer: 1 Plug From: 0.0 Plug To: 30.0 Plug Depth UOM: ft					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1008208156			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008210702			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		20.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008210998			
Layer:		1			
Slot:		10			
Screen Top Depth:		20.0			
Screen End Depth:		30.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.0			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008211400			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1008211154			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		25.0			
Water Found Depth UOM:		ft			
<u>Links</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1007700056			Tag No:	A183329
Depth M:				Contractor:	7215
Year Completed:	2019			Path:	
Well Completed Dt:	2019/09/26			Latitude:	43.5192343770541
Audit No:	Z319477			Longitude:	-79.8797798415789

53	1 of 1	NNW/235.7	200.0 / 0.14	80 ONTARIO STREET NROTH MILTON ON	WWIS
Well ID:	7257996			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	17-Feb-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z225984			Contractor:	7241
Tag:	A183329			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (TRAFALGAR)				
Site Info:	WKQ-008610				
PDF URL (Map):					

Additional Detail(s) (Map)

Well Completed Date: 2016/01/06
Year Completed: 2016
Depth (m): 7.62
Latitude: 43.5192168568235
Longitude: -79.8798296587564
Path:

Bore Hole Information

Bore Hole ID:	1005889179	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590531.00
Code OB Desc:		North83:	4819085.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	06-Jan-2016 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1005987213			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		3.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005987212			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005987214			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		20.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987222			
Layer:		1			
Plug From:		25.0			
Plug To:		14.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987223			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Plug From:		14.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987224			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1005987221			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1005987211			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1005987217			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1005987218			
Layer:		1			
Slot:		.10			
Screen Top Depth:		15.0			
Screen End Depth:		25.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
 <u>Water Details</u>					
Water ID:		1005987216			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:	1005987215				
Diameter:	6.0				
Depth From:	0.0				
Depth To:	25.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
<u>Links</u>					
Bore Hole ID:	1005889179			Tag No:	A183329
Depth M:	7.62			Contractor:	7241
Year Completed:	2016			Path:	725\7257996.pdf
Well Completed Dt:	2016/01/06			Latitude:	43.5192168568235
Audit No:	Z225984			Longitude:	-79.8798296587564
54	1 of 1	N/236.6	199.9 / 0.00	45 Ontario Street North Milton ON L9T 2T2	EHS
Order No:	20180731078			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	08-AUG-18			Search Radius (km):	.25
Date Received:	31-JUL-18			X:	-79.878111
Previous Site Name:				Y:	43.519434
Lot/Building Size:					
Additional Info Ordered:					
55	1 of 1	WNW/238.3	196.7 / -3.11	80 Ontario Street Norrth Milton ON	WWIS
Well ID:	7340816			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	13-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	XQYZQT6A			Contractor:	7147
Tag:	_NO_TAG			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (MILTON)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7340816.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/08/23				
Year Completed:	2019				
Depth (m):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		43.5181873388187			
Longitude:		-79.8813582174328			
Path:		734\7340816.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1007616664			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590409.00
Code OB Desc:				North83:	4818969.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	23-Aug-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007617243				
Layer:	1				
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:					
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1007617790				
Layer:	1				
Plug From:					
Plug To:					
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1007617865				
Layer:	1				
Plug From:	0.0				
Plug To:	9.600000381469727				
Plug Depth UOM:	m				
<u>Pipe Information</u>					
Pipe ID:	1007616888				
Casing No:	0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007617480			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.599999904632568			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007617631			
Layer:		1			
Slot:					
Screen Top Depth:		4.599999904632568			
Screen End Depth:		7.599999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007616889			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1007617185			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		3.799999952316284			
Water Found Depth UOM:		m			
<u>Links</u>					
Bore Hole ID:	1007616664		Tag No:	_NO_TAG	
Depth M:			Contractor:	7147	
Year Completed:	2019		Path:	734\7340816.pdf	
Well Completed Dt:	2019/08/23		Latitude:	43.5181873388187	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	XQYZQT6A			Longitude:	-79.8813582174328
56	1 of 2	E/240.0	195.8 / -4.01	Childs Drive and Ontario St Milton ON	SPL
Ref No:	4887-7XF373			Discharger Report:	
Site No:				Material Group:	
Incident Dt:				Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	Pipe Or Hose Leak			Sector Type:	Pipeline
Incident Event:				Agency Involved:	
Contaminant Code:	35			Nearest Watercourse:	
Contaminant Name:	NATURAL GAS (METHANE)			Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Confirmed			Site Municipality:	
Nature of Impact:	Air Pollution			Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:				Northing:	
MOE Response:	No Field Response			Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	11/2/2009			Site Map Datum:	
Dt Document Closed:	11/20/2009			SAC Action Class:	TSSA - Fuel Safety Branch
Incident Reason:	Damage By Moving Equipment - Containers damaged by moving			Source Type:	
Site Name:	Childs Drive and Ontario St<UNOFFICIAL>				
Site County/District:					
Municipality No:					
Site Geo Ref Meth:					
Incident Summary:	Union Gas: 2 inch service line hit				
Contaminant Qty:	0 other - see incident description				
56	2 of 2	E/240.0	195.8 / -4.01	CHILDS DR & ONTARIO ST, MILTON ON	INC
Incident No:	226136			Any Health Impact:	
Incident ID:	2377256			Any Enviro Impact:	
Instance No:				Service Interrupted:	
Status Code:	Causal Analysis Complete			Was Prop Damaged:	
Attribute Category:	FS-Incident			Reside App. Type:	
Context:				Commer App. Type:	
Date of Occurrence:				Indus App. Type:	
Time of Occurrence:				Institut App. Type:	
Incident Created On:				Venting Type:	
Instance Creation Dt:				Vent Conn Mater:	
Instance Install Dt:				Vent Chimney Mater:	
Occur Insp Start Date:				Pipeline Type:	Main Distribution Pipeline
Approx Quant Rel:				Pipeline Involved:	
Tank Capacity:				Pipe Material:	Steel
Fuels Occur Type:				Depth Ground Cover:	
Fuel Type Involved:				Regulator Location:	
Enforcement Policy:				Regulator Type:	
Prc Escalation Req:				Operation Pressure:	
Tank Material Type:				Liquid Prop Make:	
Tank Storage Type:				Liquid Prop Model:	
Tank Location Type:				Liquid Prop Serial No:	
Pump Flow Rate Cap:				Liquid Prop Notes:	
Task No:				Equipment Type:	
Notes:				Equipment Model:	
Drainage System:				Serial No:	
Sub Surface Contam.:				Cylinder Capacity:	
Aff Prop Use Water:				Cylinder Cap Units:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contam. Migrated: Contact Natural Env: Incident Location: Occurrence Narrative: Operation Type Involved: Item: Item Description: Device Installed Location:					
Cylinder Mat Type: Near Body of Water: CHILDS DR & ONTARIO ST, MILTON - 2" PIPELINE HIT Expired Locates - Imprudent Mechanical Excavation					
57	1 of 12	ESE/240.3	194.8 / -5.07	Dr. John Kim Chiropractic Professional Corporation 106 Wakefield Road Milton ON L9T 2L8	GEN
Generator No: ON3794165 SIC Code: 621310 SIC Description: Offices of Chiropractors Approval Years: 06,07,08 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
57	2 of 12	ESE/240.3	194.8 / -5.07	Dr. Strohan's Office 106 Wakefield Road Milton ON L9T 2L8	GEN
Generator No: ON6459899 SIC Code: 621110 SIC Description: Offices of Physicians Approval Years: 06 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					
57	3 of 12	ESE/240.3	194.8 / -5.07	Dr. John Kim Chiropractic Professional Corporation 106 Wakefield Road Milton ON L9T 2L8	GEN
Generator No: ON3794165 SIC Code: 621310					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		Offices of Chiropractors 2009			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		264 PHOTOPROCESSING WASTES			
57	4 of 12	ESE/240.3	194.8 / -5.07	Dr. John Kim Chiropractic Professional Corporation 106 Wakefield Road Milton ON L9T 2L8	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON3794165 621310 Offices of Chiropractors 2010			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		264 PHOTOPROCESSING WASTES			
57	5 of 12	ESE/240.3	194.8 / -5.07	Dr. Susan Bermingham Dentistry PC 106 Wakefield Road #1 Milton ON L9T 2L8	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON8687854 621210 OFFICES OF DENTISTS 2015 Canada Tracey McDonald CO_ADMIN 905-878-0555 Ext. No No			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
57	6 of 12	ESE/240.3	194.8 / -5.07	Dr. Susan Bermingham Dentistry PC 106 Wakefield Road #1 Milton ON L9T 2L8	GEN
Generator No:		ON8687854			
SIC Code:		621210			
SIC Description:		OFFICES OF DENTISTS			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Tracey McDonald			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		905-878-0555 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
57	7 of 12	ESE/240.3	194.8 / -5.07	Dr. Susan Bermingham Dentistry PC 106 Wakefield Road #1 Milton ON L9T 2L8	GEN
Generator No:		ON8687854			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
57	8 of 12	ESE/240.3	194.8 / -5.07	Union Gas Limited 106 Wakefield Dr Milton ON	SPL
Ref No:		3441-ATRK4X		Discharger Report:	
Site No:		NA		Material Group:	
Incident Dt:		2017/12/05		Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:				Sector Type:	
Incident Event:		Leak/Break		Agency Involved:	
Contaminant Code:		35		Nearest Watercourse:	
Contaminant Name:		NATURAL GAS (METHANE)		Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:		1075		Site Region:	
Environment Impact:				Site Municipality:	
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:		Air		Nothing:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2017/12/05 Dt Document Closed: 2017/12/16 Incident Reason: Operator/Human Error Site Name: commercial<UNOFFICIAL> Site County/District: Regional Municipality of Halton Municipality No: Site Geo Ref Meth: Incident Summary: TSSA FSB: gas meter hit, made safe Contaminant Qty: 0 n/a Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Pipeline/Components Source Type:					
57	9 of 12	ESE/240.3	194.8 / -5.07	Dr. Susan Bermingham Dentistry PC 106 Wakefield Road #1 Milton ON L9T 2L8	GEN
Generator No: ON8687854 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: Detail(s) Waste Class: 312 P Waste Class Name: Pathological wastes					
57	10 of 12	ESE/240.3	194.8 / -5.07	PINCHIN LTD 106 WAKEFIELD ROAD MILTON ON L9T 2L8	GEN
Generator No: ON9702305 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: Detail(s) Waste Class: 150 L Waste Class Name: Inert organic wastes					
57	11 of 12	ESE/240.3	194.8 / -5.07	Dr. Susan Bermingham Dentistry PC 106 Wakefield Road #1 Milton ON L9T 2L8	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON8687854 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: 312 P Waste Class Name: Pathological wastes					
57	12 of 12	ESE/240.3	194.8 / -5.07	Dr. Susan Bermingham Dentistry PC 106 Wakefield Road #1 Milton ON L9T 2L8	GEN
Generator No: ON8687854 SIC Code: SIC Description: Approval Years: As of Oct 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: 312 P Waste Class Name: PATHOLOGICAL WASTES					
58	1 of 1	ESE/240.3	194.8 / -5.07	106 Wakefield Road Milton ON	EHS
Order No: 20180405018 Status: C Report Type: Standard Report Report Date: 10-APR-18 Date Received: 05-APR-18 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.875109 Y: 43.515898					
59	1 of 1	W/244.9	199.2 / -0.64	51 Millside Drive Milton ON L9T	EHS
Order No: 20180418096 Status: C Report Type: Standard Report Report Date: 25-APR-18 Date Received: 18-APR-18 Previous Site Name:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.882193 Y: 43.516613					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; Title Searches					
60	1 of 1	W/247.3	199.7 / -0.20	51 Millside Drive Milton ON L9T 1S8	EHS
Order No: 20180524158 Status: C Report Type: Standard Express Report Report Date: 24-MAY-18 Date Received: 24-MAY-18 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.882227 Y: 43.516671			
61	1 of 1	WSW/250.6	191.9 / -7.93	295 Main Street East Milton ON L9T 1P1	EHS
Order No: 20060818010 Status: C Report Type: Basic Report Report Date: 8/28/2006 Date Received: 8/18/2006 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps And /or Site Plans		Nearest Intersection: Millside Drive Municipality: Halton Client Prov/State: ON Search Radius (km): 0.25 X: -79.881342 Y: 43.515164			
62	1 of 1	SSW/250.9	191.6 / -8.22	Near Pine Street and Fulton Street Milton ON	SPL
Ref No: 6856-9B9PR2 Site No: Incident Dt: 2013/09/05 Year: Incident Cause: Unknown / N/A Incident Event: Contaminant Code: 44 Contaminant Name: SEWAGE SLUDGE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Confirmed Nature of Impact: Surface Water Pollution Receiving Medium: Receiving Env: MOE Response: Priority Field Response (ERP Callout) Dt MOE Arvl on Scn: 2013/09/05 MOE Reported Dt: 2013/09/05 Dt Document Closed:		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Unknown / N/A Agency Involved: Nearest Watercourse: Site Address: Near Pine Street and Fulton Street Site District Office: Site Postal Code: Site Region: Site Municipality: Milton Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Pollution Incident Reports (PIRs) and "Other" calls			
Incident Reason: Unknown / N/A Site Name: 16 Mile Creek <UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: Halton Region CA: black material in 16 mile crk Contaminant Qty: 0 other - see incident description		Source Type:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
63	1 of 1	S/253.1	192.5 / -7.36	CHEMLAWN 337 OAK ST. TANK TRUCK (CARGO) MILTON TOWN ON L9T 1H8	SPL
Ref No: 34165 Site No: Incident Dt: 5/3/1990 Year: Incident Cause: CONTAINER OVERFLOW Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: LAND / WATER Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 5/3/1990 Dt Document Closed: Incident Reason: ERROR Site Name: Site County/District: Municipality No: 14402 Site Geo Ref Meth: Incident Summary: CHEMLAWN - 450 L FERTILIZER TO ROAD AND SEWER. Contaminant Qty:		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: REG. WORKS DEPT. Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: MILTON TOWN Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:			
64	1 of 1	WSW/255.5	192.0 / -7.83	Gearhead Bike Shop 295 Main St E Milton ON L9T 1P1	GEN
Generator No: ON7638173 SIC Code: 451110 SIC Description: Sporting Goods Stores Approval Years: 07,08 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					
65	1 of 1	SW/255.9	192.1 / -7.78	296 Main Street East Milton ON L9T 1P3	EHS
Order No: 20031016009 Status: C Report Type: Basic Report Report Date: 10/22/03 Date Received: 10/16/03 Previous Site Name: Lot/Building Size:		Nearest Intersection: Main St. & Millside Dr. Municipality: Halton Client Prov/State: ON Search Radius (km): 0.25 X: -79.881131 Y: 43.514853			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:		Title Search			
66	1 of 1	NE/257.1	199.9 / 0.00	55 ONTARIO ST S MILTON MALL Milton ON	WWIS
Well ID:	7255423			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	06-Jan-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z199465			Contractor:	6988
Tag:	A174930			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (TRAFALGAR)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/725\7255423.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2015/07/27				
Year Completed:	2015				
Depth (m):	6.1				
Latitude:	43.5190388242409				
Longitude:	-79.8763684529611				
Path:	725\7255423.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1005856057			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590811.00
Code OB Desc:				North83:	4819069.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-Jul-2015 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005963194				
Laver:	1				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005963195			
Layer:		2			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		6.099999904632568			
Formation End Depth:					
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005963203			
Layer:		2			
Plug From:		2.700000047683716			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005963202			
Layer:		1			
Plug From:		0.30000001192092896			
Plug To:		2.700000047683716			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005963201			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005963193			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1005963198			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005963199			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.049999952316284			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.0			
<u>Water Details</u>					
Water ID:		1005963197			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005963196			
Diameter:		10.199999809265137			
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1005856057			Tag No:	A174930
Depth M:	6.1			Contractor:	6988
Year Completed:	2015			Path:	725\7255423.pdf
Well Completed Dt:	2015/07/27			Latitude:	43.5190388242409
Audit No:	Z199465			Longitude:	-79.8763684529611

67	1 of 1	WNW/258.2	195.8 / -4.07	80 ONTARIO ST N Milton ON	WWIS
Well ID:	7346212			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	31-Oct-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z319476			Contractor:	7215

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:	A273718			Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	7 HALTON
MILTON TOWN (MILTON)					
PDF URL (Map): <u>Additional Detail(s) (Map)</u> Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:					
2019/09/26 2019 43.518439773416 -79.8813906726355 					
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1007700059			Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	 17 590406.00 4818997.00 UTM83 4 margin of error : 30 m - 100 m www
on Water Well Record					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: Layer: Plug From: Plug To: Plug Depth UOM:	1008209768				
1 0.0 30.0 ft					
<u>Pipe Information</u>					
Pipe ID: Casing No: Comment: Alt Name:	1008208157				
0					
<u>Construction Record - Casing</u>					
Casing ID:	1008210703				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:					
		1			
Material:					
		5			
Open Hole or Material:					
		PLASTIC			
Depth From:					
		0.0			
Depth To:					
		20.0			
Casing Diameter:					
		2.0			
Casing Diameter UOM:					
		Inch			
Casing Depth UOM:					
		ft			
<u>Construction Record - Screen</u>					
Screen ID:					
		1008210999			
Layer:					
		1			
Slot:					
		10			
Screen Top Depth:					
		20.0			
Screen End Depth:					
		30.0			
Screen Material:					
		5			
Screen Depth UOM:					
		ft			
Screen Diameter UOM:					
		inch			
Screen Diameter:					
		2.0			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
		1008211401			
Pump Test ID:					
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
		ft			
Rate UOM:					
		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:					
		1008211155			
Layer:					
		1			
Kind Code:					
		8			
Kind:					
		Untested			
Water Found Depth:					
		25.5			
Water Found Depth UOM:					
		ft			
<u>Links</u>					
Bore Hole ID:					
		1007700059		Tag No:	A273718
Depth M:					
				Contractor:	7215
Year Completed:					
		2019		Path:	
Well Completed Dt:					
		2019/09/26		Latitude:	43.518439773416
Audit No:					
		Z319476		Longitude:	-79.8813906726355
68	1 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON L9T 1R1	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON7738332 SIC Code: 624190 SIC Description: Other Individual and Family Services Approval Years: 05,06,07,08 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
68	2 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON L9T 1R1	GEN
Generator No: ON7738332 SIC Code: 624190 SIC Description: Other Individual and Family Services Approval Years: 2009 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
68	3 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON L9T 1R1	GEN
Generator No: ON7738332 SIC Code: 624190 SIC Description: Other Individual and Family Services Approval Years: 2010 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
68	4 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON L9T 1R1	GEN
Generator No:		ON7738332			
SIC Code:		624190			
SIC Description:		Other Individual and Family Services			
Approval Years:		2011			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
68	5 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON L9T 1R1	GEN
Generator No:		ON7738332			
SIC Code:		624190			
SIC Description:		Other Individual and Family Services			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
68	6 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON	GEN
Generator No:		ON7738332			
SIC Code:		624190			
SIC Description:					
Approval Years:		2013			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
68	7 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON L9T 1R1	GEN
Generator No:		ON7738332			
SIC Code:		624190			
SIC Description:		624190			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Kerri Purgavie			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		905-878-8853 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
68	8 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON L9T 1R1	GEN
Generator No:		ON7738332			
SIC Code:		624190			
SIC Description:		624190			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Kerri Purgavie			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		905-878-8853 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
68	9 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON L9T 1R1	GEN
Generator No:		ON7738332			
SIC Code:		624190			
SIC Description:		624190			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Kerri Purgavie			
Choice of Contact:		CO_OFFICIAL			

195 erisinfo.com | Environmental Risk Information Services Order No: 23030300040

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
68	13 of 13	NNE/258.8	199.9 / 0.00	Animal Hospital Milton 491 Main Street East Milton ON L9T 1R1	GEN
Generator No: ON7738332 SIC Code: SIC Description: Approval Years: As of Oct 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
69	1 of 3	N/258.9	199.9 / 0.00	Lowe's Home Centres (CANADA) Inc. 55 Ontario Street Milton ON L9T 2M3	GEN
Generator No: ON7690950 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		242 T			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Halogenated pesticides and herbicides			
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		221 I			
Waste Class Name:		Light fuels			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		331 L			
Waste Class Name:		Waste compressed gases including cylinders			

69	2 of 3	N/258.9	199.9 / 0.00	Lowe's Home Centres (CANADA) Inc. 55 Ontario Street Milton ON L9T 2M3	GEN
Generator No:		ON7690950			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		242 T			
Waste Class Name:		Halogenated pesticides and herbicides			
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		221 I			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Light fuels			
Waste Class:		331 L			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
69	3 of 3	N/258.9	199.9 / 0.00	Lowe's Home Centres (CANADA) Inc. 55 Ontario Street Milton ON L9T 2M3	GEN
Generator No:		ON7690950			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		263 L			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		263 A			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		242 T			
Waste Class Name:		HALOGENATED PESTICIDES			
Waste Class:		331 L			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		146 T			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		331 I			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		148 A			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		221 I			
Waste Class Name:		LIGHT FUELS			
Waste Class:		212 I			
Waste Class Name:		ALIPHATIC SOLVENTS			
70	1 of 1	NNE/260.3	199.9 / 0.00	ON	WWIS
Well ID:		2801699		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Public		Data Entry Status:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	02-Oct-1962 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	1307
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (MILTON)				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/280\2801699.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	1962/09/08				
Year Completed:	1962				
Depth (m):	10.3632				
Latitude:	43.5195921730437				
Longitude:	-79.8777019263274				
Path:	280\2801699.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	10148253			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590702.40
Code OB Desc:				North83:	4819129.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	5
Date Completed:	08-Sep-1962 00:00:00			UTMRC Desc:	margin of error : 100 m - 300 m
Remarks:				Location Method:	p5
Loc Method Desc:	Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	931426337				
Layer:	2				
Color:	7				
General Color:	RED				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	12.0				
Formation End Depth:	32.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931426336			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931426338			
Layer:		3			
Color:					
General Color:					
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		32.0			
Formation End Depth:		34.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		962801699			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10696823			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930252209			
Layer:		1			
Material:		3			
Open Hole or Material:		CONCRETE			
Depth From:					
Depth To:		34.0			
Casing Diameter:		30.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		992801699			
Pump Set At:					
Static Level:		15.0			
Final Level After Pumping:					
Recommended Pump Depth:		32.0			
Pumping Rate:		25.0			
Flowing Rate:					
Recommended Pump Rate:		25.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
<u>Water Details</u>					
Water ID:		933603517			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		34.0			
Water Found Depth UOM:		ft			
<u>Links</u>					
Bore Hole ID:	10148253			Tag No:	
Depth M:	10.3632			Contractor:	1307
Year Completed:	1962			Path:	280\2801699.pdf
Well Completed Dt:	1962/09/08			Latitude:	43.5195921730437
Audit No:				Longitude:	-79.8777019263274
71	1 of 1	WNW/262.3	195.3 / -4.57	80 ONTARIO STREET NORTH MILTON ON	WWIS
Well ID:	7257997			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	17-Feb-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z225983			Contractor:	7241
Tag:	A183331			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (TRAFALGAR)				
Site Info:	WKQ-008610 A0-A 04				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2015/01/06				
Year Completed:	2015				
Depth (m):	8.2296				
Latitude:	43.5180304965411				
Longitude:	-79.8818931546259				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1005889182			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590366.00
Code OB Desc:				North83:	4818951.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06-Jan-2015 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005987227				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:	66				
Mat3 Desc:	DENSE				
Formation Top Depth:	2.0				
Formation End Depth:	20.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005987228				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	05				
Mat2 Desc:	CLAY				
Mat3:	66				
Mat3 Desc:	DENSE				
Formation Top Depth:	20.0				
Formation End Depth:	27.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005987226			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987236			
Layer:		1			
Plug From:		27.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987237			
Layer:		2			
Plug From:		16.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005987238			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005987235			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005987225			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Construction Record - Casing

Casing ID: 1005987231
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 17.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1005987232
Layer: 1
Slot: .10
Screen Top Depth: 17.0
Screen End Depth: 27.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.25

Water Details

Water ID: 1005987230
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole Diameter

Hole ID: 1005987229
Diameter: 6.0
Depth From: 0.0
Depth To: 27.0
Hole Depth UOM: ft
Hole Diameter UOM: inch

Links

Bore Hole ID:	1005889182	Tag No:	A183331
Depth M:	8.2296	Contractor:	7241
Year Completed:	2015	Path:	725\7257997.pdf
Well Completed Dt:	2015/01/06	Latitude:	43.5180304965411
Audit No:	Z225983	Longitude:	-79.8818931546259

[72](#)

1 of 1

ENE/264.1

199.2 / -0.64

50 Ontario St S
Milton ON

EHS

Order No: 20131218024
Status: C
Report Type: Custom Report
Report Date: 07-FEB-14
Date Received: 18-DEC-13
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -79.87497
Y: 43.518117

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
73	1 of 1	ENE/264.3	199.6 / -0.26	25 Ontario Street South Milton ON	EHS
Order No:	20070810002			Nearest Intersection:	Main St E & Childs Dr
Status:	C			Municipality:	
Report Type:	CAN - Custom Report			Client Prov/State:	
Report Date:	8/21/2007			Search Radius (km):	1
Date Received:	8/10/2007			X:	-79.875022
Previous Site Name:				Y:	43.51818
Lot/Building Size:					
Additional Info Ordered:					
74	1 of 5	NW/266.9	196.2 / -3.66	PRIVATE OWNER 80 ONTARIO STREET MOTOR VEHICLE (OPERATING FLUID) MILTON TOWN ON	SPL
Ref No:	39700			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	7/17/1990			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	OTHER CONTAINER LEAK			Sector Type:	
Incident Event:				Agency Involved:	MILTON FIRE DEPT.
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	POSSIBLE			Site Municipality:	MILTON TOWN
Nature of Impact:	Water course or lake			Site Lot:	
Receiving Medium:	LAND			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	7/17/1990			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:	UNKNOWN			Source Type:	
Site Name:					
Site County/District:					
Municipality No:	14402				
Site Geo Ref Meth:					
Incident Summary:	BACKENTRY - 2.5L GASOLINEFROM CAR TO 16 MILE CREEKVIA FLOOR DRAIN.				
Contaminant Qty:					
74	2 of 5	NW/266.9	196.2 / -3.66	CATHERTON CHARITABLE FOUNDATION 80 ONTARIO STREET NORTH MILTON ON L9T 4Z6	GEN
Generator No:	ON7509283				
SIC Code:	541990				
SIC Description:	ALL OTHER PROFESSIONAL, SCIENTIFIC AND TECHNICAL SERVICES				
Approval Years:	2016				
PO Box No:					
Country:	Canada				
Status:					
Co Admin:					
Choice of Contact:	CO_OFFICIAL				
Phone No Admin:					
Contaminated Facility:	No				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
74	3 of 5	NW/266.9	196.2 / -3.66	80 Ontario Street North Milton ON L9T 4Z6	EHS
Order No:		20181031037		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	ON
Report Date:		05-NOV-18		Search Radius (km):	.25
Date Received:		31-OCT-18		X:	-79.881083
Previous Site Name:				Y:	43.518582
Lot/Building Size:					
Additional Info Ordered:					
74	4 of 5	NW/266.9	196.2 / -3.66	Catherton Charitable Foundation 80 Ontario Street North Milton ON L9T 4Z6	GEN
Generator No:		ON5999202			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2019			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
74	5 of 5	NW/266.9	196.2 / -3.66	Melloul-Blamey Construction 80 Ontario St N Milton ON L9T4Z6	GEN
Generator No:		ON3247050			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
75	1 of 1	E/269.7	197.8 / -2.04	MILTON MALL ONTARIO ST. & CHILDS DR. MILTON ON	WWIS
Well ID:		7114860		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Observation Wells		Date Received:	
Water Type:				12-Nov-2008 00:00:00	
Casing Material:				Selected Flag:	
Audit No:		Z82823		TRUE	
Tag:		A066787		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				6809	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				HALTON	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		MILTON TOWN (MILTON)		Concession Name:	
Site Info:				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7114860.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2008/09/02			
Year Completed:		2008			
Depth (m):		9.4488			
Latitude:		43.5174538871428			
Longitude:		-79.8745171878614			
Path:		711\7114860.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1001881191		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				590963.00	
Cluster Kind:				North83:	
Date Completed:		02-Sep-2008 00:00:00		Org CS:	
Remarks:				UTM83	
Loc Method Desc:		on Water Well Record		UTMRC:	
Elevrc Desc:				3	
Location Source Date:				UTMRC Desc:	
Improvement Location Source:				margin of error : 10 - 30 m	
Improvement Location Method:				Location Method:	
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1001959310			
Laver:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1001959311			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		34			
Mat2 Desc:		TILL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		5.0			
Formation End Depth:		31.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1001959314			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1001959318			
Layer:		5			
Plug From:		24.0			
Plug To:		31.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1001959315			
Layer:		2			
Plug From:		1.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1001959316			
Layer:		3			
Plug From:		2.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		22.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1001959317			
Layer:		4			
Plug From:		22.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1001959324			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		AUGER			
 <u>Pipe Information</u>					
Pipe ID:		1001959309			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1001959320			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		21.0			
Casing Diameter:		9.625			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1001959321			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
 <u>Water Details</u>					
Water ID:		1001959319			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1001959312			
Diameter:		12.0			
Depth From:		0.0			
Depth To:		21.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1001959313			
Diameter:		8.0			
Depth From:		21.0			
Depth To:		31.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1001881191			Tag No:	A066787
Depth M:	9.4488			Contractor:	6809
Year Completed:	2008			Path:	711\7114860.pdf
Well Completed Dt:	2008/09/02			Latitude:	43.5174538871428
Audit No:	Z82823			Longitude:	-79.8745171878614

76	1 of 1	WNW/270.4	195.7 / -4.14	ON	WWIS
Well ID:	7351859			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	22-Jan-2020 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C45985			Contractor:	7215
Tag:	A273718			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (MILTON)			
Site Info:					
PDF URL (Map):					

Additional Detail(s) (Map)

Well Completed Date: 2019/08/09
Year Completed: 2019
Depth (m):
Latitude: 43.5185485302728
Longitude: -79.8814629019366
Path:

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1007700050			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590378.00
Code OB Desc:				North83:	4818982.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	26-Sep-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1008209765				
Layer:	1				
Plug From:	0.0				
Plug To:	30.0				
Plug Depth UOM:	ft				
 <u>Pipe Information</u>					
Pipe ID:	1008208154				
Casing No:	0				
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:	1008210700				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	20.0				
Casing Diameter:	2.0				
Casing Diameter UOM:	Inch				
Casing Depth UOM:	ft				
 <u>Construction Record - Screen</u>					
Screen ID:	1008210996				
Layer:	1				
Slot:	10				
Screen Top Depth:	20.0				
Screen End Depth:	30.0				
Screen Material:	5				
Screen Depth UOM:	ft				
Screen Diameter UOM:	inch				
Screen Diameter:	2.0				
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1008211398				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Water Details</u>					
Water ID: 1008211152 Layer: 1 Kind Code: 8 Kind: Untested Water Found Depth: 24.5 Water Found Depth UOM: ft					
<u>Links</u>					
Bore Hole ID: 1007700050 Depth M: Year Completed: 2019 Well Completed Dt: 2019/09/26 Audit No: Z309280 Tag No: A273718 Contractor: 7215 Path: 734\7346209.pdf Latitude: 43.5183081237688 Longitude: -79.8817395507848					
78	1 of 1	NNE/272.9	199.9 / 0.00	The Reliance Machine Works Co. 45 Ontario St N Unit 2C Milton ON L9T 2T2	SCT
Established: 1/1/2001 Plant Size (ft²): Employment:					
<u>--Details--</u>					
Description: Machine Shops SIC/NAICS Code: 332710					
79	1 of 1	NNW/277.8	197.5 / -2.36	88 ONTARIO ST N Milton ON	WWIS
Well ID: 7229623 Construction Date: Use 1st: Test Hole Use 2nd: Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z158662 Tag: A160329 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 16-Oct-2014 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6988 Form Version: 7 Owner: County: HALTON Lot: Concession:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (TRAFALGAR)			
Site Info:					
PDF URL (Map):				https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7229623.pdf	
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2014/08/29			
Year Completed:		2014			
Depth (m):		6.7			
Latitude:		43.5195961758267			
Longitude:		-79.8799463737446			
Path:		722\7229623.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1005165109		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 17	
Code OB:				East83: 590521.00	
Code OB Desc:				North83: 4819127.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:		29-Aug-2014 00:00:00		UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005401921			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		4.300000190734863			
Formation End Depth:		6.699999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005401920			
Layer:		2			
Color:		6			
General Color:		BROWN			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		06			
Most Common Material:		SILT			
Mat2:					
Mat2 Desc:					
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		2.4000000953674316			
Formation End Depth:		4.300000190734863			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005401919			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		79			
Mat3 Desc:		PACKED			
Formation Top Depth:		0.0			
Formation End Depth:		2.4000000953674316			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005401928			
Layer:		1			
Plug From:		0.0			
Plug To:		3.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005401927			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005401918			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005401924			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.299999952316284			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1005401925			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.299999952316284			
Screen End Depth:		6.400000095367432			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.0			
<u>Water Details</u>					
Water ID:		1005401923			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005401922			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		6.699999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1005165109			Tag No:	A160329
Depth M:	6.7			Contractor:	6988
Year Completed:	2014			Path:	722\7229623.pdf
Well Completed Dt:	2014/08/29			Latitude:	43.5195961758267
Audit No:	Z158662			Longitude:	-79.8799463737446
80	1 of 1	WNW/279.4	194.8 / -5.09	80 Ontario Street Norrth Milton ON	WWIS
Well ID:	7340815			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	13-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	JDF6PFFI			Contractor:	7147
Tag:	_NO_TAG			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MILTON TOWN (MILTON)			
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7340815.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/08/23			
Year Completed:		2019			
Depth (m):					
Latitude:		43.5181489814986			
Longitude:		-79.8820394429111			
Path:		734\7340815.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007616661		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				17	
Code OB Desc:				East83:	
Open Hole:				590354.00	
Cluster Kind:				North83:	
Date Completed:		23-Aug-2019 00:00:00		4818964.00	
Remarks:				Org CS:	
Loc Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007617242			
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007617864			
Layer:		1			
Plug From:		0.0			
Plug To:		7.599999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007617789			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Pipe Information</u>					
Pipe ID:		1007616886			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007617479			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.599999904632568			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007617630			
Layer:		1			
Slot:					
Screen Top Depth:		4.599999904632568			
Screen End Depth:		7.599999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.300000190734863			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007616887			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1007617184			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		3.799999952316284			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth UOM:		m			
<u>Links</u>					
Bore Hole ID:	1007616661			Tag No:	_NO_TAG
Depth M:				Contractor:	7147
Year Completed:	2019			Path:	734\7340815.pdf
Well Completed Dt:	2019/08/23			Latitude:	43.5181489814986
Audit No:	JDF6PFFI			Longitude:	-79.8820394429111

<u>81</u>	1 of 1	ENE/286.1	199.9 / 0.00	55 ONTARIO ST S Milton ON	WWIS
Well ID:	7311350			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	11-May-2018 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z284928			Contractor:	7241
Tag:	A246758			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (TRAFALGAR)				
Site Info:					
PDF URL (Map):					

Additional Detail(s) (Map)

Well Completed Date: 2018/04/17
 Year Completed: 2018
 Depth (m): 3.6576
 Latitude: 43.5182486671842
 Longitude: -79.8747622476401
 Path:

Bore Hole Information

Bore Hole ID:	1007057098	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590942.00
Code OB Desc:		North83:	4818983.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	17-Apr-2018 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007273093			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.5			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007273092			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		0.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007273101			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007273102			
Layer:		2			
Plug From:		0.5			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007273103			
Layer:		3			
Plug From:		4.0			
Plug To:		12.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007273100			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1007273091			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007273096			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007273097			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1007273095			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1007273094			
Diameter:		2.5			
Depth From:		0.0			
Depth To:		12.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1007057098			Tag No:	A246758
Depth M:	3.6576			Contractor:	7241
Year Completed:	2018			Path:	731\7311350.pdf
Well Completed Dt:	2018/04/17			Latitude:	43.5182486671842
Audit No:	Z284928			Longitude:	-79.8747622476401

82	1 of 1	NNW/291.3	199.0 / -0.88	80 ONTARIO ST N Milton ON	WWIS
Well ID:	7346210			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	31-Oct-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z319474			Contractor:	7215
Tag:	A183228			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	MILTON TOWN (MILTON)				
Site Info:					
PDF URL (Map):					

Additional Detail(s) (Map)

Well Completed Date: 2019/09/26
Year Completed: 2019
Depth (m):
Latitude: 43.5196084503102
Longitude: -79.8802802265804
Path:

Bore Hole Information

Bore Hole ID:	1007700053	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	590494.00
Code OB Desc:		North83:	4819128.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	26-Sep-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Annular Space/Abandonment Sealing Record

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1008209766			
Layer:		1			
Plug From:		0.0			
Plug To:		30.0			
Plug Depth UOM:		ft			
<u>Pipe Information</u>					
Pipe ID:		1008208155			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008210701			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		20.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008210997			
Layer:		1			
Slot:		10			
Screen Top Depth:		20.0			
Screen End Depth:		30.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.0			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008211399			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1008211153			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code: 8 Kind: Untested Water Found Depth: 25.0 Water Found Depth UOM: ft					
Links					
Bore Hole ID: 1007700053 Depth M: Year Completed: 2019 Well Completed Dt: 2019/09/26 Audit No: Z319474					
Tag No: A183228 Contractor: 7215 Path: Latitude: 43.5196084503102 Longitude: -79.8802802265804					
83	1 of 1	WSW/293.1	190.3 / -9.60	82 Millside Drive Milton ON	EHS
Order No: 20110318016 Status: C Report Type: Custom Report Report Date: 3/24/2011 Date Received: 3/18/2011 11:18:02 AM Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -79.882446 Y: 43.515619					
84	1 of 2	ESE/293.6	195.9 / -3.94	PIPELINE HIT - 1/2" 101 WAKEFIELD ROAD,,MILTON,ON,L9T 2L7,CA ON	PINC
Incident Id: Incident No: 1730772 Incident Reported Dt: 10/2/2015 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT - 1/2" Incident Address: 101 WAKEFIELD ROAD,,MILTON,ON,L9T 2L7,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
84	2 of 2	ESE/293.6	195.9 / -3.94	101 Wakefield drive, Milton Milton ON	SPL
Ref No: 4127-A2WKFQ Site No: NA Incident Dt: 10/1/2015 Year:					
Discharger Report: Material Group: Health/Env Conseq: Client Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Cause: Incident Event: Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 10/2/2015 Dt Document Closed: 11/27/2015		Sector Type: Unknown / N/A Agency Involved: Nearest Watercourse: Site Address: 101 Wakefield drive, Milton Site District Office: Site Postal Code: Site Region: Site Municipality: Milton Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill		Source Type: Incident Reason: Operator/Human Error Site Name: line strike<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: TSSA 1/2" pl main, made safe. Contaminant Qty: 0 other - see incident description	

85	1 of 1	NW/294.7	199.6 / -0.30	80 ONTARIO STREET NORTH MILTON ON	WWIS
Well ID: 7257995 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z225985 Tag: A183328 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: MILTON TOWN (TRAFALGAR) Site Info: WKQ-008610 A0-A 04		Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 17-Feb-2016 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		PDF URL (Map): Additional Detail(s) (Map) Well Completed Date: 2016/01/06 Year Completed: 2016 Depth (m): 8.2296 Latitude: 43.5195916567966 Longitude: -79.8804042704456 Path:	
Bore Hole Information		Bore Hole ID: 1005889176		Elevation:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	590484.00
Code OB Desc:				North83:	4819126.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06-Jan-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005987153			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.25			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005987156			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		20.0			
Formation End Depth:		27.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005987154			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		0.25			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005987155			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		2.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005996277			
Layer:		1			
Plug From:		27.0			
Plug To:		18.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005996278			
Layer:		2			
Plug From:		18.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005996279			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005987161			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005987152			
Casing No:		0			
Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005987159			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		17.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005987160			
Layer:		1			
Slot:		.10			
Screen Top Depth:		17.0			
Screen End Depth:		27.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1005987158			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1005987157			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		27.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1005889176			Tag No:	A183328
Depth M:	8.2296			Contractor:	7241
Year Completed:	2016			Path:	725\7257995.pdf
Well Completed Dt:	2016/01/06			Latitude:	43.5195916567966
Audit No:	Z225985			Longitude:	-79.8804042704456
86	1 of 15	NNW/295.7	197.4 / -2.49	BIG ARN'S SPORTS WHOLESALE & REPAIR 88 ONTARIO STREET NORTH MILTON ON L9T 2T2	GEN
Generator No:	ON1828200				
SIC Code:	5942				
SIC Description:	SPORTING GOODS, WH.				
Approval Years:	94,95,96,97,98,99,00,01				
PO Box No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
86	2 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 ontario street MILTON ON L9T 2T1	GEN
Generator No:		ON7914794			
SIC Code:		561799			
SIC Description:		All Other Services to Buildings and Dwellings			
Approval Years:		04,05			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
86	3 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 ontario street MILTON ON L9T 2T1	GEN
Generator No:		ON7914794			
SIC Code:		561799			
SIC Description:		All Other Services to Buildings and Dwellings			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
86	4 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 ontario street MILTON ON	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON7914794 SIC Code: 561799 SIC Description: ALL OTHER SERVICES TO BUILDINGS AND DWELLINGS Approval Years: 2013 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
86	5 of 15	NNW/295.7	197.4 / -2.49	Enterprise Rent A Car Canada Company 88 Ontario Street North # 2 Milton ON	GEN
Generator No: ON4493253 SIC Code: 532111 SIC Description: Approval Years: 2013 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
86	6 of 15	NNW/295.7	197.4 / -2.49	Enterprise Rent A Car Canada Company 88 Ontario Street North # 2 Milton ON L9T2T1	GEN
Generator No: ON4493253 SIC Code: 532111 SIC Description: 532111 Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Mike Stopczynski Choice of Contact: CO_OFFICIAL Phone No Admin: 5194515884 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
86	7 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 Ontario Street MILTON ON L9T 2T1	GEN
Generator No:		ON7914794			
SIC Code:		561799			
SIC Description:		ALL OTHER SERVICES TO BUILDINGS AND DWELLINGS			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		SIMA AHMAR			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		905 837 2289 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
86	8 of 15	NNW/295.7	197.4 / -2.49	Enterprise Rent A Car Canada Company 88 Ontario Street North # 2 Milton ON L9T2T1	GEN
Generator No:		ON4493253			
SIC Code:		532111			
SIC Description:		532111			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Mike Stopczynski			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		5194515884 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
86	9 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 Ontario Street MILTON ON L9T 2T1	GEN
Generator No:		ON7914794			
SIC Code:		561799			
SIC Description:		ALL OTHER SERVICES TO BUILDINGS AND DWELLINGS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		SIMA AHMAR			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		905 837 2289 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
86	10 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 ontario street MILTON ON L9T 2T1	GEN
Generator No:		ON7914794			
SIC Code:		561799			
SIC Description:		ALL OTHER SERVICES TO BUILDINGS AND DWELLINGS			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		SIMA AHMAR			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		905 837 2289 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
86	11 of 15	NNW/295.7	197.4 / -2.49	Enterprise Rent A Car Canada Company 88 Ontario Street North # 2 Milton ON L9T2T1	GEN
Generator No:		ON4493253			
SIC Code:		532111			
SIC Description:		532111			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Mike Stopczynski			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		5194515884 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
86	12 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 Ontario Street MILTON ON L9T 2T1	GEN
Generator No:		ON7914794			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		251 L Waste oils/sludges (petroleum based)			
86	13 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 Ontario Street MILTON ON L9T 2T1	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON7914794 As of Jul 2020 Canada Registered			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		251 L Waste oils/sludges (petroleum based)			
86	14 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 Ontario Street MILTON ON L9T 2T1	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON7914794 As of Nov 2021 Canada Registered			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		251 L Waste oils/sludges (petroleum based)			
86	15 of 15	NNW/295.7	197.4 / -2.49	2016789 ontario inc. 88 Ontario Street MILTON ON L9T 2T1	GEN
Generator No: SIC Code: SIC Description: Approval Years:		ON7914794 As of Oct 2022			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country:Canada Status:Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: Waste Class Name:		251 L OIL SKIMMINGS & SLUDGES			
87	1 of 1	S/295.9	190.4 / -9.49	332 OAK ST. Milton ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		7135386 Test Hole Test Hole Z107473 A093123			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003056786			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		05			
Mat3 Desc:		CLAY			
Formation Top Depth:		12.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003056785			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		68			
Mat3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003056788			
Layer:		1			
Plug From:		15.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003056790			
Layer:		3			
Plug From:		1.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003056789			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Plug From:		4.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003056795			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003056784			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003056792			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1003056793			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.0			
<u>Water Details</u>					
Water ID:		1003056791			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1003056787			
Diameter:		8.0			
Depth From:		15.0			
Depth To:		0.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Links					
Bore Hole ID:	1002864395			Tag No:	A093123
Depth M:	4.572			Contractor:	7215
Year Completed:	2009			Path:	713\7135386.pdf
Well Completed Dt:	2009/11/06			Latitude:	43.5137641570519
Audit No:	Z107473			Longitude:	-79.8783840143498
<u>88</u>	1 of 2	NNE/297.5	199.9 / 0.00	APPLIED WIRING ASSEMBLIES INC. 505 MAIN ST E MILTON ON L9T 3J2	SCT
Established:	1981				
Plant Size (ft²):	0				
Employment:	60				
--Details--					
Description:	ELECTRONIC COMPONENTS, NOT ELSEWHERE CLASSIFIED				
SIC/NAICS Code:	3679				
Description:	Other Fabricated Wire Product Manufacturing				
SIC/NAICS Code:	332619				
Description:	Semiconductor and Other Electronic Component Manufacturing				
SIC/NAICS Code:	334410				
Description:	Switchgear and Switchboard, and Relay and Industrial Control Apparatus Manufacturing				
SIC/NAICS Code:	335315				
<u>88</u>	2 of 2	NNE/297.5	199.9 / 0.00	APPLIED WIRING ASSEMBLIES INC. 505 MAIN STREET EAST MILTON ON L9T 3J2	GEN
Generator No:	ON2525100				
SIC Code:	5612				
SIC Description:	OTHER IRON/STEEL PR.				
Approval Years:	99,00,01				
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				

Unplottable Summary

Total: **41** Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	R.M. OF HALTON	OAK ST/ONTARIO ST/FULTON ST.	MILTON TOWN ON	
CA	R.M. OF HALTON	LOT 13, CONC. 2	MILTON TOWN ON	
CA		Main Street	Milton ON	
CA	The Corporation of the Town of Milton	Court Street (within the right-of-way of Court Street)	Milton ON	
CA	The Regional Municipality of Halton	Main Street	Milton ON	
CA	R.M. OF HALTON	PINE ST./FULTON ST./PRINCE ST.	MILTON TOWN ON	
CA	R.M. OF HALTON	FULTON ST/MAIN ST/OAK ST.	MILTON ON	
CA	MILTON TOWN	FULTON ST./MAIL ST./PEARL ST.	MILTON ON	
CA	R.M. OF HALTON	FULTON ST/MAIN ST/OAK ST.	MILTON ON	
CA	R.M. OF HALTON	PINE ST./FULTON ST./PRINCE ST.	MILTON TOWN ON	
CA	R.M. HALTON	ONTARIO STREET	MILTON TOWN ON	
CA	R.M. OF HALTON-HALTON CENTENNIAL MANOR	ONTARIO STREET	MILTON TOWN ON	
CA	MILTON TOWN	ONTARIO STREET	MILTON TOWN ON	
CA	R.M. OF HALTON	ONTARIO STREET	MILTON TOWN ON	
CA	MINISTRY OF GOVERNMENT SERVICES-LOT 12	ONTARIO ST., CONC. 3	MILTON TOWN ON	
CA	TRAYNOR GROUP	MAIN ST. E. DAL BELLO PROJ.	MILTON TOWN ON	
CA	R.M. OF HALTON	OAK ST/ONTARIO ST/FULTON ST.	MILTON TOWN ON	

CA	T. DALBELLO	DAL BELLO PROJ. MAIN ST. E.	MILTON TOWN ON	
CONV	LOBLAWS SUPERMARKETS LIMITED		ON	
ECA	The Regional Municipality of Halton	Regional Road 25	Milton ON	L6M 3L1
ECA	The Regional Municipality of Halton	Regional Road 25	Milton ON	L6M 3L1
ECA	The Corporation of the Town of Milton	Oak St	Milton ON	L9T 6Z5
ECA	Town of Milton	Main St E	Milton ON	L9T 6Z5
GEN	BELL CANADA	VARIOUS BELL CANADA MANHOLES AND ACCESS CHAMBERS WITHIN THE MOE CENTRAL REG.	(SEE SCHEDULE "B") ON	
GEN	MARSHALL STEEL LIMITED 15-053	RR #3, HWY. 25 NORTH C/O P.O. BOX 1014	MILTON ON	L9T 4B6
GEN	MARSHALL STEEL LIMITED	RR #3, HWY. 25 NORTH C/O P.O. BOX 1014	MILTON ON	L9T 4B6
GEN	FRANKEL STEEL LTD.	RR #3, HWY. 25 NORTH	MILTON ON	L9T 2X7
PRT	999870 ONTARIO LIMITED RAYS TEXACO SERVICE	HWY 25	MILTON ON	
PRT	ONTARIO HYDRO	MAIN ST E	MILTON ON	L9T 2N3
RST	DURANTE AUTO SERVICE & TOWING INC	REGIONAL ROAD 25	MILTON ON	L2T 2X7
SCT	CHUDLEIGHS	HWY 25 RR 1	MILTON ON	L9T 2X5
SCT	CHUDLEIGHS	HWY 25 N	MILTON ON	L9P 1M7
SPL	Canadian Pacific Railway Company	MILTON TERMINAL RAIL YARD<UNOFFICIAL>	Milton ON	
SPL	CANADIAN PACIFIC RAILWAYS	CP RAIL AT COURT ST, NORTH., JUST WEST OF REGIONAL ROAD 25. TRAIN	MILTON TOWN ON	
SPL		MVA on Ontario Street, south of Pine Street<UNOFFICIAL>	Milton ON	
SPL	PHILIP ENTERPRISES	HWY 25 AT THE ESCARPMENT HAMILTON WASTE DISPOSAL SITE.	MILTON TOWN ON	
SPL	Canadian Pacific Railway Company	CP RAIL EXPRESS WAY TERMINAL<UNOFFICIAL>	Milton ON	
SPL	Neelands Refrigeration Limited	Main St	Milton ON	
WWIS		con 2	ON	

WWIS

con 3

ON

WWIS

con 3

ON

Unplottable Report

Site: R.M. OF HALTON
OAK ST/ONTARIO ST/FULTON ST. MILTON TOWN ON

Database:
CA

Certificate #: 7-0278-97-
Application Year: 97
Issue Date: 4/21/1997
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF HALTON
LOT 13, CONC. 2 MILTON TOWN ON

Database:
CA

Certificate #: 7-0165-96-
Application Year: 96
Issue Date: 4/1/1996
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Main Street Milton ON

Database:
CA

Certificate #: 1536-586UTR
Application Year: 02
Issue Date: 4/9/02
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: The Corporation of the Regional Municipality of Halton
Client Address: 1151 Bronte Road
Client City: Oakville
Client Postal Code: L6M 3L1
Project Description: Construction of Sanitary Sewers
Contaminants:
Emission Control:

Site: The Corporation of the Town of Milton
Court Street (within the right-of-way of Court Street) Milton ON

Database:
CA

Certificate #: 1352-6AQQTJ

Application Year: 2005
Issue Date: 3/24/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **The Regional Municipality of Halton**
Main Street Milton ON

Database:
CA

Certificate #: 7888-5XLSJ8
Application Year: 2004
Issue Date: 4/1/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **R.M. OF HALTON**
PINE ST./FULTON ST./PRINCE ST. MILTON TOWN ON

Database:
CA

Certificate #: 3-0818-90-
Application Year: 90
Issue Date: 5/18/1990
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **R.M. OF HALTON**
FULTON ST/MAIN ST/OAK ST. MILTON ON

Database:
CA

Certificate #: 7-0373-98-
Application Year: 98
Issue Date: 5/21/1998
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MILTON TOWN
FULTON ST./MAIL ST./PEARL ST. MILTON ON

Database:
CA

Certificate #: 3-1165-98-
Application Year: 98
Issue Date: 8/21/1998
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF HALTON
FULTON ST/MAIN ST/OAK ST. MILTON ON

Database:
CA

Certificate #: 3-0562-98-
Application Year: 98
Issue Date: 5/21/1998
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF HALTON
PINE ST./FULTON ST./PRINCE ST. MILTON TOWN ON

Database:
CA

Certificate #: 7-0698-90-
Application Year: 90
Issue Date: 5/18/1990
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. HALTON
ONTARIO STREET MILTON TOWN ON

Database:
CA

Certificate #: 7-0140-87-
Application Year: 87
Issue Date: 3/3/1987
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:

Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF HALTON-HALTON CENTENNIAL MANOR
ONTARIO STREET MILTON TOWN ON

Database:
CA

Certificate #: 7-1242-91-
Application Year: 91
Issue Date: 10/21/1991
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MILTON TOWN
ONTARIO STREET MILTON TOWN ON

Database:
CA

Certificate #: 3-0232-87-
Application Year: 87
Issue Date: 3/12/1987
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF HALTON
ONTARIO STREET MILTON TOWN ON

Database:
CA

Certificate #: 3-0175-87-
Application Year: 87
Issue Date: 3/3/1987
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MINISTRY OF GOVERNMENT SERVICES-LOT 12
ONTARIO ST., CONC. 3 MILTON TOWN ON

Database:
CA

Certificate #: 7-0865-91-
Application Year: 91

Issue Date: 7/12/1991
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **TRAYNOR GROUP**
MAIN ST. E. DAL BELLO PROJ. MILTON TOWN ON

Database:
CA

Certificate #: 7-1046-88-
Application Year: 88
Issue Date: 7/13/1988
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **R.M. OF HALTON**
OAK ST/ONTARIO ST/FULTON ST. MILTON TOWN ON

Database:
CA

Certificate #: 3-0367-97-
Application Year: 97
Issue Date: 4/21/1997
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **T. DALBELLO**
DAL BELLO PROJ. MAIN ST. E. MILTON TOWN ON

Database:
CA

Certificate #: 3-1209-88-
Application Year: 88
Issue Date: 7/13/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: LOBLAWS SUPERMARKETS LIMITED
ON

Database:
CONV

File No:
Crown Brief No: 02-0108-0749
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: STORE AND DISPLAY PESTICIDE IN MANNER LIKELY TO BRING IT INTO CONTACT WITH FOOD.
Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: PA
Regulation: 914
Section: 125(C)
Act/Regulation/Section: PA 914 125(C)
Date of Offence:
Date of Conviction:
Date Charged: 3/24/2003
Charge Disposition: FINED
Fine: \$7000
Synopsis:

Site: The Regional Municipality of Halton
Regional Road 25 Milton ON L6M 3L1

Database:
ECA

Approval No: 2035-8NQN4C
Approval Date: 2011-12-12
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: The Regional Municipality of Halton
Address: Regional Road 25
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/9448-8NNPMG-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: The Regional Municipality of Halton
Regional Road 25 Milton ON L6M 3L1

Database:
ECA

Approval No: 1474-9NCGLP
Approval Date: 2014-08-28
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: The Regional Municipality of Halton
Address: Regional Road 25
Full Address:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: The Corporation of the Town of Milton
Oak St Milton ON L9T 6Z5

Database:
ECA

Approval No: 3887-A8SH44
Approval Date: 2016-04-18
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: The Corporation of the Town of Milton
Address: Oak St
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/5351-A45TBZ-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: Town of Milton
Main St E Milton ON L9T 6Z5

Database:
ECA

Approval No: 6921-C4NPJA
Approval Date: 2021-07-15
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name: Halton
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Town of Milton
Address: Main St E
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/6156-C4FRCS-14.pdf>
PDF Site Location:

MOE District: Halton-Peel
City:
Longitude:
Latitude:
Geometry X: -8882987.0103
Geometry Y: 5388896.027599997

Site: BELL CANADA
VARIOUS BELL CANADA MANHOLES AND ACCESS CHAMBERS WITHIN THE MOE CENTRAL REG. (SEE
SCHEDULE "B") ON

Database:
GEN

Generator No: ONR000303
SIC Code: 517110, 517210, 517510
SIC Description: WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE)
Approval Years: 2013
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 150
Waste Class Name: INERT INORGANIC WASTES

Waste Class: 253
Waste Class Name: EMULSIFIED OILS

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Site: MARSHALL STEEL LIMITED 15-053
RR #3, HWY. 25 NORTH C/O P.O. BOX 1014 MILTON ON L9T 4B6

Database:
GEN

Generator No: ON0354500
SIC Code: 3029
SIC Description: OTHER FAB. STRUCTURE
Approval Years: 94,95,96
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 211
Waste Class Name: AROMATIC SOLVENTS

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Site: MARSHALL STEEL LIMITED
RR #3, HWY. 25 NORTH C/O P.O. BOX 1014 MILTON ON L9T 4B6

Database:
GEN

Generator No: ON0354500
SIC Code: 3029
SIC Description: OTHER FAB. STRUCTURE
Approval Years: 88,89,90
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 211
Waste Class Name: AROMATIC SOLVENTS

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Site: FRANKEL STEEL LTD.
RR #3, HWY. 25 NORTH MILTON ON L9T 2X7

Database:
GEN

Generator No: ON0354500
SIC Code: 3029
SIC Description: OTHER FAB. STRUCTURES
Approval Years: 86,87
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Site: 999870 ONTARIO LIMITED RAYS TEXACO SERVICE
HWY 25 MILTON ON

Database:
PRT

Location ID: 8834
Type: retail
Expiry Date: 1995-09-30
Capacity (L): 0
Licence #: 0076372051

Site: ONTARIO HYDRO
MAIN ST E MILTON ON L9T 2N3

Database:
PRT

Location ID: 8847
Type: private
Expiry Date:
Capacity (L): 13638.00
Licence #: 0001004974

Site: DURANTE AUTO SERVICE & TOWING INC
REGIONAL ROAD 25 MILTON ON L2T 2X7

Database:
RST

Headcode: 1186800
Headcode Desc: Service Stations-Gasoline, Oil & Natural Gas
Phone: 9058787200
List Name:
Description:

Site: CHUDLEIGHS
HWY 25 RR 1 MILTON ON L9T 2X5

Database:
SCT

Established: 1963
Plant Size (ft²): 0
Employment: 50

--Details--

Description: BREAD AND OTHER BAKERY PRODUCTS, EXCEPT COOKIES AND CRACKERS
SIC/NAICS Code: 2051

Site: CHUDLEIGHS
HWY 25 N MILTON ON L9P 1M7

Database:
SCT

Established: 1963
Plant Size (ft²): 0
Employment: 50

--Details--

Description: BREAD & OTHER BAKERY PRODUCTS, EXCEPT COOKIES & CRACKERS
SIC/NAICS Code: 2051

Site: Canadian Pacific Railway Company
MILTON TERMINAL RAIL YARD<UNOFFICIAL> Milton ON

Database:
SPL

Ref No:	6837-5RX5K8	Discharger Report:	
Site No:		Material Group:	Oil
Incident Dt:	10/1/2003	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Container Leak (Fuel Tank Barrels)	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:	13	Nearest Watercourse:	
Contaminant Name:	DIESEL FUEL	Site Address:	
Contaminant Limit 1:		Site District Office:	Halton-Peel
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	Central
Environment Impact:		Site Municipality:	Milton
Nature of Impact:		Site Lot:	
Receiving Medium:	Land	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	10/1/2003	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	Equipment Failure	Source Type:	
Site Name:	MILTON TERMINAL RAIL YARD<UNOFFICIAL>		
Site County/District:			
Municipality No:			
Site Geo Ref Meth:			
Incident Summary:	CP Rail - 115 L diesel fuel to ground.		
Contaminant Qty:	115 L		

Site: CANADIAN PACIFIC RAILWAYS
CP RAIL AT COURT ST, NORTH., JUST WEST OF REGIONAL ROAD 25. TRAIN MILTON TOWN ON

Database:
SPL

Ref No:	177899	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	2/25/2000	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	OTHER CONTAINER LEAK	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	POSSIBLE	Site Municipality:	MILTON TOWN
Nature of Impact:	Multi Media Pollution	Site Lot:	
Receiving Medium:	LAND	Site Conc:	
Receiving Env:		Northing:	

MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	2/25/2000	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	UNKNOWN	Source Type:	
Site Name:			
Site County/District:			
Municipality No:	14402		
Site Geo Ref Meth:			
Incident Summary:	CP RAIL: 1000L DIESEL SPILL FROM TRAIN.PD,FD, MILTON WORKS, CP.		
Contaminant Qty:			

Site:	MVA on Ontario Street, south of Pine Street<UNOFFICIAL> Milton ON	Database:	SPL

Ref No:	4750-68KMM4	Discharger Report:	0
Site No:		Material Group:	Oil
Incident Dt:	1/12/2005	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Other Transport Accident	Sector Type:	Other Motor Vehicle
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:	DIESEL FUEL	Site Address:	
Contaminant Limit 1:		Site District Office:	Halton-Peel
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	Possible	Site Municipality:	Milton
Nature of Impact:	Other Impact(s)	Site Lot:	
Receiving Medium:	Water	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	1/12/2005	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Spills
Incident Reason:	Equipment/Vehicles	Source Type:	
Site Name:	MVA on Ontario Street, south of Pine Street<UNOFFICIAL>		
Site County/District:			
Municipality No:			
Site Geo Ref Meth:			
Incident Summary:	Penske/Little Caesar's Pizza, diesel to c/b		
Contaminant Qty:	90.9 L		

Site:	PHILIP ENTERPRISES	Database:	SPL
	HWY 25 AT THE ESCARPMENT HAMILTON WASTE DISPOSAL SITE. MILTON TOWN ON		

Ref No:	19000	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	5/20/1989	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	UNKNOWN	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	NOT ANTICIPATED	Site Municipality:	MILTON TOWN
Nature of Impact:		Site Lot:	
Receiving Medium:	LAND	Site Conc:	
Receiving Env:		Northing:	4780000.00
MOE Response:		Easting:	593500.00
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	5/23/1989	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	UNKNOWN	Source Type:	
Site Name:			

Site County/District:
Municipality No: 14402
Site Geo Ref Meth:
Incident Summary: F.A.W. OIL - UNKNOWN AMT.CALCIUM CHLORIDE TO ROAD ON SATURDAY.
Contaminant Qty:

Site: Canadian Pacific Railway Company
 CP RAIL EXPRESS WAY TERMINAL<UNOFFICIAL> Milton ON

Database:
 SPL

Ref No:	4812-5LYEZZ	Discharger Report:	
Site No:		Material Group:	Oil
Incident Dt:	4/26/2003	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:		Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:	13	Nearest Watercourse:	
Contaminant Name:	DIESEL FUEL	Site Address:	
Contaminant Limit 1:		Site District Office:	Halton-Peel
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	Central
Environment Impact:	Possible	Site Municipality:	Milton
Nature of Impact:		Site Lot:	
Receiving Medium:	Land	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	4/26/2003	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Spill to Land
Incident Reason:		Source Type:	
Site Name:	CP RAIL EXPRESS WAY TERMINAL<UNOFFICIAL>		
Site County/District:			
Municipality No:			
Site Geo Ref Meth:			
Incident Summary:	CP Rail - spill of 112.5 L diesel fuel.		
Contaminant Qty:	112.5 L		

Site: Neelands Refrigeration Limited
 Main St Milton ON

Database:
 SPL

Ref No:	6771-7D9NUU	Discharger Report:	
Site No:		Material Group:	
Incident Dt:		Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Valve / Fitting Leak Or Failure	Sector Type:	Other
Incident Event:		Agency Involved:	
Contaminant Code:	38	Nearest Watercourse:	
Contaminant Name:	REFRIGERANT GAS, N.O.S.	Site Address:	
Contaminant Limit 1:		Site District Office:	Halton-Peel
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	Possible	Site Municipality:	Milton
Nature of Impact:	Air Pollution	Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:	No Field Response	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	3/31/2008	Site Map Datum:	
Dt Document Closed:	4/24/2008	SAC Action Class:	Air Spills - Gases and Vapours
Incident Reason:	Other - Reason not otherwise defined	Source Type:	
Site Name:	Real Canadian Superstore<UNOFFICIAL>		
Site County/District:			
Municipality No:			
Site Geo Ref Meth:			
Incident Summary:	Real Canadian Superstore: Refrid leak, fix		
Contaminant Qty:	181 kg		

Site:
con 2 ON

Database:
WWIS

Well ID: 2809386
Construction Date:
Use 1st: Domestic
Use 2nd:
Final Well Status: Water Supply
Water Type:
Casing Material:
Audit No: 218063
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: MILTON TOWN (TRAFALGAR)
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 07-Jun-2001 00:00:00
Selected Flag: TRUE
Abandonment Rec:
Contractor: 1737
Form Version: 1
Owner:
County: HALTON
Lot:
Concession: 02
Concession Name: DS N
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10155640
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 26-Feb-2001 00:00:00
Remarks:
Loc Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 17
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock
Materials Interval

Formation ID: 931455362
Layer: 2
Color: 7
General Color: RED
Mat1: 17
Most Common Material: SHALE
Mat2: 74
Mat2 Desc: LAYERED
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 15.0
Formation End Depth: 125.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931455361
Layer: 1

Color: 6
General Color: BROWN
Mat1: 05
Most Common Material: CLAY
Mat2: 11
Mat2 Desc: GRAVEL
Mat3: 85
Mat3 Desc: SOFT
Formation Top Depth: 0.0
Formation End Depth: 15.0
Formation End Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 962809386
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction:

Pipe Information

Pipe ID: 10704210
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930264775
Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From:
Depth To:
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930264776
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To:
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pumping Test Method Desc: PUMP
Pump Test ID: 992809386
Pump Set At:
Static Level: 48.0
Final Level After Pumping: 73.0
Recommended Pump Depth: 120.0
Pumping Rate: 1.0
Flowing Rate:
Recommended Pump Rate: 1.0
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 2

Water State After Test: CLOUDY
Pumping Test Method: 1
Pumping Duration HR: 2
Pumping Duration MIN:
Flowing: No

Draw Down & Recovery

Pump Test Detail ID: 934458155
Test Type: Recovery
Test Duration: 30
Test Level: 61.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934716653
Test Type: Recovery
Test Duration: 45
Test Level: 58.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934978014
Test Type: Recovery
Test Duration: 60
Test Level: 56.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934175759
Test Type: Recovery
Test Duration: 15
Test Level: 66.0
Test Level UOM: ft

Water Details

Water ID: 933613575
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 96.0
Water Found Depth UOM: ft

Site:
con 3 ON

Database:
WWIS

Well ID: 2809300
Construction Date:
Use 1st: Domestic
Use 2nd:
Final Well Status: Water Supply
Water Type:
Casing Material:
Audit No: 217936
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 30-Jan-2001 00:00:00
Selected Flag: TRUE
Abandonment Rec:
Contractor: 1737
Form Version: 1
Owner:
County: HALTON
Lot:
Concession: 03
Concession Name: CON

Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: MILTON TOWN (NASSAGAWEYA)
Site Info:

Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10155556
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 31-Aug-2000 00:00:00
Remarks:
Loc Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 17
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock
Materials Interval

Formation ID: 931455020
Layer: 3
Color: 6
General Color: BROWN
Mat1: 05
Most Common Material: CLAY
Mat2: 85
Mat2 Desc: SOFT
Mat3:
Mat3 Desc:
Formation Top Depth: 5.0
Formation End Depth: 12.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931455018
Layer: 1
Color: 8
General Color: BLACK
Mat1: 02
Most Common Material: TOPSOIL
Mat2: 85
Mat2 Desc: SOFT
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931455021
Layer: 4

Color: 2
General Color: GREY
Mat1: 15
Most Common Material: LIMESTONE
Mat2: 73
Mat2 Desc: HARD
Mat3:
Mat3 Desc:
Formation Top Depth: 12.0
Formation End Depth: 50.0
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931455019
Layer: 2
Color: 6
General Color: BROWN
Mat1: 05
Most Common Material: CLAY
Mat2: 31
Mat2 Desc: COARSE GRAVEL
Mat3:
Mat3 Desc:
Formation Top Depth: 1.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 962809300
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction:

Pipe Information

Pipe ID: 10704126
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930264678
Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From:
Depth To:
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930264679
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To:
Casing Diameter: 6.0

Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pumping Test Method Desc: PUMP
Pump Test ID: 992809300
Pump Set At:
Static Level: 12.0
Final Level After Pumping: 30.0
Recommended Pump Depth: 30.0
Pumping Rate: 10.0
Flowing Rate:
Recommended Pump Rate: 10.0
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 1
Water State After Test: CLEAR
Pumping Test Method: 1
Pumping Duration HR: 2
Pumping Duration MIN:
Flowing: No

Draw Down & Recovery

Pump Test Detail ID: 934458109
Test Type: Recovery
Test Duration: 30
Test Level: 12.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934175714
Test Type: Recovery
Test Duration: 15
Test Level: 14.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934716188
Test Type: Recovery
Test Duration: 45
Test Level: 12.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934977968
Test Type: Recovery
Test Duration: 60
Test Level: 12.0
Test Level UOM: ft

Water Details

Water ID: 933613505
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 21.0
Water Found Depth UOM: ft

Water Details

Water ID: 933613506
Layer: 2
Kind Code: 1
Kind: FRESH
Water Found Depth: 45.0
Water Found Depth UOM: ft

Site:
con 3 ON

Database:
[WWIS](#)

Well ID: 2806676
Construction Date:
Use 1st: Domestic
Use 2nd:
Final Well Status:
Water Type:
Casing Material:
Audit No: NA
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: MILTON TOWN (NASSAGAWEYA)
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 28-Jul-1987 00:00:00
Selected Flag: TRUE
Abandonment Rec:
Contractor: 1660
Form Version: 1
Owner:
County: HALTON
Lot:
Concession: 03
Concession Name: CON
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10152945
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 15-May-1987 00:00:00
Remarks:
Loc Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 17
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock Materials Interval

Formation ID: 931443857
Layer: 3
Color: 6
General Color: BROWN
Mat1: 28
Most Common Material: SAND
Mat2: 73
Mat2 Desc: HARD
Mat3:
Mat3 Desc:
Formation Top Depth: 36.0

Formation End Depth: 46.0
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931443856
Layer: 2
Color: 6
General Color: BROWN
Mat1: 05
Most Common Material: CLAY
Mat2: 13
Mat2 Desc: BOULDERS
Mat3: 73
Mat3 Desc: HARD
Formation Top Depth: 1.0
Formation End Depth: 36.0
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931443855
Layer: 1
Color:
General Color:
Mat1: 02
Most Common Material: TOPSOIL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 962806676
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10701515
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930260087
Layer: 1
Material:
Open Hole or Material:
Depth From:
Depth To: 46.0
Casing Diameter:
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pumping Test Method Desc: PUMP
Pump Test ID: 992806676
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code:
Water State After Test:
Pumping Test Method: 1
Pumping Duration HR: 2
Pumping Duration MIN:
Flowing: No

Water Details

Water ID: 933610039
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 41.0
Water Found Depth UOM: ft

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial [AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial [AGR](#)

The Ontario Ministry of Northern Development, Mines, Natural Resources and Forestry (ONDMNRF) maintains this database of pits and quarries. The database provides information regarding the registered owner/operator, location name, operation type, approval type, and maximum annual tonnage.

Government Publication Date: Up to Oct 2022

Abandoned Mine Information System:

Provincial [AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Mar 2022

Anderson's Waste Disposal Sites:

Private [ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial [AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private [AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-May 31, 2022

Borehole:

Provincial [BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2020

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-May 31, 2022

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Sep 2022

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Nov 2022

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Jan 31, 2023

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database contains information on more than 113,000 percussion, overburden, sonic and diamond drill holes from assessment files on record with the department of Mines and Minerals. Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted to the MNDM. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Oct 2022

Delisted Fuel Tanks:

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Feb 28, 2022

Environmental Activity and Sector Registry:

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011- Jan 31, 2023

Environmental Registry:

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Jan 31, 2023

Environmental Compliance Approval:

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011- Jan 31, 2023

Environmental Effects Monitoring:

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Dec 31, 2022

Environmental Issues Inventory System:

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2021

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Dec 2022

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: May 31, 2018

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Oct 31, 2022

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Dec 2019

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 21, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2022

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2021

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Apr 2018

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jun 30, 2021

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Nov 30, 2022**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the MNR handed over to the Ontario Oil, Gas and Salt Resources Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database include well owner/operator, location, permit issue date, and well cap date, license No., status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provide for each well record.

Government Publication Date: 1800-Aug 2021**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Jan 31, 2023**Canadian Pulp and Paper:**

Private

[PAP](#)

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014**Parks Canada Fuel Storage Tanks:**

Federal

[PCFT](#)

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011- Jan 31, 2023

Pipeline Incidents:

Provincial PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Private and Retail Fuel Storage Tanks:

Provincial PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Jan 31, 2023

Ontario Regulation 347 Waste Receivers Summary:

Provincial REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2019

Record of Site Condition:

Provincial RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up.

RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09).

Government Publication Date: 1997-Sept 2001, Oct 2004-Dec 2022

Retail Fuel Storage Tanks:

Private RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-May 31, 2022

Scott's Manufacturing Directory:

Private SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial SPL

List of spills and incidents made available the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X. The Ministry of the Environment, Conservation and Parks cites the coronavirus pandemic as an explanation for delays in releasing data pursuant to requests.

Government Publication Date: 1988-Sep 2020; Dec 2020-Mar 2021

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2020

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2020

Variances for Abandonment of Underground Storage Tanks:

Provincial

VAR

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

WDS

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011- Jan 31, 2023

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

WDSH

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30th, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

WWIS

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Jun 30 2022

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

Appendix 'G'


1. 1954 Aerial Photograph;
2. 1960 Aerial Photograph;
3. 1978 Aerial Photograph;
4. 2004 Aerial Photograph;
5. 2013 Aerial Photograph;
6. 2019 Aerial Photograph, and;
7. 2022 Aerial Photograph.

Aerial Photo – 1954




Scale – 1:6,000

Aerial Photo – 1960

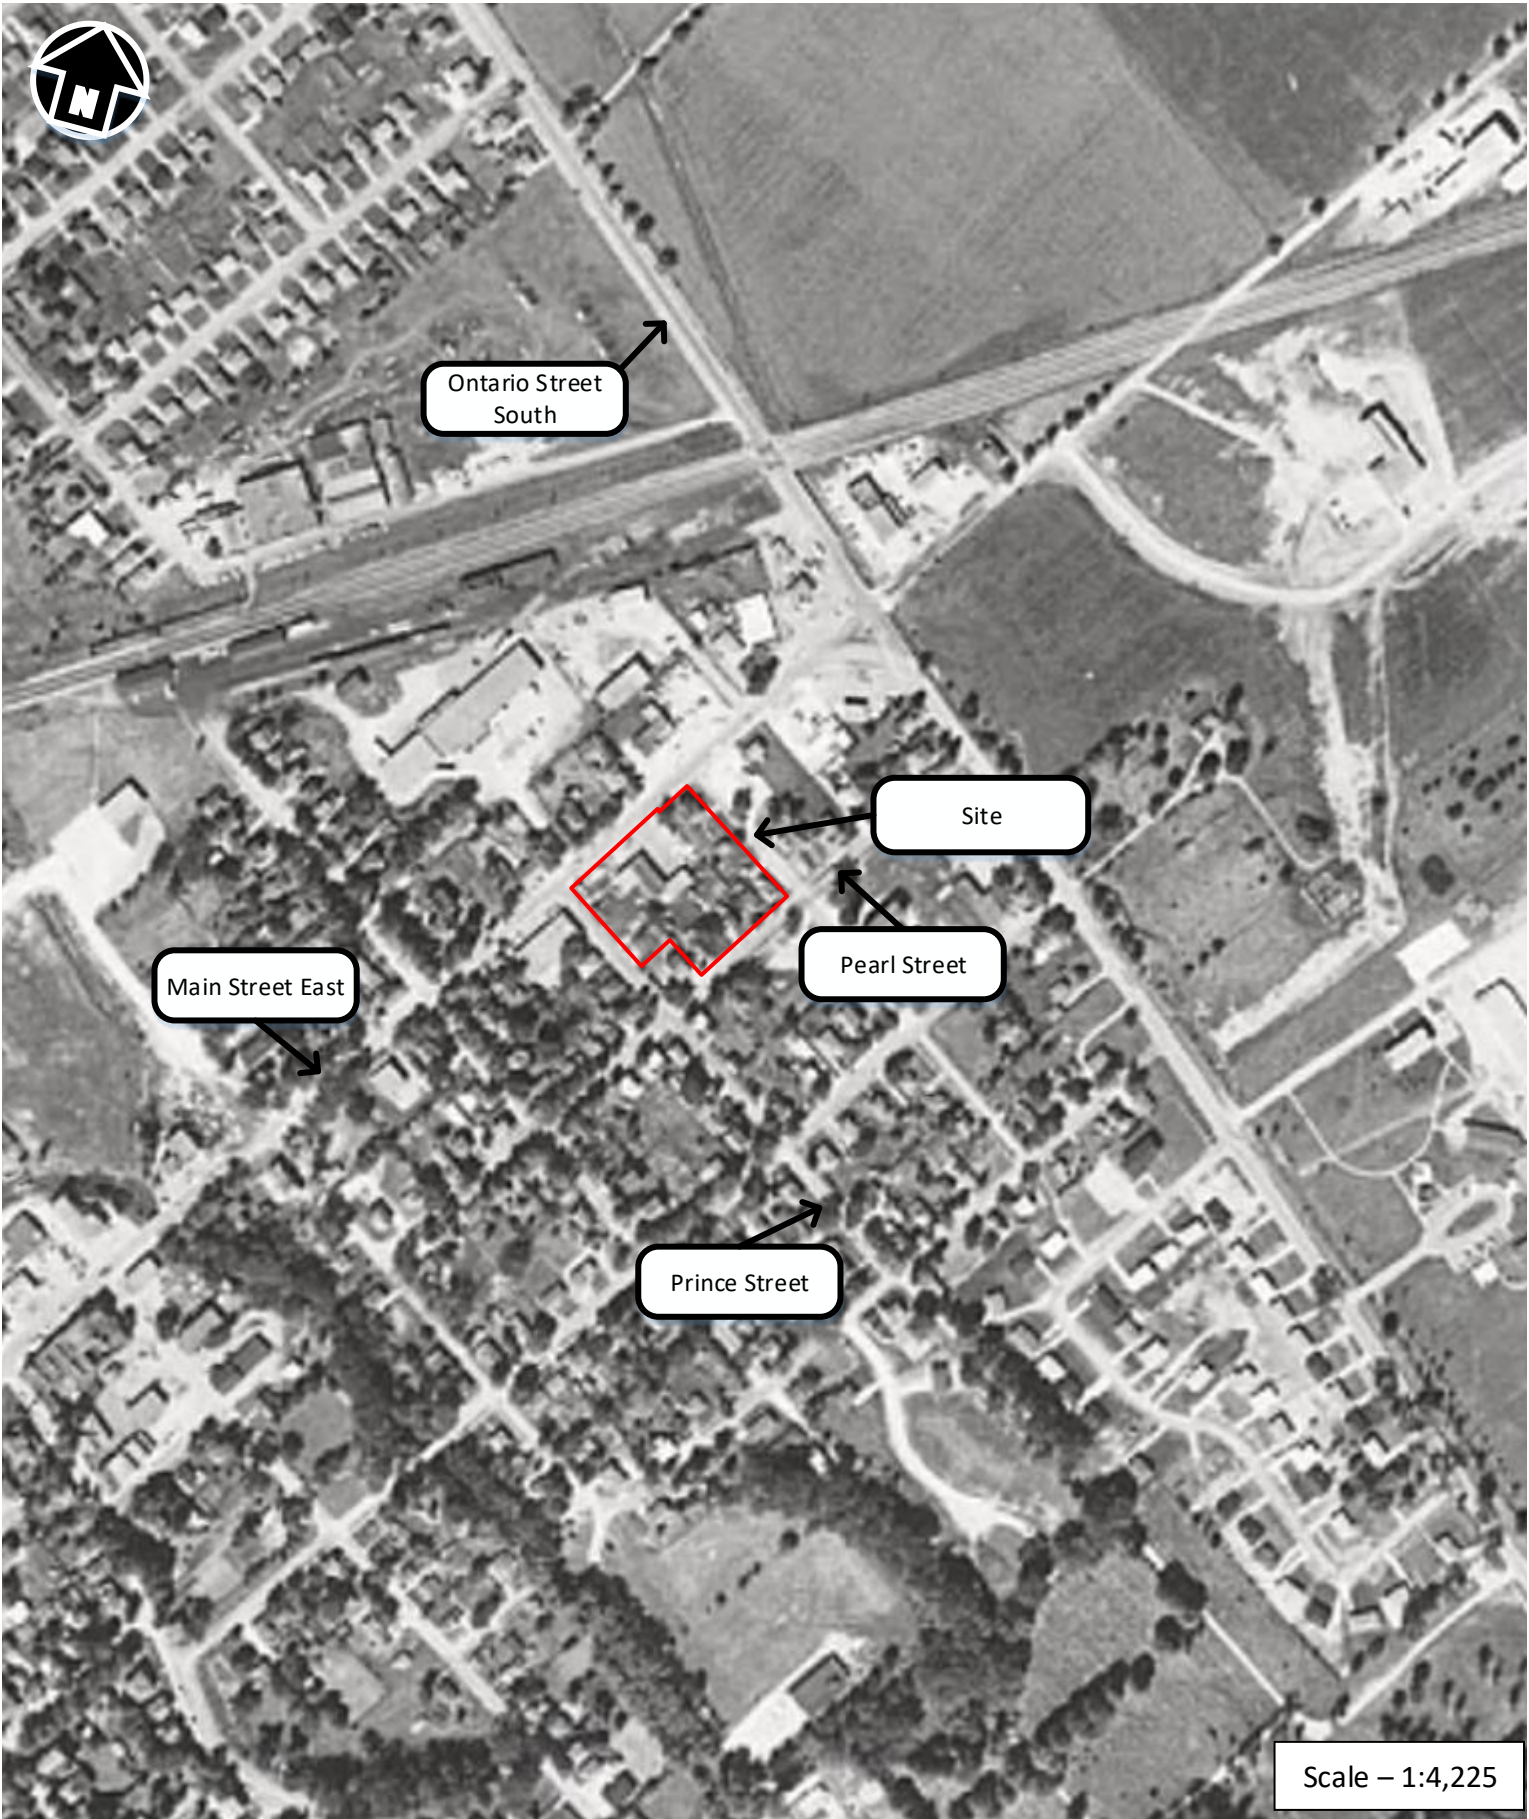

Scale – 1:4,225

Aerial Photo – 1978

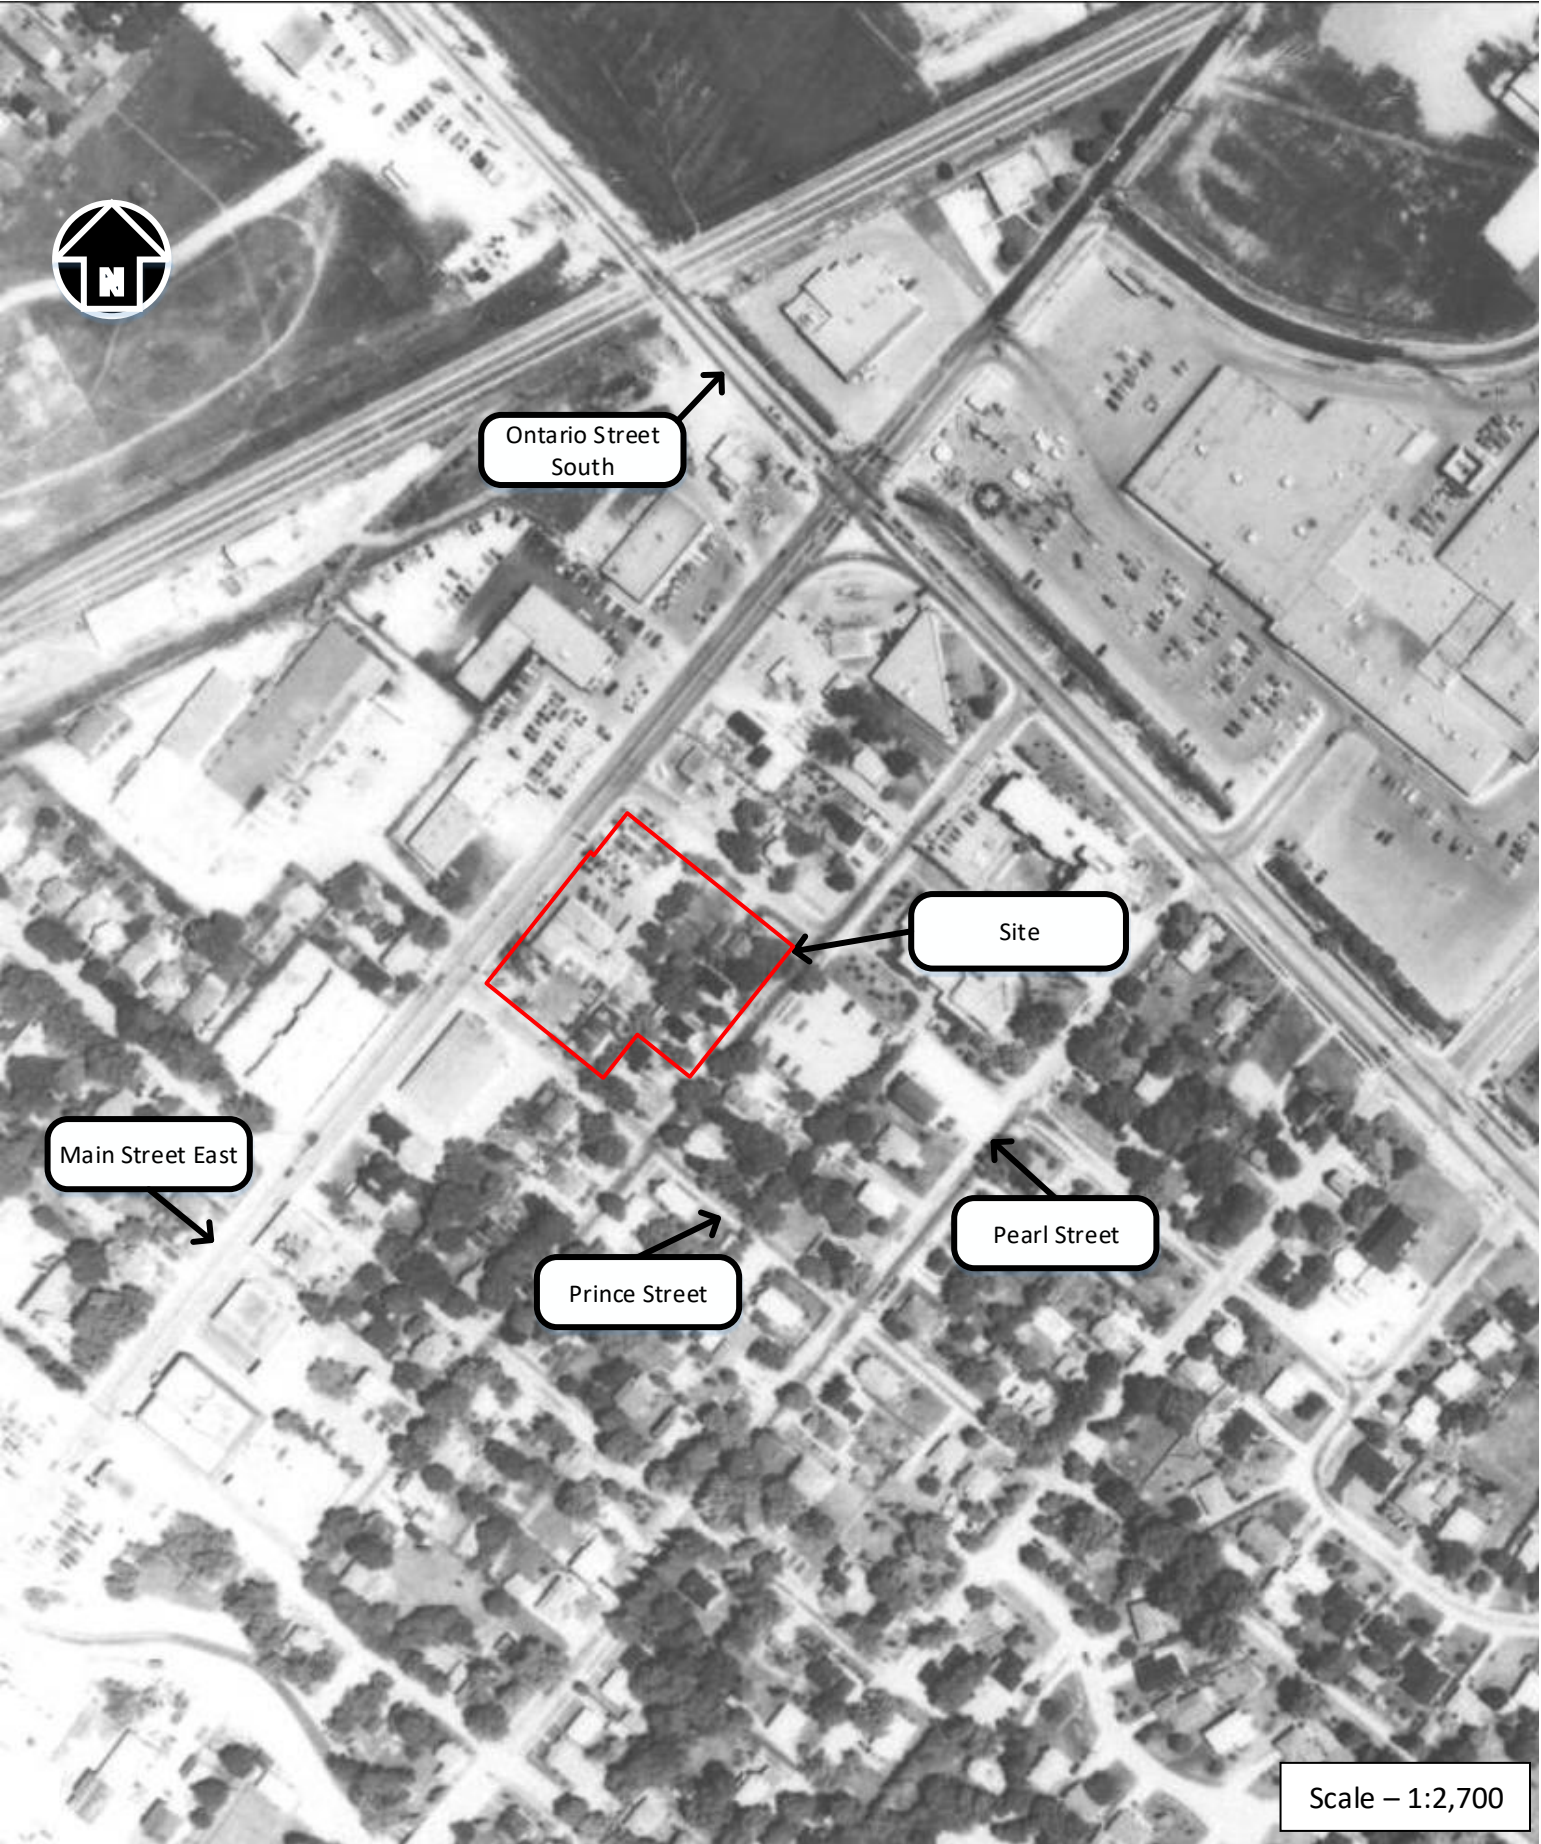

Ontario Street South

Site


Main Street East

Prince Street


Pearl Street

Scale – 1:2,700

Aerial Photo – 2004

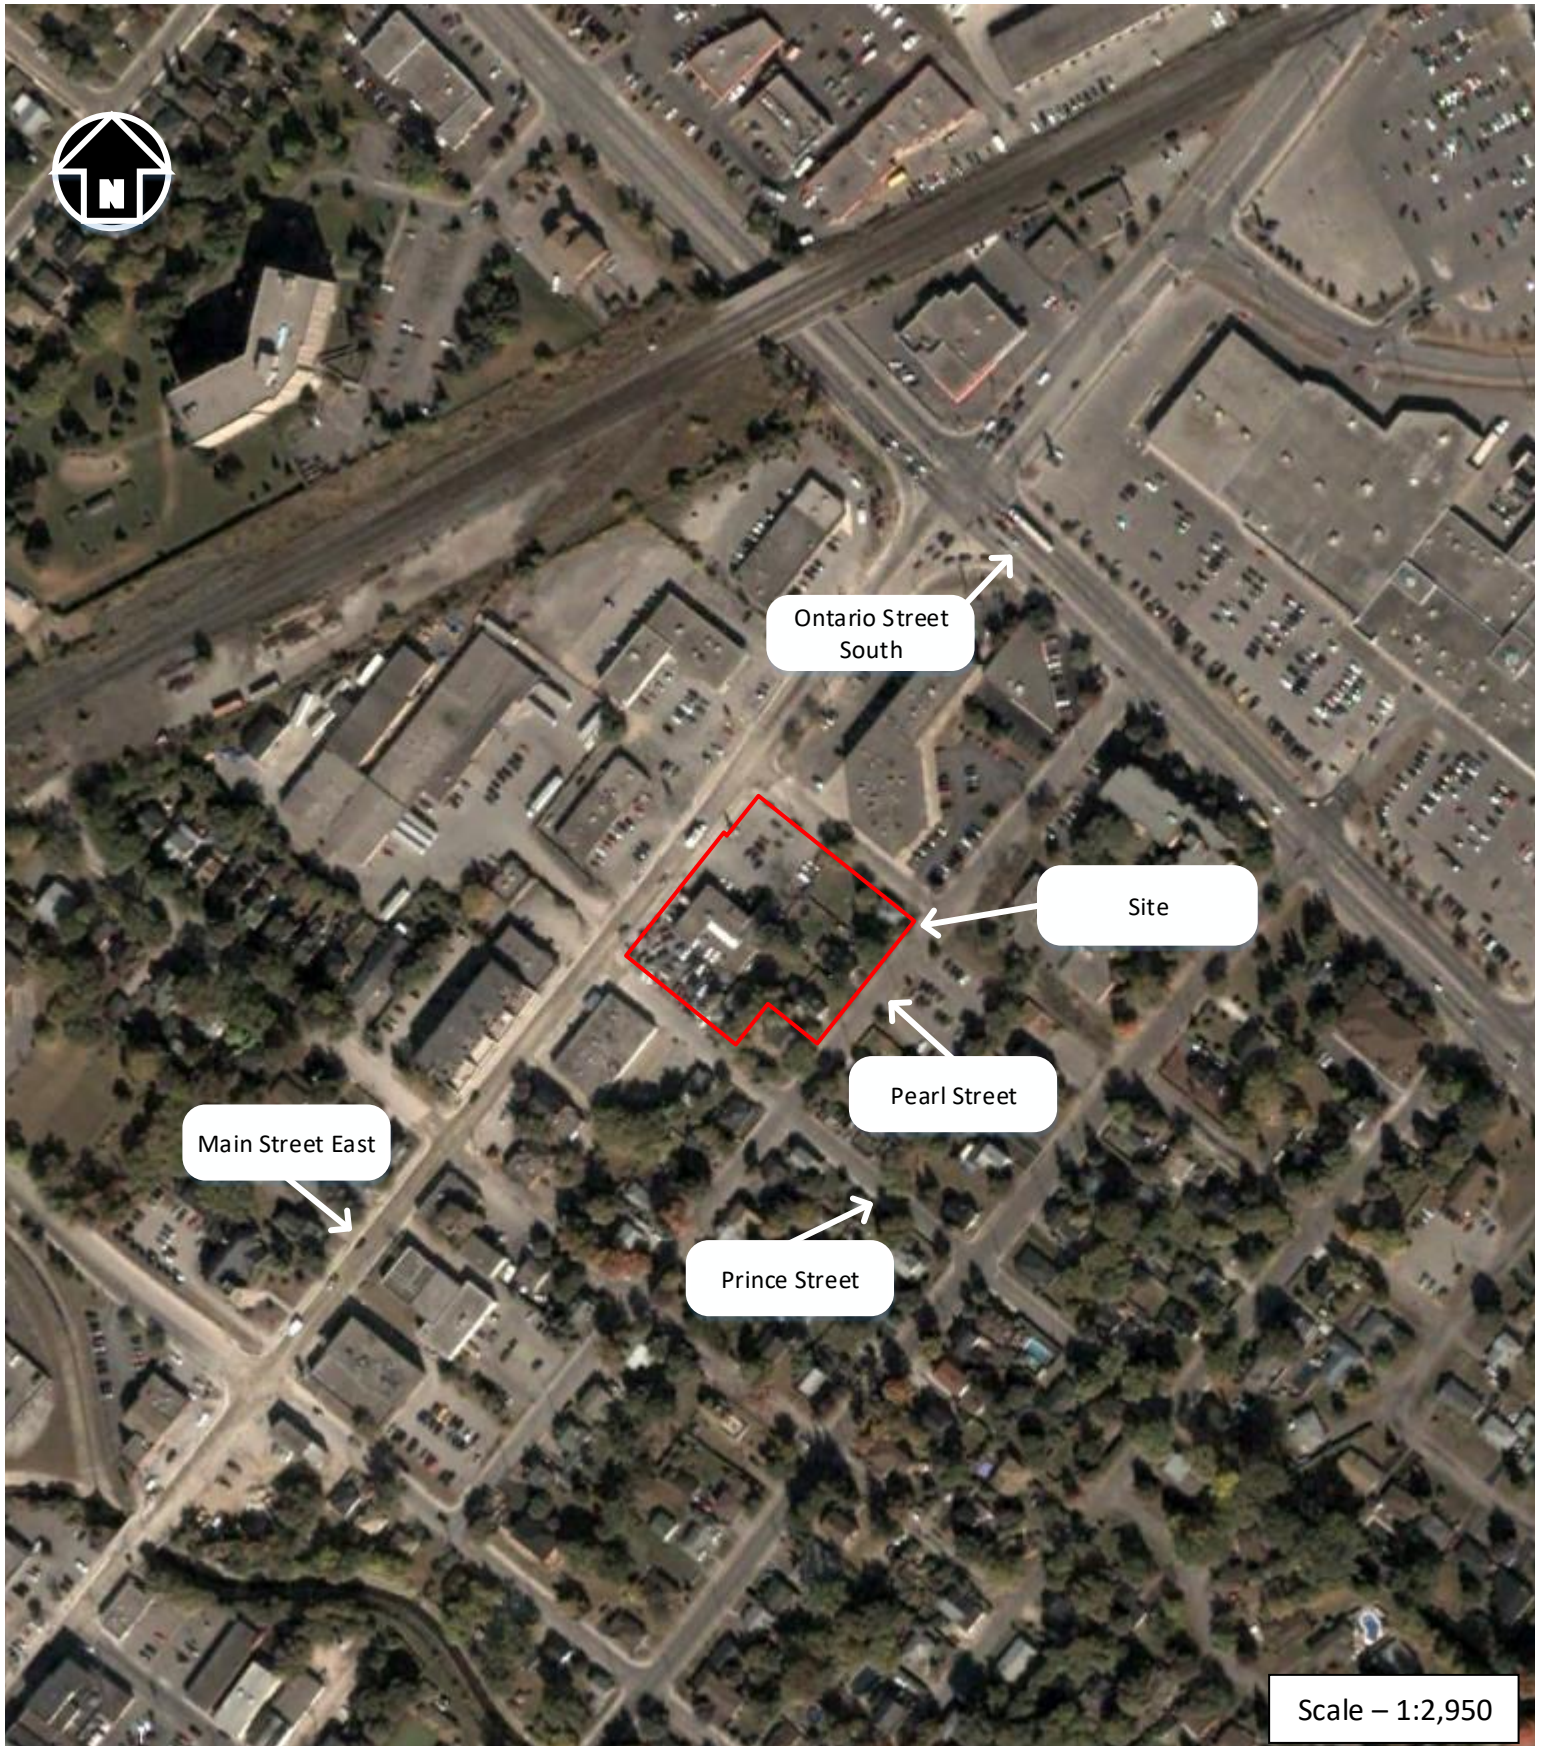


Aerial Photo – 2013

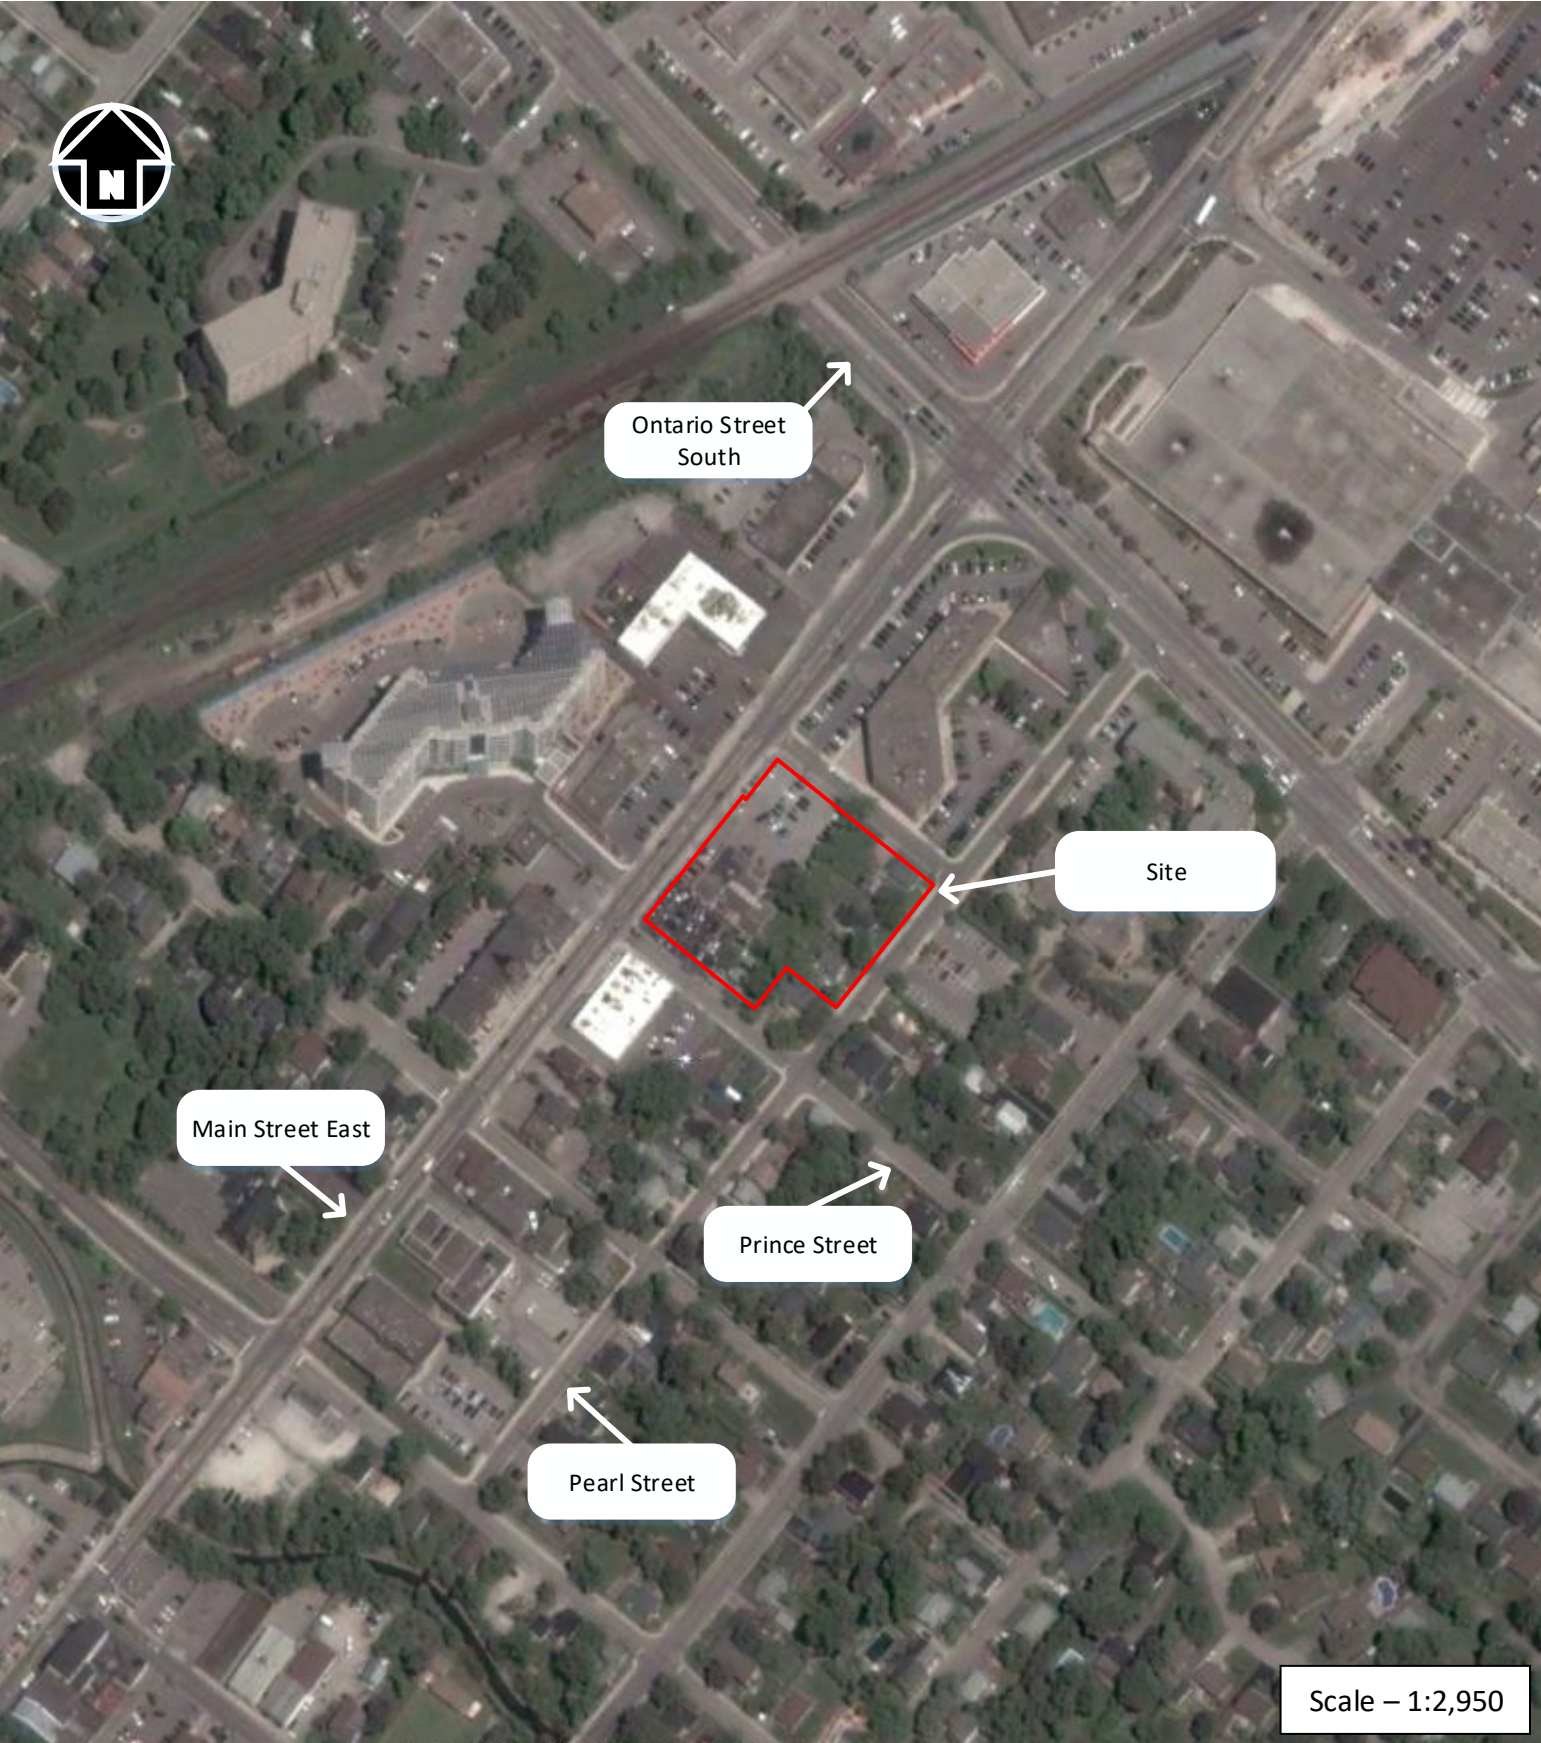


Scale – 1:2,950

Aerial Photo – 2019

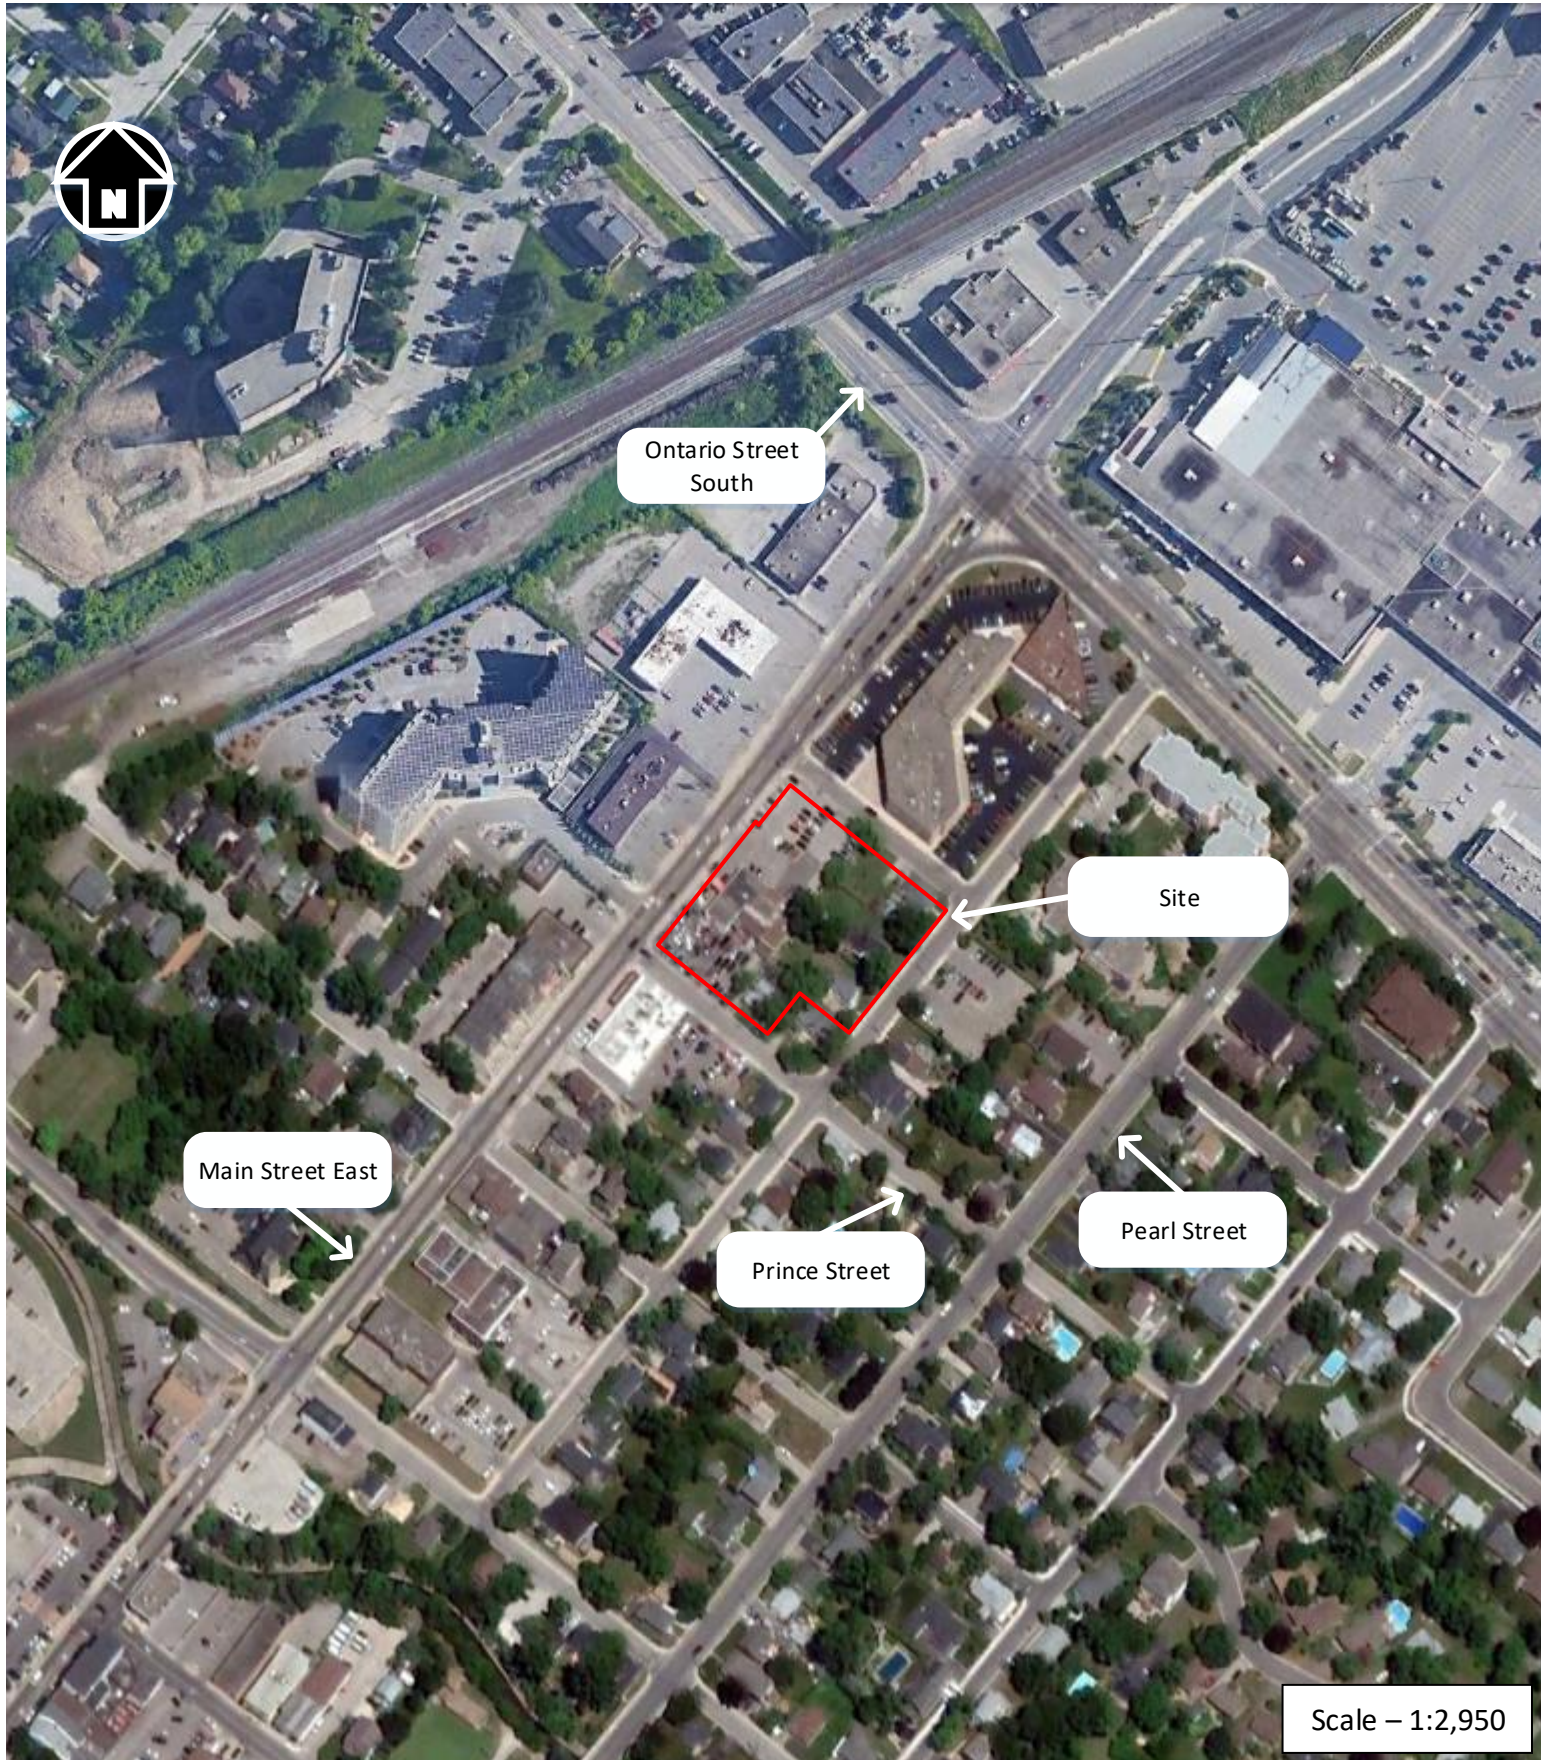

Scale – 1:2,950


Aerial Photo – 2022

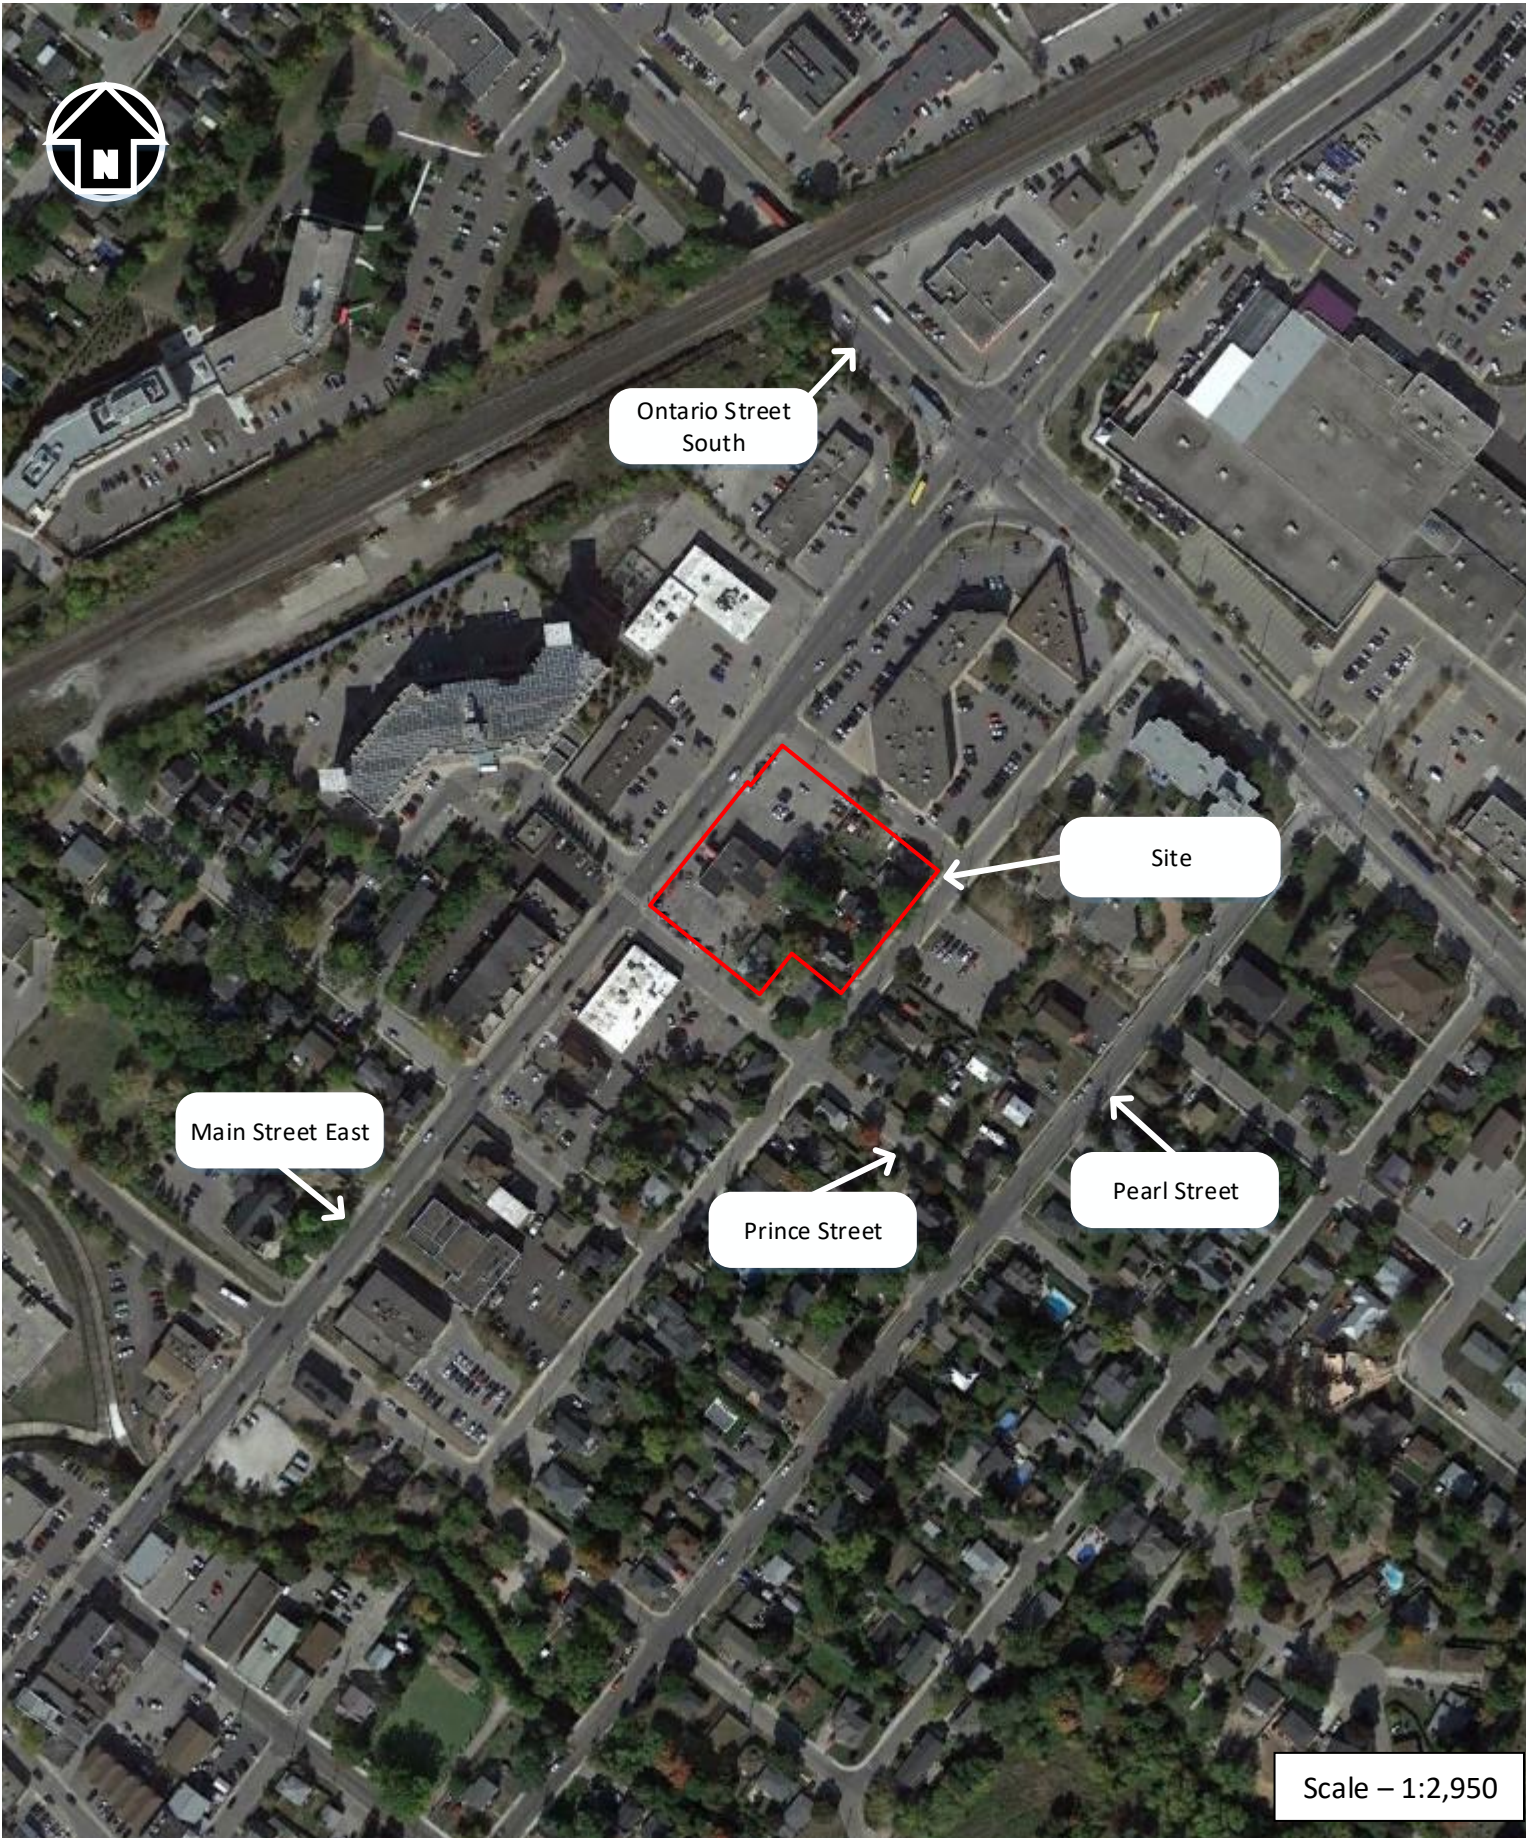

Scale – 1:2,950

Appendix 'H'

1. 1909 Topographic Map;
2. 1942 Topographic Map;
3. 1972 Topographic Map;
4. 1998 Topographic Map, and;
5. 2021 Topographic Map.

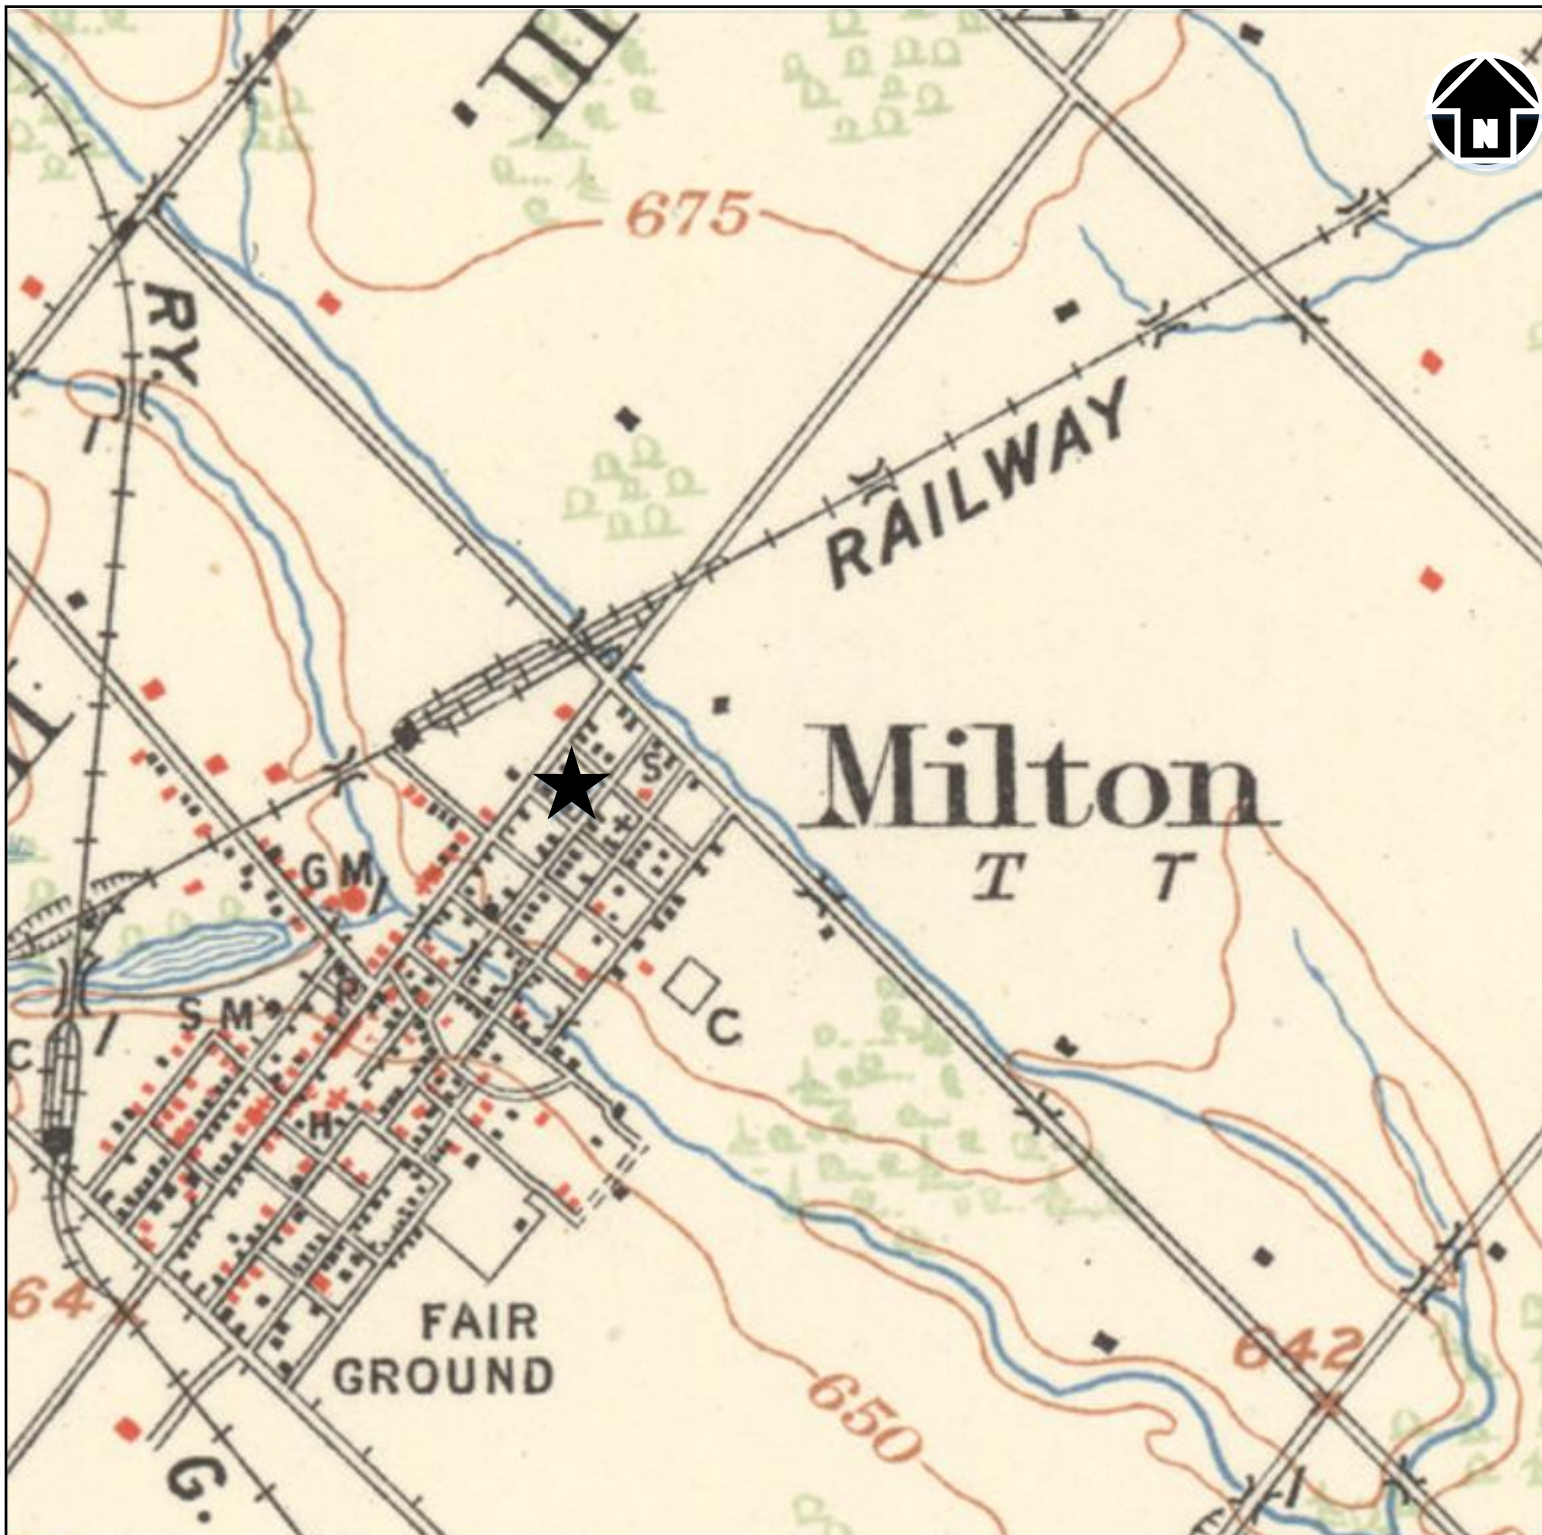

LEGEND



= Site Location

NOTES:

1. This drawing should be read in conjunction with Soil-Mat Engineers and Consultants Ltd. Report No.: SM 220141-E.
2. Topographic Map of Ontario, Brampton Sheet 30M/12.
3. Base map provided by: Department of Militia and Defence, 1909.

Soil-Mat

Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE

Phase One Environmental Site Assessment
Main Street and Prince Street,
Milton, Ontario

DRAWING TITLE

Topographic Map 1909

PROJECT No. SM 220141-E

SCALE 1: 63,360


DATE March 2023

CHECKED KG

DRAWN AL

FILE NAME 220141 Topo 1909.vsd

DRAWING No. 4a

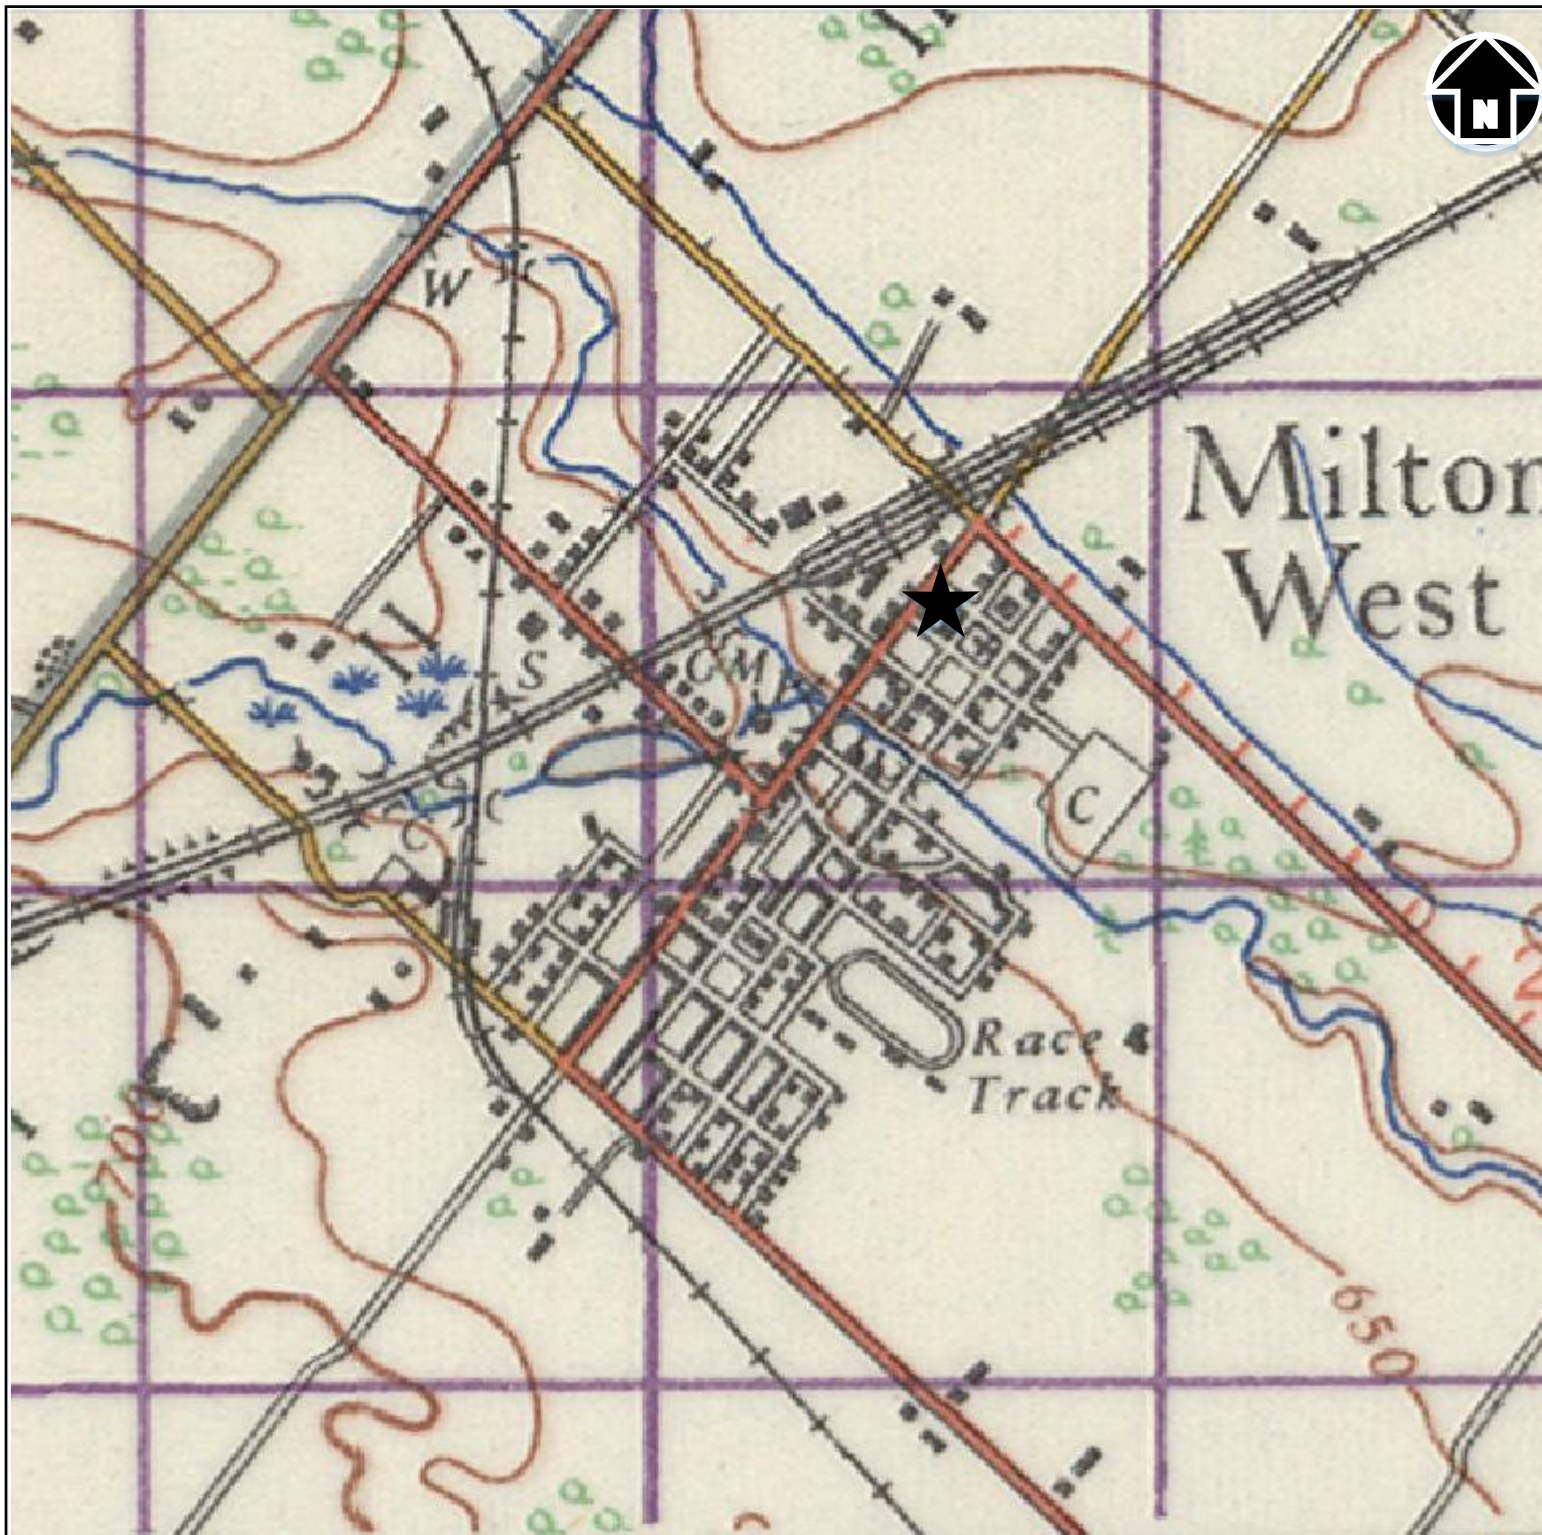

LEGEND



= Site Location

NOTES:

1. This drawing should be read in conjunction with Soil-Mat Engineers and Consultants Ltd. Report No.: SM 220141-E.
2. Topographic Map of Ontario, Brampton Sheet 30M/12.
3. Base map provided by: Department of National Defence, 1942.

Soil-Mat
Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE

Phase One Environmental Site Assessment
Main Street and Prince Street,
Milton, Ontario

DRAWING TITLE

Topographic Map 1942

PROJECT No. SM 220141-E

SCALE 1: 63,360


DATE March 2023

CHECKED KG

DRAWN AL

FILE NAME 220141 Topo 1942.vsd

DRAWING No. 4b

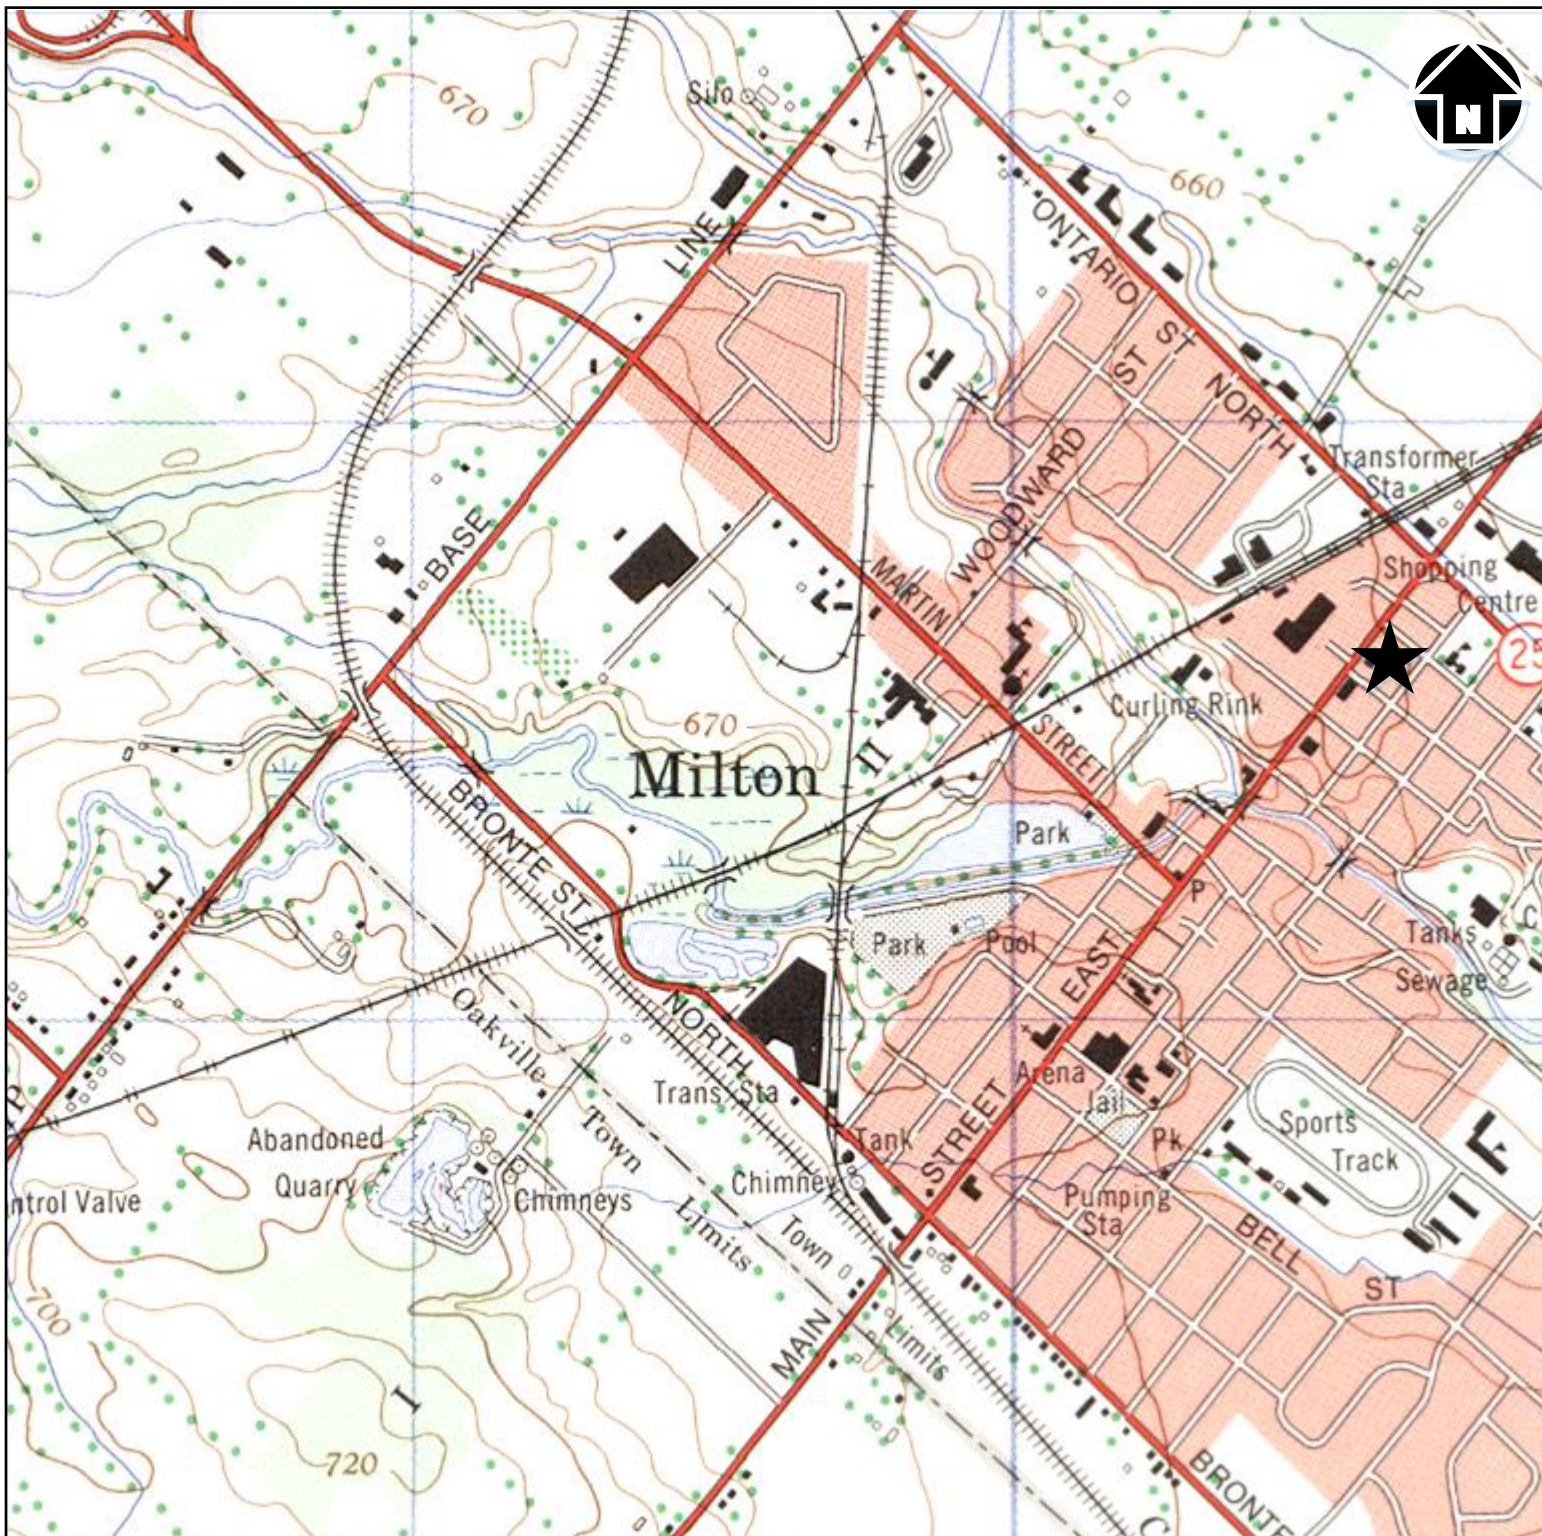

LEGEND



= Site Location

NOTES:

1. This drawing should be read in conjunction with Soil-Mat Engineers and Consultants Ltd. Report No.: SM 220141-E.
2. Topographic Map of Ontario, Milton Sheet 30M/12d, Edition 1.
3. Base map provided by: Department of Energy, Mines, and Resources, R.C.E. 1972.

Soil-Mat
Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE

Phase One Environmental Site Assessment
Main Street and Prince Street,
Milton, Ontario

DRAWING TITLE

Topographic Map 1972

PROJECT No. SM 220141-E

SCALE 1: 25,000


DATE March 2023

CHECKED KG

DRAWN AL

FILE NAME 220141 Topo 1972.vsd

DRAWING No. 4c

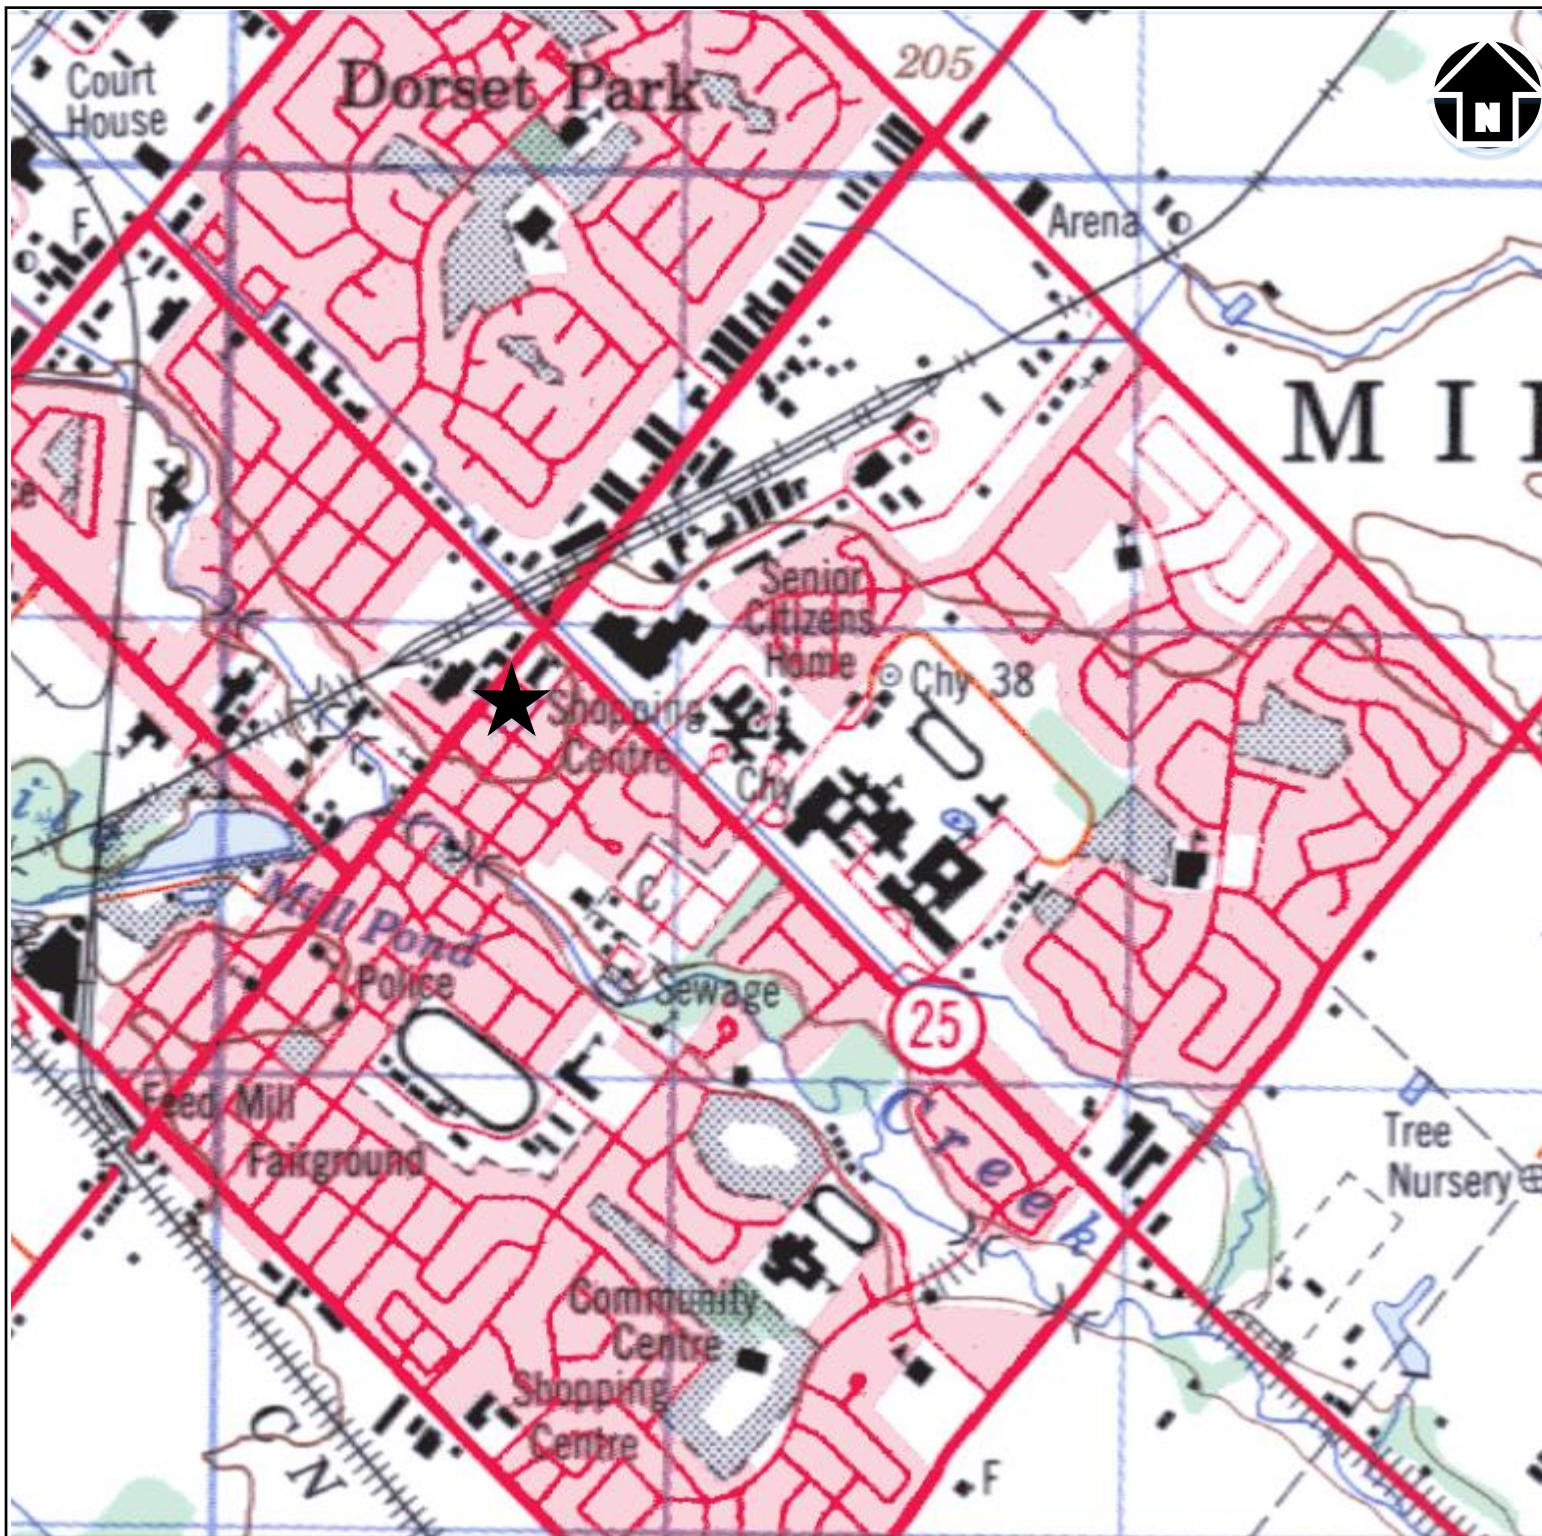

LEGEND



= Site Location

NOTES:

1. This drawing should be read in conjunction with Soil-Mat Engineers and Consultants Ltd. Report No.: SM 220141-E.
2. Topographic Map of Ontario, Brampton Sheet 30M/12, Edition 7.
3. Base map provided by: 1994 © Her Majesty The Queen in Right of Canada.

Soil-Mat

Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE

Phase One Environmental Site Assessment
Main Street and Prince Street,
Milton, Ontario

DRAWING TITLE

Topographic Map 1994

PROJECT No. SM 220141-E

SCALE 1: 50,000


DATE March 2023

CHECKED KG

DRAWN AL

FILE NAME 220141 Topo 1994.vsd

DRAWING No. 4d

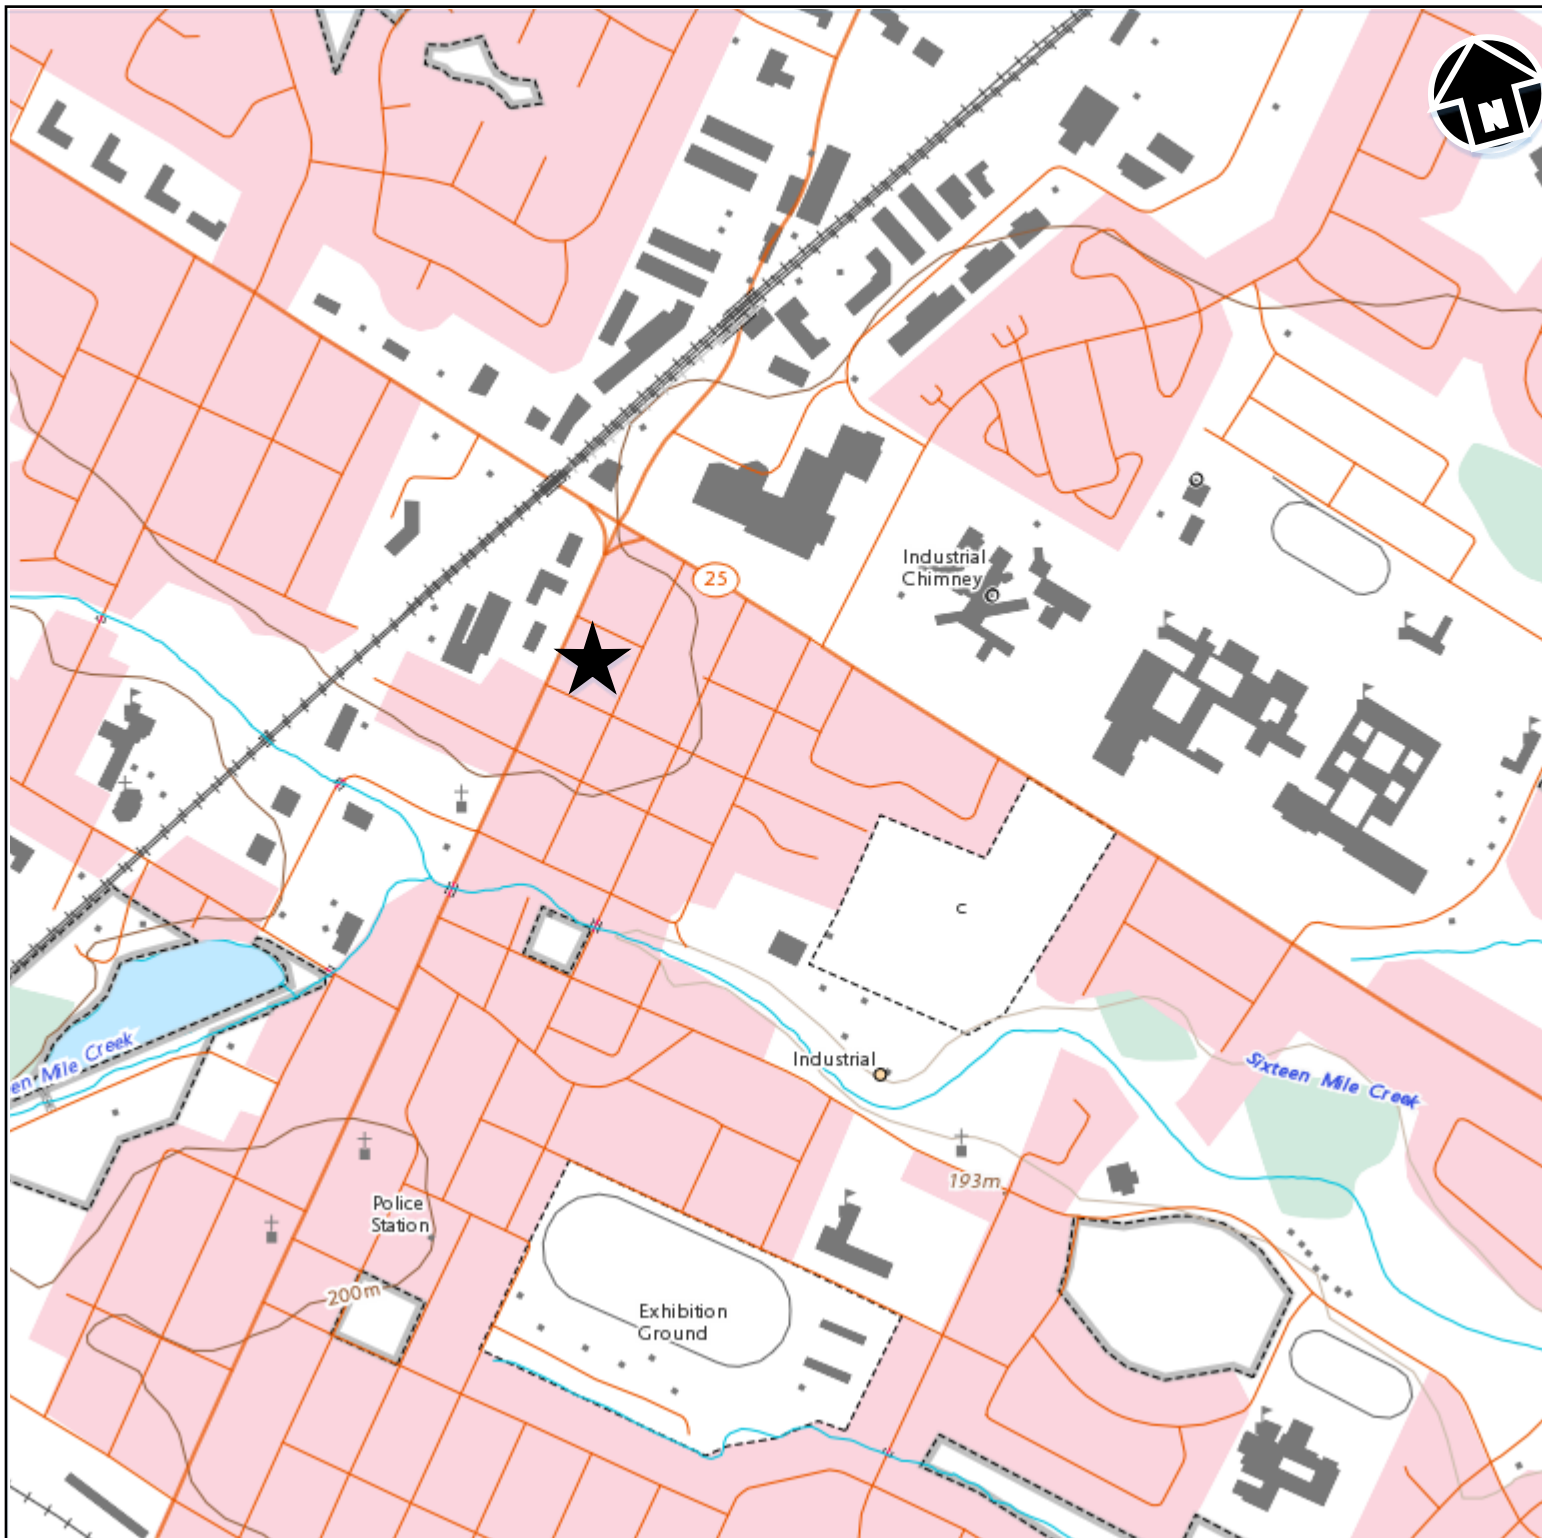

LEGEND



= Site Location

NOTES:

1. This drawing should be read in conjunction with Soil-Mat Engineers and Consultants Ltd. Report No.: SM 220141-E.
2. Topographic Map of Ontario, Milton 2021.
3. Base map provided by: The Atlas of Canada, Government of Canada.

Soil-Mat

Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE

Phase One Environmental Site Assessment
Main Street and Prince Street,
Milton, Ontario

DRAWING TITLE

Topographic Map 2021

PROJECT No. SM 220141-E

SCALE 1: 17,500

DATE March 2023

CHECKED KG

DRAWN AL

FILE NAME 220141 Topo 2021.vsd

DRAWING No. 4e

Appendix 'I'

1. Table of Current and Past Uses

388 Main Street East [PIN 24954-0139]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
May 31, 1989 to Present	Slessor Motors (Milton) Inc.	This portion of the Phase One Property was occupied by a multi-unit commercial and residential building.	Residential and Commercial	- Aerial photographs from 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
March 16, 1964 to May 31, 1989	Ivan Kingsley Slessor	This portion of the Phase One Property was occupied by a multi-unit commercial and residential building.	Residential and Commercial	- An aerial photograph from 1978 illustrates this portion of the Site as observed during our site reconnaissance. - A topographic map from 1972 illustrates this portion of the Site as a developed area with a building.
February 10, 1964 to March 16, 1964	William Ralph Morton	This portion of the Phase One Property was occupied by a multi-unit commercial and residential building.	Residential and Commercial	There were no readily available visual aids for the Phase One Property for this time period.
March 25, 1961 to February 10, 1964	Johnny G Laspoitis, Tom Laspoitis	This portion of the Phase One Property was occupied by a multi-unit commercial and residential building.	Residential and Commercial	There were no readily available visual aids for the Phase One Property for this time period.
June 27, 1951 to March 25, 1961	Raymond Joseph Waters	This portion of the Phase One Property was partially converted from residential lands to commercial lands circa 1954 to 1960.	Residential and Commercial	- An aerial photograph from 1960 illustrates the commercial/residential building and central parking lot as observed during our Site reconnaissance and the eastern dwelling with its own lawn on this portion of the Site. - An aerial photograph from 1954 illustrates two [2] dwellings and their respective lawns on this portion of the Site.
May 17, 1950 to June 27, 1951	William Frederick Johnson	This portion of the Phase One Property was occupied by two [2] dwellings from circa 1942 to 1954.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
August 17, 1903 to May 17, 1950	Jacob Johnson, Mary Johnson	This portion of the Phase One Property was occupied by three [3] dwellings from circa 1909 to 1927 and two [2] dwellings from circa 1942 to 1954.	Residential	- A topographic map from 1942 illustrates two [2] buildings on this portion of the Site. - A Fire Insurance Plan from 1927 illustrates three [3] buildings on this portion of the Site. - A topographic map from 1909 illustrates three [3] buildings on this portion of the Site.
March 22, 1895 to August 17, 1903	Hannah Armstrong, Robert Armstrong	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
October 27, 1894 to March 22, 1895	Joseph Harley Borres	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
May 28, 1877 to October 27, 1894	John Stinson Hatton	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
May 28, 1860 to May 28, 1877	Kenny White	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 2, 1852 to May 28, 1860	Thomas Bowes	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
September 18, 1851 to July 2, 1852	Mathias Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to September 18, 1851	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

17 Prince Street [PIN 24954-0140]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
November 5, 1996 to Present	Beverly Allan Slessor	This portion of the Phase One Property was occupied by a dwelling with an attached garage.	Residential	- Aerial photographs from 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
May 11, 1979 to November 5, 1996	Gillian Slessor	This portion of the Phase One Property was occupied by a dwelling with an attached garage.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
April 7, 1976 to May 11, 1979	DV Parrott Co Ltd	This portion of the Phase One Property was occupied by a dwelling with an attached garage.	Residential	An aerial photograph from 1978 illustrates this portion of the Site as observed during our site reconnaissance.
April 11, 1972 to April 7, 1976	Ray Watter Fabianits, Mary Louise Fabianits	This portion of the Phase One Property was occupied by a dwelling with an attached garage.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
March 6, 1958 to April 11, 1972	Christina Fabianits	This portion of the Phase One Property was converted from a vacant lot to residential lands circa 1954 to 1960.	Residential	- A topographic map from 1972 illustrates this portion of the Site as a developed area. - An aerial photograph from 1960 illustrates this portion of the Site as observed during our site reconnaissance.
July 27, 1952 to March 6, 1958	Augustino Restiro	This portion of the Phase One Property was converted from a vacant lot to residential lands circa 1954 to 1960.	Residential	An aerial photograph from 1954 illustrates a vacant lot on this portion of the Site.
November 26, 1943 to July 27, 1952	William Humphrey Neville	This portion of the Phase One Property was comprised of a vacant lot.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
September 8, 1941 to November 26, 1943	John Kitchen	This portion of the Phase One Property was comprised of a vacant lot.	Residential and Agriculture or Other	A topographic map from 1942 illustrates no buildings on this portion of the Site.
November 24, 1904 to September 8, 1941	John Morley	This portion of the Phase One Property was comprised of a vacant lot.	Residential and Agriculture or Other	- A Fire Insurance Plan from 1927 does not illustrate any buildings on this portion of the Site. - A topographic map from 1909 does not illustrate any buildings on this portion of the Site.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
November 25, 1892 to November 24, 1904	Thomas Washington Crozier	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 11 1889 to November 25, 1892	Eliza Janet Robson	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
May 6, 1887 to March 11 1889	Walter M Johnson	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 12, 1887 to May 6, 1887	Daniel McCutcheur, Florence McCutcher	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
February 18, 1885 to January 12, 1887	John Hunter	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
October 27, 1852 to February 18, 1885	Mary Ann Bowes	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 12, 1852 to October 27, 1852	Charles F Teetzel	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to July 12, 1852	Kenny Kerffessau	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 20, 1823 to March 24, 1832	George Will	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	This portion of the Phase One Property was comprised of a vacant lot.	Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

395 Pearl Street [PIN 24954-0142]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
December 23, 1998 to Present	Kim Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	- Aerial photographs from 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - A topographic map from 2021 illustrates this portion of the Site as a developed area.
November 30, 1972 to December 23, 1998	Beverly Allan Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	- An aerial photograph from 1978 illustrates this portion of the Site as observed during our site reconnaissance. - A topographic map from 1998 illustrates this portion of the Site as a developed area.
July 17, 1956 to November 30, 1972	Angus Morrison, Grace Morrison	This portion of the Phase One Property was occupied by a dwelling.	Residential	- An aerial photograph from 1960 illustrates this portion of the Site as observed during our site reconnaissance. - A topographic map from 1972 illustrates this portion of the Site as a developed area.
August 12, 1941 to July 17, 1956	Samuel Smith	This portion of the Phase One Property was occupied by a dwelling.	Residential	- An aerial photograph from 1954 illustrates this portion of the Site as observed during our site reconnaissance. - A topographic map from 1942 does not illustrate any buildings on this portion of the Site.
November 28, 1921 to August 12, 1941	Edward Smith	This portion of the Phase One Property was occupied by a dwelling.	Residential	A Fire Insurance Plan from 1927 illustrates a building on this portion of the Site.
August 18, 1919 to November 28, 1921	Annie Fay	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
December 26, 1912 to August 18, 1919	Percy Allport	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
September 27, 1910 to December 26, 1912	John Sinclair McCannell	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
August 18, 1879 to September 27, 1910	Samuel Nixon	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1909 illustrates a building on this portion of the Site.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
May 17, 1878 to August 18, 1879	Eliza Arthurs	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
August 26, 1874 to May 17, 1878	Duncan Devarr	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
November 27, 1873 to August 26, 1874	William Eaton Witchell	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 2, 1870 to November 27, 1873	Christina B Davis	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
November 3, 1852 to April 2, 1870	William Martin	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 12, 1852 to November 3, 1852	Charles F Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to July 12, 1852	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

399 Pearl Street [PIN 24954-0143]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
December 31, 1975 to Present	Milton Motor Sales Limited	This portion of the Phase One Property was occupied by a dwelling.	Residential	- Aerial photographs from 1978, 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
September 30, 1947 to December 31, 1975	John G Purdy, Marjorie A Purdy	This portion of the Phase One Property was occupied by a dwelling.	Residential	- A topographic map from 1972 illustrates this portion of the Site as a developed area. - Aerial photographs from 1954 and 1960 illustrate this portion of the Site as observed during our site reconnaissance.
May 28, 1921 to September 30, 1947	Henry Fay, Eva Ann Fay	This portion of the Phase One Property was occupied by a dwelling.	Residential	- A topographic map from 1942 illustrates a building on this portion of the Site. - A Fire Insurance Plan from 1927 illustrates a building on this portion of the Site.
February 23, 1918 to May 28, 1921	Samuel Henson	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
December 19, 1912 to February 23, 1918	William Sloan	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
September 27, 1910 to December 19, 1912	John Sinclair McCannell	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
August 18, 1879 to September 27, 1910	Samuel Nixon	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1909 illustrates a building on this portion of the Site.
May 17, 1878 to August 18, 1879	Eliza Arthurs	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
August 26, 1874 to May 17, 1878	Duncan Devarr	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
November 27, 1873 to August 26, 1874	William Eaton Witchell	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 2, 1870 to November 27, 1873	Christina B Davis	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 2, 1852 to April 2, 1870	Elizabeth Fetzsimon	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
September 18, 1851 to July 2, 1852	Mathias Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to September 18, 1851	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

405 Pearl Street [PIN 24954-0144]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
August 2, 1996 to Present	Beverly Allan Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	- Aerial photographs from 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
February 28, 1980 to August 2, 1996	Gillian Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
February 19, 1976 to February 28, 1980	Charles J Auger	This portion of the Phase One Property was occupied by a dwelling.	Residential	An aerial photograph from 1978 illustrates this portion of the Site as observed during our site reconnaissance.
October 30, 1950 to February 19, 1976	Susan P Auger	This portion of the Phase One Property was occupied by a dwelling.	Residential	- A topographic map from 1972 illustrates this portion of the Site as a developed area. - Aerial photographs from 1954 and 1960 illustrate this portion of the Site as observed during our site reconnaissance.
August 21, 1950 to October 30, 1950	Harold Raymond Sterling	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
April 20, 1942 to August 21, 1950	Rose Annie Sales	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
April 9, 1934 to April 20, 1942	Robert Wicks, Elizabeth Wicks	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1942 illustrates a building on this portion of the Site.
May 4, 1912 to April 9, 1934	Jacob Johnson	This portion of the Phase One Property was occupied by a dwelling.	Residential	A Fire Insurance Plan from 1927 illustrates a building on this portion of the Site.
September 27, 1910 to May 4, 1912	John Sinclair McCannell	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
December 8, 1891 to September 27, 1910	Samuel Nixon	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1909 illustrates a building on this portion of the Site.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
July 27, 1891 to December 8, 1891	William J Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 7, 1888 to July 27, 1891	Martha M Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 14, 1869 to April 7, 1888	James Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
December 16, 1862 to April 14, 1869	Joseph Graham	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
June 12, 1854 to December 16, 1862	William LP Eager	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 25, 1854 to June 12, 1854	William D Lyon	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 12, 1852 to March 25, 1854	Charles F Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to July 12, 1852	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.


409 Pearl Street [PIN 24954-0145]:

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
August 31, 1973 to Present	Beverly Slessor	This portion of the Phase One Property was occupied by a dwelling.	Residential	- Aerial photographs from 1978, 2004, 2013, 2019 and 2022 illustrate this portion of the Site as observed during our site reconnaissance. - Topographic maps from 1998 and 2021 illustrate this portion of the Site as a developed area.
December 17, 1948 to August 31, 1973	Richard Ferrier	This portion of the Phase One Property was occupied by a dwelling.	Residential	- A topographic map from 1972 illustrates this portion of the Site as a developed area. - Aerial photographs from 1954 and 1960 illustrate this portion of the Site as observed during our site reconnaissance.
August 6, 1941 to December 17, 1948	Charles Robertson	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1942 illustrates a building on this portion of the Site.
May 4, 1912 to August 6, 1941	Jacob Johnson	This portion of the Phase One Property was occupied by a dwelling.	Residential	A Fire Insurance Plan from 1927 illustrates a building on this portion of the Site.
September 27, 1910 to May 4, 1912	John Sinclair McCannell	This portion of the Phase One Property was occupied by a dwelling.	Residential	There were no readily available visual aids for the Phase One Property for this time period.
December 8, 1891 to September 27, 1910	Samuel Nixon	This portion of the Phase One Property was occupied by a dwelling.	Residential	A topographic map from 1909 illustrates a building on this portion of the Site.
July 27, 1891 to December 8, 1891	William J Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 7, 1888 to July 27, 1891	Martha M Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
April 14, 1869 to April 7, 1888	James Kidney	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
December 16, 1862 to April 14, 1869	Joseph Graham	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
June 12, 1854 to December 16, 1862	William LP Eager	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 25, 1854 to June 12, 1854	William D Lyon	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
July 12, 1852 to March 25, 1854	Charles F Teetzel	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
March 24, 1832 to July 12, 1852	Kenny Kerfessau	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
January 20, 1823 to March 24, 1832	George Will	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.
Up to January 20, 1823	Crown	As there were no readily available visual aids prior to 1909, it is unclear when this property was first developed as residential land.	Residential and Agriculture or Other	There were no readily available visual aids for the Phase One Property for this time period.

Appendix 'J'

1. Phase One Conceptual Site Model

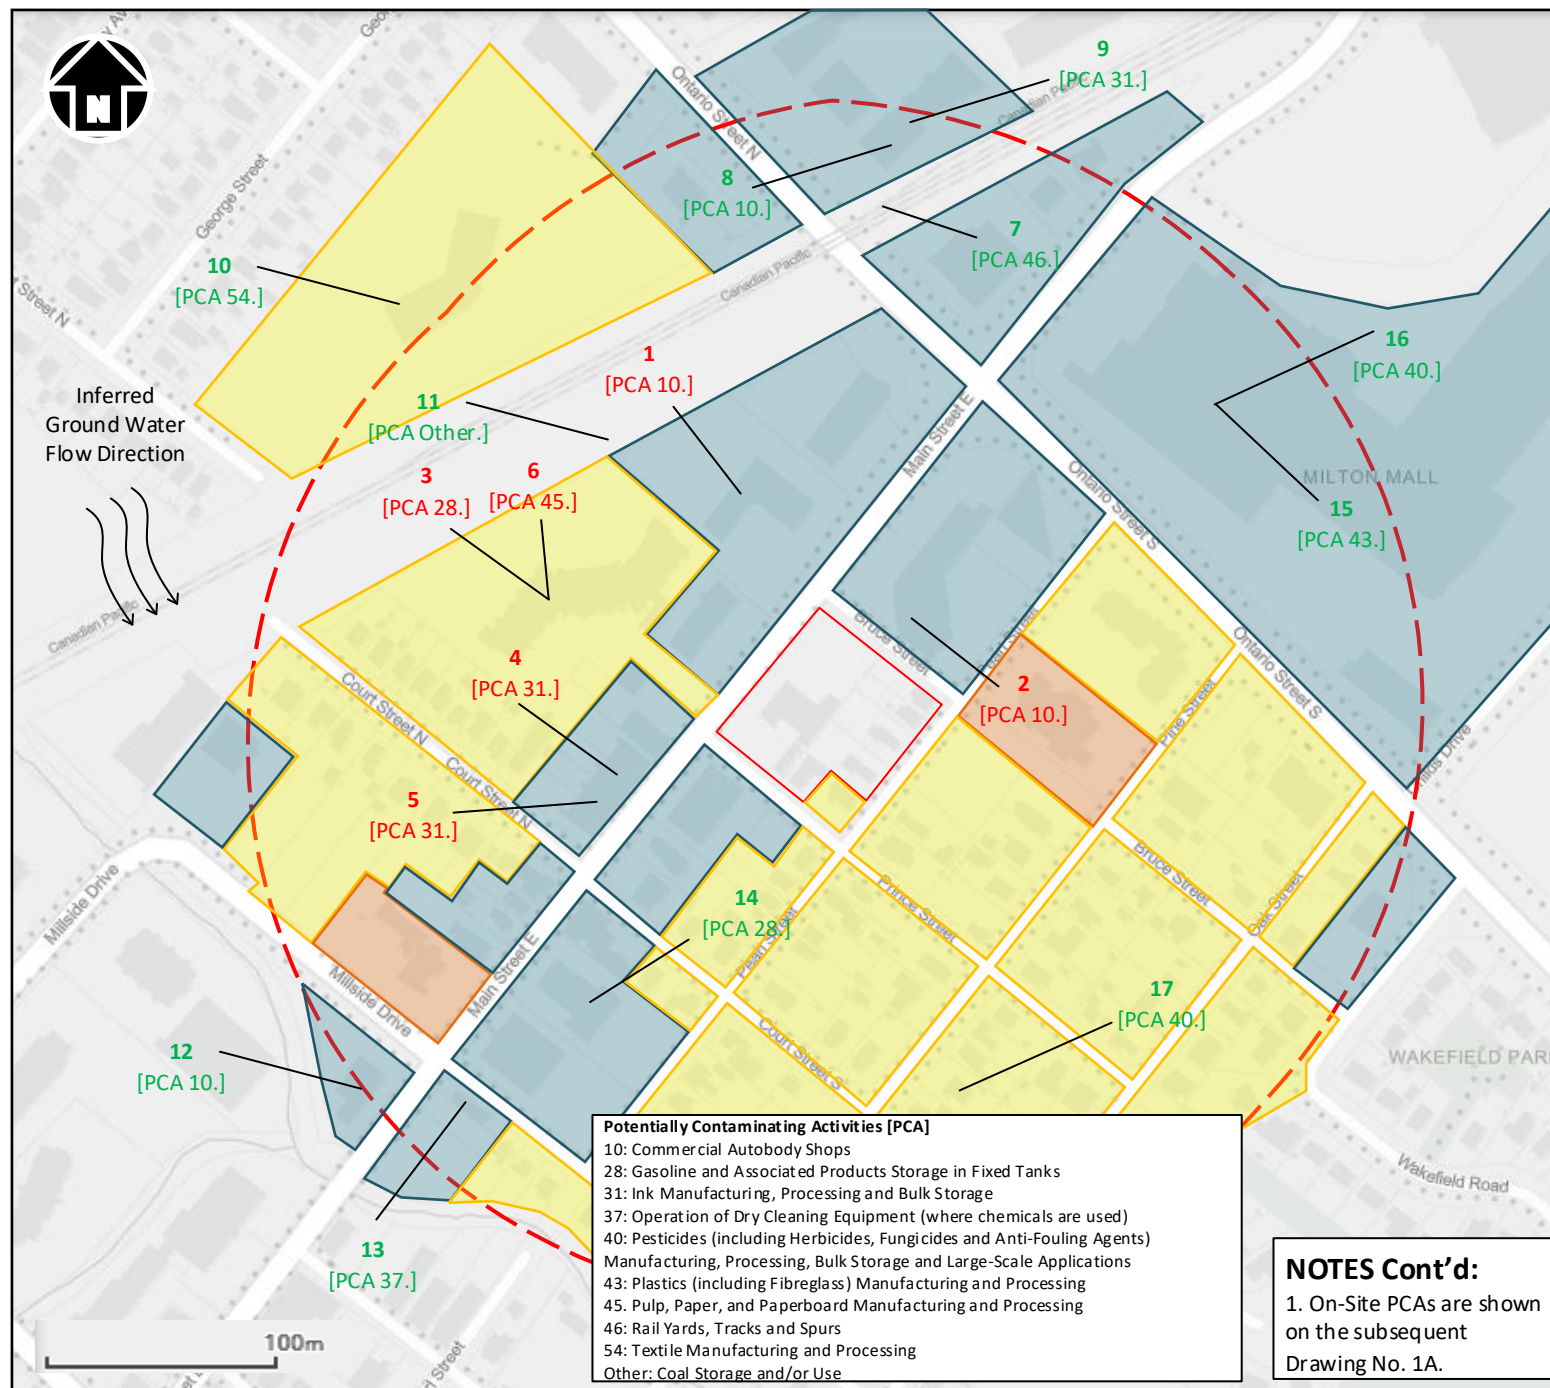

LEGEND

- = Site Boundary
- = Phase One ESA Study Area
- = Institutional Lands
- = Residential Lands
- = Commercial Lands
- PCA # = Off-Site PCA causing an APEC on the RSC Property
- PCA # = Off-Site PCA not causing an APEC on the RSC Property

NOTES:

1. Base map retrieved from Town of Milton.

Soil-Mat

Engineers & Consultants Ltd.

CLIENT

MIKMADA HOMES

PROJECT TITLE

Phase One Environmental Site Assessment
Main Street East and Prince Street
Milton, Ontario

DRAWING TITLE

Phase One
Conceptual Site Model

PROJECT No. SM 220141-E

DATE April 2023

CHECKED KG

DRAWN AL

FILE NAME
220141 Phase One CSM.vsd

DRAWING No. 1

Potentially Contaminating Activities [PCA]

- 10: Commercial Autobody Shops
- 28: Gasoline and Associated Products Storage in Fixed Tanks
- 31: Ink Manufacturing, Processing and Bulk Storage
- 37: Operation of Dry Cleaning Equipment (where chemicals are used)
- 40: Pesticides (including Herbicides, Fungicides and Anti-Fouling Agents)
- 43: Plastics (including Fibreglass) Manufacturing and Processing
- 45: Pulp, Paper, and Paperboard Manufacturing and Processing
- 46: Rail Yards, Tracks and Spurs
- 54: Textile Manufacturing and Processing
- Other: Coal Storage and/or Use

NOTES Cont'd:

1. On-Site PCAs are shown on the subsequent Drawing No. 1A.

Conceptual Site Model Notes

CSM Off-Site Property Number	Current Occupant	Potential Contaminating Activity	Contaminants of Potential Concern	Qualified Person Specific Comments
1	Play It Again Sports	Yes	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the property recognised as '409 Main Street East', which is located approximately 15 metres northwest [up-gradient] of the Phase One Property [Murray Wilson Pontiac Buick Cadillac Ltd, from circa 1985 to 1990]. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is considered a PCA likely to cause an APEC on the Site.
2	The Salvation Army Thrift Store	Yes	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Information contained in the Vernon City Directory Series revealed a commercial automotive repair facility formerly operated on the property recognised as '420 Main Street East', which is located approximately 10 metres northeast [up-gradient] of the Phase One Property [Rick's Auto Repair, from circa 1981]. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is considered a PCA likely to cause an APEC on the Site.
3	Green Life Condominium	Yes	PHCs, PAHs, and BTEX	Information contained in the EcoLog ERIS database search revealed fuel storage tanks on the property recognised as '383 Main Street East', which is located approximately 55 metres northwest [up-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is considered a PCA likely to cause an APEC on the Site.

Prepared by Soil-Mat Engineers & Consultants Ltd. [April, 2023]

CSM Off-Site Property Number	Current Occupant	Potential Contaminating Activity	Contaminants of Potential Concern	Qualified Person Specific Comments
4	La Vie Nails Bar	Yes	Metals, PHCs, VOCs, and BTEX.	Information contained in the Vernon City Directory Series revealed a print shop formerly operated on the property recognised as '361 Main Street East', which is located approximately 50 metres west-southwest [trans-gradient/down-gradient] of the Phase One Property [Kwik Kopy Printing, from circa 1990]. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is considered a PCA likely to cause an APEC on the Site.
5	FastSigns	Yes	Metals, PHCs, VOCs, and BTEX.	Our visual observations of the Phase One Study Area revealed an active print shop on the property recognised as '357 Main Street East', which is located approximately 55 metres southwest [trans-gradient/down-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is considered a PCA likely to cause an APEC on the Site.
6	Green Life Condominium	Yes	Metals, VOCs, PHCs and PAHs.	Information contained in the aerial photographs, an acknowledged Record of Site Condition [RSC ID# 79919], and the EcoLog ERIS database search revealed a paperboard container manufacturing facility that formerly operated on the property recognised as '383 Main Street East', which is located approximately 55 metres northwest [up-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is considered a PCA likely to cause an APEC on the Site.
7	Canadian Pacific Railway	No	PAHs	Information contained in the aerial photographs, topographic maps, Fire Insurance Plans, and our visual observations of the Phase One Study Area revealed a railway line located approximately 155 metres northwest [up-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.

Prepared by Soil-Mat Engineers & Consultants Ltd. [April, 2023]

CSM Off-Site Property Number	Current Occupant	Potential Contaminating Activity	Contaminants of Potential Concern	Qualified Person Specific Comments
8	Master Mechanic Milton	No	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Our visual observations of the Phase One Study Area revealed an autobody shop operating on the property recognised as '45 Ontario Street North' [Unit 1], which is located approximately 215 metres north-northeast [up-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.
9	Minuteman Press	No	Metals, PHCs, VOCs, and BTEX.	Our visual observations of the Phase One Study Area revealed a print shop operating on the property recognised as '45 Ontario Street North' [Unit 2C], which is located approximately 240 metres north-northeast [up-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.
10	Milgate Place	No	Metals and VOCs.	Information contained in a Fire Insurance Plan from 1927 revealed a textile factory on the property recognised as '80 Ontario Street North', which is located approximately 215 metres northwest [up-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.
11	Canadian Pacific Railway	No	PAHs	Information contained in a Fire Insurance Plan from 1927 revealed a coal shed located approximately 125 metres northwest [up-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.

Prepared by Soil-Mat Engineers & Consultants Ltd. [April, 2023]

CSM Off-Site Property Number	Current Occupant	Potential Contaminating Activity	Contaminants of Potential Concern	Qualified Person Specific Comments
12	Halifax Donair	No	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Information contained in the Vernon City Directory Series revealed an autobody shop formerly operated on the property recognised as '295 Main Street East', which is located approximately 225 metres southwest [trans-gradient] of the Phase One Property [Johnson Bros Garage, from circa 1985]. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.
13	Bud's Cannabis Store	No	VOCs	Information contained in the Vernon City Directory Series revealed a dry cleaner formerly operated on the property recognised as '300 Main Street East', which is located approximately 220 metres southwest [trans-gradient] of the Phase One Property [Knight's Dry Cleaners, from circa 1985 to 1990]. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.
14	Bell	No	PHCs, PAHs, and BTEX	Information contained in the EcoLog ERIS database search revealed fuel oil tanks on the property recognised as '330 Main Street East', which is located approximately 135 metres southwest [trans-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.
15	Milton Mall	No	OCs	Information contained in the EcoLog ERIS database search revealed records of the Pesticide Register on the property recognised as '55 Ontario Street South', which is located approximately 150 metres northeast [trans-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.

Prepared by Soil-Mat Engineers & Consultants Ltd. [April, 2023]

CSM Off-Site Property Number	Current Occupant	Potential Contaminating Activity	Contaminants of Potential Concern	Qualified Person Specific Comments
16	Milton Mall	No	Metals, PHCs and VOCs.	Information contained in the EcoLog ERIS database search revealed record of the Scott's Manufacturing Directory for Coating, Engraving, Heat Treating and Allied Activities All Other Plastic Product Manufacturing on the property recognised as '55 Ontario Street South', which is located approximately 150 metres northeast [trans-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.
17	Residential	No	OCs	Information contained in the EcoLog ERIS database search revealed records of the Pesticide Register on the property recognised as '366 Pine Street', which is located approximately 120 metres south-southeast [down-gradient] of the Phase One Property. Given the location of the property to the Site with respect to the inferred groundwater flow direction and the distance between the property and the Site, this property is not considered a PCA likely to cause an APEC on the Site.

SUPPORTING INFORMATION TO SATISFY TABLE 1, SCHEDULE D, PART VI OF THE RSC REGULATION

1. Based on the findings of the Phase One Environmental Site Assessment [ESA], four [4] potentially contaminating activities [PCAs] were identified on the Phase One Property and six [6] PCAs were identified in the Phase One Study Area that resulted in ten [10] areas of potential environmental concern [APECs] on the Phase One Property. The remaining properties identified in the Phase One Study Area were not considered significant environmental liabilities to the Phase One Property. The APECs are listed below in Table format. The Phase One Property is illustrated on the attached Drawing No.: 1. The APECs associated with the PCA on the Phase One Property is illustrated on the attached Drawing No.: 1A.

Prepared by Soil-Mat Engineers & Consultants Ltd. [April, 2023]

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Locations of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC #1	The historic automotive repair facility on the '17 Prince Street' portion of the Phase One Property.	10. Commercial Autobody Shop [PCA A]	On-Site	Metals, Petroleum Hydrocarbons [PHCs], Volatile Organic Compounds [VOCs], Polycyclic Aromatic Hydrocarbons [PAHs], Polychlorinated Biphenyls [PCBs] and Benzene, Toluene, Ethylbenzene and Xylenes [BTEX]	Soil and Groundwater
APEC #2	The historic automotive repair facility on the '388 Main Street East' portion of the Phase One Property.	10. Commercial Autobody Shop [PCA B]	On-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater
APEC #3	To the north of the dwelling on the '405 Pearl Street' portion of the Phase One Property.	28. Gasoline and Associated Products Storage in Fixed Tanks [PCA C]	On-Site	PHCs, PAHs and BTEX	Soil and Groundwater
APEC #4	In the immediate vicinity of the three [3] former structures on the '388 Main Street East' portion of the Phase One Property.	30. Importation of Fill Material of Unknown Quality [PCA D]	On-Site	Metals, PHCs and BTEX	Soil
APEC #5	The northeastern limit of the Phase One Property.	10. Commercial Autobody Shop [PCA E]	Off-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Locations of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC #6	The eastern limit of the Phase One Property.	10. Commercial Autobody Shop [PCA F]	Off-Site	Metals, PHCs, VOCs, PAHs, PCBs, and BTEX.	Soil and Groundwater
APEC #7	The northern limit of the Phase One Property.	28. Gasoline and Associated Products Storage in Fixed Tanks [PCA G]	Off-Site	PHCs, PAHs, and BTEX	Soil and Groundwater
APEC #8	The western limit of the Phase One Property.	31. Ink Manufacturing, Processing and Bulk Storage [PCA H]	Off-Site	Metals, PHCs, VOCs, and BTEX.	Soil
APEC #9	The western limit of the Phase One Property.	31. Ink Manufacturing, Processing and Bulk Storage [PCA I]	Off-Site	Metals, PHCs, VOCs, and BTEX.	Soil
APEC #10	The northern limit of the Phase One Property.	45. Pulp, Paper, and Paperboard Manufacturing and Processing [PCA J]	Off-Site	Metals, VOCs, PHCs and PAHs.	Soil and Groundwater

- There are no water bodies in whole or in part on the Phase One Property or within the Phase One ESA Study Area [250 metre radius from the limits of the Phase One Property]. The local and regional groundwater flow direction is inferred to the southeast toward Lake Ontario.
- There are no areas of natural significance located in whole or in part on the Phase One Property or in the Phase One Study Area.
- There are no potable groundwater wells or groundwater monitoring wells located on the Phase One Property.

5. A review of the MOE's water well records revealed a record of twenty [20] groundwater monitoring wells located within the Phase One Study Area. The groundwater monitoring wells are reportedly located between 35 and 240 metres from the Site and reportedly terminate between 2.92 and 13 metres below the ground surface. In addition, our review of the MOE water well records did not reveal any records of potable groundwater wells on lands located within the Phase One Study Area.
6. The proposed development on the Phase One Property will be serviced with buried utilities, including storm and sanitary sewers, a municipal water supply, hydro and other soft services. The depth and location of these service trenches are not anticipated to affect, direct or alter the migration of any potential off-site contaminants.
7. SOIL-MAT ENGINEERS & CONSULTANTS LTD. have been retained to undertake a geotechnical report on the Property however, was not complete at the time of this report. A review of the Ministry of Northern Development and Mine's "Quaternary Geology of the Brampton Area, Southern Ontario Sheet Map P3171" and the "Paleozoic Geology of the Brampton Area, Southern Ontario Sheet Map M2337", revealed the Site to be underlain by glaciolacustrine massive to laminated clay and silt, in turn, underlain by Queenston Formation red shale bedrock. The depth to the groundwater table is anticipated to be approximately 6.9 metres below the ground surface elevation based on information ferreted out from groundwater well records for water wells located within the Phase One Study Area.
8. The validity of the CSM may be affected if the future use of the Phase One Property diverts from the current understanding of the proposed development to include the installation of multi-level basements or deep groundwater wells that may artificially alter or redirect local groundwater toward the Phase One Property. In this scenario, given the distance of the limited potential contaminating activities with relation to the Site, these activities are not considered a significant liability to the Phase One Property, and as a result it is recommended that intrusive soil and/or groundwater sampling and monitoring would not be required in this scenario.
9. Based on the results of the Phase One ESA, it is the opinion of SOIL-MAT ENGINEERS & CONSULTANTS LTD. that a Phase Two ESA is required for the property.

Appendix 'K'

2. Site Reconnaissance Photographs



Photo of the east side of the commercial/residential building at 388 Main Street East. Taken from the eastern portion of the Site, facing west.



Photo of the north side of the commercial/residential building at 388 Main Street East. Taken from the northern portion of the Site, facing southeast.



Photo of the west side of the commercial/residential building at 388 Main Street East. Taken from the western portion of the Site, facing northeast.



Photo of the north side of the garage and residential building at 17 Prince Street. Taken from the western portion of the Site, facing south.



Photo of the garage interior at 17 Prince Street. Taken from the south side of the garage, facing north.



Photo of the south side of the dwelling at 395 Pearl Street. Taken from the southern portion of the Site, facing north.



Photo of the south side of the dwelling at 399 Pearl Street. Taken from the southern portion of the Site, facing northeast.



Photo of the south side of the dwelling at 405 Pearl Street. Taken from the southeastern portion of the Site, facing north.



Photo of the former underground storage tank area, located north of the dwelling at 405 Pearl Street.
Taken from the southeastern portion of the Site, facing west.



Photo of the south side of the dwelling at 409 Pearl Street. Taken from the southeastern portion of the
Site, facing northwest.

Appendix 'L'

1. Qualifications of Assessor

COMPANY BACKGROUND

SOIL-MAT ENGINEERS & CONSULTANTS LTD. [SOIL-MAT ENGINEERS] is a Canadian Consulting Engineering firm owned by its senior staff. Over the past thirty years the principals of SOIL-MAT ENGINEERS have undertaken geotechnical investigations in all areas of Hamilton and surrounding area and are familiar with the distinct geology of the area and therefore well-versed with the various soil, bedrock and groundwater conditions. SOIL-MAT ENGINEERS has a staff of over twenty-five engineers and technical staff who specialize in geotechnical assignments, environmental assessments, hydrogeological investigations and construction quality control/assurance projects. The company commenced operation on June 15, 1992 and has undertaken over 5,000 projects since its inception. The firm and all professional staff are in good standing with Professional Engineers Ontario. The company has maintained a current Certificate of Authorisation since it was granted on April 28, 1992. The firm's office and laboratory facilities are located at 401 Grays Road in Hamilton, Ontario.

REPORT AUTHORS

Alex Lajkosz, B.Sc.

Environmental Technician

Mr. Lajkosz has over three years of experience in conducting Phase I ESA research and Phase II ESA fieldwork, including soil and groundwater sampling. Mr. Lajkosz has also been a key project member on a number of Phase I Environmental Site Assessment projects, including species at risk assessments for numerous construction projects throughout the Greater Toronto Area.

Keith Gleadall, B.A., EA Dipl.

Vice-President [Senior Professional]

Mr. Gleadall has over fourteen years of experience in conducting Phase I, II and III Environmental Site Assessments and has successfully completed the requirements of the Associated Environmental Site Assessors of Canada and a Post Graduate Diploma in Environmental Site Assessment from Niagara College. Mr. Gleadall is responsible for undertaking numerous hydrogeological investigations, primarily within the City of Hamilton, associated with the development of residential and commercial subdivision projects, together with Phase I, II and III Environmental Site Assessments. Projects have included the decommissioning of underground and above ground fuel oil storage tanks, the implementation of in-situ and ex-situ remediation programmes, the decommissioning of a former dry cleaning facility and numerous 'dig and dump' remediation projects.

Stephen R. Sears, B. Eng. Mgmt., P. Eng.
Director [Senior Professional]

Mr. Sears has over twenty-two years of experience in the geotechnical and geo-environmental fields. Mr. Sears holds current Consulting Engineer designations with the Professional Engineers Ontario and the Association of Professional Engineers and Geoscientists of Saskatchewan and has supervised the geotechnical investigations for numerous industrial, commercial and residential development projects in Southern Ontario, slope stability assignments associated with Hamilton Conservation Authority, Conservation Halton and Niagara Peninsula Conservation Authority requirements, and several high rise developments throughout Ontario. Mr. Sears has also been involved in geotechnical and hydrogeological investigations for industrial park developments in the Greater Toronto Area and Niagara Peninsula. Some of Mr. Sears' projects have included the decommissioning and reconstruction of underground and above ground fuel oil storage tanks in Ontario and Saskatchewan, the study of the containment structures at a number of Petroleum Storage Facilities in Ontario and numerous 'dig and dump' remediation projects.